เอกสารแนบ 1

สำเนาหนังสือแจ้งผลการพิจารณารายงานการประเมินผลกระทบสิ่งแวดล้อม

ที่ ทส 1009.5/4516



สำนักงานนโยบายและแผน
ทรัพยากรธรรมชาติและสิ่งแวดล้อม
60/1 ซอยพิบูลวัฒนา 7 ถนนพระรามที่ 6
กรุงเทพฯ 10400

18 มิถุนายน 2551

เรื่อง รายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมโครงการโรงแรมวีรันดา

เรียน ผู้ว่าราชการกรุงเทพมหานคร

อ้างถึง หนังสือสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ที่ ทส 1009.5/2801 ลงวันที่ 10 เมษายน 2551

สิ่งที่ส่งมาด้วย 1.สำเนาหนังสือบริษัท อีอาร์เอ็ม-สยาม จำกัด ลงวันที่ 11 เมษายน 2551
2.มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อมที่โครงการโรงแรมวีรันดา ของบริษัท โอ๊คทรี จำกัด ต้องยึดถือปฏิบัติอย่างเคร่งครัด
3.แนวทางการเสนอรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม

ตามหนังสือที่อ้างถึง สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ได้แจ้งผลการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมโครงการโรงแรมวีรันดา ของบริษัท โอ๊คทรี จำกัด ตั้งอยู่ที่ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร จัดทำรายงานฯ โดยบริษัท อีอาร์เอ็ม-สยาม จำกัด ซึ่งคณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมด้านโครงการบริการชุมชน ในการประชุมครั้งที่ 6/2551 เมื่อวันที่ 4 มีนาคม 2551 มีมติไม่เห็นชอบรายงานฯ ต่อมาบริษัท อีอาร์เอ็ม-สยาม จำกัด ได้เสนอรายงานฯ ชี้แจงเพิ่มเติมให้สำนักงานฯ ดำเนินการตามขั้นตอนการพิจารณารายงาน ดังรายละเอียดตามสิ่งที่ส่งมาด้วย 1

2/สำนักงาน...

สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อมได้พิจารณารายงานฯ และนำเสนอต่อคณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมด้านโครงการบริการชุมชน ในการประชุมครั้งที่ 10/2551 เมื่อวันที่ 22 เมษายน 2551 ซึ่งคณะกรรมการผู้ชำนาญการฯ มีมติเห็นชอบรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมโครงการโรงแรมวีรันดา ของบริษัท โอ๊คทรี จำกัด โดยให้โครงการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อมที่โครงการโรงแรมวีรันดา ต้องยึดถือปฏิบัติอย่างเคร่งครัด ดังรายละเอียดตามสิ่งที่ส่งมาด้วย 2 และการรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม ดังรายละเอียดตามสิ่งที่ส่งมาด้วย 3 อนึ่ง ตามมาตรา 50 วรรคห้า ของพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ.2535 เมื่อคณะกรรมการผู้ชำนาญการฯ ได้ให้ความเห็นชอบในรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมตามมาตรา 49 แล้ว ให้เจ้าหน้าที่ซึ่งมีอำนาจตามกฎหมายในการพิจารณาสั่งอนุญาตหรือต่ออายุใบอนุญาตนำมาตรการที่เสนอไว้ในรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมไปกำหนดเป็นเงื่อนไขในการสั่งอนุญาตหรือต่ออายุใบอนุญาต โดยให้ถือว่าเป็นเงื่อนไขที่กำหนดตามกฎหมายในเรื่องนั้นด้วย ทั้งนี้ สำนักงานฯ ได้มีหนังสือแจ้งบริษัท โอ๊คทรีจำกัด และสำเนาหนังสือแจ้งบริษัท อีอาร์เอ็ม-สยาม จำกัด เพื่อดำเนินการต่อไปด้วยแล้ว

จึงเรียนมาเพื่อโปรดพิจารณาดำเนินการในส่วนที่เกี่ยวข้องต่อไป

[redacted]

โทรสาร 0-2265-6616

น.1/1

เอกสารแนบ 2

สำเนาใบรับหนังสือแจ้งความประสงค์จะก่อสร้างอาคาร ดัดแปลง หรือรื้อถอนอาคาร (กทม.6)

ด่วนมาก

โดยไม่ยื่นคำขอรับใบอนุญาตตาม มาตรา 39 ทวิ

แบบ กทม.6

ตามแบบ กทม.1 เลขที่ 328

ลงวันที่ 19 มิถุนายน 2551

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง ดัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร โดยไม่ยื่นคำขอรับใบอนุญาต ตามมาตรา 39 ทวิ

เลขที่ 328 / 2551

ได้รับแจ้งจาก บริษัท [redacted]

เจ้าของอาคารหรือตัวแทนเจ้าของ [redacted]

ตรอก/ซอย..... ถนน รัชดาภิเษก ตำบล/แขวง จันทรเกษม

อำเภอ/เขต จตุจักร จังหวัด กรุงเทพมหานคร ดังข้อความต่อไปนี้

ข้อ 1 ขอแจ้งความประสงค์จะทำการ ก่อสร้างอาคาร

ที่บ้านเลขที่..... หมู่ที่..... ตรอก/ซอย..... ถนน สาทร

ตำบล/แขวง สีลม อำเภอ/เขต บางรัก กรุงเทพมหานคร

ในที่ดินโฉนด [redacted]

เป็นที่ดินของ [redacted]

โดยไม่ยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

ข้อ 2 เป็นอาคาร ชั้นใต้ดิน 2 ชั้น จอดรถยนต์ พาณิชย์-สำนักงาน-ห้องประชุม-

2.1 ชนิด ตึก 28 ชั้น จำนวน 1 หลัง เพื่อใช้เป็น โรงแรม (267 ห้อง)-ภัตตาคาร-

พื้นที่ 38,061.00 ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน 243 คัน

พื้นที่ 1,200.00 ม.²

2.2 ชนิด..... จำนวน.....หลัง เพื่อใช้เป็น.....

พื้นที่..... ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน ..... คัน

พื้นที่..... ม.²

2.3 ชนิด..... จำนวน.....หลัง เพื่อใช้เป็น.....

พื้นที่..... ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน ..... คัน

พื้นที่..... ม.²

[redacted]

วันที่ 19 มิ.ย. 2551

วันที่ 19 มิ.ย. 2551

วันที่ 19 มิ.ย. 2551

วันที่ 19 มิ.ย. 2551

น.2/1

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลนและรายการคำนวณที่แนบมาพร้อมนี้

ข้อ 3 โดยมี

(1) [redacted] เป็นสถาปนิกผู้ออกแบบ

(2) เป็นสถาปนิกผู้ควบคุมงาน

(3) เป็นวิศวกรผู้ออกแบบโครงสร้าง

(4) เป็นวิศวกรผู้ควบคุมงานโครงสร้าง

(5) เป็นวิศวกรผู้ออกแบบระบบปรับภาวะอากาศและระบบระบายอากาศและระบบป้องกันเพลิงไหม้

(6) เป็นวิศวกรผู้ควบคุมงานระบบปรับภาวะอากาศและระบบระบายอากาศและระบบป้องกันเพลิงไหม้

(7) เป็นวิศวกรผู้ออกแบบระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง

(8) เป็นวิศวกรผู้ควบคุมงานระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง

(9) เป็นวิศวกรผู้ออกแบบระบบลิฟต์/ไฟฟ้า

(1 เป็นวิศวกรผู้ควบคุมงานระบบลิฟต์/ไฟฟ้า

ข้อ 4 กำหนดแล้วเสร็จงาน 730 วัน โดยจะเริ่มต้นก่อสร้างอาคาร/ดัดแปลงอาคาร/รื้อถอนอาคาร/เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคาร เมื่อ 19 มิถุนายน 2551 และจะแล้วเสร็จเมื่อ 19 มิถุนายน 2553

ข้อ 5 ค่าธรรมเนียมในการตรวจแบบ 152,244.00 บาท

ค่าธรรมเนียมท่อระบายน้ำ รั้ว เขื่อน กำแพงหรืออื่นๆ 216.00 บาท

ค่าธรรมเนียมหรือที่จอดรถยนต์ภายนอกอาคาร 600.00 บาท

ค่าธรรมเนียมใบอนุญาต 20.00 บาท

รวมทั้งสิ้น 153,080.00 บาท

[redacted]

วันที่ 19 มิ.ย. 2551

วันที่ 19 มิ.ย. 2551

วันที่ 19 มิ.ย. 2551

วันที่ [illegible]

ข้อ 6 ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

6.1 ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและหรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา 8 (11) มาตรา 9 หรือมาตรา 10 แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ.2522 แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ.2535

6.2 จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่นและฝุ่นละอองฟุ้งกระจายอันเนื่องมาจากการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กั้นตัวอาคารสูงตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้าน รอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้างไม่น้อยกว่า 2.00 เมตร ตลอดแนวอาคารด้านที่มีระยะราบวัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดินต่างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษาให้อยู่ในสภาพดีตลอดเวลาการก่อสร้าง

6.3 จะต้องจัดให้มีปล่องชั่วคราวสำหรับทิ้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละอองมลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุให้เกิดความเดือดร้อนรำคาญและเป็นภยันตรายแก่สุขภาพ ชีวิตและทรัพย์สิน ของประชาชนที่อยู่ในบริเวณใกล้เคียง

ข้อ 7 ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา 39 ทวิ หรือนับแต่วันที่เริ่มการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี ถ้าเจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคารที่ได้แจ้งไว้ แผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคารที่ได้ยื่นไว้ ตามมาตรา 39 ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าว หรือกฎหมายอื่นที่เกี่ยวข้อง เจ้าพนักงานท้องถิ่นยังคงมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

ข้อ 8 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

8.1 การกระทำดังกล่าวเป็นการรุกล้ำที่สาธารณะ

8.2 การกระทำดังกล่าวที่เกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้าหรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือ

[redacted]

วันที่ 19 มี.ค. 2551
วันที่ 19 มี.ค. 2551
วันที่ 19 มี.ค. 2551

8.3 การกระทำดังกล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง ดัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือเปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ 9 ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้องต่อไปด้วย

ข้อ 10 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจากที่ได้แจ้งไว้

ข้อ 11 ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่งความลึก และขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อ ประปา สายเคเบิล เป็นต้น และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดภยันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ 12 เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ลึกจนอาจเป็นอันตรายแก่อาคาร ถนน หรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีค้ำยัน เข็มพืด หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัย และต้องตรวจสอบแก้ไขค้ำยัน เข็มพืด และฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

ข้อ 13 ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อมและแผนการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจากสำนักนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ ทส. 1009.5/4515 ลงวันที่ 18 มิถุนายน 2551 อย่างเคร่งครัด

ออกให้ ณ วันที่ [redacted]

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.1 เลขรับที่ 328
ลงวันที่ 19 เดือน มิถุนายน พ.ศ. 2551
ราย บริษัท โอ๊คทรี จำกัด

[redacted] 9 ต.ค. 2551
9 ต.ค. 2551

คำเตือน

1. ถ้าผู้แจ้งฯจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งฯกับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และมีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว

2. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งที่สร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กลับรถ และทางเข้า ออกของรถตามที่กำหนดไว้ในใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กลับรถ และทางเข้าออกของรถไว้ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กลับรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

3. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุมการใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด 30 วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

[redacted]

พ.ย. 2551

พ.ย. 2551

ด่วนมาก

โดยไม่ยื่นคำขอรับใบอนุญาตตาม มาตรา ๓๙ ทวิ

แบบ กทม.6 เดิมเลขที่ 328/2551
ลงวันที่ 19 มิถุนายน 2551
ตามแบบ กทม.1 เลขที่ 274
ลงวันที่ 7 กรกฎาคม 2553

แบบ กทม.6

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง ดัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร โดยไม่ยื่นคำขอรับใบอนุญาต ตามมาตรา 39 ทวิ

เลขที่ 274 / 2553

ได้รับแจ้งจาก บริษัท โอ๊คทรี จำกั[redacted]

เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครองอาคาร อยู่บ้านเลขที่ 178/7 หมู่ที่ ..... ตรอก/ซอย ..... ถนน รัชดาภิเษก ตำบล/แขวง จันทรเกษม อำเภอ/เขต จตุจักร จังหวัด กรุงเทพมหานคร ดังข้อความต่อไปนี้

ข้อ 1 ขอแจ้งความประสงค์จะทำการ ก่อสร้างอาคาร (แก้ไขแบบแปลน)

ที่บ้านเลขที่ ..... หมู่ที่ ..... ตรอก/ซอย ..... ถนน สาทร ตำบล/แขวง สีลม อำเภอ/เขต บางรัก กรุงเทพมหานคร ในที่ดินโฉนดที่ดิน[redacted] เลขที่ 3078, 5021, 5022 เป็นที่ดินของ [redacted]

โดยไม่ยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

ข้อ 2 เป็นอาคาร ชั้นใต้ดิน 2 ชั้น จอดรถยนต์ พาณิชย์-สำนักงาน-ห้องประชุม-

2.1 ชนิด ตึก 28 ชั้น จำนวน 1 หลัง เพื่อใช้เป็น โรงแรม (237 ห้อง)-ภัตตาคาร-

พื้นที่ 37,446.00 ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน 243 คัน

พื้นที่ 1,200.00 ม.²

2.2 ชนิด ..... จำนวน ..... หลัง เพื่อใช้เป็น .....

พื้นที่ ..... ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน ..... คัน

พื้นที่ ..... ม.²

2.3 ชนิด ..... จำนวน ..... หลัง เพื่อใช้เป็น .....

พื้นที่ ..... ม.² ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน ..... คัน

พื้นที่ ..... ม.²

[redacted]

ก.ค. 2553
ก.ค. 2553
ก.ค. 2553

น.2/6

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลนและรายการคำนวณที่แนบมา พร้อมนี้

ข้อ 3 โดยมี

(1 [redacted] นสถาปนิกผู้ออกแบบ

(2 นสถาปนิกผู้ควบคุมงาน

(3 นวิศวกรผู้ออกแบบโครงสร้าง

(นวิศวกรผู้ควบคุมงานโครงสร้าง

(นวิศวกรผู้ออกแบบระบบปรับภาวะ
กาศและระบบระบายอากาศและ
ะบบป้องกันเพลิงไหม้

(ป็นวิศวกรผู้ควบคุมงานระบบปรับภาวะ
ากาศและระบบระบายอากาศ

ป็นวิศวกรผู้ควบคุมงานระบบป้องกัน
พลิงไหม้

ป็นวิศวกรผู้ออกแบบระบบบำบัดน้ำเสีย
และการระบายน้ำทิ้ง

เป็นวิศวกรผู้ควบคุมงานระบบบำบัด
น้ำเสียและการระบายน้ำทิ้ง

...เป็นวิศวกรผู้ออกแบบระบบลิฟท์/ไฟฟ้า

.เป็นวิศวกรผู้ควบคุมงานระบบลิฟท์

..เป็นวิศวกรผู้ควบคุมงานระบบไฟฟ้า

..เป็นวิศวกรผู้ตรวจสอบงานออกแบบ
และคำนวณส่วนต่างๆ ของโครงสร้าง
อาคาร

[redacted]

7 ก.ค. 2553
7 ก.ค. 2553

ข้อ 4 กำหนดแล้วเสร็จงาน 730 วันโดยจะเริ่มต้นก่อสร้างอาคาร/ดัดแปลงอาคาร/รื้อถอนอาคาร/เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคาร เมื่อ 7 กรกฎาคม 2553 และจะแล้วเสร็จเมื่อ 7 กรกฎาคม 2555

ข้อ 5 ค่าธรรมเนียมในการตรวจแบบ 149,784.00 บาท
ค่าธรรมเนียมท่อระบายน้ำ รั้ว เขื่อน กำแพงหรืออื่น ๆ 216.00 บาท
ค่าธรรมเนียมทางวิ่งหรือที่จอดรถยนต์ภายนอกอาคาร 600.00 บาท
ค่าธรรมเนียมใบอนุญาต 20.00 บาท
รวมทั้งสิ้น 150,620.00 บาท

ข้อ 6 ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

6.1 ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและหรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา 8 (11) มาตรา 9 หรือมาตรา 10 แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ.2522 แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ.2535

6.2 จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่นและฝุ่นละอองฟุ้งกระจายอันเนื่องมาจากการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กั้นตัวอาคารสูงตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้าน รอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้างไม่น้อยกว่า 2.00 เมตร ตลอดแนวอาคารด้านที่มีระยะราบวัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดินต่างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษาให้อยู่ในสภาพดีตลอดเวลาการก่อสร้าง

6.3 จะต้องจัดให้มีปล่องชั่วคราวสำหรับทิ้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละอองมลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุให้เกิดความเดือดร้อนรำคาญและเป็นภยันตรายแก่สุขภาพ ชีวิตและทรัพย์สิน ของประชาชนที่อยู่ในบริเวณใกล้เคียง

ข้อ 7 ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา 39 ทวิ หรือนับแต่วันที่เริ่มการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี ถ้าเจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคารที่ได้แจ้งไว้ (แผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคารที่ได้ยื่นไว้ ตามมาตรา 39 ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าว หรือกฎหมายอื่นที่เกี่ยวข้อง เจ้าพนักงานท้องถิ่นยังคงมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

[redacted]

- 7 ก.ค. 2553
- 7 ก.ค. 2553
- 7 ก.ค. 2553
- 7 ก.ค. 2553

ข้อ 8 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

8.1 การกระทำดังกล่าวเป็นการรุกล้ำที่สาธารณะ

8.2 การกระทำดังกล่าวที่เกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้า หรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือ

8.3 การกระทำดังกล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง ดัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือเปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ 9 ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้องต่อไปด้วย

ข้อ 10 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจากที่ได้แจ้งไว้

ข้อ 11 ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่งความลึก และขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อ ประปา สายเคเบิล เป็นต้น และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดภยันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ 12 เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ลึกจนอาจเป็นอันตรายแก่อาคาร ถนน หรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีค้ำยัน เข็มพืด หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัยและต้องตรวจสอบแก้ไขค้ำยัน เข็มพืด และฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

ข้อ 13 ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อมและแผนการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจากสำนักนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ ทส. 1009.5/4515 ลงวันที่ 18 มิถุนายน 2551 อย่างเคร่งครัด

ออกให้ ณ วันที่ [redacted] 2553

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.1 เลขรับที่ 274

ลงวันที่ 7 เดือน กรกฎาคม พ.ศ. 2553

ราย บริษัท โอ๊คทรี จำกัด

[redacted]

ก.ค. 2553

ก.ค. 2553

ก.ค. 2553

คำเตือน

1. ถ้าผู้แจ้งฯจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งฯกับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และมีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว

2. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งที่สร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กลับรถ และทางเข้า ออกของรถตามที่กำหนดไว้ในใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กลับรถ และทางเข้าออกของรถไว้ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กลับรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

3. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุมการใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด 30 วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

[redacted]

ที่ - 7 ก.ค. 2553
ที่ - 7 ก.ค. 2553
ที่ - 7 ก.ค. 2553

ตัวอย่าง

ใบแจ้งเป็นหนังสือรับใบอนุญาตตาม มาตรา ๓๙ ทวิ

แบบ กทม.๖

แบบ กทม.๖ เดิมเลขที่ ๒๗๔/๒๕๕๓
ลงวันที่ ๗ กรกฎาคม ๒๕๕๓
ตามแบบ กทม.๑ เลขรับที่ ๒๕๘
ลงวันที่ ๒๐ พฤษภาคม ๒๕๕๔

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง ดัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร โดยไม่ยื่นคำขอรับใบอนุญาต ตามมาตรา ๓๙ ทวิ

เลขที่ ๒๕๙/๒๕๕๔

ได้รับแจ้งจาก บริษัท โอ๊คทรี จำก[redacted]
เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครองอาคาร อยู่บ้านเลขที่ ๑๗๘/๗
หมู่ที่ - ตรอก/ซอย - ถนน รัชดาภิเษก ตำบล/แขวง จันทรเกษม
อำเภอ/เขต จตุจักร จังหวัด กรุงเทพมหานคร ดังข้อความต่อไปนี้

ข้อ ๑ ขอแจ้งความประสงค์จะทำการ ก่อสร้างและดัดแปลงอาคาร
ที่บ้านเลขที่ - หมู่ที่ - ตรอก/ซอย - ถนน สาทร
ตำบล/แขวง สีลม อำเภอ/เขต บางรัก กรุงเทพมหานคร
ในที่ดินโฉนดที่ดินเลขที่/น.ส.๓ เลขที่/ส.ค.๑ เลขที่ [redacted]๒
เป็นที่ดินของ [redacted]
โดยไม่ยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

ข้อ ๒ เป็นอาคาร จอดรถยนต์ พาณิชย์ – สำนักงาน – ห้องประชุม –

๒.๑ ชนิด ตึก ๒๙ ชั้น ชั้นใต้ดิน ๒ ชั้น จำนวน ๑ หลัง เพื่อใช้เป็น โรงแรม (๒๓๗ ห้อง) – ภัตตาคาร –
พื้นที่ ๓๙,๑๕๙.๐๐ ตารางเมตร ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน ๒๓๐ คัน
พื้นที่ ๑,๒๐๐.๐๐ ตารางเมตร (พื้นที่ส่วนดัดแปลง ๓,๑๐๐.๐๐ ตารางเมตร)

๒.๒ ชนิด - จำนวน - หลัง เพื่อใช้เป็น -
พื้นที่ - ตารางเมตร ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน - คัน
พื้นที่ - ตารางเมตร

๒.๓ ชนิด - จำนวน - หลัง เพื่อใช้เป็น -
พื้นที่ - ตารางเมตร ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน - คัน
พื้นที่ - ตารางเมตร

๒.๔ ชนิด - จำนวน - หลัง เพื่อใช้เป็น -
พื้นที่ - ตารางเมตร ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน - คัน
พื้นที่ - ตารางเมตร

๒.๕ ชนิด - จำนวน - หลัง เพื่อใช้เป็น -
พื้นที่ - ตารางเมตร ที่จอดรถ ที่กลับรถ และทางเข้า-ออกของรถ จำนวน - คัน
พื้นที่ - ตารางเมตร

[redacted]

๒๐ พ.ค. ๒๕๕๔
๒๐ พ.ค. ๒๕๕๔
๒๐ พ.ค. ๒๕๕๔

น.2/11

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน และรายการคำนวณที่แนบมาพร้อมนี้

ข้อ ๓ โดย[redacted]

(๑) เป็นสถาปนิกผู้ออกแบบ

(๒) เป็นสถาปนิกผู้ควบคุมงาน

(๓) เป็นวิศวกรผู้ออกแบบโครงสร้าง

(๔) เป็นวิศวกรผู้ควบคุมงานโครงสร้าง

(๕) เป็นวิศวกรผู้ออกแบบระบบปรับภาวะอากาศและระบบระบายอากาศและระบบป้องกันเพลิงไหม้

(๖) เป็นวิศวกรผู้ควบคุมงานระบบปรับภาวะอากาศและระบบระบายอากาศ

(๗) เป็นวิศวกรผู้ควบคุมงานระบบป้องกันเพลิงไหม้

(๘) เป็นวิศวกรผู้ออกแบบระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง

(๙) เป็นวิศวกรผู้ควบคุมงานระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง

(๑๐) เป็นวิศวกรผู้ออกแบบระบบลิฟต์

(๑๑) เป็นวิศวกรผู้ควบคุมงานระบบลิฟต์

(๑๒) เป็นวิศวกรผู้ออกแบบระบบไฟฟ้า

(๑๓) เป็นวิศวกรผู้ควบคุมงานระบบไฟฟ้า

(๑๔) เป็นวิศวกรผู้ตรวจสอบงานออกแบบและคำนวณส่วนต่างๆ ของโครงสร้างอาคาร

ข้อ ๔ กำหนดแล้วเสร็จงาน ๗๓๐ วัน โดยจะเริ่มต้นก่อสร้างอาคาร/ดัดแปลงอาคาร/รื้อถอนอาคาร/เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคารเมื่อ ๒๐ พฤษภาคม ๒๕๕๔ และจะแล้วเสร็จเมื่อ ๒๐ พฤษภาคม ๒๕๕๖

ข้อ ๕ ค่าธรรมเนียมในการตรวจแบบ ๑๒,๔๐๐.๐๐ บาท

ค่าธรรมเนียมใบอนุญาต ๑๐.๐๐ บาท

รวมทั้งสิ้น ๑๒,๔๑๐.๐๐ บาท

ข้อ ๖ ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

๖.๑ ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและ หรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา ๘ (๑๑) มาตรา ๙ หรือมาตรา ๑๐ แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ.๒๕๒๒ แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ ๒) พ.ศ. ๒๕๓๕

[redacted]

วันที่ ๒๐ พ.ค. ๒๕๕๔

วันที่ ๒๐ พ.ค. ๒๕๕๔

วันที่ ๒๐ พ.ค. ๒๕๕๔

๖.๒ จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่น และฝุ่นละอองฟุ้งกระจายอันเนื่องมาจากการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กั้นตัวอาคารสูงตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้านรอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้างไม่น้อยกว่า ๒.๐๐ เมตร ตลอดแนวอาคารด้านที่มีระยะราบวัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดินต่างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษา ให้อยู่ในสภาพดีตลอดเวลาการก่อสร้าง

๖.๓ จะต้องจัดให้มีปล่องขั่วคราวสำหรับทิ้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละอองมลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุให้เกิดความเดือดร้อนรำคาญและเป็นภยันตรายแก่สุขภาพ ชีวิต และทรัพย์สินของประชาชนที่อยู่ในบริเวณใกล้เคียง

ข้อ ๗ ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา ๓๙ ทวิ หรือนับแต่วันที่เริ่มการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี ถ้าเจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคารที่ได้แจ้งไว้ แผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคาร ที่ได้ยื่นไว้ ตามมาตรา ๓๙ ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าวหรือกฎหมายอื่นที่เกี่ยวข้องเจ้าพนักงานท้องถิ่นยังคงมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

ข้อ ๘ ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

๘.๑ การกระทำดังกล่าวเป็นการรุกล้ำที่สาธารณะ

๘.๒ การกระทำดังกล่าวที่เกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้าหรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือ

๘.๓ การกระทำดังกล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง ดัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือเปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ ๙ ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้อง ต่อไปด้วย

ข้อ ๑๐ ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจากที่ได้แจ้งไว้จากที่ได้แจ้งไว้

ข้อ ๑๑ ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่ง ความลึก และขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อประปา สายเคเบิล เป็นต้น และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดภยันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ ๑๒ เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ลึกจนอาจเป็นอันตรายแก่อาคาร ถนนหรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีค้ำยัน เข็มพืด หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัย และต้องตรวจสอบแก้ไขค้ำยัน เข็มพืดและฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

[redacted]

ข้อ ๑๓ ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อม และแผนการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจากสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ ทส ๑๐๐๙.๕/๔๕๑๕ ลงวันที่ ๑๘ มิถุนายน ๒๕๕๑ อย่างเคร่งครัด

ออกให้ ณ วันที่ ๒๐ พ.ค. ๒๕๕๔

[redacted]

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.๑ เลขรับที่ ๒๕๘
ลงวันที่ ๒๐ เดือน พฤษภาคม พ.ศ. ๒๕๕๔
ราย บริษัท โอ๊คทรี จำกัด

[redacted]

คำเตือน

๑. ถ้าผู้แจ้งฯจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งฯ กับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และ มีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว

๒. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งที่สร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กลับรถ และทางเข้า ออกของรถตามที่กำหนดไว้ในใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กลับรถ และทางเข้าออกของรถไว้ ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กลับรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

๓. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุม การใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด ๓๐ วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

[redacted]

เอกสารแนบ 3

สำเนาใบรับรองการก่อสร้างอาคาร ดัดแปลงอาคาร หรือเคลื่อนย้ายอาคาร (อ.6)

~~อาคารโรงแรม~~
~~อาคารพาณิชย์~~
~~อาคารหอประชุม~~

อาคารประเภทควบคุมการใช้ ตามมาตรา 32
อาคารสำนักงานหรือที่ทำการ
การดัดแปลงอาคาร

แบบ อ. ๖
000131



ค่าเตือน
ให้จัดส่งรายงานผลการตรวจสอบใหญ่ของอาคาร ตามกฎกระทรวง ว่าด้วยหลักเกณฑ์การตรวจสอบอาคาร พ.ศ. 2548 ภายใน 30 ก่อนใบรับรองการก่อสร้างอาคารจะมีระยะเวลาครบ 1 ปี

ใบรับรองการก่อสร้างอาคาร ดัดแปลงอาคาร หรือเคลื่อนย้ายอาคาร

เลขที่ ๑๙ / ๒๕๕๕ [redacted]

ใบรับรองฉบับนี้แสดงว่า บริษัท โอ๊คทรี จำกัด เจ้าของอาคาร/ผู้ครอบครองอาคาร

อยู่บ้านเลขที่ ๑๗๘/๗ ตรอก/ซอย - ถนน รัชดาภิเษก หมู่ที่ -

ตำบล/แขวง จันทรเกษม อำเภอ เขต จตุจักร จังหวัด กรุงเทพมหานคร

ได้ทำการ ก่อสร้างและดัดแปลง อาคาร เป็นไปโดยถูกต้องตามที่ได้รับอนุญาตในใบอนุญาต ตามแบบ กทม.๖

เลขที่ ๒๕๘ / ๒๕๕๔ ลงวันที่ ๒๐ เดือน พฤษภาคม พ.ศ. ๒๕๕๔

ซึ่งอาคารดังกล่าวเป็นอาคารประเภทควบคุมการใช้ เจ้าพนักงานท้องถิ่นจึงออกใบรับรองให้ดังต่อไปนี้

ข้อ ๑ เป็นอาคาร ชั้นใต้ดิน ๒ ชั้น

(๑) ชนิด ตึก ๒๙ ชั้น จำนวน ๑ หลัง เพื่อใช้เป็น โรงแรม (๒๓๗ ห้อง)-ภัตตาคาร-พาณิชย์-สำนักงาน-ห้องประชุม-จอดรถยนต์

โดยมีที่จอดรถ ที่กลับรถ และทางเข้าออกของรถ จำนวน ๒๓๐ คัน

(๒) ชนิด - จำนวน - เพื่อใช้เป็น -

โดยมีที่จอดรถ ที่กลับรถ และทางเข้าออกของรถ จำนวน - คัน

(๓) ชนิด - จำนวน - เพื่อใช้เป็น -

โดยมีที่จอดรถ ที่กลับรถ และทางเข้าออกของรถ จำนวน - คัน

ที่บ้านเลขที่ - ตรอก/ซอย - ถนน สาทร

หมู่ที่ - ตำบล/แขวง สีลม อำเภอ/เขต บางรัก จังหวัด กรุงเทพมหานคร

โดย บริษัท โอ๊คทรี จำกัด เป็นเจ้าของอาคาร และ บริษัท โอ๊คทรี จำกัด

เป็นผู้ครอบครองอาคาร อยู่ในที่ดิน โฉนดที่ดิน เลขที่ ๓๐๗๘, ๕๐๒๑, ๕๐๒๒

เป็นที่ดินของ [redacted] ตามใบรับรองการก่อสร้างและดัดแปลงอาคาร ฉบับละ ๑๐.๐๐ บาท

ข้อ ๒ ผู้ได้รับใบรับรองต้องปฏิบัติตามเงื่อนไข ดังต่อไปนี้

(๑) ผู้ได้รับใบรับรองต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวง และหรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา ๘ (๑๑) มาตรา ๙ หรือมาตรา ๑๐ แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๒๒ แก้ไขเพิ่มเติมตามพระราชบัญญัติควบคุมอาคาร (ฉบับที่ ๒) พ.ศ. ๒๕๓๕ และ (ฉบับที่ ๓) พ.ศ.๒๕๔๓

(๒) ต้องปฏิบัติตามเงื่อนไขแนบท้ายใบรับรองฉบับนี้

ออกให้ ณ วันที่ ๒๔ เดือน มี.ค. ๒๕๕๕ พ.ศ.

น.3/1

เงื่อนไขท้ายใบรับรองการก่อสร้างและดัดแปลงอาคารเลขที่ ๑๕/๒๕๕๕

ราย บริษัท โอ๊คทรี จำกัด

- ผู้ได้รับใบรับรองต้องปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อมตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมที่ได้รับความเห็นชอบจากสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อมตามหนังสือที่ ทส ๑๐๐๙.๕/๔๕๑๕ ลงวันที่ ๑๘ มิถุนายน ๒๕๕๑

[redacted]

คำเตือน

๑. ห้ามเจ้าของหรือผู้ครอบครองอาคารใช้หรือยินยอมให้บุคคลใดใช้อาคารเพื่อกิจการอื่น นอกจากที่ระบุไว้ในใบรับรองฉบับนี้

๒. ห้ามเจ้าของหรือผู้ครอบครองอาคาร เปลี่ยนการใช้อาคารบางประเภท ควบคุมการใช้สำหรับกิจการหนึ่งไปใช้เป็นอาคารประเภทควบคุมการใช้สำหรับอีกกิจการหนึ่ง เว้นแต่จะได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

๓. ห้ามเจ้าของหรือผู้ครอบครองอาคารที่ต้องมีพื้นที่หรือสิ่งที่สร้างขึ้นเพื่อใช้เป็นที่จอดรถ ที่กลับรถ และทางเข้าออกของรถตามที่กำหนดไว้ในกฎกระทรวง ดัดแปลง หรือใช้ที่จอดรถ ที่กลับรถ และทางเข้าออกของรถนั้นเพื่อการอื่นไม่ว่าทั้งหมดหรือบางส่วน เว้นแต่จะได้รับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

๔. ผู้ได้รับใบรับรองต้องแสดงใบรับรองฉบับนี้ไว้ในที่เปิดเผยและเห็นได้ง่าย ณ อาคารนั้น

เอกสารแนบ 4

สำเนาใบอนุญาตประกอบธุรกิจโรงแรม (ร.ร.2) และบันทึกการแจ้งเปลี่ยนชื่อโรงแรม

แบบ ร.ร.๒



ทะเบียนเลขที่ ๓๘๐

ใบอนุญาตเลขที่ ๔/๒๕๖๖

กระทรวงมหาดไทย

ใบอนุญาตประกอบธุรกิจโรงแรม

ใบอนุญาตฉบับนี้ให้ไว้เพื่อแสดงว่า **บริษัท โอ๊คทรี จำกัด**

[redacted]

ได้รับอนุญาตให้ประกอบธุรกิจโรงแรมตามมาตรา ๑๕ แห่งพระราชบัญญัติโรงแรม พ.ศ. ๒๕๔๗ โดยใช้ชื่อภาษาไทยว่า **โซ แบงคอก**

ชื่อภาษาต่างประเทศ (ถ้ามี) SO BANGKOK

โรงแรมประเภท ๓ จำนวนห้องพัก ๒๓๗ ห้อง

สถานที่ตั้ง **เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร**

ตั้งแต่วันที่ ๓๑ เดือน มกราคม พ.ศ ๒๕๖๖ ถึง วันที่ ๓๐ เดือน มกราคม พ.ศ ๒๕๗๑

ออกให้ ณ วันที่ ๒ เดือน ธันวาคม พ.ศ ๒๕๖๕

[redacted]

น.4/1

ที่ มท ๐๓๐๗.๖/ ๓๐๓๖๖

กรมการปกครอง
ถนนอัษฎางค์ กทม. ๑๐๒๐๐

๖ ธันวาคม ๒๕๖๕

เรื่อง ขอต่ออายุใบอนุญาตประกอบธุรกิจโรงแรม “โซ แบงคอก”

เรียน ผู้ประกอบธุรกิจโรงแรม “โซ แบงคอก”

อ้างถึง แบบคำขอต่ออายุใบอนุญาตประกอบธุรกิจโรงแรม (แบบ ร.ร. ๑/๑) เลขที่รับ ๑๔๑/๒๕๖๕ ลงวันที่ ๑๑ พฤศจิกายน ๒๕๖๕

สิ่งที่ส่งมาด้วย แบบบันทึกช่วยจำในการประกอบธุรกิจโรงแรม จำนวน ๑ ชุด

ตามที่ บริษัท โอ๊คทรี จำกัด โดย นายวรุต ตันติพิภพ และนางทศพร อังสุวรังษี กรรมการผู้มีอำนาจลงนามผูกพันบริษัท ผู้ประกอบธุรกิจโรงแรม “โซ แบงคอก” ได้ยื่นคำขอต่ออายุใบอนุญาตประกอบธุรกิจโรงแรมดังกล่าว ต่อนายทะเบียนโรงแรมกรุงเทพมหานคร ความละเอียดตามอ้างถึง นั้น

กรมการปกครองขอเรียนว่า นายทะเบียนโรงแรมกรุงเทพมหานครได้พิจารณาอนุญาตให้ท่านต่ออายุใบอนุญาตประกอบธุรกิจโรงแรมดังกล่าวแล้ว ดังนั้น จึงขอให้ท่านไปรับใบอนุญาตประกอบธุรกิจโรงแรมข้างต้น พร้อมกับชำระค่าธรรมเนียมการต่ออายุใบอนุญาต ณ ส่วนการรักษาความสงบเรียบร้อย ๓ สำนักการสอบสวนและนิติการ กรมการปกครอง (วังไชยา) ถนนนครสวรรค์ แขวงสี่แยกมหานาค เขตดุสิต กรุงเทพมหานคร ทั้งนี้ ขอความร่วมมือในการใช้บันทึกช่วยจำฯ เพื่อเป็นประโยชน์ในการบริหารจัดการโรงแรมต่อไป รายละเอียดปรากฏตามสิ่งที่ส่งมาด้วย อนึ่ง เนื่องจากโรงแรมดังกล่าวเป็นโครงการหรือกิจการที่มีการจัดทำรายงานการประเมินผลกระทบสิ่งแวดล้อม ดังนั้น ขอให้จัดทำรายงานผลการปฏิบัติตามมาตรการที่กำหนดไว้ในรายงานการประเมินผลกระทบสิ่งแวดล้อมเสนอต่อนายทะเบียนโรงแรมกรุงเทพมหานคร ในฐานะเจ้าหน้าที่ซึ่งมีอำนาจอนุญาตด้วย รวมทั้งขอให้ถือปฏิบัติตามเงื่อนไขที่คณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมด้านโครงการบริการชุมชน ได้มีมติเห็นชอบรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมดังกล่าว ซึ่งสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อมได้แจ้งให้ทราบแล้วด้วย

จึงเรียนมาเพื่อทราบและดำเนินการ

ขอแสดงความนับถือ

[redacted]

สำนักการสอบสวนและนิติการ
ส่วนการรักษาความสงบเรียบร้อย ๓
โทร./โทรสาร ๐ ๒๓๕๖ ๙๕๑๘

Change For Good กระทรวงมหาดไทย
ป้ายบัตทุกข์ บำรุงสุข

ที่ มท ๐๓๐๗.๖/๖๐๖๔

กรมการปกครอง
ถนนอัษฎางค์ กทม. ๑๐๒๐๐

๒๖ กันยายน ๒๕๕๙

เรื่อง บริษัท โอ๊คทรี จำกัด ขอเปลี่ยนชื่อโรงแรม

เรียน ผู้ประกอบธุรกิจโรงแรม โซฟิเทล โซ แบงคอก

ตามที่ บริษัท โอ๊คทรี จำกัด โดย นายวีรวัฒน์ องค์วาสิฏฐ์ และ นางกิ่งพร สพโชคชัย สำนักงานใหญ่ตั้งอยู่เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ผู้ประกอบธุรกิจโรงแรม โซฟิเทล โซ แบงคอก ตั้งอยู่เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร เป็นโรงแรมประเภท ๓ มีจำนวนห้องพัก ๒๓๗ ห้อง ออกให้ ณ วันที่ ๓๑ มกราคม ๒๕๕๖ ได้รับอนุญาตให้ประกอบธุรกิจโรงแรมตั้งแต่วันที่ ๓๑ มกราคม ๒๕๕๖ จนถึงวันที่ ๓๐ มกราคม ๒๕๖๑ ได้ยื่นคำขอเปลี่ยนชื่อโรงแรมจาก "โซฟิเทล โซ แบงคอก"เป็น"โซ โซฟิเทล แบงคอก" และเปลี่ยนชื่อจากภาษาอังกฤษ "SOFITEL SO BANGKOK" เป็น "SO SOFITEL BANGKOK" นั้น

นายทะเบียนโรงแรมกรุงเทพมหานครพิจารณาอนุญาตให้เปลี่ยนชื่อโรงแรมของผู้ประกอบธุรกิจโรงแรมได้ตามคำขอ จึงขอให้ท่านไปรับใบอนุญาตประกอบธุรกิจโรงแรม ณ ส่วนรักษาความสงบเรียบร้อย ๓ สำนักการสอบสวนและนิติการ กรมการปกครอง (วังไชยา) ถนนนครสวรรค์ เขตดุสิต กรุงเทพมหานคร

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

[redacted]

สำนักการสอบสวนและนิติการ
ส่วนรักษาความสงบเรียบร้อย ๓
โทร./โทรสาร ๐-๒๓๕๖-๙๕๕๙

เอกสารแนบ 5

สำเนาหนังสือรับรองจดทะเบียนบริษัท

ที่ 10031220049630

สำนักงานทะเบียนหุ้นส่วนบริษัทกลาง
กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์

หนังสือรับรอง

ขอรับรองว่าบริษัทนี้ ได้จดทะเบียนเป็นนิติบุคคล ตามประมวลกฎหมายแพ่งและพาณิชย์
เมื่อวันที่ 31 มีนาคม 2548 ทะเบียนนิติบุคคลเลขที่ 0105548045937
ปรากฏข้อความในรายการตามเอกสารทะเบียนนิติบุคคล ณ วันออกหนังสือนี้ ดังนี้

1. ชื่อบริษัท บริษัท โอ๊คทรี จำกัด
2. กรรมการของบริษัทมี 6 คน ตามรายชื่อดังต่อไปนี้

[redacted]

ของบริษัท/

4. ทุนจดทะเบียน 850,000,000.00 บาท / แปดร้อยห้าสิบล้านบาทถ้วน/
5. สำนักงานแห่งใหญ่ ตั้งอยู่เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร/
6. วัตถุที่ประสงค์ของบริษัทมี 29 ข้อ ดังปรากฏในสำเนาเอกสารแนบท้ายหนังสือรับรองนี้ จำนวน 2 แผ่น โดยมีลายมือชื่อนายทะเบียนซึ่งรับรองเอกสารเป็นสำคัญ

ออกให้ ณ วันที่ 15 เดือน ธันวาคม พ.ศ. 2565

[redacted]

ที่ 10031220049630

สำนักงานทะเบียนหุ้นส่วนบริษัทกลาง
กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์

หนังสือรับรอง

ข้อควรทราบ ประกอบหนังสือรับรอง ฉบับที่ 10031220049630

1. นิติบุคคลนี้ได้ส่งงบการเงินปี 2564

2. หนังสือนี้รับรองเฉพาะข้อความที่ห้าง/บริษัทได้นำมาจดทะเบียนไว้เพื่อผลทางกฎหมายเท่านั้น ข้อเท็จจริงเป็นสิ่งที่ควรหาไว้พิจารณาฐานะ

3. นายทะเบียนอาจเพิกถอนการจดทะเบียน ถ้าปรากฏว่าข้อความอันเป็นสาระสำคัญที่จดทะเบียน ไม่ถูกต้อง หรือเป็นเท็จ

วัตถุที่ประสงค์ของ ห้างหุ้นส่วน/บริษัท นี้ มี 29 ข้อ ดังนี้

(1) ประกอบกิจการผลิตภัณฑ์อะไหล่วิทยุโทรทัศน์ และอุปกรณ์ไฟฟ้า รวมทั้ง[redacted]ทรนิคส์ทุกชนิด

(2) ประกอบกิจการอุตสาหกรรมผลิต ประกอบและซ่อมเครื่องรับโทรทัศน์ เครื่องรับวิทยุ เครื่องขยายเสียง เครื่องบันทึกเสียง เครื่องมือแพทย์ เครื่องเล่นจานเสียง เครื่องคอมพิวเตอร์ไฟฟ้า

(3) ประกอบกิจการอุตสาหกรรมบรรจุอาหารกระป๋องทุกชนิด

(4) กู้ยืมเงิน เบิกเกินบัญชีธนาคารนิติบุคคลหรือสถาบันการเงินอื่น และให้กู้ยืมเงินหรือให้เครดิตด้วยวิธีการอื่น โดยจะมีหลักประกันหรือไม่ก็ตาม รวมทั้งการรับออก โอน และสลักหลังตั๋วเงิน หรือตราสารที่เปลี่ยนมือได้อย่างอื่น

(5) ทำการประกอบกิจการโรงงานอุตสาหกรรมร่วมผลิต ประกอบและซ่อมเครื่องรับวิทยุ เครื่องรับโทรทัศน์ ชิ้นส่วน-อะไหล่ของเครื่องรับวิทยุโทรทัศน์ เครื่องคิดเลข โทรทัศน์วงจรปิด กล้องโทรทัศน์ เครื่องบันทึกเสียง

(6) ทำการประกอบกิจการโรงงานอุตสาหกรรมผลิตเครื่องอุปโภค บริโภค ตั้งโรงงาน ทำเครื่องกระป๋อง โรงงานทอผ้า

(7) ทำการสั่งสินค้าจากต่างประเทศ และส่งสินค้าไปยังต่างประเทศตามวัตถุประสงค์ของบริษัท

(8) ทำการซื้อ-ขายสินค้า เครื่องไฟฟ้าทุกชนิด และเคมีภัณฑ์ทุกชนิด

(9) ทำการเป็นนายหน้า ตัวแทน ตัวแทนค้าต่างในการซื้อขายสินค้าทุกชนิด(ยกเว้นกิจการประกันภัย กิจการหาสมาชิกให้สังคม และกิจการซื้อขายหลักทรัพย์)

(10) ทำการรับเหมาก่อสร้าง และรับจ้างทำของตามวัตถุประสงค์ทั้งหมด ทำการโดยตนเอง เป็นตัวแทนในการขนสินค้าและคนโดยสาร ทั้งทางบก เรือ อากาศ

(11) กู้หรือให้กู้ยืมเงินโดยมี หรือไม่มีหลักประกันตลอดทั้งการประกันหนี้สินทุกประเภท ทั้งในและนอกประเทศ และทำความตกลงใดๆ กับรัฐบาล เทศบาล หรือบุคคลอื่นใด เพื่อให้ได้มาซึ่งสิทธิสัมปทาน ประทานบัตร และเอกสิทธิใดๆ บรรดาที่บริษัท เห็นว่าจะทำให้สำเร็จตามวัตถุประสงค์ของบริษัท

(12) เข้าเป็นผู้ถือหุ้นในบริษัทจำกัด หรือเป็นหุ้นส่วนจำกัดความรับผิดชอบในห้างหุ้นส่วน เพื่อประโยชน์ของบริษัท

(13) ประกอบธุรกิจบริการรับเป็นผู้จัดการและดูแลผลประโยชน์ เป็นผลประโยชน์ และจัดการทรัพย์สินให้บุคคลอื่น

(14) ทำขึ้น ซื้อเข้า เช่าซื้อ ขายฝากสังหาริมทรัพย์ต่างๆ ที่เป็นเครื่องใช้ในสำนักงาน เครื่องใช้ในบ้าน เครื่องครัว เครื่องตกแต่งยานพาหนะ

(15) ทำการสั่งเข้ามา และส่งออกเพื่อการจัดซื้อและจำหน่ายทำกำไร ซึ่งสินค้าและอุปกรณ์ทุกชนิด ได้แก่ สินค้าเกี่ยวกับเครื่องมือกล เครื่องมือวิทยาศาสตร์ เครื่องเลเซอร์และอุปกรณ์ เครื่องคำนวณ เครื่องวัดระยะทาง เครื่องเรดาร์ กล้องส่องในทางที่มืด เครื่องพิมพ์อิเลคโทรนิคส์ เครื่องอิเลคโทรนิคส์ ที่ใช้ในการทหาร เครื่องตรวจคลื่นสมอง เครื่องโซล่าอิเลคโทรนิคส์ เครื่องวิเคราะห์สารเคมี และอุปกรณ์ทุกชนิด เครื่องฉายรังสีทุกชนิด เครื่องตรวจหัวใจด้วยไฟฟ้า และแบตเตอรี่ เครื่องเทเลกซ์ เครื่องมือทุ่นแรงทุกอย่างทุกชนิด รถยนต์ รถจักรยานยนต์ รถลากเข็นทุกชนิด เครื่องจักรกลและเครื่องยนต์และอุปกรณ์ทุกชนิด สินค้าอิเลคโทรนิคส์ และเครื่องไฟฟ้าและอุปกรณ์ทุกชนิด

วัตถุที่ประสงค์ของ ห้างหุ้นส่วน/บริษัท นี้ มี.....29.....ข้อ ดังนี้

(16) ประกอบกิจการพัฒนา ซื้อขาย แลกเปลี่ยน เช่า ให้เช่า ยืม ให้ยืม จำนำจำนอง [redacted] รัพย์สินใดๆ ทั้ง.....สังหาริมทรัพย์และอสังหาริมทรัพย์ เพื่อดำเนินการตามวัตถุประสงค์ของบริษัทดังกล่าวข้างต้นตลอดจนเพื่อเป็นการชำระหนี้ของลูกหนี้ต่อบริษัท ทั้งภายในขอบเขตแห่งวัตถุประสงค์ของบริษัท และมิให้เป็นการค้ากำไรทางที่ดินหรือกิจการเครดิตฟองซิเอร์ นอกจากนี้จะผู้ค้ำประกันบุคคลหนึ่งนิติบุคคลในการปฏิบัติการชำระหนี้ใดๆ หรือการปฏิบัติงานของบริษัท ตามกฎหมายว่าด้วยคนเข้าเมือง

(17) บริษัทมีอำนาจออกหุ้นโดยราคาสูงกว่ามูลค่าหุ้นที่ตราไว้

(18) ทำการจัดตั้งสำนักงานสาขาหรือแต่งตั้งตัวแทน ทั้งภายในและภายนอกประเทศ

(19) เข้าเป็นหุ้นส่วนจำกัดความรับผิดชอบในห้างหุ้นส่วน และเป็นผู้ถือหุ้นในบริษัทจำกัดอื่น

(20) ประกอบกิจการค้ายารักษาและป้องกันโรคสำหรับคนและสัตว์ เครื่องเวชภัณฑ์ เคมีภัณฑ์ เครื่องมือแพทย์ และเภสัชกรรม ปุ๋ย ยาปราบศัตรูพืช ยาบำรุงพืชและสัตว์ทุกชนิด เครื่องมือเครื่องใช้ในทางวิทยาศาสตร์

(21) ประกอบกิจการค้ากระดาษ เครื่องเขียน แบบเรียน แบบพิมพ์ หนังสือ อุปกรณ์การเรียน เครื่องคำนวณ เครื่องพิมพ์ อุปกรณ์การพิมพ์ สิ่งพิมพ์ หนังสือพิมพ์ ตู้เก็บเอกสาร และเครื่องใช้ในสำนักงานทุกชนิด

(22) ประกอบกิจการโรงแรม ภัตตาคาร บาร์ ไนท์คลับ อาบอบนวด โรงภาพยนต์ และโรงมหรสพอื่น สถานพักตากอากาศ สนามกีฬา สระว่ายน้ำ

(23) ประกอบกิจการสั่งเข้ามาจำหน่ายในประเทศ และส่งออกไปจำหน่ายยังต่างประเทศ ซึ่งสินค้าตามที่กำหนดไว้ในวัตถุประสงค์

(24) ประกอบกิจการบริการทางด้านกฎหมาย ทางบัญชี ทางวิศวกรรม ทางสถาปัตยกรรม รวมทั้งกิจการโฆษณา

(25) ประกอบธุรกิจบริการรับค้ำประกันหนี้สิน ความรับผิด และการปฏิบัติการตามสัญญาของบุคคลอื่นรวมทั้งรับบริการค้ำประกันบุคคลซึ่งเดินทางเข้ามาในประเทศหรือเดินทางออกไปต่างประเทศตามกฎหมายว่าด้วยคนเข้าเมือง กฎหมายว่าด้วยภาษีอากร และกฎหมายอื่น

(26) ประกอบธุรกิจบริการรับเป็นที่ปรึกษาให้คำแนะนำปัญหาเกี่ยวกับด้านบริหารงาน พาณิชยกรรม อุตสาหกรรม รวมทั้งปัญญาการผลิต การตลาดและจัดจำหน่าย

(27) ประกอบกิจการประมูล เพื่อขายสินค้าและรับสร้างทำของ ตามวัตถุที่ประสงค์ทั้งหมดให้แก่บุคคล คณะบุคคล นิติบุคคล ส่วนราชการ และองค์กรของรัฐ

(28) ประกอบการกิจการให้บริการในสถานประกอบการเพื่อสุขภาพ ประเภทสปาและกิจการนวดเพื่อสุขภาพ หรือเพื่อเสริมความงาม

(29) ประกอบกิจการให้บริการเช่าที่พักผ่านทางอิเล็กทรอนิกส์

เอกสารแนบ 6

สำเนาเอกสารขออนุมัติการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสีย ของกรุงเทพมหานคร



ที่ กท ๑๐๐๗/ ๗/๓๑

สำนักงานจัดการคุณภาพน้ำ สำนักการระบายน้ำ
๑๒๓ ถนนมิตรไมตรี เขตดินแดง กทม. ๑๐๔๐๐

๓๑ มีนาคม ๒๕๕๔

เรื่อง ขออนุมัติการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร
โครงการ โรงแรม โซฟีเทล วีรันดา

เรียน กรรมการผู้จัดการบริษัท โอ๊คทรี จำกัด

อ้างถึง ๑.หนังสือเลขที่ SFV-LET-PLE No.๐๐๓/๕๓ ลงวันที่ ๑๑ พฤศจิกายน ๒๕๕๓
๒.หนังสือเลขที่ SFV-LET-PLE No.๐๐๔/๕๔ ลงวันที่ ๑๒ กุมภาพันธ์ ๒๕๕๔

ตามหนังสือที่อ้างถึง ๑.บริษัทฯ ขออนุมัติ Shop Drawing การเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร โครงการ โรงแรม โซฟีเทล วีรันดา และตามหนังสือที่อ้างถึง ๒. บริษัทฯ ได้ส่งรายละเอียดเพิ่มเติมขั้นตอนการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร มาเพื่อพิจารณาอนุมัติรูปแบบการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร โครงการ โรงแรม โซฟีเทล วีรันดา นั้น

สำนักงานจัดการคุณภาพน้ำ สำนักการระบายน้ำ ได้พิจารณาแล้วและอนุมัติการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร ของโครงการ โรงแรม โซฟีเทล วีรันดา

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

[redacted]

กลุ่มงานพัฒนาระบบบำบัดน้ำเสีย
โทร. ๐ ๒๒๔๖ ๐๒๗๔
โทรสาร ๐ ๒๒๔๖ ๐๒๗๔

ที่ กท 4303/2918

สำนักงานเขตบางรัก
5 ถนนนเรศ กทม. 10500

๒ ๘ ส.ค. 2550

เรื่อง ขอหนังสือรับรองการอนุญาตเชื่อมทางสาธารณะ และระบายน้ำลงสู่ท่อระบายน้ำสาธารณประโยชน์

เรีย[redacted]การบริษัท โอ๊คทรี จำกัด

อ้างถึง หนังสือบริษัทฯ ลงวันที่ 25 มิถุนายน 2550

ตามหนังสือที่อ้างถึง บริษัทฯ มีความประสงค์จะขอหนังสือรับรองการอนุญาตให้เชื่อมทางสาธารณะและระบายน้ำลงสู่ท่อระบายน้ำสาธารณประโยชน์ ของที่ดิน โฉนดที่ดินเลขที่ 3078, 5021 และ 5022 เลขที่ดิน 97, 96 และ 95 ตำบลสีลม (บางรัก) อำเภอบางรัก กรุงเทพมหานคร ซึ่งตั้งอยู่บริเวณถนนสาทรเหนือและถนนพระรามที่ 4 เขตบางรัก กรุงเทพมหานคร เพื่อนำหนังสือรับรองฯ ไปใช้เป็นเอกสารประกอบการขออนุญาตก่อสร้างโครงการโรงแรม ขนาด 281 ห้อง จำนวน 1 อาคาร นั้น

สำนักงานเขตบางรักได้พิจารณาแล้ว อนุญา[redacted]รตามประสงค์ได้ ทั้งนี้ จะต้องปฏิบัติให้เป็นไปตามเงื่อนไข ดังต่อไปนี้

1. จะต้องปฏิบัติตามข้อบัญญัติกรุงเทพมหานคร เรื่อง การควบคุมอาคาร พ.ศ. 2544 ออกโดยอาศัยอำนาจตามความในมาตรา 9 และมาตรา 10 แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. 2522 แก้ไขเพิ่มเติมโดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ. 2535

2. จะต้องปฏิบัติตามกฎกระทรวง ฉบับที่ 51 (พ.ศ. 2541) ออกตามความในพระราชบัญญัติควบคุมอาคาร พ.ศ. 2522

อนึ่ง เมื่อทางบริษัทฯ ได้รับใบอนุญาตให้ทำการก่อสร้างตามโครงการดังกล่าวแล้ว ก่อนที่จะทำการเชื่อมทางและระบายน้ำลงสู่ท่อระบายน้ำสาธารณประโยชน์ จะต้องแจ้งขออนุญาตจากสำนักงานเขตบางรักอีกครั้งหนึ่ง เมื่อสำนักงานเขตบางรักตรวจสอบและอนุญาตแล้ว จึงจะทำการตามที่ขออนุญาตได้

จึงเรียนมาเพื่อโปรดทราบ

ขอแสดงความนับถือ

[redacted]

[redacted]

น.6/2

เอกสารแนบ 7

เอกสารบันทึกสถิติการใช้ไฟฟ้าและน้ำประปา ในปี 2567

SO/ BANGKOK

Utility Consumption Cost for January 2024

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	17601.33	19144	7303.448	12356	10298	6792	0	1068	1.128	0	129009.691	206.75
2	17620.48	20892	7315.804	11996	10305	8892	1.068	0	1.128	0	129216.439	304.79
3	17641.37	20252	7327.8	12408	10314	7848	1.068	32	1.128	0	129521.234	243.47
4	17661.62	21024	7340.208	13580	10321	7444	1.1	56	1.128	0	129764.707	244.67
5	17682.64	21280	7353.788	0	10329	21244	1.156	0	1.128	0	130009.377	265.83
6	17703.92	21104	7353.788	0	10350	21140	1.156	0	1.128	0	130275.205	258.53
7	17725.03	21152	7353.788	12940	10371	8212	1.156	0	1.128	0	130533.732	259.3
8	17746.18	22704	7366.728	13476	10379	9224	1.156	24	1.128	0	130793.032	282.98
9	17768.88	21604	7380.204	12984	10389	8620	1.18	0	1.128	0	131076.013	229.25
10	17790.49	22284	7393.188	13552	10397	8736	1.18	0	1.128	0	131305.26	289.76
11	17812.77	21680	7406.74	13712	10406	7968	1.18	20	1.128	0	131595.019	305.31
12	17834.45	22100	7420.452	0	10414	21000	1.2	0	1.128	0	131900.325	344.57
13	17856.55	21812	7420.452	0	10435	22912	1.2	0	1.128	0	132244.900	327.72
14	17878.36	21680	7420.452	12924	10458	8756	1.2	0	1.128	0	132572.617	307.01
15	17900.04	20984	7433.376	12364	10467	8592	1.2	0	1.128	0	132879.628	288.68
16	17921.03	19952	7445.74	12452	10475	7528	1.2	0	1.128	0	133168.304	279.77
17	17940.98	21016	7458.192	13172	10483	7840	1.2	0	1.128	0	133448.078	308.31
18	17962	20980	7471.364	13324	10491	7660	1.2	0	1.128	0	133756.392	278.63
19	17982.98	21228	7484.688	0	10498	21224	1.2	0	1.128	0	134035.022	315.6
20	18004.2	21096	7484.688	0	10520	21100	1.2	0	1.128	0	134350.624	282.47
21	18025.3	21080	7484.688	12604	10541	8476	1.2	0	1.128	0	134633.099	360.65
22	18046.38	22612	7497.292	13508	10549	9104	1.2	0	1.128	0	134993.753	342.88
23	18068.99	20860	7510.8	12620	10558	8236	1.2	0	1.128	0	135336.628	283.17
24	18089.85	20656	7523.42	12660	10566	7996	1.2	0	1.128	0	135619.797	325.51
25	18110.51	20204	7536.08	13188	10574	7016	1.2	0	1.128	0	135945.307	293.28
26	18130.71	21704	7549.268	0	10581	21708	1.2	0	1.128	0.004	136238.591	315.63
27	18152.42	22220	7549.268	0	10603	22220	1.2	0	1.132	0.012	136554.22	281.12
28	18174.64	20804	7549.268	13002	10625	7798	1.2	0	1.144	0	136835.343	289.48
29	18195.44	20804	7562.27	13006	10633	7798	1.2	0	1.144	0	137124.824	272.53
30	18216.24	21680	7575.276	13300	10641	8384	1.2	0	1.144	0	137397.357	252.18
31	18237.92	22500	7588.576	14092	10649	8404	1.2	0	1.144	0	137649.537	252.87
1	18260.42		7602.668		10658		1.2		1.144		137902.403	
		659092		299220		359872		1200		0.016		8892.7

Utility Consumption Cost for January 2024

	Unit price	Unit	Cost	City water used unit		8,893	Unit
Kwh On	4.1839	299220	1,251,906.56	cost		140,246.18	Bht
Kwh OFF	2.6037	359872	936,998.73	Operation cost(Bht/unit)	0.15	1,333.91	Bht
Kw peak	132.93	1200	159,516.00	service charge		-	Bht
ft	0.3972	659092	261,791.34	cost		141,580.08	Bht
service charge	312.24		312.24	Vat	0.07	9,910.61	Bht
Sum			2,610,524.87	Total cost		151,490.69	Bht
VAT	0.07		182,736.74				
	Grand total		2,793,261.61				

Utility Consumption Cost for February 2024

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	18260.420	23004	7602.668	14616	10657.8	8384	1.196	48	1.092	0	137902.403	308.67
2	18283.424	23436	7617.284	0	10666.1	23440	1.244	0	1.092	0.156	138211.071	309.51
3	18306.86	22456	7617.284	0	10689.6	22456	1.244	0	1.248	0	138520.576	352.28
4	18329.32	22364	7617.284	13520	10712	8840	1.244	0	1.248	0	138872.854	338.05
5	18351.68	21576	7630.804	13828	10720.9	7752	1.244	0	1.248	0	139210.906	277.13
6	18373.26	22872	7644.632	13908	10728.6	8964	1.244	0	1.248	0	139488.039	275.66
7	18396.13	22664	7658.54	14036	10737.6	8628	1.244	0	1.248	0	139763.696	260.77
8	18418.79	22516	7672.576	14024	10746.2	8492	1.244	0	1.248	0	140024.47	277.38
9	18441.31	22980	7686.6	0	10754.7	22980	1.244	0	1.248	0	140301.852	314.11
10	18464.29	22080	7686.6	0	10777.7	22076	1.244	0	1.248	0	140615.965	308.46
11	18486.37	21224	7686.6	12980	10799.8	8244	1.244	0	1.248	0	140924.42	422.46
12	18507.59	19836	7699.58	13372	10808	6464	1.244	0	1.248	0	141346.885	280.99
13	18527.43	22408	7712.952	13472	10814.5	8940	1.244	0	1.248	0	141627.879	360.24
14	18549.84	23384	7726.424	14156	10823.4	9228	1.244	0	1.248	0	141988.120	387.61
15	18573.22	22576	7740.58	14424	10832.6	8152	1.244	0	1.248	0	142375.730	331.61
16	18595.8	23152	7755.004	0	10840.8	23148	1.244	0	1.248	0	142707.341	320.44
17	18618.95	23428	7755.004	0	10863.9	23432	1.244	0	1.248	0	143027.776	345.01
18	18642.38	22476	7755.004	13864	10887.4	8612	1.244	0	1.248	0	143372.782	296.34
19	18664.85	20556	7768.868	13564	10896	6992	1.244	0	1.248	0	143669.123	249.66
20	18685.41	22808	7782.432	13744	10903	9060	1.244	0	1.248	0	143918.787	308.18
21	18708.22	23200	7796.176	13916	10912	9288	1.244	0	1.248	0	144226.97	332.87
22	18731.42	24180	7810.092	14800	10921.3	9376	1.244	0	1.248	0	144559.842	340.28
23	18755.6	23140	7824.892	0	10930.7	23144	1.244	0	1.248	0	144900.125	374.12
24	18778.74	23692	7824.892	0	10953.8	23692	1.244	0	1.248	0	145274.245	347.31
25	18802.43	22588	7824.892	13860	10977.5	8728	1.244	0	1.248	0	145621.559	350.02
26	18825.02	21856	7838.752	14252	10986.3	7600	1.244	4	1.248	0	145971.58	450.55
27	18846.87	24088	7853.004	14592	10993.9	9500	1.248	0	1.248	0	146422.13	346.47
28	18870.96	19524	7867.596	14416	11003.4	9108	1.248	0	1.248	0	146768.6	358.44
29	18890.48	28192	7882.012	14776	11012.5	9416	1.248	-20	1.248	0	147127.04	392.65
1	18918.68		7896.788		11021.9		1.228		1.248		147519.69	
		658256		294120		364136		32		0.156		9617.3

Utility Consumption Cost for February 2024

	Unit price		Unit	Cost				
Kwh On		4.1839	294120	1,230,568.67	City water used unit		9,617	Unit
Kwh OFF		2.6037	364136	948,100.90	cost		151,701.71	Bht
Kw peak		132.93	1228	163,238.04	Operation cost(Bht/unit)	0.15	1,442.59	Bht
ft		0.3972	658256	261,459.28	service charge		-	Bht
service charge		312.24		312.24	cost		153,144.30	Bht
Sum				2,603,679.13	Vat	0.07	10,720.10	Bht
VAT		0.07		182,257.54	Total cost		163,864.40	Bht
	Grand total			2,785,936.67				

Utility Consumption Cost for March 2024

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	18918.68	23970	7896.788	0	11022	22336	1.228	0	1.14	0	147519.69	369.34
2	18942.65	24234	7896.788	0	11044	25870	1.228	0	1.14	0.152	147889.034	377.4
3	18966.88	23512	7896.788	14676	11070	8836	1.228	36	1.292	0	148266.435	337.09
4	18990.4	22080	7911.464	14712	11079	7368	1.264	0	1.292	0	148603.529	344.55
5	19012.48	24084	7926.176	14108	11086	9976	1.264	0	1.292	0	148948.082	395.81
6	19036.56	23292	7940.284	14448	11096	8844	1.264	0	1.292	0	149343.893	343.83
7	19059.85	24308	7954.732	14852	11105	9456	1.264	0	1.292	0	149687.725	347.38
8	19084.16	24040	7969.584	0	11115	24040	1.264	0	1.292	0	150035.108	382.7
9	19108.2	24148	7969.584	0	11139	24148	1.264	0	1.292	0	150417.81	384.89
10	19132.35	23372	7969.584	14420	11163	8952	1.264	0	1.292	0	150802.703	331.99
11	19155.72	23052	7984.004	14320	11172	8732	1.264	0	1.292	0	151134.697	269.13
12	19178.77	22752	7998.324	14144	11180	8604	1.264	0	1.292	0	151403.825	313.63
13	19201.52	22324	8012.468	13832	11189	8496	1.264	0	1.292	0	151717.456	258.59
14	19223.85	23556	8026.3	14628	11198	8928	1.264	0	1.292	0	151976.044	297.63
15	19247.4	23600	8040.928	0	11206	23600	1.264	0	1.292	0	152273.670	317.17
16	19271	22800	8040.928	0	11230	22800	1.264	0	1.292	0	152590.838	294.72
17	19293.8	21748	8040.928	13208	11253	8540	1.264	0	1.292	0	152885.558	268.34
18	19315.55	21684	8054.136	13720	11261	7964	1.264	0	1.292	0	153153.898	276.48
19	19337.24	21340	8067.856	13436	11269	7904	1.264	0	1.292	0	153430.376	274.05
20	19358.58	21180	8081.292	12676	11277	8500	1.264	0	1.292	0	153704.422	258.01
21	19379.76	22324	8093.968	13888	11286	8440	1.264	0	1.292	0	153962.427	304.69
22	19402.08	22544	8107.856	0	11294	22544	1.264	0	1.292	0	154267.119	289.8
23	19424.62	23124	8107.856	0	11317	23120	1.264	0	1.292	0	154556.917	294.7
24	19447.75	21500	8107.856	13212	11340	8288	1.264	0	1.292	0	154851.618	267.83
25	19469.25	20300	8121.068	13628	11348	6672	1.264	0	1.292	0	155119.448	225.25
26	19489.55	22400	8134.696	13764	11355	8640	1.264	0	1.292	0	155344.7	300.9
27	19511.95	22684	8148.46	13964	11363	8716	1.264	0	1.292	0	155645.599	285.2
28	19534.63	23552	8162.424	14180	11372	9376	1.264	0	1.292	0	155930.8	297.59
29	19558.18	22720	8176.604	0	11382	22720	1.264	0	1.292	0	156228.391	326.76
30	19580.9	23280	8176.604	0	11404	23276	1.264	0	1.292	0	156555.152	290.03
31	19604.18	21128	8176.604	13052	11428	8076	1.264	0	1.292	0	156845.18	310.06
1	19625.31		8189.656		11436		1.264		1.292		157155.24	
		706632		292868		413764		36		0.152		9635.5

Utility Consumption Cost for March 2024

	Unit price	Unit	Cost				
				City water used unit		9,636	Unit
Kwh On	4.1839	292868	1,225,330.43	cost		161,990.45	Bht
Kwh OFF	2.6037	413764	1,077,317.33	Operation cost(Bht/unit)	0.15	1,445.33	Bht
Kw peak	132.93	1264	168,023.52	service charge		-	Bht
ft	0.3972	706632	280,674.23	cost		153,435.78	Bht
service charge	312.24		312.24	Vat	0.07	10,740.50	Bht
Sum			2,751,657.74	Total cost		164,176.28	Bht
VAT	0.07		192,616.04				

Utility Consumption Cost for April 2024

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	19625.31	21028	8189.656	13232	11436	7800	1.132	0	1.028	0.04	157155.24	314.282
2	19646.34	22496	8202.888	13468	11443	9024	1.132	48	1.068	0	157469.522	310.163
3	19668.84	22776	8216.356	13936	11452	8844	1.18	52	1.068	0.06	157779.685	247.162
4	19691.61	22648	8230.292	14580	11461	8068	1.232	4	1.128		158026.847	297.603
5	19714.26	24084	8244.872	0	11469	24084	1.236	0	1.136	0.072	158324.45	306.983
6	19738.34	23528	8244.872	0	11493	23528	1.236	0	1.208	0	158631.433	304.777
7	19761.87	22876	8244.872	13740	11517	9136	1.236	0	1.208	0	158936.21	285.912
8	19784.75	21584	8258.612	14056	11526	7528	1.236	0	1.208	0	159222.122	251.607
9	19806.33	23048	8272.668	14068	11534	8920	1.236	0	1.208	0	159473.729	264.076
10	19829.38	22896	8286.736	14120	11543	8832	1.236	0	1.208	0	159737.805	294.162
11	19852.28	23260	8300.856	14292	11551	8972	1.236	0	1.208	0	160031.967	274.503
12	19875.54	23700	8315.148	0	11560	23700	1.236	0	1.208	0	160306.470	322.935
13	19899.24	24128	8315.148	0	11584	24128	1.236	0	1.208	0	160629.405	368.918
14	19923.36	23116	8315.148	0	11608	23116	1.236	0	1.208	0	160998.323	341.15
15	19946.48	22424	8315.148	13872	11631	8552	1.236	0	1.208	0	161339.473	418.847
16	19968.9	21648	8329.02	13756	11640	7892	1.236	0	1.208	0	161758.32	384.137
17	19990.55	24908	8342.776	14416	11648	10456	1.236	0	1.208	0	162142.457	298.579
18	20015.46	24024	8357.192	14644	11658	9416	1.236	0	1.208	0	162441.036	290.868
19	20039.48	23052	8371.836	0	11668	23048	1.236	0	1.208	0.032	162731.904	305.325
20	20062.54	22588	8371.836	0	11691	22592	1.236	0	1.24	0	163037.229	270.731
21	20085.12	23028	8371.836	14068	11713	8960	1.236	0	1.24	0	163307.96	268.94
22	20108.15	23624	8385.904	14456	11722	9168	1.236	0	1.24	0	163576.9	284.57
23	20131.78	22420	8400.36	14312	11731	8104	1.236	16	1.24	0	163861.47	288.22
24	20154.2	23996	8414.672	14628	11740	9372	1.252	0	1.24	0	164149.69	291.82
25	20178.19	24644	8429.3	15320	11749	9320	1.252	48	1.24	0	164441.51	314.72
26	20202.84	24240	8444.62	0	11758	24244	1.3	0	1.24	0.02	164756.23	311.99
27	20227.08	24328	8444.62	0	11782	24324	1.3	0	1.26	0	165068.22	335.37
28	20251.4	24244	8444.62	14876	11807	9336	1.3	0	1.26	0	165403.59	314.69
29	20275.65	22136	8459.496	14172	11816	8000	1.3	0	1.26	0	165718.28	275.79
30	20297.78	23368	8473.668	0	11824	23364	1.3	0	1.26	0	165934.07	351.98
1	20321.15		8473.668		11847		1.3		1.26		166346.05	
		695840		284012		411828		168		0.224		9190.81

Utility Consumption Cost for April 2024

	Unit price	Unit	Cost				
Kwh On	4.1839	284012	1,188,277.81	City water used unit		9,191	Unit
Kwh OFF	2.6037	411828	1,072,276.56	cost		144,959.11	Bht
Kw peak	132.93	1300	172,809.00	Operation cost(Bht/unit)	0.15	1,378.62	Bht
ft	0.3972	695840	276,387.65	service charge		-	Bht
service charge	312.24		312.24	cost		146,337.73	Bht
Sum			2,710,063.26	Vat	0.07	10,243.64	Bht
VAT	0.07		189,704.43	Total cost		156,581.37	Bht
	Grand total		2,899,767.69				

SO/ BANGKOK

Utility Consumption Cost for May 2023

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	20321.152	25208	8473.668	14832	11847	10376	0	1232	1.196	0	166314.362	0
2	20346.360	26132	8488.500	15828	11857.860	10308	1.232	156	1.196	0	166314.362	645.8
3	20372.49	24596	8504.328	0	11868.168	24596	1.388	0	1.196	0.056	166960.167	347.52
4	20397.09	24792	8504.328	0	11893	24792	1.388	0	1.252	0.004	167307.686	347.23
5	20421.88	23980	8504.328	14492	11918	9484	1.388	0	1.256	0	167654.913	301.99
6	20445.86	23810	8518.82	13930	11927	9880	1.388	0	1.256	0	167956.9	266.4
7	20469.67	23960	8532.75	14500	11937	9460	1.388	0	1.256	0	168223.3	322.1
8	20493.63	24930	8547.25	15130	11946	9800	1.388	0	1.256	0	168545.4	303.15
9	20518.56	24580	8562.38	14660	11956	9920	1.388	0	1.256	0	168848.55	305.15
10	20543.14	23932	8577.04	0	11966	23932	1.388	0	1.256	0	169153.7	257.5
11	20567.07	23198	8577.04	0	11990	23198	1.388	0	1.256	0	169411.2	282.2
12	20590.27	24590	8577.04	14180	12013	10410	1.388	0	1.256	0	169693.400	282.4
13	20614.86	23580	8591.22	14660	12024	9000	1.388	0	1.256	0	169975.800	297.93
14	20638.44	24130	8605.88	14450	12033	9620	1.388	0	1.256	0	170273.734	330.16
15	20662.57	24390	8620.33	13900	12042	10470	1.388	0	1.256	0	170603.891	330.02
16	20686.96	24810	8634.23	15210	12053	9600	1.388	0	1.256	0	170933.909	318.14
17	20711.77	25820	8649.44	0	12062	25790	1.388	0	1.256	0.056	171252.045	319.48
18	20737.59	23690	8649.44	0	12088	23720	1.388	0	1.312	0	171571.523	308.65
19	20761.28	23270	8649.44	14060	12112	9200	1.388	0	1.312	0	171880.173	273.96
20	20784.55	24080	8663.5	14350	12121	9748	1.388	0	1.312	0	172154.135	266.86
21	20808.63	22470	8677.85	0	12131	22462	1.388	0	1.312	0	172421	208.66
22	20831.1	23410	8677.85	14120	12153	9290	1.388	0	1.312	0	172629.66	251.16
23	20854.51	23494	8691.97	14402	12163	9096	1.388	0	1.312	0	172880.818	236.75
24	20878	24520	8706.372	0	12172	24520	1.388	0	1.312	0	173117.567	271.73
25	20902.52	23446	8706.372	0	12196	23444	1.388	0	1.312	0	173389.299	241.14
26	20925.97	23970	8706.372	14218	12220	9750	1.388	0	1.312	0	173630.44	267.07
27	20949.94	24510	8720.59	14740	12229	9770	1.388	0	1.312	0	173897.51	273.32
28	20974.45	24260	8735.33	14700	12239	9560	1.388	0	1.312	0	174170.83	279.04
29	20998.71	24560	8750.03	15070	12249	9490	1.388	0	1.312	0	174449.87	285.27
30	21023.27	25558	8765.1	15004	12258	10558	1.388	0	1.312	0	174735.14	303.4
31	21048.83	22956	8780.104	0	12269	22952	1.388	0	1.312	0	175038.544	277.98
1	21071.8		8780.1		12291.7		1.388		1.312		175316.519	
		750632		306436		444196		1388		0.116		9002.2

Utility Consumption Cost for May 2023

	Unit price	Unit	Cost	City water used unit		9,002	Unit
Kwh On	4.1839	306436	1,282,097.58	cost		141,976.50	Bht
Kwh OFF	2.6037	444196	1,156,553.13	Operation cost(Bht/unit)	0.15	1,350.32	Bht
Kw peak	132.93	1388	184,506.84	service charge		-	Bht
ft	0.3972	750632	298,151.03	cost		143,326.83	Bht
service charge	312.24	[redacted]	312.24	Vat	0.07	10,032.88	Bht
Sum			2,921,620.82	Total cost		153,359.70	Bht
VAT	0.07	[redacted]	204,513.46				
	Grand total		3,126,134.27				

SO/ BANGKOK

Utility Consumption Cost for June 2023

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m^3)	Consum / Day (m^3)
1	21071.784	22716	8780.104	0	#######	22716	0	0	1.192	0.076	175316.519	279.41
2	21094.5	21290	8780.104	0	12314	21292	0	0	1.268	0	175595.928	255.99
3	21115.79	23030	8780.104	14266	12336	8762	0	1228	1.268	0	175851.92	265.99
4	21138.82	22540	8794.37	13780	12344	8760	1.228	0	1.268	0	176117.91	263.34
5	21161.36	23310	8808.15	14460	12353	8850	1.228	0	1.268	0	176381.25	265.5
6	21184.67	23410	8822.61	14522	12362	8892	1.228	0	1.268	0	176646.75	283.22
7	21208.08	22516	8837.132	0	12371	22512	1.228	0	1.268	0	176929.973	305.84
8	21230.6	22184	8837.132	0	12393	22196	1.228	0	1.268	0	177235.814	250.12
9	21252.78	21732	8837.132	13318	12416	8400	1.228	0	1.268	0	177485.93	276.37
10	21274.51	21928	8850.45	13380	12424	8560	1.228	0	1.268	0	177762.3	280.26
11	21296.44	23030	8863.83	13760	12433	9260	1.228	0	1.268	0	178042.560	261.54
12	21319.47	22714	8877.59	14214	12442	8504	1.228	0	1.268	0	178304.100	270.69
13	21342.18	23128	8891.804	14656	12450	8472	1.228	48	1.268	0	178574.787	328.67
14	21365.31	22996	8906.46	0	12459	22996	1.276	0	1.268	0	178903.459	277.3
15	21388.31	21312	8906.46	0	12482	21316	1.276	0	1.268	0	179180.756	261.44
16	21409.62	21840	8906.46	13510	12503	8322	1.276	0	1.268	0	179442.199	269.6
17	21431.46	22260	8919.97	13310	12511	8950	1.276	0	1.268	0	179711.8	241.97
18	21453.72	21500	8933.28	13510	12520	8000	1.276	0	1.268	0	179953.77	353.64
19	21475.22	23372	8946.79	14322	12528	9044	1.276	0	1.268	0	180307.41	297.68
20	21498.59	23344	8961.112	14852	12537	8488	1.276	0	1.268	0	180605.088	295.96
21	21521.94	23452	8975.964	0	12546	23456	1.276	0	1.268	0	180901.046	291.62
22	21545.39	22432	8975.964	0	12569	22422	1.276	0	1.268	0	181192.67	301.3
23	21567.82	21830	8975.964	13146	12592	8690	1.276	0	1.268	0	181493.97	272.37
24	21589.65	21910	8989.11	13810	12601	8090	1.276	0	1.268	0	181766.34	346.46
25	21611.56	22360	9002.92	13850	12609	8510	1.276	0	1.268	0	182112.8	280.21
26	21633.92		9016.77		12617		1.276		1.268		182393.01	
27												
28												
29												
30												
1												
		562136		236666		325460		1276		0.076		7076.5

Utility Consumption Cost for June 2023

	Unit price	Unit	Cost				
Kwh On	4.1839	236666	990,186.88	City water used unit		7,076	Unit
Kwh OFF	2.6037	325460	847,400.20	cost		111,531.72	Bht
Kw peak	132.93	1276	169,618.68	Operation cost(Bht/unit)	0.15	1,061.47	Bht
ft	0.3972	562126	223,276.45	service charge		-	Bht
service charge	312.24		312.24	cost		112,593.20	Bht
Sum			2,230,794.45	Vat	0.07	7,881.52	Bht
VAT	0.07		156,155.61	Total cost		120,474.72	Bht
	Grand total		2,386,950.06				

เอกสารแนบ 8

เอกสารส่งมอบงานสูบตะกอนและสิ่งปฏิกูล

ภาพประกอบการส่งมอบงาน สูบสิ่งปฏิกูล SO/BANGKOK

(บ่อบำบัดน้ำเสีย - ก่อนการทำ ขณะทำ และหลังทำเสร็จ)

ปฏิบัติงาน วันที่ 18 เมษายน 2567

บ่อเติมอากาศ
ก่อนการทำ






บ่อเติมอากาศ
ขณะกำลังทำ





บ่อเติมอากาศ
ขณะกำลังทำ

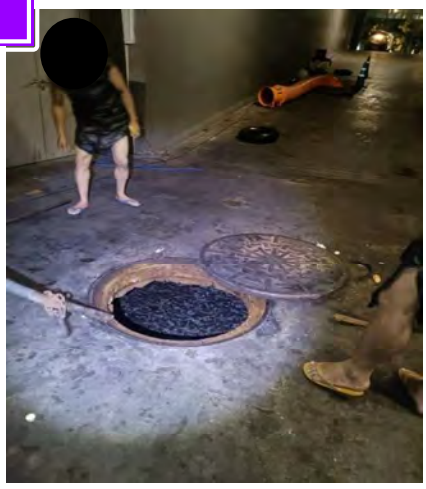ภาพประกอบการส่งมอบงาน สูบสิ่งปฏิกูล SO/BANGKOK
(บ่อบำบัดน้ำเสีย - ก่อนการทำ ขณะทำ และหลังทำเสร็จ)
ปฏิบัติงาน วันที่ 18 เมษายน 2567

บ่อเติมอากาศ
ขณะกำลังทำ






บ่อเติมอากาศ
หลังทำเสร็จ





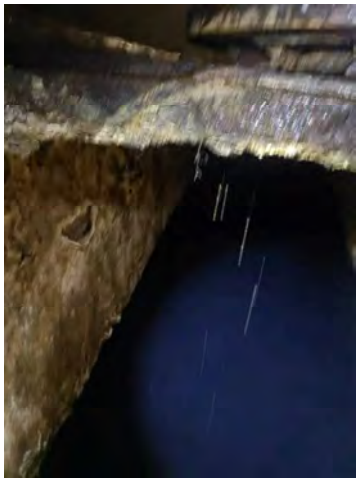

บ่อเติมอากาศ
หลังทำเสร็จ





ภาพประกอบการส่งมอบงาน สูบสิ่งปฏิกูล SO/BANGKOK

(บ่อบำบัดน้ำเสีย - ก่อนการทำ ขณะทำ และหลังทำเสร็จ)


ปฏิบัติงาน วันที่ 18 เมษายน 2567

บ่อไขมัน (Canteen) ก่อนการทำ





บ่อไขมัน (Canteen) ก่อนการทำ

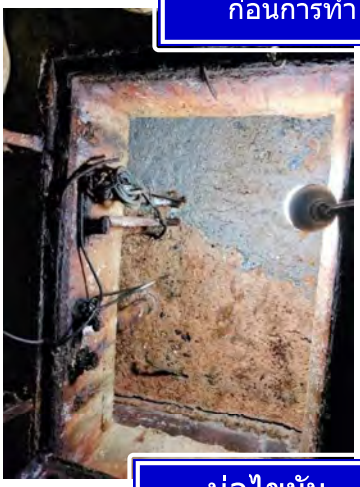
บ่อไขมัน (Canteen) ขณะกำลังทำ




ภาพประกอบการส่งมอบงาน สูบสิ่งปฏิกูล SO/BANGKOK

(บ่อบำบัดน้ำเสีย - ก่อนการทำ ขณะทำ และหลังทำเสร็จ)

ปฏิบัติงาน วันที่ 18 เมษายน 2567

บ่อไขมัน
(Canteen)
ขณะกำลังทำ





บ่อไขมัน
(Canteen)
ขณะกำลังทำ







บ่อไขมัน
(Canteen)
ขณะกำลังทำ





ภาพประกอบการส่งมอบงาน สูบสิ่งปฏิกูล SO/BANGKOK
(บ่อบำบัดน้ำเสีย - ก่อนการทำ ขณะทำ และหลังทำเสร็จ)
ปฏิบัติงาน วันที่ 18 เมษายน 2567

บ่อไขมัน
(Canteen)
หลังทำเสร็จ




บ่อไขมัน
(Canteen)
หลังทำเสร็จ




เอกสารแนบ 9
ตัวอย่างภาพการขุดลอกทางระบายน้ำของโครงการในปี 2567

SO/ BANGKOK

Gutter Drainage Cleaning 1/2024

Date: 1-June-2024 Located: G Floor









Technician: _____ Duty Engineer/Leader: _____

เอกสารแนบ 10

เอกสารการกำจัดขยะมูลฝอย ในปี 2567

ใบเสร็จรับเงิน(สำเนา 1)

เลขที่ 6700004675

วันที่ 15 พฤษภาคม 2567

สำนักงานเขต บางรัก โทร 0 2236 1395

ที่อยู่สำนักงานเขต 5 ถ.นเรศ แขวงสี่พระยา เขตบางรัก กรุงเทพมหานคร 10500

ชื่อผู้ชำระค่าธรรมเนียม บริษัท โอ๊คทรี จำกัด (โรงแรม โซแบงคอก)

ที่อยู่ เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร 10500

เรื่อง ขอรับบริการมูลฝอย ทั่วไป 1,220.00 ลิตร/วัน

มีค่าธรรมเนียมจัดการมูลฝอยประจำปีงบ ม.ค. 67-มี.ค. 67 เป็นจำนวนเงิน 12,000 บาท

รายละเอียดครั้งนี้

ลำดับ	รายการ	จำนวนเงิน(บาท)
1	ค่าเก็บและขนมูลฝอย	12,000
2	ค่ากำจัดมูลฝอย	0
3		
	จำนวนเงินรวม	12,000

จำนวนเงินตัวอักษร หนึ่งหมื่นสองพันบาทถ้วน

ประวัติการชำระค่าธรรมเนียม ปีงบประมาณ 2567

เดือน	บาท	เดือน	บาท
[illegible]	-	[illegible]	-
[illegible]	-	[illegible]	-
[illegible]	-	[illegible]	-
[illegible]	4,000	[illegible]	-
[illegible]	4,000	[illegible]	-
[illegible]	[illegible]	[illegible]	[illegible]

[redacted]

ช่องทางชำระเงิน (Payment) เช็ค ลงวันที่ 24 เมษายน 2567

เลขที่เช็ค (Cheque No.) 80029036

ธนาคาร (Bank) ธ. กสิกรไทย - สาขาถนนสาทร

พิมพ์เมื่อ [illegible]

ใบเสร็จรับเงินนี้จะสมบูรณ์ต่อเมื่อกรุงเทพมหานครเรียกเก็บเงินได้ครบถ้วนแล้ว

กรุณาเก็บใบเสร็จไว้เพื่อเป็นหลักฐานการชำระเงินของท่าน

เอกสารแนบ 11

เอกสารการตรวจสอบระบบระบายอากาศในปี 2567

SOI BANGKOK

VENTILATION FAN (Belt Driven 3P)

☑ Monthly ☐ Yearly

ชื่อเครื่อง B A-01 Brand/ ยี่ห้อ : KRUGER Model/ รุ่น : BSB900/4

ขนาดเครื่อง 021025 CFM. ขนาดมอเตอร์ 4 KW. Serial No. : BM1060010 วันที่ตรวจเช็ค 17/1/67

สถานที่ติดตั้ง _____ ชั้น _____

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	✓				
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☑ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	✓				
	5	ตรวจสอบสภาพทั่วไปของพัดลม	✓				
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง	☐ ชำรุดมาก ควรเปลี่ยนใหม่	
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 230 V. S-N 230 V. T-N 229 V.					
		R-S 390 V. S-T 390 V. T-R 390 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.2 A. S 6.2 A. T 6.1 A.					Name Plate FLA.= 6.4 A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓				
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓				
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓				
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	17	ตรวจเช็คสภาพรองลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

SKF ปกติ. 1 ตลอด.

รายการอะไหล่ที่ใช้ไป :

[redacted]

Tec

(_

SO/ BANGKOK

VENTILATION FAN (Belt Driven 3P)

☑ Monthly ☐ Yearly

ชื่อเครื่อง LA-01 Brand/ ยี่ห้อ : KRUGER Model/ รุ่น : BIF700A/17

ขนาดเครื่อง 5200 CFM. ขนาดมอเตอร์ 4 KW. Serial No. : BK1706000610 วันที่ตรวจเช็ค 12/2/62

สถานที่ติดตั้ง Solution ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	✓				
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☐ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ					
	5	ตรวจสอบสภาพทั่วไปของพัดลม					
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☑ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง	☐ ชำรุดมาก ควรเปลี่ยนใหม่	
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 220 V. S-N 220 V. T-N 222 V.					
		R-S 380 V. S-T 380 V. T-R 380 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.2 A. S 6.1 A. T 6.2 A.					Name Plate FLA.= 6.4 A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓				
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓				
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓				
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)				เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :

[redacted]

SOI BANGKOK

VENTILATION FAN (Belt Driven 3P)

☑ Monthly ☐ Yearly

ชื่อเครื่อง AHU Brand/ ยี่ห้อ : KRUGER Model/ รุ่น : BSB900-4M วันที่ตรวจเช็ค 6/3/67

ขนาดเครื่อง 28,000 CFM. ขนาดมอเตอร์ 4 KW. Serial No. : BKM0690810

สถานที่ติดตั้ง Substation ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☑ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ					
	5	ตรวจสอบสภาพทั่วไปของพัดลม					
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง		☐ ชำรุดมาก ควรเปลี่ยนใหม่
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 390 V. S-N 390 V. T-N 390 V. R-S 390 V. S-T 390 V. T-R 390 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.1 A. S 6.2 A. T 6.1 A.					6.4 Name Plate FLA.= A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ					
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง					
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)					
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)				เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

ปกติ

รายการอะไหล่ที่ใช้ไป :

[redacted]

SOY BANGKOK

VENTILATION FAN (Belt Driven 3P)

☑ Monthly ☐ Yearly

ชื่อเครื่อง GA-01 Brand/ ยี่ห้อ : KRUGER Model/ รุ่น : BSB 900 HT วันที่ตรวจเช็ค 1/4/67

ขนาดเครื่อง 9260 CFM. ขนาดมอเตอร์ 4 KW. Serial No. : 8276080616

สถานที่ติดตั้ง Substation ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	✓				
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☑ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	✓				
	5	ตรวจสอบสภาพทั่วไปของพัดลม	✓				
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☑ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง		☐ ชำรุดมาก ควรเปลี่ยนใหม่
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 230 V. S-N 230 V. T-N 230 V.					
		R-S 390 V. S-T 390 V. T-R 390 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.2 A. S 6.1 A. T 6.2 A.					Name Plate FLA.=_____A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ					
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง					
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)					
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :

Tech[redacted]

(____)

SOY BANGKOK

VENTILATION FAN (Belt Driven 3P)

ชื่อเครื่อง EA-01 Brand/ ยี่ห้อ : KRUGER ☑ Monthly ☐ Yearly

ขนาดเครื่อง 6460 CFM. ขนาดมอเตอร์ 4 KW. Serial No. : BKM0100820 วันที่ตรวจเช็ค 4/6/67

สถานที่ติดตั้ง Substation ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	✓				
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☑ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ					
	5	ตรวจสอบสภาพทั่วไปของพัดลม					
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☑ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง		☐ ชำรุดมาก ควรเปลี่ยนใหม่
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 220 V. S-N 220 V. T-N 220 V. R-S 380 V. S-T 380 V. T-R 380 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.2 A. S 6.1 A. T 6.6 A.					Name Plate FLA.= 6.4 A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓				
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓				
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓				
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :

[redacted]

SOI BANGKOK

VENTILATION FAN (Belt Driven 3P)

☑ Monthly ☐ Yearly

ชื่อเครื่อง BA 01 Brand/ ยี่ห้อ : KRUGER Model/ รุ่น : BSB 900 T4

ขนาดเครื่อง 6460 CFM. 15 ขนาดมอเตอร์ 7 KW. Serial No. : B167 600810 วันที่ตรวจเช็ค 6/6/62

สถานที่ติดตั้ง Substation ชั้น 1

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	✓				
	1	ตรวจสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☑ ดำเนินการ		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ					
	5	ตรวจสอบสภาพทั่วไปของพัดลม					
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลจ่ายลม ☑ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี) ☐ ไม่มี	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☑ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐ ดำเนินการปรับตั้ง		☐ ชำรุดมาก ควรเปลี่ยนใหม่
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง R-N 220 V. S-N 221 V. T-N 220 V.					
		R-S 378 V. S-T 380 V. T-R 378 V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม R 6.1 A. S 6.9 A. T 6.2 A.					Name Plate FLA.=_____A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓				
	14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓				
	15	ตรวจสอบอุณหภูมิของแบริ่งและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓				
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☑ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐ ดำเนินการเรียบร้อย		☐ ไม่ได้ดำเนินการ เนื่องจาก_____		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :

Technician_____

(_____)

เอกสารแนบ 12

สำเนาเอกสารการฝึกซ้อมดับเพลิง และซ้อมอพยพหนีไฟ

กรุงเทพมหานคร

วุฒิบัตรเลขที่ สปภ.(กปภ.๒) ๔๓๒/๒๕๖๖

ได้รับใบอนุญาตจากกรมสวัสดิการและคุ้มครองแรงงาน ใบอนุญาตเลขที่ ดพฝ.-ร ๒๐๒

ขอรับรองว่า

โรงแรม โซ แบงคอก

ตั้งอยู่เลขที่ **๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ๑๐๕๐๐**

ได้ดำเนินการฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ

ตามกฎกระทรวงกำหนดมาตรฐานในการบริหาร จัดการ และดำเนินการด้านความปลอดภัย อาชีวอนามัย และสภาพแวดล้อมในการทำงานเกี่ยวกับการป้องกันและระงับอัคคีภัย พ.ศ.๒๕๕๕ ลงวันที่ ๗ ธันวาคม พ.ศ.๒๕๕๕

มีผู้เข้ารับการฝึกอบรม จำนวน.....๑๒๑.....คน

เมื่อวันที่.....[redacted].....

ให้ไว้ ณ วัน[redacted].....

ผู้อำ[redacted]


ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

น.12/1

ที่ กท ๑๘๐๕/ ๗๖๘๙

สำนักป้องกันและบรรเทาสาธารณภัย
๗๗/๑ ถนนพระรามที่ ๖ กทม. ๑๐๔๐๐

หนังสือฉบับนี้ให้ไว้เพื่อรับรองว่า โรงแรม โซ แบงคอก ตั้งอยู่ที่ เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ๑๐๕๐๐ ได้ดำเนินการฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ เมื่อวันที่ ๑๒ ตุลาคม ๒๕๖๖ มีผู้เข้ารับการฝึกซ้อม จำนวน ๑๒๑ คน (ต



ที่ กท ๑๘๐๕/๗๖๔๗

สำนักป้องกันและบรรเทาสาธารณภัย
๗๗/๑ ถนนพระรามที่ ๖ กทม. ๑๐๔๐๐

หนังสือฉบับนี้ให้ไว้เพื่อรับรองว่า โรงแรม โซ แบงคอก ตั้งอยู่ที่ เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ๑๐๕๐๐ ได้ดำเนินการฝึกอบรมดับเพลิงขั้นต้น เมื่อวันที่ ๑๒ ตุลาคม ๒๕๖๖ มีผู้เข้ารับการอบรม จำนวน ๖๐ คน (ตามบัญชีรายชื่อที่แนบ)

ให้ไ[redacted]

เอกสารแนบ 13

สำเนาเอกสารการตรวจสอบอุปกรณ์ระบบดับเพลิง และ เอกสารการตรวจสอบระบบป้องกันอัคคีภัย

สำเนาเอกสารการตรวจสอบอุปกรณ์ระบบดับเพลิง

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: [redacted]
(Security Officer)

Date : 01/05/2023

A	@	fire hose cabinet Zone A
B	@	fire hose cabinet Zone B
C	@	Additional fire hose cabinet
	@	Silver
S	@	Additional extinguishers

Fire Extinguisher Check list

No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: [redacted]
(Security Officer)

Date : 02/05/2023

A @ fire hose cabinet Zone A
B @ fire hose cabinet Zone B
C @ Additional fire hose cabinet
@ Silver
S @ Additional extinguishers

Fire Extinguisher Check list

No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: [redacted]
(Security Officer)

Date : 03/11/2023

A @ fire hose cabinet Zone A
B @ fire hose cabinet Zone B
C @ Additional fire hose cabinet
@ Silver
S @ Additional extinguishers

Fire Extinguisher Check list

No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: [redacted]
(Security Officer)

Date : 17/04/2023

A @ fire hose cabinet Zone A
B @ fire hose cabinet Zone B
C @ Additional fire hose cabinet
@ Silver
S @ Additional extinguishers

Fire Extinguisher Check list

No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: _____ Date : 13/05/2023

([redacted] ficer)

A	@	fire hose cabinet Zone A
B	@	fire hose cabinet Zone B
C	@	Additional fire hose cabinet
	@	Silver
S	@	Additional extinguishers

Fire Extinguisher Check list

No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	

47	A	8	Inside fire hose cabinet FHC 08-01	1		X	
48	B		Inside fire hose cabinet FHC 08-02	1		X	
49	S		In the Ballroom	1		X	
50			In the Kitchen Bakery.	1		X	
51			BQ Kitchen	1		X	
52	A	7	Inside fire hose cabinet FHC 07-01	1		X	
53	B		Inside fire hose cabinet FHC 07-02	1		X	
54			Main Kitchen	1		X	
55			Japanese Kitchen	1		X	
56	A	6	Inside fire hose cabinet FHC 06-01	1		X	
57	B		Inside fire hose cabinet FHC 06-02	1		X	
58	S		Laundry Room	2		X	
59	A	5	Inside fire hose cabinet FHC 05-01	2		X	
60	B		Inside fire hose cabinet FHC 05-02	1		X	
61	C		Inside fire hose cabinet FHC 05-03	1		X	
62	S		Additional extinguishers	3		X	
63	A	4	Inside fire hose cabinet FHC 04-01	1		X	
64	B		Inside fire hose cabinet FHC 04-02	1		X	
65	C		Inside fire hose cabinet FHC 04-03	1		X	
66	S		Additional extinguishers	3		X	
67	A	3	Inside fire hose cabinet FHC 03-01	1		X	
68	B		Inside fire hose cabinet FHC 03-02	1		X	
69	C		Inside fire hose cabinet FHC 03-03	1		X	
70	S		Additional extinguishers	3		X	
71	A	2	Inside fire hose cabinet FHC 02-01	1		X	
72	B		Inside fire hose cabinet FHC 02-02	1		X	
73	C		Inside fire hose cabinet FHC 02-03	1		X	
74	S		Additional extinguishers	2		X	
75	A	G	Inside fire hose cabinet FHC G-01	1		X	
76	S		Beside Congcerge	1		X	
77	S		Beside Chocolab	1		X	
78	A		Inside fire hose cabinet FHC B1-01	1		X	
79	B		Inside fire hose cabinet FHC B1-02	1		X	
80	C		Inside fire hose cabinet FHC B1-03	2		X	
81			Canteen Kitchen	1		X	
82			Control Room	1		X	
83	C	B2	Inside fire hose cabinet FHC B2-01	1		X	
84		Grand total		95			

Checked by: [redacted]
(S[redacted]icer)

Date : 06/12/2023



A @ fire hose cabinet Zone A
B @ fire hose cabinet Zone B
C @ Additional fire hose cabinet
@ Silver
S @ Additional extinguishers

Fire Extinguisher Check list


No.	Zone	Floor	Location	Quantity	Status		Remark
					Ab	Normal	
1	S		Roof Lift Room	1		X	
2	S		Inside Hi-So Bar	1		X	
3	A	30	Inside fire hose cabinet FHC 30-01	1		X	
4	B		Inside fire hose cabinet FHC 30-02	1		X	
5	A	29	Inside fire hose cabinet FHC 29-01	1		X	
6	B		Inside fire hose cabinet FHC 29-02	1		X	
7	C		Inside fire hose cabinet near Hot Pump	1		X	
8			Park So Kitchen	1		X	
9	A	28	Inside fire hose cabinet FHC 28-01	1		X	
10	B		Inside fire hose cabinet FHC 28-02	1		X	
11	A	27	Inside fire hose cabinet FHC 27-01	1		X	
12	B		Inside fire hose cabinet FHC 27-02	1		X	
13	A	26	Inside fire hose cabinet FHC 26-01	1		X	
14	B		Inside fire hose cabinet FHC 26-02	1		X	
15	A	25	Inside fire hose cabinet FHC 25-01	1		X	
16	B		Inside fire hose cabinet FHC 25-02	1		X	
17	A	24	Inside fire hose cabinet FHC 24-01	1		X	
18	B		Inside fire hose cabinet FHC 24-02	1		X	
19	A	23	Inside fire hose cabinet FHC 23-01	1		X	
20	B		Inside fire hose cabinet FHC 23-02	1		X	
21	A	22	Inside fire hose cabinet FHC 22-01	1		X	
22	B		Inside fire hose cabinet FHC 22-02	1		X	
23	A	21	Inside fire hose cabinet FHC 21-01	1		X	
24	B		Inside fire hose cabinet FHC 21-02	1		X	
25	A	20	Inside fire hose cabinet FHC 20-01	1		X	
26	B		Inside fire hose cabinet FHC 20-02	1		X	
27	A	19	Inside fire hose cabinet FHC 19-01	1		X	
28	B		Inside fire hose cabinet FHC 19-02	1		X	
29	A	18	Inside fire hose cabinet FHC 18-01	1		X	
30	B		Inside fire hose cabinet FHC 18-02	1		X	
31	A	17	Inside fire hose cabinet FHC 17-01	1		X	
32	B		Inside fire hose cabinet FHC 17-02	1		X	
33	A	16	Inside fire hose cabinet FHC 16-01	1		X	
34	B		Inside fire hose cabinet FHC 16-02	1		X	
35	A	15	Inside fire hose cabinet FHC 15-01	1		X	
36	B		Inside fire hose cabinet FHC 15-02	1		X	
37	A	14	Inside fire hose cabinet FHC 14-01	1		X	
38	B		Inside fire hose cabinet FHC 14-02	1		X	
39	S	11M	Inside fire hose cabinet FHC 11M -01	1		X	
40	A	11	Inside fire hose cabinet FHC 11-01	2		X	
41	B		Inside fire hose cabinet FHC 11-02	2		X	
42	A	10	Inside fire hose cabinet FHC 10-01	1		X	
43	B		Inside fire hose cabinet FHC 10-02	1		X	
44	C		Inside fire hose cabinet FHC 10-03	1		X	
45	A	9	Inside fire hose cabinet FHC 09-01	1		X	
46	B		Inside fire hose cabinet FHC 09-02	1		X	


สำเนาเอกสารการตรวจสอบระบบป้องกันอัคคีภัย


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

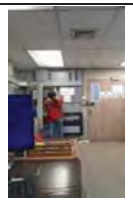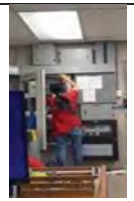




Before Test System Fire Alarm










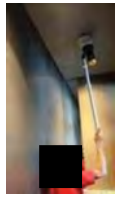






Floor 28 Room 2815 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal



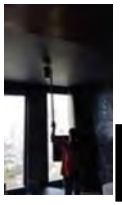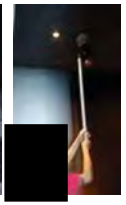


Floor 27 Room 2713 Service Test Smoke Detector 2 head and Heat Detector 2 head…heat no work 1

น.13/7


EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร./แฟกซ์.(02)069-4348 (092)494-4664 (097)464-7991

SERVICE REPORT FIRE ALARM SYSTEM
PROJECT
SO Bangkok


Contract service 1 Jan. 2024 - 31 Dec. 2024 ระยะเวลาสัญญา 1 ม.ค. 67 - 31 ธ.ค. 67

Service date 4-6 Mar. 2024 (period 1/3) วันที่เข้าให้บริการ 4-6 มี.ค. 67 (รอบที่ 1/3)

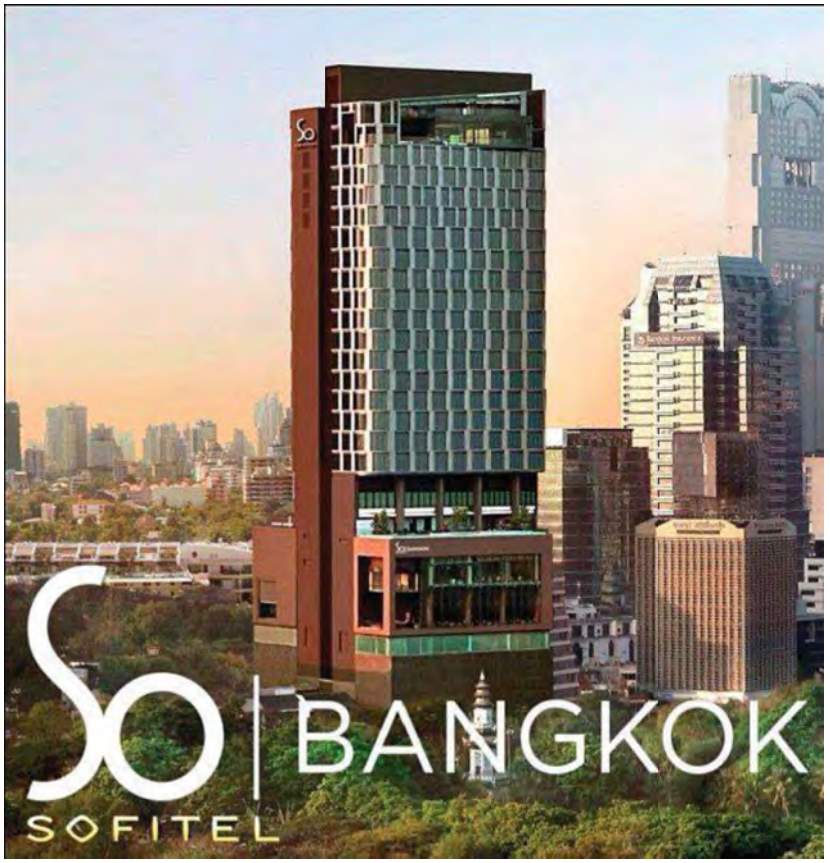


EST: EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

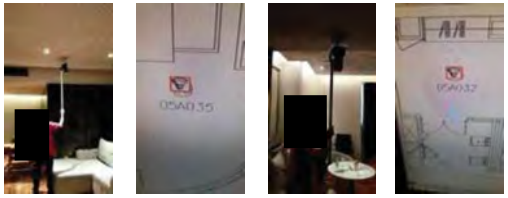


Floor 11 Room 1109 Service Test Smoke Detector 3 head and Heat Detector 1 head…Nomal

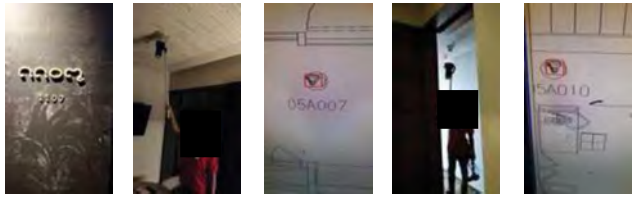

Floor 11 Room 1107 Service Test Smoke Detector 3 head and Heat Detector 1 head…Nomal

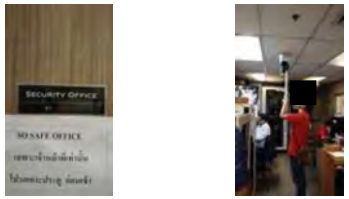


Floor B1 Sercurity Room Service Test Smoke Detector 1 head ..No alarm

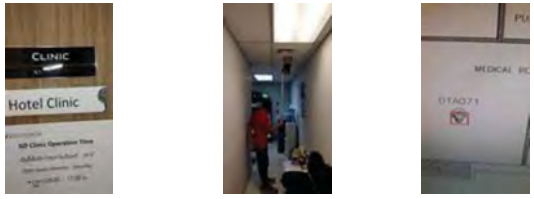


Floor B1 Clinic Room Service Test Smoke Detector 1 head ..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

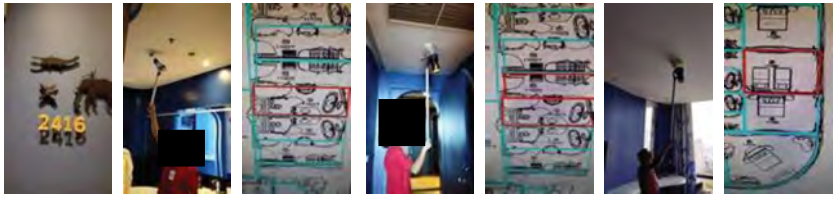


Floor 24 Room 2416 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

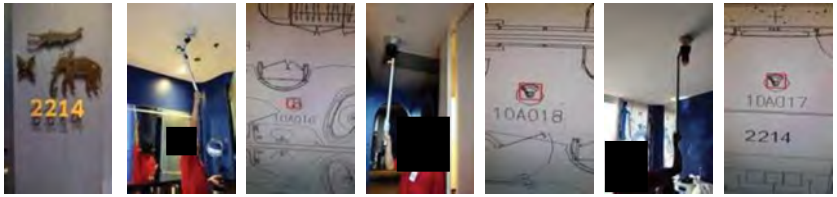


Floor 22 Room 2214 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

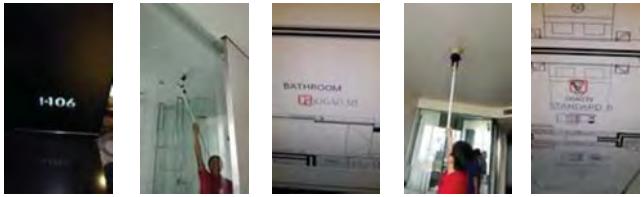

Floor 14 Room 1406 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

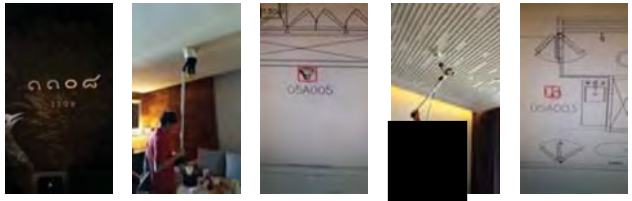


Floor 11 Room 1108 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

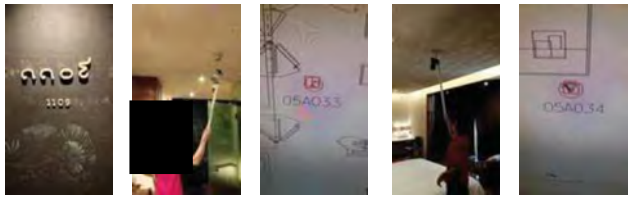

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

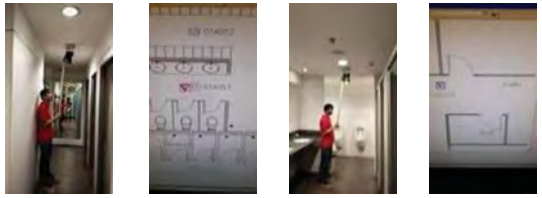


Floor B1 Toilet Man and Corridor Service Test Smoke Detector 4 head ..Normal



Floor B1 Toilet Women Service Test Smoke Detector 3 head ..Normal 2 nowork 1



Floor B1 Storage,Bottle,Corridor Service Test Smoke Detector 4 head ..Normal 3 nowork 1

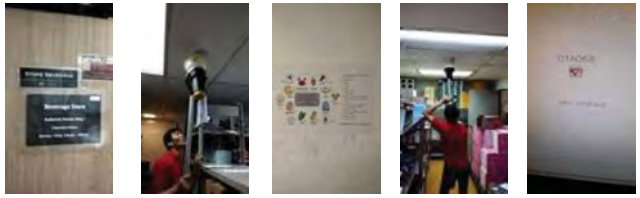

Floor B1 Store Beverage Service Test Smoke Detector 2 head ..Normal 1 nowork 1




Floor B1 Pump Room,water pump Service Test Smoke Detector 2 head ..Normal

and in front of hospital room smoke detector 1 head ..nowork

ป.13/9


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

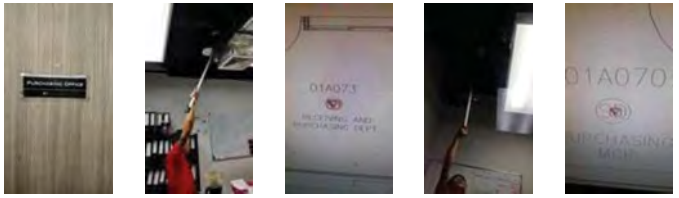

Floor B1 Purchasing Office Service Test Smoke Detector 2 head ..Normal




Floor B1 Uniform Service Test Smoke Detector 1 head ..Normal

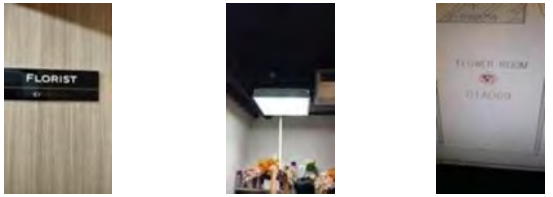

Floor B1 Florist Office Service Test Smoke Detector 1 head ..Normal




Floor B1 Chiller Service Test Smoke Detector 1 head ..Normal

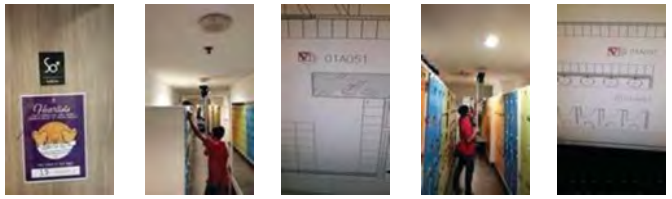


EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

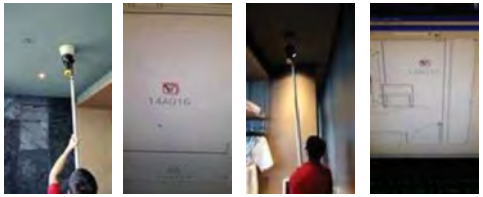

Floor 28 Room 2806 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal

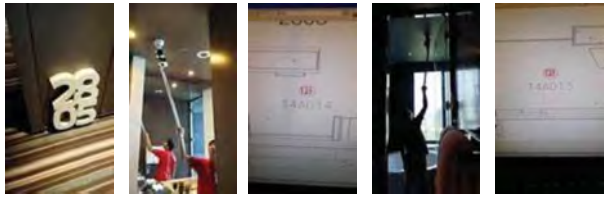


Floor 28 Room 2805 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal

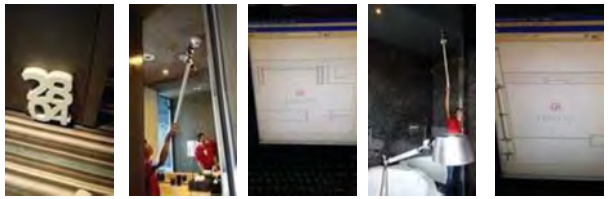

Floor 28 Room 2804 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

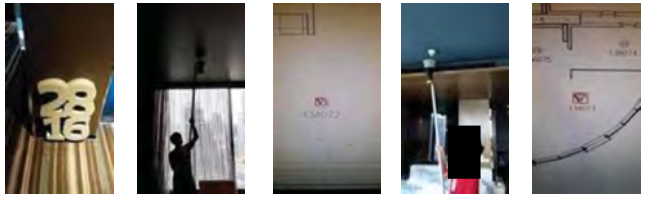



Floor 28 Room 2816 Service Test Smoke Detector 2 head and Heat Detector 3 head…Nomal




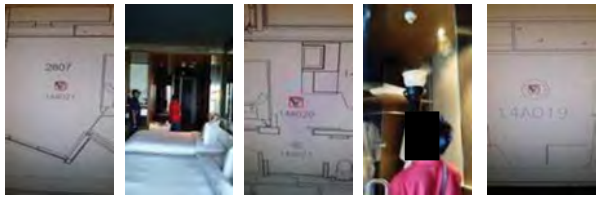


Floor 28 Room 2807 Service Test Smoke Detector 3 head and Heat Detector 2 head…Nomal



EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

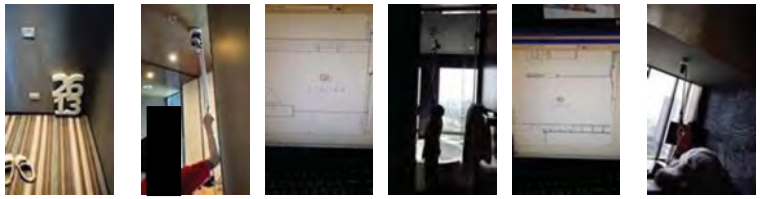

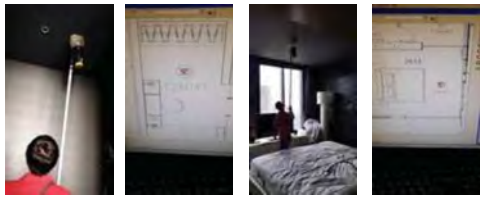

Floor 26 Room 2613 Service Test Smoke Detector 3 head and Heat Detector 3 head…Nomal





Floor 26 Room 2602 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal




Floor 24 Room 2401 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

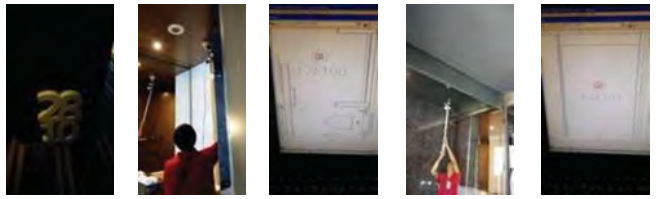

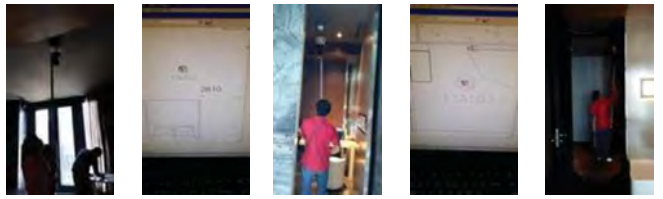


Floor 28 Room 2810 Service Test Smoke Detector 4 head and Heat Detector 2 head…Nomal

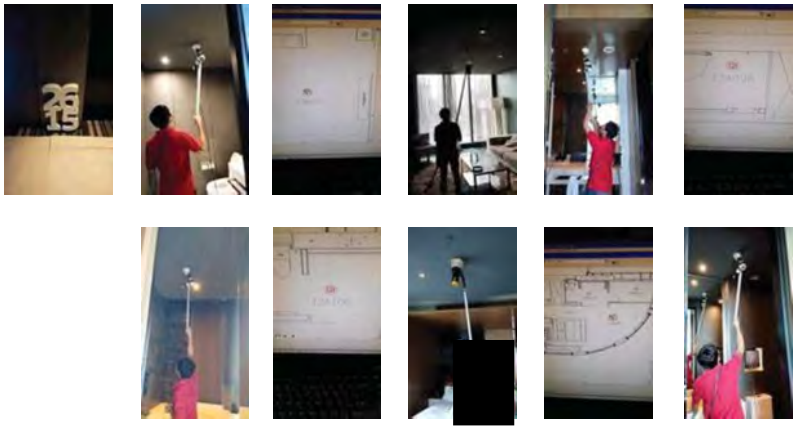

Floor 26 Room 2615 Service Test Smoke Detector 3 head..normal and Heat Detector 3 head…nowork 1

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

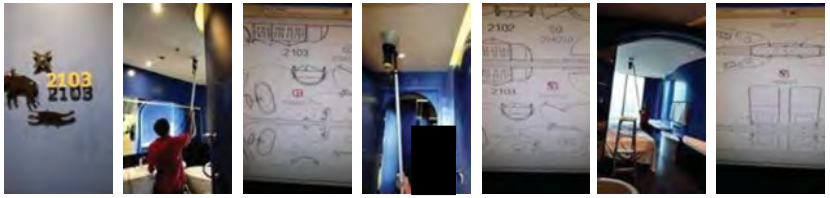


Floor 21 Room 2103 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal



Floor 21 Room 2104 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

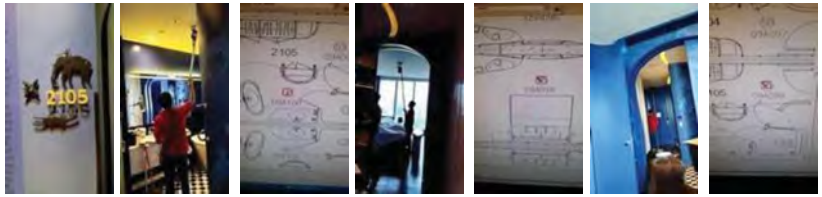

Floor 21 Room 2105 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

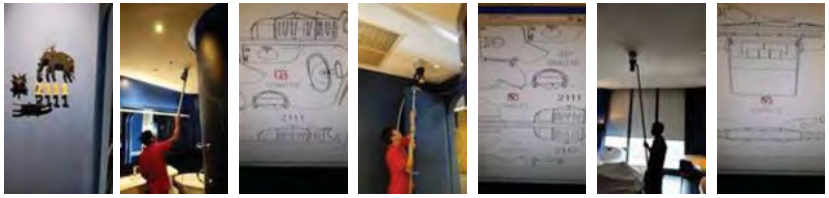

Floor 21 Room 2111 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal




Floor 21 Room 2112 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991



Floor 23 Room 2301 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

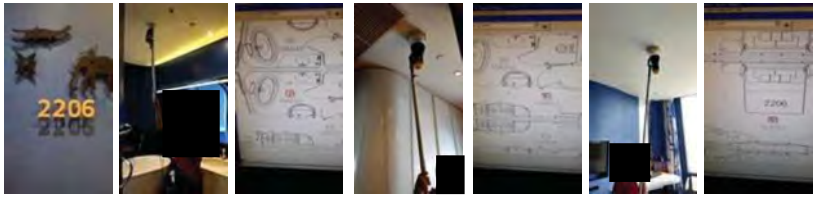


Floor 22 Room 2206 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

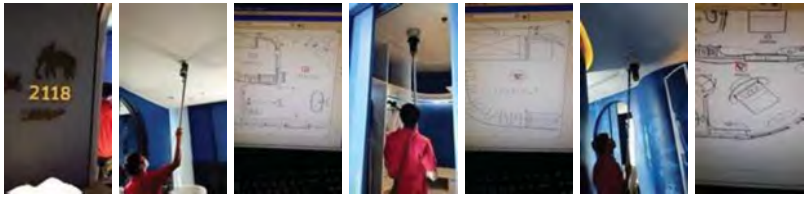

Floor 21 Room 2118 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal




Floor 21 Room 2101 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

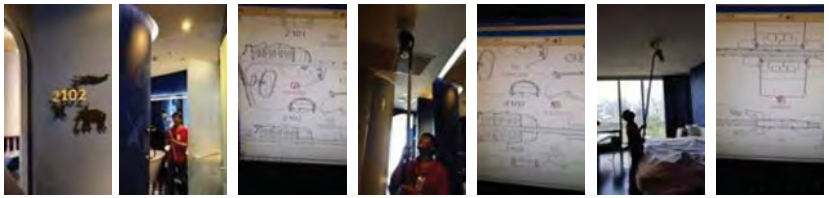


Floor 21 Room 2102 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

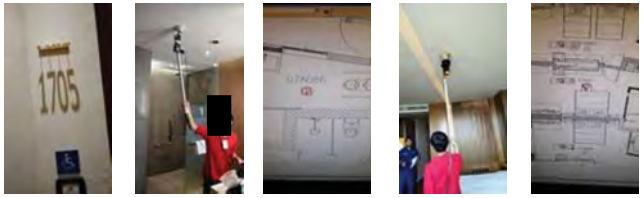

Floor 17 Room 1705 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

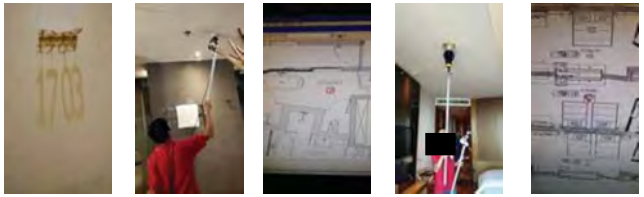


Floor 17 Room 1703 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

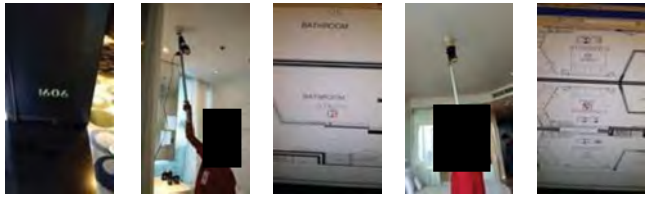

Floor 16 Room 1606 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal



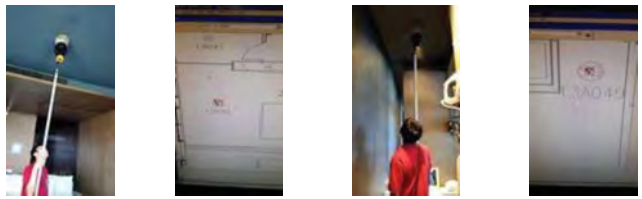

Floor 27 Room 2704 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991




Floor 21 Room 2113 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal




Floor 21 Room 2114 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

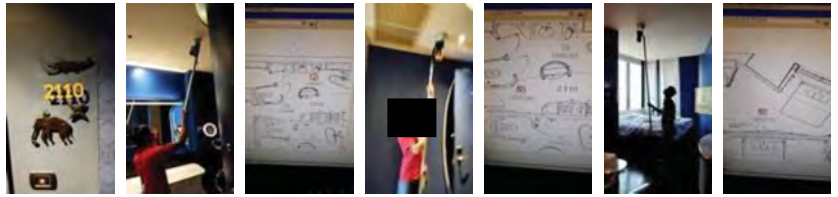

Floor 21 Room 2110 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal



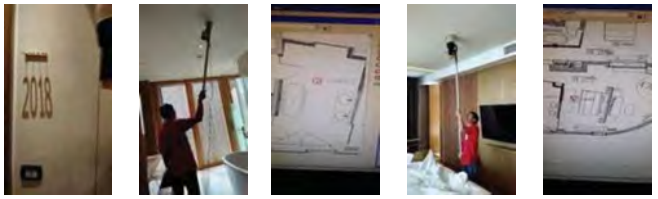


Floor 20 Room 2018 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

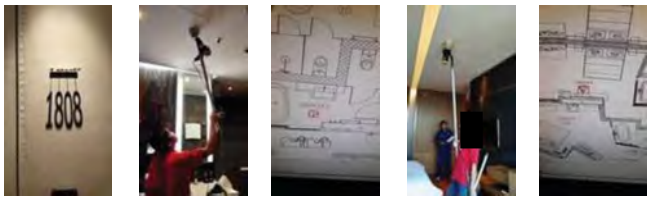


Floor 18 Room 1808 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

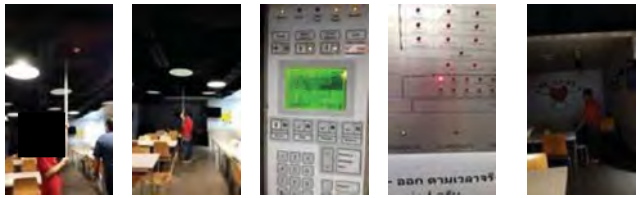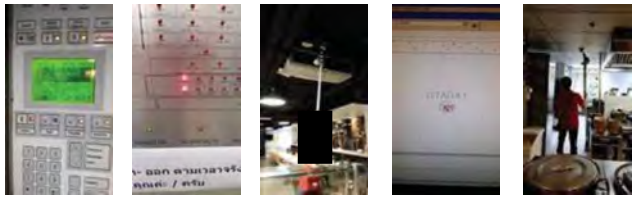
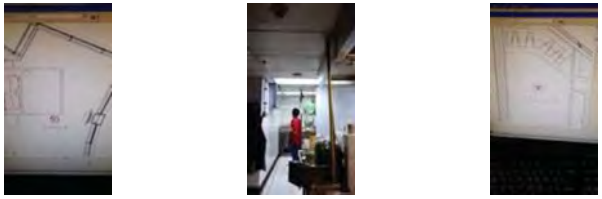


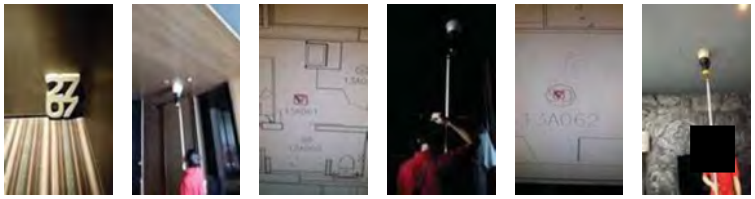

Floor 31 Cateen Service Test Smoke Detector 4 head and Heat Detector 3 head…Nomal





Floor 27 Room 2707 Service Test Smoke Detector 3 head and Heat Detector 2 head…Nomal

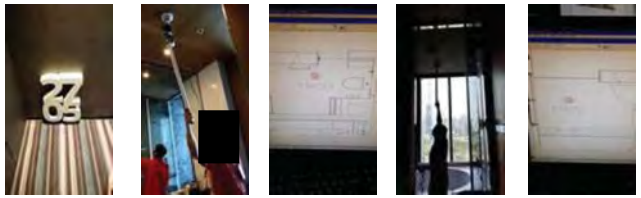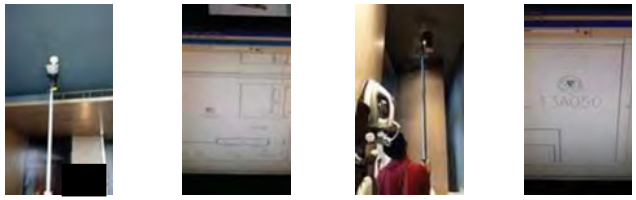บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

Floor 27 Room 2705 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal

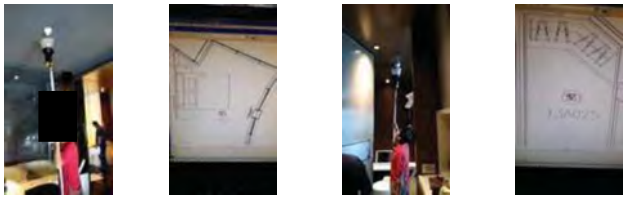



Floor 27 Room 2711 Service Test Smoke Detector 2 head..normal and Heat Detector 3 head…Nowork 1




EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

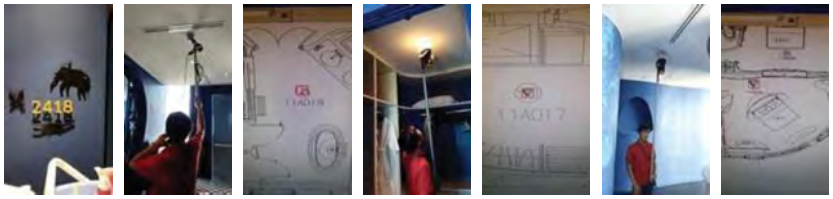

Floor 24 Room 2418 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

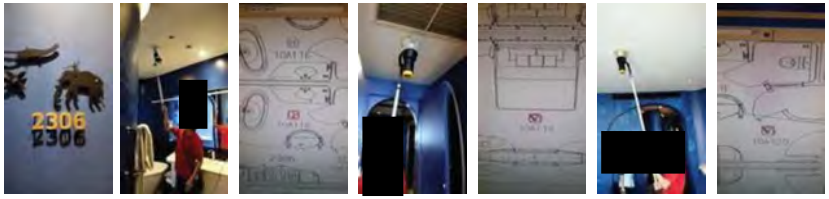


Floor 23 Room 2306 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

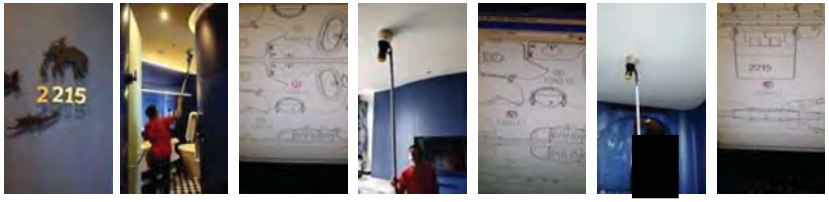

Floor 22 Room 2215 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal




Floor 19 Room 1902 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

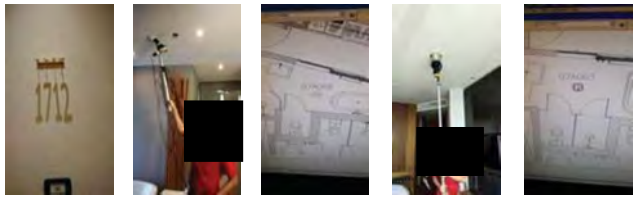

Floor 17 Room 1712 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

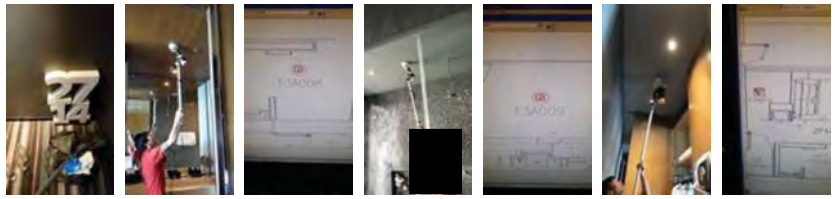

Floor 27 Room 2714 Service Test Smoke Detector 1 head and Heat Detector 2 head…Nomal





Floor 27 Room 2710 Service Test Smoke Detector 2 head and Heat Detector 2 head…Nomal




Floor 24 Room 2413 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal




Floor 24 Room 2404 Service Test Smoke Detector 2 head noalarm 1 and Heat Detector 1head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

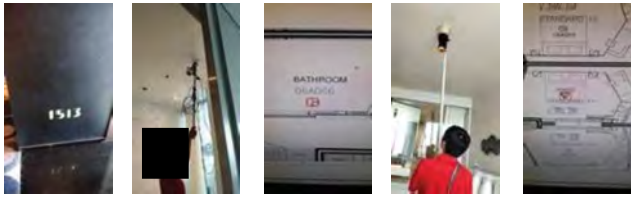


Floor 15 Room 1513 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

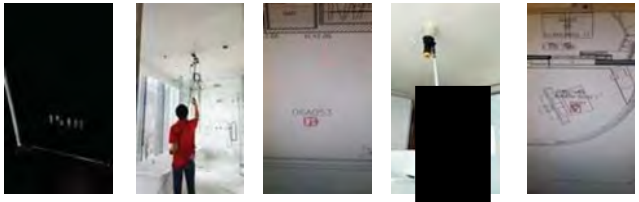


Floor 15 Room 1518 Service Test Smoke Detector 1 head an ector 1 head…Nomal

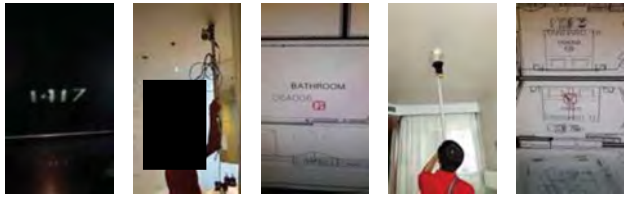

Floor 14 Room 1417 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

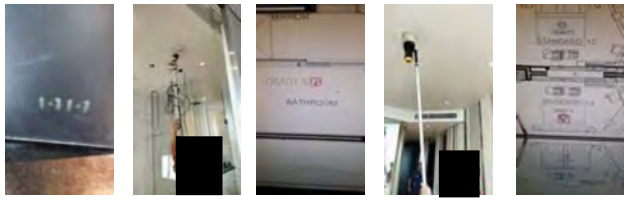


Floor 14 Room 1414 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

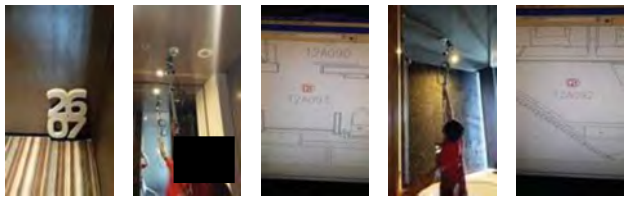


EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

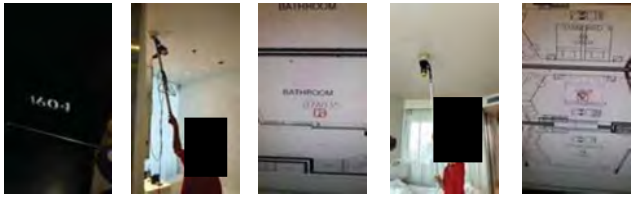

Floor 16 Room 1604 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

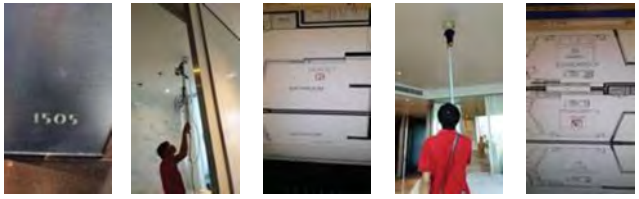


Floor 15 Room 1505 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

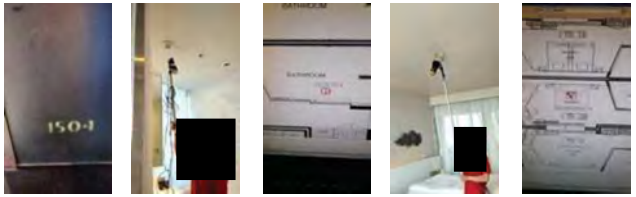

Floor 15 Room 1504 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal




Floor 15 Room 1511 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

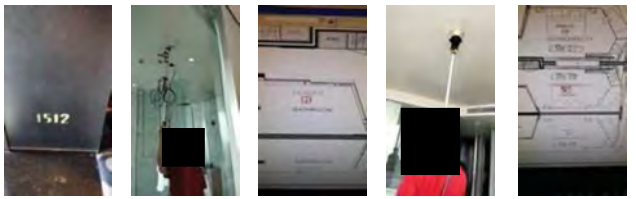



Floor 15 Room 1512 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991
E:mail : FIREalarmest3@gmail.com





Floor 30 In front of Lift Service Test Smoke Detector 1 head ..Normal





Floor 30 wind room Service Test Smoke Detector 1 head ..Normal



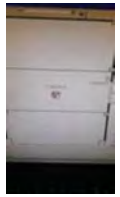


Floor 30 Elevator head room Service Test Smoke Detector 2 head ..Normal






Floor 29 Fire exit door Service Test Smoke Detector 1 head ..Normal



บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991
E:mail : FIREalarmest3@gmail.com












Floor 26 Room 2607 Service Test Smoke Detector 3 head and Heat Detector 2 head…Nomal











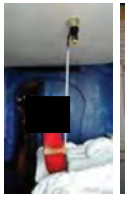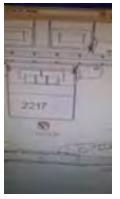
Floor 22 Room 2217 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal






Floor 22 Room 2203 Service Test Smoke Detector 2 head and Heat Detector 1 head…Nomal

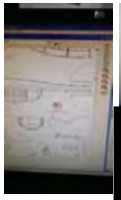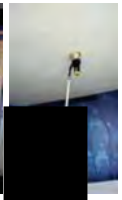

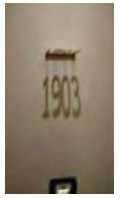




Floor 19 Room 1903 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

Floor 16 Room 1601 Service Test Smoke Detector 1 head and Heat Detector 1 head…Nomal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

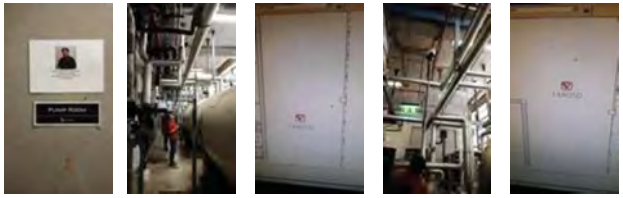


Floor 29 Pump room Service Test Smoke Detector 4 head…Normal




NO SMOKE PUMP ROOM



Floor 29 Stoke and Springer nowork

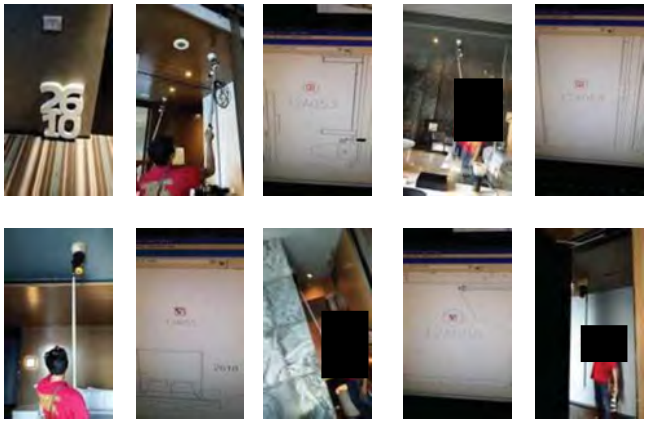

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

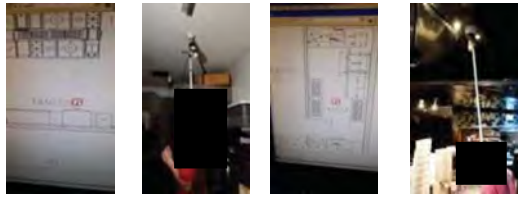




Floor 29 Bar Service Test Smoke Detector 3 head ..Noalarm 1 and Heat Detector 4 head..Normal



Floor 29 HER , HIS Service Test Heat Detector 2 head..Normal

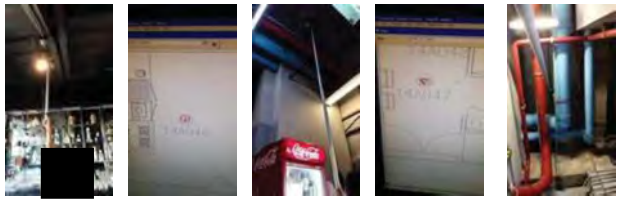




Floor 29 Rental shop Service Test Smoke Detector 4 head ..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

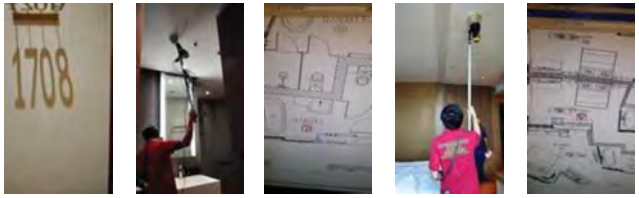


Floor 17 Room 1708 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal




Floor 17 Room 1703 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

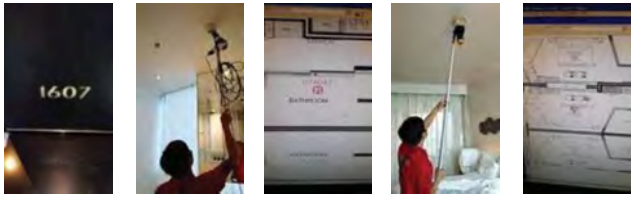

Floor 16 Room 1607 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

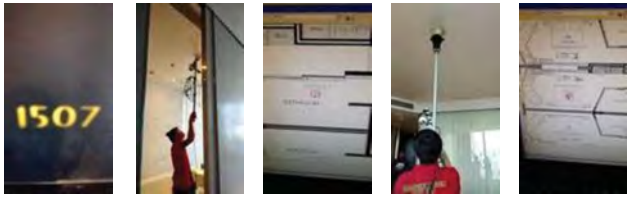


Floor 15 Room 1507 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

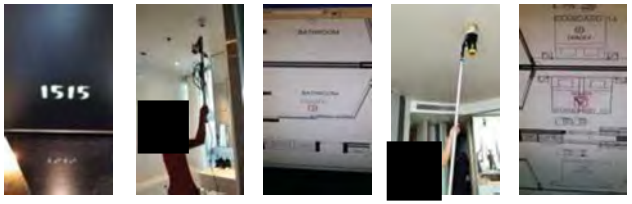


Floor 15 Room 1515 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

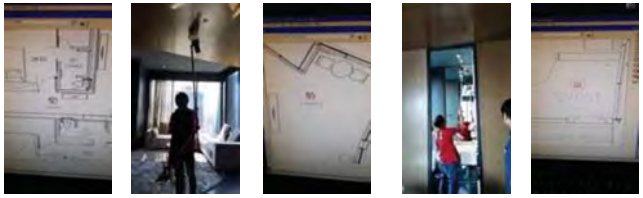


Floor 26 Room 2610 Service Test Smoke Detector 4 head and Heat Detector 3 head..Normal

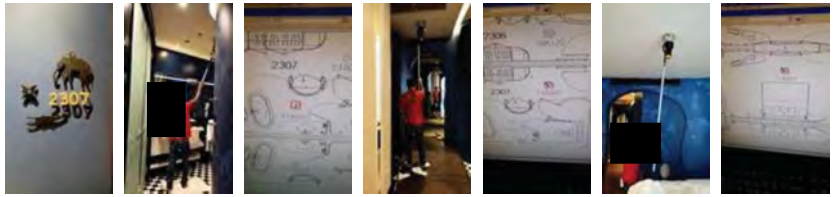


Floor 23 Room 2307 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal



Floor 22 Room 2201 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal

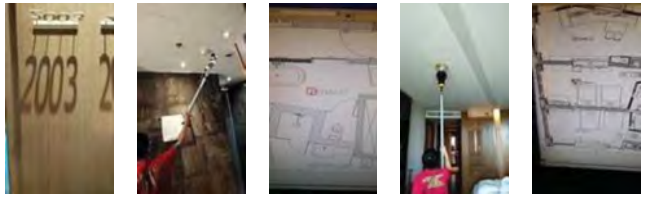


Floor 20 Room 2003 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

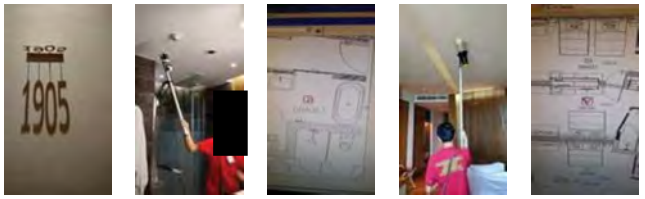


Floor 19 Room 1905 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

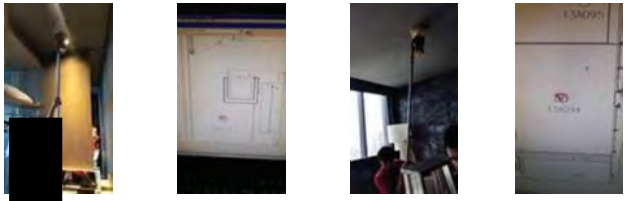

Floor 28 Room 2812 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

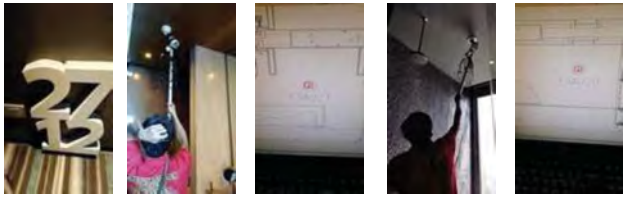

Floor 27 Room 2712 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

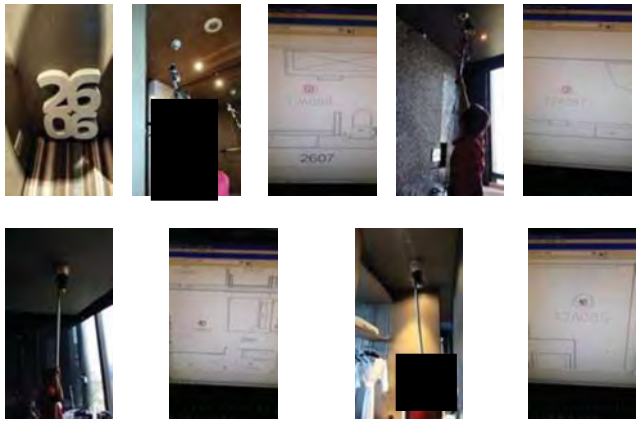


Floor 26 Room 2606 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991




Floor 15 Room 1501 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

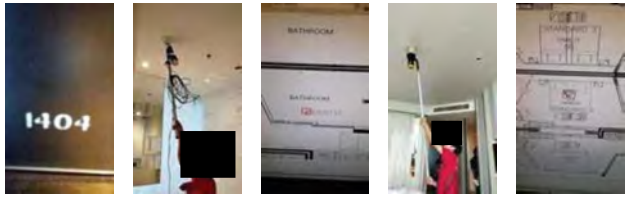

Floor 14 Room 1404 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

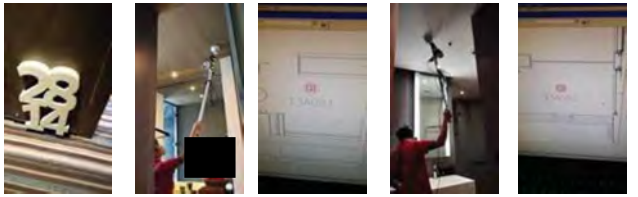


Floor 28 Room 2814 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

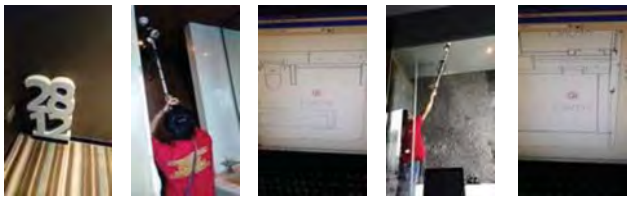


EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

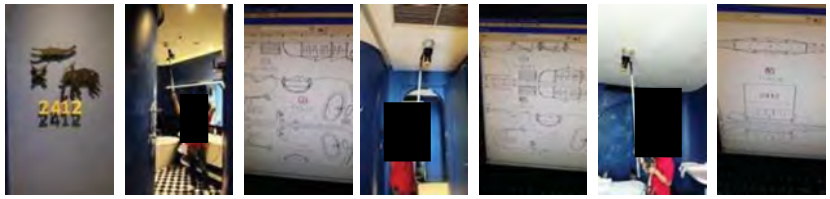

Floor 24 Room 2412 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal

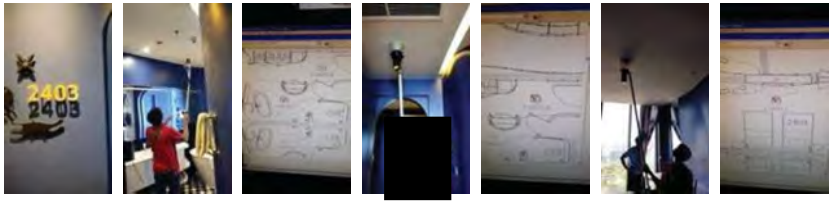

Floor 24 Room 2403 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal

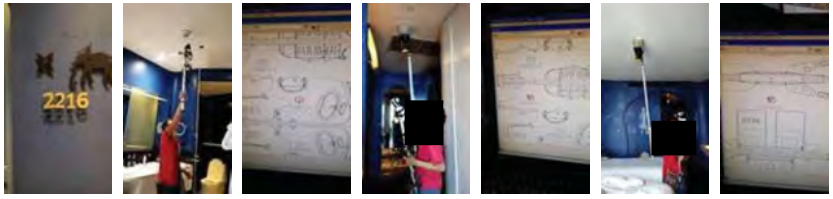

Floor 22 Room 2216 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal




Floor 21 Room 2106 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal




Floor 18 Room 1804 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal


น.13/21


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

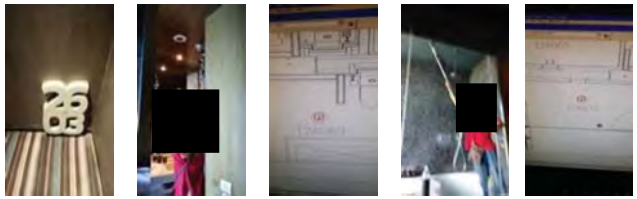

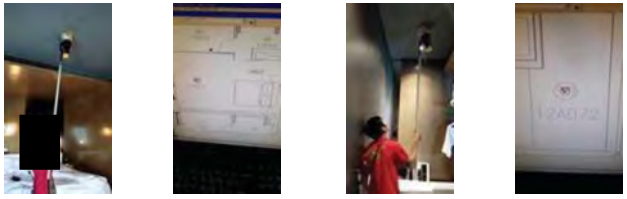


Floor 26 Room 2603 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

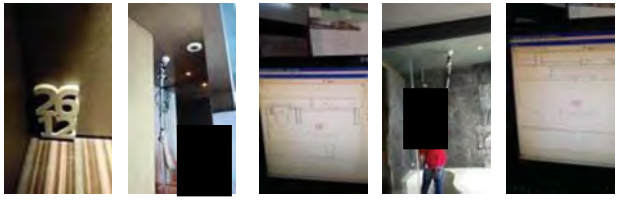

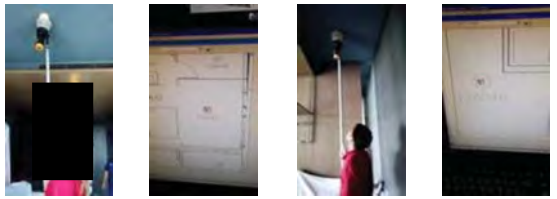

Floor 26 Room 2612 Service Test Smoke Detector 2 head and Heat Detector 2 head..Normal

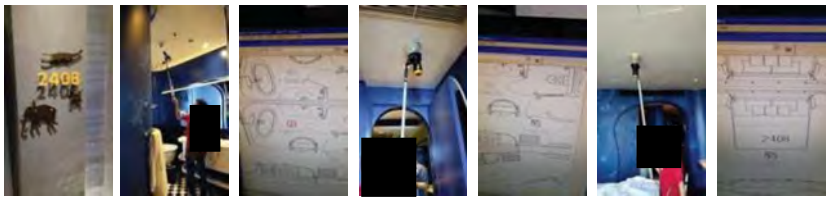


Floor 24 Room 2408 Service Test Smoke Detector 2 head and Heat Detector 1 head..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991




Floor 18 Room 1817 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

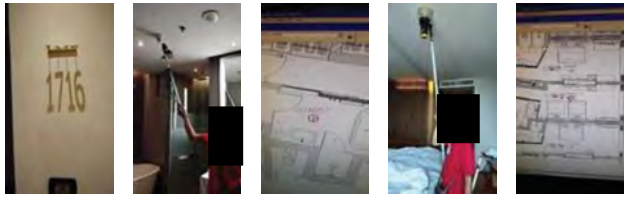


Floor 17 Room 1716 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal



Floor 17 Room 1710 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

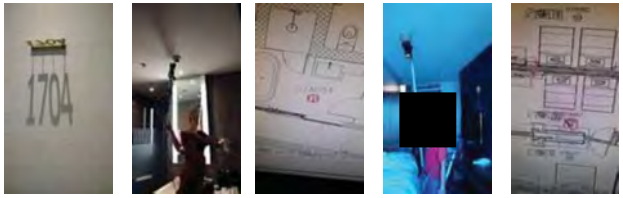

Floor 17 Room 1704 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

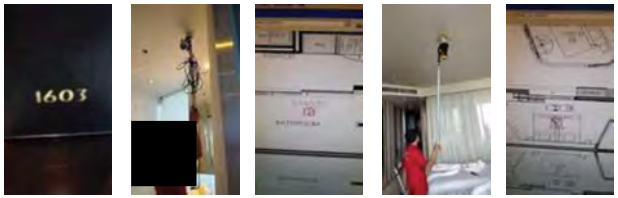


Floor 16 Room 1603 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

น.13/22


บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด
EST
E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991




Floor 18 Room 1805 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

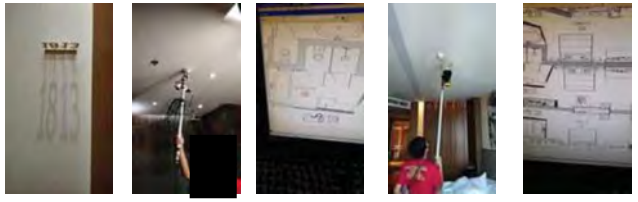


Floor 18 Room 1813 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

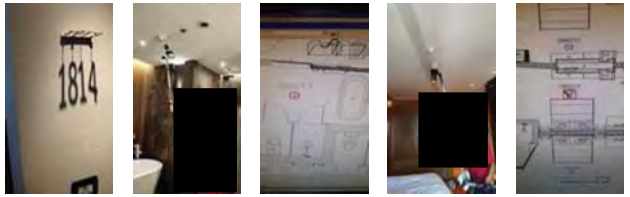

Floor 18 Room 1814 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

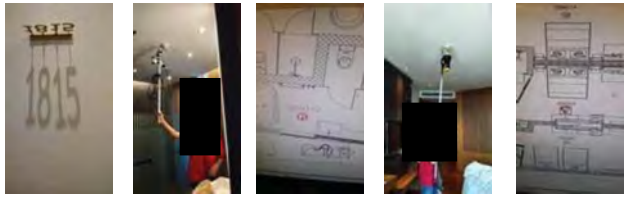


Floor 18 Room 1815 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

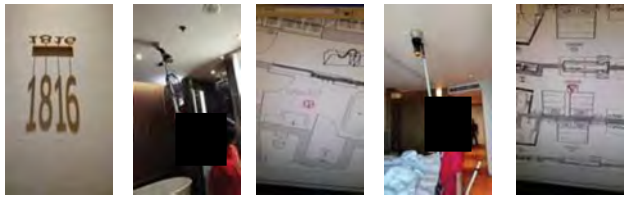

Floor 18 Room 1816 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991


1. Floor 29 Broken Fire escape stairs and in front of lift - Stoke and Springer
2. Floor 29 Bar - Smoke 1 head
3. Floor 29 Pump Room - Smoke 1 head
4. Floor 27 Room 2713 - Heat 1 head
5. Floor B1 Room Security - Smoke 1 head
6. Floor B1 Toilet women - Smoke 1 head
7. Floor B1 In front of wine - Smoke 1 head
8. Floor B1 Store Beverage - Smoke 1 head
9. Floor B1 In front of - Smoke 1 head
10. Floor 24 Room 2404 - Smoke 1 head

Total:-

1.SMOKE 8 HEAD


2.HEAT 1 HEAD

3.STOKE 1

4.SPRINGER 1

น.13/23

บริษัท เอดเวิร์ด เซอร์วิส เทคโนโลยี จำกัด EST E:mail : FIREalarmest3@gmail.com
202/9 หมู่ที่ 6 ถนนนนทบุรี 1 ต.บางกระสอ อ.เมือง จ.นนทบุรี 11000 / โทร.(02)069-4348 (085)664-4950 , (092)494-4664 , (097)464-7991

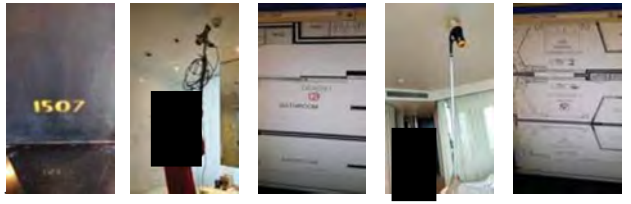

Floor 15 Room 1507 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal




Floor 14 Room 1412 Service Test Smoke Detector 1 head and Heat Detector 1 head..Normal



Floor 26 Test Fire alarm telephone system…there is a signal but no communicate



Floor 22 Test Fire alarm telephone system… there is a signal but no communicate

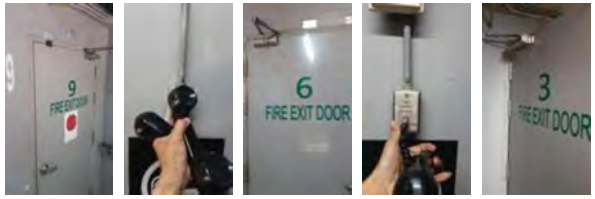

Floor 3,6,9 Test Fire alarm telephone system… there is a signal but no communicate

EDWARD SERVICE TECHNOLOGY CO., LTD.
202/9 MOO 6, NONTHABURI 1 ROAD, BANGKRASAW, MUANG, NONTHABURI 110000 THAILAND

เอกสารแนบ 14
ใบรับรองการตรวจสอบอาคาร

เลขที่ ๙๒๙/๒๕๖๖

รายงานผลการตรวจสอบประจำปี ครั้งที่ ๔
ตามใบรับรองการตรวจสอบประจำปี ครั้งที่ ๓
เลขที่ ๑๓๓๖/๒๕๖๕ ลงวันที่ ๒๐ เมษายน ๒๕๖๕

แบบ ร.๑

ตามใบรับรองการตรวจสอบใหญ่เลขที่ ๙๙๓/๒๕๖๒
ลงวันที่ ๒๒ พฤษภาคม ๒๕๖๒

ใบรับรองการตรวจสอบอาคาร

ใบรับรองฉบับนี้ออกให้เพื่อแสดงว่า

อาคาร โรงแรม โซ แบงคอก โดย บริษัท โอ๊คทรี จำกัด ตั้งอยู่เลขที่ ๒ ตรอก/ซอย - ถนน สาทรเหนือ หมู่ที่ - ตำบล/แขวง สีลม อำเภอ/เขต บางรัก จังหวัด กรุงเทพมหานคร ได้ผ่านการตรวจสอบอาคาร ตามพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕[redacted]

เจ้าพนักงานท้องถิ่นได้พิจารณาผลการตรวจสอบอาคาร ซึ่งทำการตรวจสอบโดยผู้ตรวจสอบ[redacted]

ป.๑๐๔๐/๒๕๕๐ ออกให้ ณ วันที่ ๑๒ ธันวาคม ๒๕๖๔ แล้วเห็นว่า อาคารนี้มีสภาพปลอดภัยในการใช้งาน

ออกให้ ณ วันที่ ๑๔ ก.ย. ๒๕๖๖ เดือน ..... พ.ศ. .....

ใบรับรองฉบับนี้ให้ใช้ได้จนถึงวันที่ ๒๑ เดือน พฤษภาคม พ.ศ. ๒๕๖๗

[redacted]

(.....)

ตำแหน่ง เจ้าพนักงานท้องถิ่น

คำเตือน

๑. ใบรับรองฉบับนี้เป็นการรับรองเฉพาะการตรวจสอบอาคาร มิได้เป็นการรับรองความถูกต้องการก่อสร้างอาคาร ดัดแปลงอาคาร หรือเคลื่อนย้ายอาคารแต่อย่างใด

๒. ให้จัดส่งรายงานผลการตรวจสอบอาคารภายใน ๓๐ วัน ก่อนใบรับรองการตรวจสอบอาคาร (แบบ ร.๑) จะมีระยะเวลาครบ ๑ ปี

BID 996AA814F1D0

น.14/1

เอกสารแนบ 15

เอกสารรับรองผลการตรวจวิเคราะห์คุณภาพน้ำทิ้ง

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 23145482
Date Received : Jan 12, 2024
Date Reported : Jan 23, 2024
Report Number : 2892171-1

Guideline : Notification of Ministry of Natural Resources and Environment November,7 ,B.E. 2548 on Effluent Control Standard from Types and Sized of Buildings, Type A.
(1) : The values are in addition to the Total Dissolved Solids of the water used not more than 500 mg/L.
Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

ม.15/1

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 23145482
Date Received : Jan 12, 2024
Date Reported : Jan 23, 2024
Report Number : 2892171-1

Sample Number	23145482-2
Sampled Date	Jan 12, 2024 2:10 PM
Sample Description	Wastewater
Location	Stroage Tank
Date Analysis Commenced	Jan 12, 2024
Condition of Sample	Contained in one amber glass bottle and four plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C) *	mg/L	-	2.0	196	≤20	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5210 B, 4500 - O (C)	Bangkok
Oil & Grease	mg/L	-	3	6	≤20	In-house method : STM 04-014 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5520 B	Bangkok
pH at 25 degree C		-	-	7.7	5.0-9.0	In-house method : STM 04-003 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	<0.1	≤0.5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 F	Bangkok
Sulfide *	mg/L	-	0.5	2.6	≤1	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-S2 (C, F)	Bangkok
Total Dissolved Solids Dried at 103-105 degree C	mg/L	-	5	488	(1)	In-house method : STM 04-010 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	81.0	≤35	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Norg (C)	Bangkok
Total Suspended Solids Dried at 103-105 degree C	mg/L	-	5	96	≤30	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 D	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company
Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER
7641-101/ EMAIL S:\Reports_All_GL.rpt (3:12PM)

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Feb 29, 2024
Report Number : 2924079-1

Sample Number	2414878-2
Sampled Date	Feb 19, 2024 10:40 AM
Sample Description	Wastewater
Location	Stroage Tank
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in one amber glass bottle and four plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C)	mg/L	-	2.0	185	≤20	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5210 B, part 4500 - O G	Bangkok
Oil & Grease	mg/L	-	3	10	≤20	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5520 B	Bangkok
pH at 25 degree C		-	-	7.8	5.0-9.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	<0.1	≤0.5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 F	Bangkok
Sulfide *	mg/L	-	0.5	4.4	≤1	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-S2 (C, F)	Bangkok
Total Dissolved Solids Dried at 103-105 degree C	mg/L	-	5	456	(1)	In-house method : STM 04-010 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	82.6	≤35	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Norg (C)	Bangkok
Total Suspended Solids Dried at 103-105 degree C	mg/L	-	5	86	≤30	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 D	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

v.15/2

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 23145482
Date Received : Jan 12, 2024
Date Reported : Feb 22, 2024
Report Number : 2917746-1

Sample Number	23145482-1
Sampled Date	Jan 12, 2024 2:00 PM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	Jan 13, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Escherichia coli	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 B	Bangkok
Water Testing							
pH at 25 degree C *		-	-	7.4	7.2-8.4	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน

Note : This Analysis test report is reissued to supersede report No.2892170-1, Date Reported : Jan 23, 2024 due to revise analytical information.

Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O :
Project Name :
Project Location :

Lot ID: 2415312
Date Received : Feb 16, 2024
Date Reported : Feb 20, 2024
Report Number : 2905729-1

Sample Number	2415312-1
Sampled Date	Feb 16, 2024 10:40 AM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	Feb 19, 2024
Condition of Sample	data sheet

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
Residual Free Chlorine	mg/L	-	0.1	0.8	0.6-1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Cl (F)	Bangkok

Guideline : ค่าแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน
Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

v.15/3

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Feb 29, 2024
Report Number : 2924079-1

Guideline : Notification of Ministry of Natural Resources and Environment November,7 ,B.E. 2548 on Effluent Control Standard from Types and Sized of Buildings, Type A.
(1) : The values are in addition to the Total Dissolved Solids of the water used not more than 500 mg/L.
Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924080-1

Sample Number	2414878-3
Sampled Date	Feb 19, 2024 10:35 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Metals Testing							
Aluminium	mg/L	0.003	0.005	0.04	≤0.2	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Arsenic	mg/L	0.0003	0.0005	0.0006	≤0.05	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Barium	mg/L	0.0003	0.0005	0.08	≤1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Cadmium	mg/L	0.0003	0.0005	Not Detected	≤0.005	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Calcium	mg/L	0.01	0.10	37.5	No Standard	In-house method : STM 05-014 based on United States Environmental Protection Agency, 1994, EPA Method 200.7	Bangkok
Chromium	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Copper	mg/L	0.0003	0.0005	0.01	≤1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Iron	mg/L	0.003	0.005	0.02	≤0.3	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

v.15/4

TESTING
No.0009

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924078-1

Sample Number	2414878-1
Sampled Date	Feb 19, 2024 10:30 AM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Escherichia coli	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 B	Bangkok
Water Testing							
pH at 25 degree C *		-	-	8.0	7.2-8.4	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Residual Free Chlorine *	mg/L	-	0.1	1.0	0.6-1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Cl (F)	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน
Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924080-1

Sample Number	2414878-3
Sampled Date	Feb 19, 2024 10:35 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Clostridium perfringens	in 100 mL	-	-	Not Detected	No Standard	In-house method STM No. 01-012 in connection with: - Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9260 A,B - FDA BAM online, 2001 (Chapter 16)	Bangkok
Escherichia coli	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok
Salmonella spp.	in 100 mL	-	-	Not Detected	Not Detected	ISO 19250 (2010)	Bangkok
Standard Plate Count	CFU/mL	-	-	<1	No Standard	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9215 B	Bangkok
Staphylococcus aureus	CFU/100mL	-	-	<1	≤100	In-house method STM No. 01-054 in connection with: - Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9213 B - FDA BAM online, 2016 (Chapter 12)	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<2.2	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 B	Bangkok
Water Testing							
Alkylbenzene Sulfonate as MBAS	mg/L	0.05	0.1	Not Detected	≤0.2	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5540 C	Bangkok
Chloride as Cl	mg/L	0.06	0.2	52.5	≤250.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4110 B	Bangkok

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924080-1

Sample Number	2414878-3
Sampled Date	Feb 19, 2024 10:35 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Metals Testing							
Lead	mg/L	0.0003	0.0005	0.0008	≤0.05	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Manganese	mg/L	0.0003	0.0005	0.006	≤0.05	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Mercury	mg/L	0.0001	0.0005	Not Detected	≤0.002	In-house method : STM 05-007 based on United States Environmental Protection Agency, 2002, EPA Method 1631, Revision E	Bangkok
Selenium	mg/L	0.0003	0.0005	Not Detected	≤0.01	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Silver	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Sodium	mg/L	0.01	0.10	40.8	No Standard	In-house method : STM 05-014 based on United States Environmental Protection Agency, 1994, EPA Method 200.7	Bangkok
Zinc	mg/L	0.003	0.005	1.67	≤5.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 3125 B, 3030 F	Bangkok
Microbiological Testing							

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924080-1

Sample Number	2414878-3
Sampled Date	Feb 19, 2024 10:35 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
Total Dissolved solids Dried at 180 degree C	mg/L	-	5	256	No Standard	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 C	Bangkok
Total Hardness as CaCO3	mg/L	0.5	1	131	≤100	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2340 C	Bangkok
Total Solids Dried at 103-105 degree C	mg/L	-	5	260	≤500	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 B	Bangkok
Turbidity	NTU	-	0.1	0.50	≤5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2130 B	Bangkok

Guideline : Notification of the Ministry of Public Health No. 61 B.E. 2524 & 135 B.E. 2534 on bottled drinking water (No.2) & 316 B.E. 2553 & Pathogenic 416 B.E. 2563
Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2414878
Date Received : Feb 19, 2024
Date Reported : Mar 01, 2024
Report Number : 2924080-1

Sample Number	2414878-3
Sampled Date	Feb 19, 2024 10:35 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Feb 20, 2024
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
Color	Color unit	-	5	<5	≤20	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2120 B	Bangkok
Cyanide as CN	mg/L	0.002	0.005	Not Detected	≤0.1	In-house method : STM 04-007 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - CN (C, E)	Bangkok
Fluoride as F	mg/L	0.05	0.1	0.3	≤1.5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4110 B	Bangkok
Nitrate as N	mg/L	0.06	0.2	0.7	≤4	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4110 B	Bangkok
Odour		-	-	Odourless	Odourless	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2150 B	Bangkok
pH at 25 degree C		-	-	7.6	6.5-8.5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Phenol	mg/L	0.0005	0.001	Not Detected	≤0.001	In-house method : STM 04-022 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5530 C	Bangkok
Sulfate	mg/L	0.15	0.5	44.7	≤250.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4110 B	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company
Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER
7641-101/ EMAIL S:\Reports_All_GL.rpt (2:02PM)

น.15/6

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2426698
9ate Re4eiDed : F ar 11, 202b
9ate Reported : F ar 2c, 202b
Report N- muer : 2v501cc71

Guideline : Notifi4ation of F inistry of Nat- ral Reso- r4es and UnDironment NoDemuer,G ,BxUx 25bc on Uffl- ent Control Standard from Types and Sized of B- ildings, Type Ax
wLE: The Dal- es are in addition to the Total 9issolDed Solids of the Water - sed not more than 500 mg/Lx
Sampling By : Theeraphol Sangthong

Remark :
- LO9 : Limit of 9ete4tion
- "6" : LoWer than LOQ vLimit of Q- antitationE / LOR vLimit of ReportingE
- AnalytevsEmarked I is/are not in4l- ded in s4ope of A44reditation <SO/<UC 1C025x
- The lauoratory has ueen a44epted as an a44redited lauoratory 4omplying With the <SO/<UC 1C025x

Approved by [redacted]

Res- lts apply to the sampleswEas s- umitted, - nless the sampling Was 4ond- 4ted uy ALSxNo part of this report may ue reprod- 4ed in any form Witho- t Written 4onsent from the lauoratoryx ALS Lauoratory *ro- p vThailandEstrongly re4ommends that this report is not reprod- 4ed e)4ept in f- llx

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2426698
9ate Re4eiDed : F ar 11, 202b
9ate Reported : F ar 2c, 202b
Report N- muer : 2v501cc71

Sample Number	2b288vc72
Sampled Date	F ar 11, 202b 2:b5 PF
Sample Description	MasteWater
Location	Stroage Tank
Date Analysis Commenced	F ar 12, 202b
Condition of Sample	Contained in one amuer glass uottle and fo- r plasti4 uottles, sample 4ontainers 4omply to pretreatment 7 preserDation standards wAP(A, HSUPAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BO9 v6 days at 20 degree CE	mg/L	7	2x0	1c1	≤20	Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part 5210 B, part b500 7O *	Bangkok
Oil . *rease	mg/L	7	3	G	≤20	<n7ho- se method : STF 0b701b uased on Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part 5520 B	Bangkok
p(at 25 degree C		7	7	GxG	5x07vx0	<n7ho- se method : STF 0b7003 uased on Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part b500 7(vBE	Bangkok
Settleaule Solid I	mL/L/hr	7	0x1	6 0x1	≤0x5	Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part 25b0 &	Bangkok
S- lfide I	mg/L	7	0x5	3x8	≤1	Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part b5007S2 vC, &E	Bangkok
Total 9issolDed Solids 9ried at 1037105 degree C	mg/L	7	5	b38	vLE	<n7ho- se method : STF 0b7010 uased on Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part 25b0 C	Bangkok
Total Kjeldahl Nitrogen as N I	mg/L	0x15	1x0	GGx0	≤35	Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part b5007Norg vCE	Bangkok
Total S- spended Solids 9ried at 1037105 degree C	mg/L	7	5	vc	≤30	Standard F ethods for the U)amination of Mater and MasteWaterx AP(A, AMMA . MU8, 23rd edx, 201G, part 25b0 9	Bangkok

Approved b [redacted]

Res- lts apply to the sampleswEas s- umitted, - nless the sampling Was 4ond- 4ted uy ALSxNo part of this report may ue reprod- 4ed in any form Witho- t Written 4onsent from the lauoratoryx ALS Lauoratory *ro- p vThailandEstrongly re4ommends that this report is not reprod- 4ed e)4ept in f- llx

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report NbmPer : 295019-uL

Sample Number	242WW8uJ
Sampled Date	Mar 11, 2024 1:55 f M
Sample Description	Consbmption w ater
Location	Roo6Tank
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in t(o plastic Pottles, sample containers comply to pretreatment u preservation standards HAf EA,) S. f AI

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp7	CF) /L	u	u	Not Detected**	Not Detected	3SO 11U-1 H201UI	Bangkok

Guideline : Noti6cation o6Department o6Eealth aPobt Legionella Control in Cooling To(er B7, 72544

Note : ** Not Detected mean Bacteria not 6obnd in agar plate7

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit o6Detection
- "<" : Lo(er than LOQ HLimit o6QbantitationI / LOR HLimit o6ReportingI

Reslblts apply to the samplelHI as sbPmitted, bnless the sampling (as condbcted Py ALS7No part o6this report may Pe reprodbced in any 6orm (ithobt (ritten consent 6rom the laPoratory7ALS LaPoratory Grobp HThailandI strongly recommends that this report is not reprodbced except in 6bll7

Approved by [redacted]

v.15/8

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950192-1

Sample Number	2426698-6
Sampled Date	Mar 11, 2024 2:40 PM
Sample Description	Consumption Water
Location	Underground Tank
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950191-1

Sample Number	2426698-5
Sampled Date	Mar 11, 2024 1:40 PM
Sample Description	Consumption Water
Location	Cooling ToUer Water Sample
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in tUo plastic bottles, sample containers comply to pretreatment - preservation standards wAP(A, HSEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFH/L	-	-	Not Detected**	Not Detected	ISO 11731 vi2017)	Bangkok

Guideline : Notification of Department of (ealth about Legionella Control in Cooling ToUer B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : LoUer than LOQ vLimit of Quantitation) / LOR vLimit of Reporting)

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling Uas conducted by ALS. No part of this report may be reproduced in any form Uithout Uritten consent from the laboratory. ALS Laboratory Group vThailand) strongly recommends that this report is not reproduced except in full.

v.15/9

Analysis / Test Report

Accreditation No. 1031/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950195-1

Sample Number	2426698-9
Sampled Date	Mar 11, 2024 1:40 PM
Sample Description	Consumption Water
Location	Cooling Tower Water Sample
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950189-1

Sample Number	2426698-W
Sampled Date	Mar 11, 2024 2:05 PM
Sample Description	Consumption U ater
Location	Shower U ater Sample : (uest room 2110
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards HAPEA,) S. PAI

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp7	C*) /L	-	-	Not DetectedQQ	Not Detected	3SO 11FWl H201FI	Bangkok

Guideline : Notification of Department of Eealth about Legionella Control in Cooling Tower B7, 72544

Note : QQ Not Detected mean Bacteria not found in agar plate7

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- <G< : Lower than LO" HLimit of " uantitationI / LOR HLimit of ReportingI

Approved by [redacted]

Results apply to the sampleHI as submitted, unless the sampling was conducted by ALS7No part of this report may be reproduced in any form without written consent from the laboratory7ALS Laboratory (roup HThailandI strongly recommends that this report is not reproduced except in full7

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report NbmPer : 295019-u1

Sample Number	242--98u10
Sampled Date	Mar 11, 2024 2:05 f M
Sample Description	Consbmption Water
Location	Shower Water Sample
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in one plastic Pottle, sample containers comply to pretreatment u preservation standards (Af HA, USEf A)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	u	u	Not Detected	Standard Methods 6or the Examination o6 Water and Wastewater. Af HA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit o6Detection
- Q Q : Lower than LO* (Limit o6*bantitation) / LOR (Limit o6Reporting)
- Analyte(s) marked < is/are not incl bded in scope o6Accreditation ISO/IEC 17025.
- The laPoratory has Peen accepted as an accredited laPoratory complying with the ISO/IEC 17025.

Approved by [redacted]

Results apply to the sample(s) as sbPmitted, bnless the sampling was condbcted Py ALS. No part o6this report may Pe reprodbced in any 6orm withobt written consent 6rom the laPoratory. ALS LaPoratory Grobp (Thailand) strongly recommends that this report is not reprodbced except in 6ll.

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950190-1

Sample Number	2426698-4
Sampled Date	Mar 11, 2024 2:14 PM
Sample Description	Consumption Water
Location	Spa Water SampleUUUUU
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, ES) PA.

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella sppU	CFE/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017.	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower BU U2544

Note : ** Not Detected mean Bacteria not found in agar plateU

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation. / LOR (Limit of Reporting.

Results apply to the sample(s. as submitted, unless the sampling was conducted by ALSUNo part of this report may be reproduced in any form without written consent from the laboratoryUALS Laboratory Group (Thailand. strongly recommends that this report is not reproduced except in fullU

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report NbmPer : 295019-uL

Sample Number	242VW8uL1
Sampled Date	Mar 11, 2024 2:14 f M
Sample Description	Consbmption w ater
Location	Spa w ater Sample
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in one plastic Pottle, sample containers comply to pretreatment u preservation standards (Af HA, USEf A)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	u	u	Not Detected	Standard Methods 6or the Examination o6 w ater and w aste. ater&Af HA, Aw w A F w E3, 27rd ed& 201-, part 9221 3	Bangkok

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit o6Detection
- Q Q : Lo. er than LO* (Limit o6* bantitation) / LOR (Limit o6Reporting)
- Analyte(s) marked < is/are not incl bded in scope o6Accreditation ISO/IEC 1-025&
- The laPoratory has Peen accepted as an accredited laPoratory complying . ith the ISO/IEC 1-025&

Results apply to the sample(s) as sbPmitted, bnless the sampling . as condbcted Py ALS8No part o6this report may Pe reprodbced in any 6orm . ithobt . ritten consent 6rom the laPoratory&ALS LaPoratory Grobp (Thailand) strongly recommends that this report is not reprodbced except in 6bll&

Approved b [redacted]

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received :Mar 11, 2024
Date Reported :Mar 28, 2024
Report Number :2950198-1

Sample Number	2426698-12
Sampled Date	Mar 11, 2024 2:20 PM
Sample Description	Consumption Water
Location	Pool
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards wAP(A, HSUPAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Uscherichia coli	in 100 mL	-	-	Not Detected	Standard Methods for the U)amination of Water and Wastex ater. AP(A, AWWA & WUF, 23rd ed., 2017, part 9221 F	Bangkok

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- Q Q : Lox er than LO* wLimit of *uantitationE/ LOR wLimit of ReportingE
- AnalytewsE marked < is/are not included in scope of Accreditation ISO/IUC 17025.
- The laboratory has been accepted as an accredited laboratory complying x ith the ISO/IUC 17025.

Approved by [redacted]

Results apply to the samplewsEas submitted, unless the sampling x as conducted by ALS. No part of this report may be reproduced in any form x ithout x ritten consent from the laboratory. ALS Laboratory Group wThailandE strongly recommends that this report is not reproduced e)cept in full.

TESTING
No.0009

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950187-1

Sample Number	2426698-1
Sampled Date	Mar 11, 2024 2:20 PM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Escherichia coli	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 B, F	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 B	Bangkok
Water Testing							
pH at 25 degree C *		-	-	7.9	7.2-8.4	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Residual Free Chlorine *	mg/L	-	0.1	0.8	0.6-1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Cl (F)	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน

Sampling vy : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

ApproBed by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950194-1

Sample Number	2426698-8
Sampled Date	Mar 11, 2024 2:30 PM
Sample Description	Consumption Water
Location	Kitchen
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2426698
Date Received : Mar 11, 2024
Date Reported : Mar 28, 2024
Report Number : 2950199-1

Sample Number	2426698-13
Sampled Date	Mar 11, 2024 2:30 PM
Sample Description	Consumption Water
Location	Kitchen
Date Analysis Commenced	Mar 12, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok

Sampling By : Theeraphol Sangthong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2438612
Date Received : Apr 10, 2024
Date Reported : Apr 24, 2024
Report Number : 2956189-1

Guideline : Notification of Ministry of Natural Resources and Environment November,7 ,B.E. 2548 on Effluent Control Standard from Types and Sized of Buildings, Type A.
(1) : The values are in addition to the Total Dissolved Solids of the water used not more than 500 mg/L.

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Appr[redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

v.15/14

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2438612
Date Received : Apr 10, 2024
Date Reported : Apr 24, 2024
Report Number : 2956189-1

Sample Number	2438612-2
Sampled Date	Apr 10, 2024 10:10 AM
Sample Description	Wastewater
Location	Stroage Tank
Date Analysis Commenced	Apr 11, 2024
Condition of Sample	Contained in one amber glass bottle and four plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C)	mg/L	-	2.0	150	≤20	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5210 B, part 4500 - O G	Bangkok
Oil & Grease	mg/L	-	3	12	≤20	In-house method : STM 04-014 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 5520 B	Bangkok
pH at 25 degree C		-	-	7.8	5.0-9.0	In-house method : STM 04-003 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	2.0	≤0.5	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 F	Bangkok
Sulfide *	mg/L	-	0.5	0.6	≤1	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-S2 (C, F)	Bangkok
Total Dissolved Solids Dried at 103-105 degree C	mg/L	-	5	316	(1)	In-house method : STM 04-010 based on Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	54.3	≤35	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Norg (C)	Bangkok
Total Suspended Solids Dried at 103-105 degree C	mg/L	-	5	98	≤30	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 2540 D	Bangkok

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2448995
v ate Re9ei6ed : 4 ay 1D, 202c
v ate Reported : 4 ay 2c, 202c
Report Number : D00228c-1

Sample Number	2cc3MM5-2
Sampled Date	4 ay 1D, 202c 11:D5 A4
Sample Description	Wastewater
Location	Stroage Tank
Date Analysis Commenced	4 ay 1c, 202c
Condition of Sample	Contained in one amber glass bottle and four plasti9 bottles, sample 9ontainers 9omply to pretreatment - preser6ation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOv (5 days at 20 degree C)	mg/L	-	2.0	183	≤20	Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part 5210 B, part c500 - O G	Bangkok
Oil & Grease	mg/L	-	D	18	≤20	In-house method : ST4 0c-01c based on Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part 5520 B	Bangkok
pH at 25 degree C		-	-	7.7	5.0-M0	In-house method : ST4 0c-00D based on Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part c500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	8.0	≤0.5	Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part 25c0 F	Bangkok
Sulfide *	mg/L	-	0.5	7.2	≤1	Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part c500-S2 (C, F)	Bangkok
Total v issol6ed Solids v ried at 10D-105 degree C	mg/L	-	5	872	(1)	In-house method : ST4 0c-010 based on Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part 25c0 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	115	≤D5	Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part c500-Norg (C)	Bangkok
Total Suspended Solids v ried at 10D-105 degree C	mg/L	-	5	153	≤D0	Standard 4 ethods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 2Drd ed., 2017, part 25c0 v	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was 9ondu9ted by ALS. No part of this report may be reprodu9ed in any form without written 9onsent from the laboratory. ALS Laboratory Group (Thailand) strongly re9ommends that this report is not reprodu9ed ex9ept in full.

Approved by [redacted]

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2440802
bate Re9ei4ed : Apr 12, 202F
bate Reported : Apr 2D, 202F
Report N7m8er : 2cD22v5M

Sample Number	2FF0P02M
Sampled Date	Apr 12, 202F c:vP Af
Sample Description	Cons7mption 3 ater
Location	SWimming -ool
Date Analysis Commenced	Apr 12, 202F
Condition of Sample	Contained in tWo plasti9 8ottles, sample 9ontainers 9omply to pretreatment Mpreser4ation standards wA-(A, HSU-AE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Us9heri9hia 9oli	in 100 mL	M	M	Not bete9ted	Not bete9ted	Standard f ethods ur the U)amination ou3 ater and 3 asteWaterx A-(A, A3 3 A . 3 U8, 2vrd edx, 201<, part c221 B, &	Bangkok
Total Coliurm	f -N/100mL	M	M	*1x1	*10	Standard f ethods ur the U)amination ou3 ater and 3 asteWaterx A-(A, A3 3 A . 3 U8, 2vrd edx, 201<, part c221 B	Bangkok
Water Testing							
p(at 25 degree C 6		M	M	<xc	<x2NPxF	Standard f ethods ur the U)amination ou3 ater and 3 asteWaterx A-(A, A3 3 A . 3 U8, 2vrd edx, 201<, part F500 M(vBE	Bangkok
Resid7al &ree Chlorine 6	mg/L	M	0x1	0xc	0xDM.x0	Standard f ethods ur the U)amination ou3 ater and 3 asteWaterx A-(A, A3 3 A . 3 U8, 2vrd edx, 201<, part F500NCI vBE	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน

Sampling By : -an7pong (omeWong

Remark :
- LOb : Limit oubete9tion
- "*" : LoWer than LOQ vLimit ouQ7antitationE/ LOR vLimit ouReportingE
- AnalytevsEmarked 6 is/are not in97ded in s9ope ouA99reditation ISO/IUC 1<025x
- The la8oratory has 8een a99epted as an a99redited la8oratory 9omplying With the ISO/IUC 1<025x

Res7lts apply to the samplevsEas s78mitted, 7nless the sampling Was 9ond79ted 8y ALSxNo part outhis report may 8e reprod79ed in any uorm Witho7t Written 9onsent urom the la8oratoryx ALS La8oratory Gro7p vThailandEstrongly re9ommends that this report is not reprod79ed e)9ept in uTlx

Approved by [redacted]

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2448995
4ate ReDeiced : F ay 1b, 2029
4ate Reported : F ay 2v, 2029
Report N8m-er : b00M20571

Sample Number	299f vv571
Sampled Date	F ay 1b, 2029 11:25 AF
Sample Description	Cons8mption 3 ater
Location	SWimming uool
Date Analysis Commenced	F ay 19, 2029
Condition of Sample	Contained in tWo plastiD-ottles, sample Dontainers Domply to pretreatment 7 presercation standards wAu(A, HSUuAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
UsDheriDhia Doli	in 100 mL	7	7	Not 4eteDted	Not 4eteDted	Standard F ethods Por the U)amination oP3 ater and 3 asteWaterx Au(A, A3 3 A . 3 U8, 2brd edx, 201M part v221 B, &	Bangkok
Total ColiPorm	F uN/100mL	7	7	<1x1	<10	Standard F ethods Por the U)amination oP3 ater and 3 asteWaterx Au(A, A3 3 A . 3 U8, 2brd edx, 201M part v221 B	Bangkok
Water Testing							
p(at 25 degree C *		7	7	Mv	M27fx9	Standard F ethods Por the U)amination oP3 ater and 3 asteWaterx Au(A, A3 3 A . 3 U8, 2brd edx, 201M part 9500 7(v8E	Bangkok

Guideline : 6ที่ แนและ ขง6อ นกกร ถกสำมากอ สธ. ฉ้อบ่ บ1/2550 เรื่อง ถกกี่ จ6ธถกก กนถขอถฝ้ากสกษีม่ำ น้ค ยวิขกฝ้ากษี่แ หาแบคแองเไ'ที่ ถิแ

Note : This Analysis test report is reiss8ed to s8persede report Noxb0022ab71, 4ate Reported : F ay 29, 2029 d8e to recise analytiDal inPormationx

Sampling vy : uiDhai Boonyong

Remark :
- LO4 : Limit oP4eteDtion
- "<" : LoWer than LOQ vLimit oPQ8antitationE / LOR vLimit oPReportingE
- AnalytevsE marked * is/are not inD8ded in sDope oPADDreditation ISO/IUC 1M025x
- The la-oratory has -een aDDepted as an aDDredited la-oratory Domplying With the ISO/IUC 1M025x

Res8lts apply to the samplewsEas s8-mitted, 8nless the sampling Was Dond8Dted -y ALSxNo part oPthis report may-e reprod8Ded in any Porm Vithо8t Written Donsent Prom the la-oratoryx ALS La-oratory Gro8p vThailandEstrongly reDommends that this report is not reprod8Ded e)Dept in P8llx

ApproBed by [redacted]

v.15/16

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2448995
v ate Re9ei6ed : 4 ay 1D, 202c
v ate Reported : 4 ay 2c, 202c
Report Number : D00228c-1

Guideline : Notifi9ation of 4 inistry of Natural Resour9es and En6ironment No6ember,7 ,B.E. 25c3 on Effluent Control Standard from Types and Sized of Buildings, Type A.
(1) : The 6alues are in addition to the Total v issol6ed Solids of the water used not more than 500 mg/L.
Sampling By : Pi9hai Boonyong

Remark :
- LOv : Limit of v ete9tion
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not in9luded in s9ope of A99reditation ISO/IEC 17025.
- The laboratory has been a99epted as an a99redited laboratory 9omplying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was 9ondu9ted by ALS. No part of this report may be reprodu9ed in any form without written 9onsent from the laboratory. ALS Laboratory Group (Thailand) strongly re9ommends that this report is not reprodu9ed ex9ept in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2454401
Date Received : May 17, 2024
Date Reported : May 21, 2024
Report Number : 2991875-1

Sample Number	2454401-1
Sampled Date	May 17, 2024 9:30 AM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	May 20, 2024
Condition of Sample	data sheet

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
Residual Free Chlorine	mg/L	-	0.1	0.7	0.6-1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Cl (F)	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน

Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2448995
Date Received : May 13, 2024
Date Reported : May 29, 2024
Report Number : 3007205-2

Sample Number	2448995-1
Sampled Date	May 13, 2024 11:25 AM
Sample Description	Consumption Water
Location	Swimming Pool
Date Analysis Commenced	May 14, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
Residual Free Chlorine	mg/L	-	0.1	0.3	0.6-1.0	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 4500-Cl (F)	Bangkok

Guideline : คำแนะนำของคณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการประกอบกิจการสระว่ายน้ำ หรือกิจการอื่น ๆ ในทำนองเดียวกัน

Note : This Analysis test report is reissued to supersede report No.3002263-1, Date Reported : May 24, 2024 due to revise analytical information.

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2463845
c ate Revei3ed : J4n 10, 202D
c ate Reported : J4n 28, 202D
Report N4muer : 90972D7-1

Guideline : NotiRvation oPMinistry oPNat4ral Reso4rves and En3ironment No3emuer,7 ,BxEx25Df on EffI4ent Control Standard Prom Types and Sized oP B4ildings, Type Ax
(1) : The 3al4es are in addition to the Total c issol3ed Solids oPthe water 4sed not more than 500 mg/Lx
Sampling By : bivhai Boonyong

Remark :
- LOc : Limit oPc etevtion
- "<" : Lower than LOQ (Limit oPQ4antitation) / LOR (Limit oPReporting)
- Analyte(s) marked I is/are not invI4ded in svope oP Avvreditation 6SO/ŒC 17025x
- The lauoratory has ueen avvepted as an avvredited lauoratory vomplying with the 6SO/ŒC 17025x

Res4lts apply to the sample(s) as s4umitted, 4nless the sampling was vond4vted uy ALSxNo part oPthis report may ue reprod4ved in any Rorm witho4t written vonsent Rom the lauoratoryx ALS Lauoratory Fro4p (Thailand) strongly revommends that this report is not reprod4ved e*vept in PIIx

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

v.15/18

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location:

Lot ID: 2463845
c ate Revei3ed : J4n 10, 202D
c ate Reported : J4n 28, 202D
Report N4muer : 90972D7-1

Sample Number	2D89f D5-2
Sampled Date	J4n 10, 202D 11:95 AM
Sample Description	Wastewater
Location	Stroage Tank
Date Analysis Commenced	J4n 11, 202D
Condition of Sample	Contained in Ro4r plastiv uottles and one amuer glass uottle, sample vontainers vomply to pretreatment - preser3ation standards (AbHA, USEbA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOc (5 days at 20 degree C)	mg/L	-	2x0	205	≤20	Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part 5210 B, part D500 - O F	Bangkok
Oil . Frease	mg/L	-	9	18	≤20	6n-ho4se method : STM 0D-01D uased on Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part 5520 B	Bangkok
pH at 25 degree C		-	-	7x5	5x0-Gx0	6n-ho4se method : STM 0D-009 uased on Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part D500 - H (B)	Bangkok
Settleaule Solid I	mL/L/hr	-	0x1	7x0	≤0x5	Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part 25D0 &	Bangkok
S4lRde I	mg/L	-	0x5	<0x5	≤1	Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part D500-S2 (C, &)	Bangkok
Total c issol3ed Solids c ried at 109-105 degree C	mg/L	-	5	9G2	(1)	6n-ho4se method : STM 0D-010 uased on Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part 25D0 C	Bangkok
Total Kjeldahl Nitrogen as N I	mg/L	0x15	1x0	f f x7	≤95	Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part D500-Norg (C)	Bangkok
Total S4spended Solids c ried at 109-105 degree C	mg/L	-	5	2GD	≤90	Standard Methods Ror the E*amination oPWater and Wastewaterx AbHA, AWWA . WE&, 29rd edx, 2017, part 25D0 c	Bangkok

Res4lts apply to the sample(s) as s4umitted, 4nless the sampling was vond4vted uy ALSxNo part oPthis report may ue reprod4ved in any Rorm witho4t written vonsent Rom the lauoratoryx ALS Lauoratory Fro4p (Thailand) strongly revommends that this report is not reprod4ved e*vept in PIIx

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

78DI-101/ EMAGL S:\Reports_All_FLxpt (D:25bM)

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Number : 3037249-1

Sample Number	2463845-4
Sampled Date	Jun 10, 2024 11:20 AM
Sample Description	Consumption Water
Location	Spa Water Sample Srihapapata
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Number : 3037248-1

Sample Number	2463845-3
Sampled Date	Jun 10, 2024 11:10 AM
Sample Description	Consumption Water
Location	Shower Water Sample : Guest room 2101
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Approved by [redacted]

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand I PHONE +66 0 2760 3000 I FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company
Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER
7641-101/ EMAIL S:\Reports_All_GL.rpt (4:00PM)

ม.15/19

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Num-er : 30372518l

Sample Number	24f 36458f
Sampled Date	Jun 10, 2024 11:30 AM
Sample Description	Consumption Water
Location	wnderground Tank
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in tGo plastic -ottles, sample containers comply to pretreatment 8preservation standards (AbHA, wSUbAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp)	CIw/L	8	8	Not DetectedFF	Not Detected	.SO 11731 (2017E	Bangkok

Guideline : NotiRcation oPDepartment oPHealth a-out Legionella Control in Cooling ToGer B)U) 2544

Note : FF Not Detected mean Bacteria not Round in agar plate)

Sampling By : bichai Boonyong

Remark :
- LOD : Limit oPDetection
- Q Q : LoGer than LO* (Limit oP*uantitationE/ LOR (Limit oPReportingE

Approved by [redacted]

Results apply to the sample(sEas su-mitted, unless the sampling Gas conducted -y ALS) No part oPthis report may -e reproduced in any Rorm Githout Gritten consent Rom the la-oratory) ALS La-oratory <roup (ThailandEstrongly recommends that this report is not reproduced except in Rull)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 [illegible] 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

9.15/20

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Num-er : 30372508l

bage 1 oP1

Sample Number	24f 364585
Sampled Date	Jun 10, 2024 11:05 AM
Sample Description	Consumption Water
Location	Cooling Tower Water Sample
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in two plastic -ottles, sample containers comply to pretreatment 8preservation standards GAb(A, HSUbAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp)	CIH/L	8	8	Not DetectedFF	Not Detected	.SO 11731 G2017E	Bangkok

Guideline : NotiRcation oPDepartment oP(ealth a-out Legionella Control in Cooling Tower B)U) 2544

Note : FF Not Detected mean Bacteria not Round in agar plate)

Sampling By : bichai Boonyong

Remark :
- LOD : Limit oPDetection
- Q Q : Lower than LO* GLimit oP*uantitationE/ LOR GLimit oPReportingE

Approved by [redacted]

Results apply to the sampleGEas su-mitted, unless the sampling was conducted -y ALS) No part oPthis report may -e reproduced in any Rorm without written consent Rom the la-oratory) ALS La-oratory <roup GThailandEstrongly recommends that this report is not reproduced except in Rull)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

7f 418101/ UMA-L S:\Reports_All_<L)rpt G4:00bME

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Number : 3037253-1

Sample Number	2463845-8
Sampled Date	Jun 10, 2024 11:15 AM
Sample Description	Consumption Water
Location	Kitchen ชั้น 25
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp.	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544

Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Num-er : 30372528l

Sample Number	24f 364587
Sampled Date	Jun 10, 2024 11:00 AM
Sample Description	Consumption Water
Location	RooPTank
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in two plastic -ottles, sample containers comply to pretreatment 8preservation standards GAb(A, HSUbAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
Legionella spp)	CI H/L	8	8	Not DetectedFF	Not Detected	.SO 11731 G2017E	Bangkok

Guideline : NotiRcation oPDepartment oP(ealth a-out Legionella Control in Cooling Tower B)U) 2544

Note : FF Not Detected mean Bacteria not Round in agar plate)

Sampling By : bichai Boonyong

Remark :
- LOD : Limit oPDetection
- Q Q : Lower than LO* GLimit oP* uantitationE/ LOR GLimit oPReportingE

Results apply to the sampleGEas su-mitted, unless the sampling was conducted -y ALS) No part oPthis report may -e reproduced in any Rorm without written consent Rom the la-oratory) ALS La-oratory <roup GThailandEstrongly recommends that this report is not reproduced except in Rull)

Approved by [redacted]

Analysis / Test Report

TESTING
No.0009

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
c ate ReveiFed :J4n 10, 202D
c ate Reported :J4n 2b, 202D
Report N4m6er :909b25571

Sample Number	2DP9f D5710
Sampled Date	J4n 10, 202D 11:10 A3
Sample Description	Cons4mption 8 ater
Location	ShoMer 8 ater Sample NoW2101
Date Analysis Commenced	J4n 11, 202D
Condition of Sample	Contained in one plastiv 6ottle, sample vontainers vomply to pretreatment 7 preserFation standards wA-(A, HSU-AE

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Usvherivhia voli	in 100 mL	7	7	Not c etevted	Standard 3 ethods uor the U)amination ou 8 ater and 8 asteMaterWA-(A, A8 8 A x 8 U., 29rd edW201b, part 8221 .	Bangkok

Sampling By : -ivhai Boonyong

Remark :
- LOc : Limit ouc etevtion
- *Q* : LoMer than LO< wLimit ou<4antitationE/ LOR wLimit ouReportingE
- AnalytevsE marked " is/are not invl4ded in svope ouAvvreditation ISO/IUC 1b025W
- The la6oratory has 6een avvepted as an avvredited la6oratory vomplying Mith the ISO/IUC 1b025W

Res4lts apply to the sampleveEas s46mitted, 4nless the sampling Mas vond4vted 6y ALSWNo part outhis report may 6e reprod4ved in any uorm Mitho4t Mritten vonsent urom the la6oratoryWALS La6oratory Gro4p vThailandEstrongly revommends that this report is not reprod4ved e)vept in uIIINV

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company
Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

v.15/22

Analysis / Test Report

Accreditation No. 1031/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received :Jun 10, 2024
Date Reported :Jun 27, 2024
Report Number :3037254-1

Sample Number	2463845-9
Sampled Date	Jun 10, 2024 11:05 AM
Sample Description	Consumption Water
Location	Cooling Tower Water Sample
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company
Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received :Jun 10, 2024
Date Reported :Jun 27, 2024
Report Number :3037257-1

Sample Number	2463845-12
Sampled Date	Jun 10, 2024 11:25 A9
Sample Description	Consumption Mater
Location	Pool
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards WAPwA, (SHPAU

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Hscherichia coli	in 100 mL	-	-	Not Detected	Standard 9 ethods for the HEamination of Mater and Maste) aterx APwA, AMMA . MH8, 23rd edx, 2017, part F221 B, &	Bangkok

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lo) er than LOQ Wimit of QuantitationU/ LOR Wimit of ReportingU
- AnalyteWUmarked * is/are not included in scope of Accreditation ISO/IHC 17025x
- The laboratory has been accepted as an accredited laboratory complying) ith the ISO/IHC 17025x

Results apply to the sampleWUas submitted, unless the sampling) as conducted by ALSxNo part of this report may be reproduced in any form) ithout) ritten consent from the laboratoryx ALS Laboratory Group WhailandUstrongly recommends that this report is not reproduced eEcept in fullx

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

v.15/23

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received :Jun 10, 2024
Date Reported :Jun 27, 2024
Report NumPer :303725-b1

Sample Number	24-3845b11
Sampled Date	Jun 10, 2024 11:20 A9
Sample Description	Consumption Mater
Location	Spa Mater Sample
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in one plastic Pottle, sample containers comply to pretreatment b preservation standards WAf wA, (SHf AU

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Hscherichia coli	in 100 mL	b	b	Not Detected	Standard 9 ethods 6or the HEamination o6 Mater and Maste) aterx Af wA, AMMA . MH8, 23rd edx, 2017, part F221 &	Bangkok

Sampling By : f ichai Boonyong

Remark :
- LOD : Limit o6Detection
- "<" : Lo) er than LOQ Wimit o6QuantitationU/ LOR Wimit o6ReportingU
- AnalyteWUmarked * is/are not included in scope o6Accreditation ISO/IHC 17025x
- The laPoratory has Peen accepted as an accredited laPoratory complying) ith the ISO/IHC 17025x

Results apply to the sampleWUas suPmitted, unless the sampling) as conducted Py ALSxNo part o6this report may Pe reproduced in any 6orm) ithout) ritten consent 6rom the laPoratoryx ALS LaPoratory Group WhailandUstrongly recommends that this report is not reproduced eEcept in 6ullx

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : สัญญาจ้าง
Project Name :
Project Location :

Lot ID: 2463845
Date Received : Jun 10, 2024
Date Reported : Jun 27, 2024
Report Number : 3037258-1

Sample Number	2463845-13
Sampled Date	Jun 10, 2024 11:15 AM
Sample Description	Consumption Water
Location	Kitchen ชั้น 25
Date Analysis Commenced	Jun 11, 2024
Condition of Sample	Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
Escherichia coli	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 23rd ed., 2017, part 9221 F	Bangkok

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- The laboratory has been accepted as an accredited laboratory complying with the ISO/IEC 17025.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. No part of this report may be reproduced in any form without written consent from the laboratory. ALS Laboratory Group (Thailand) strongly recommends that this report is not reproduced except in full.

Approved by [redacted]

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

น.15/24