


Blast Proposal Design From Customer							
Location:	Sila Mitchaen	Shot Type to be fired:	Production and Development				
Actual Blasting Date:	07/02/2025	Shot Material Type:	Electric Detonator				
Name Engineer	Somyot	Name Operator	Thanasak				
Drill and Blast Design Parameters							
Primary Blast Hole - Design							
Drilling Requirements		Unit	Quantity	Charging Requirements		Unit	Quantity
Drill Hole Diameter		mm.	102	Primer Type			Emulsion
Estimated Number of Hole		hole	58	Total Blasting Agent for Blast		kg	58
Burden		m.	4.0	Explosive Type/Blend Name			Bulk Emulsion
Spacing		m.	5.0	Explosive Product SG		g/cc	1.15
Bench Height		m.	10.3	Explosive Charge Per hole		kg/hole	84.82
Subdrill		m.	0.5	Total Bulk emulsion for Blast		kg	4,861.56
Shot Volume		BCM	11,948.0	Total Explosive for Blast		kg	4,919.56
Total Hole Depth		m	10.8	Electric Cap			
		Ton	29,870.0				
Total High Explosive		%	1.18				
Explosive Factor (PF)		kg/bcm	0.412	Stemming Length		m.	3.00
Design Powder Factor		G/T	164.70	Stemming Material Type			Cutting
BlastReport From TKPV							
Drill and Blast Actual Parameters							
Primary Blast Hole - Actual							
Drilling Requirements		Unit	Quantity	Charging Requirements		Unit	Quantity
Drill Hole Diameter		mm.	102	Primer Type			Emulsion
Actual Number of Hole		hole	58	Total Blasting Agent for Blast		kg	116
Burden		m.	4.0	Explosive Type/Blend Name			Bulk Emulsion
Spacing		m.	5.0	Explosive Product SG		g/cc	1.15
Bench Height		m.	10.3	Explosive Charge Per hole		kg/hole	82.00
Subdrill		m.	0.5	Total Bulk emulsion for Blast		kg	4,640.00
Shot Volume		BCM	11,948.0	Total Explosive for Blast		kg	4,756.00
Total Hole Depth		m.	10.8	Electric Cap		#1,2,3,4,5	5,5,6,6,6
		Ton	29,870.0			#6,7,8,9,10	6,6,6,6,6
HE 55 x 350 mm.		Pcs.	116	Stemming Length		m.	3.00
HE>Total Explosive		%	2.44	Stemming Material Type			Cutting
Actual Explosive Factor (PF)		kg/bcm	0.398	Total Cost		THB/Ton	6.25
Actual Powder Factor		G/T	160.00				
Total Cost		THB/bcm	45.63				
Remark : มีสิทธิ์ 4%							

Remark : มีรูโพรง 4%

Blast Report

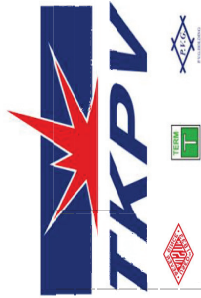

Your Partner with Total Blasting Solutions



Please contact us:
TKPV COMPANY LIMITED
 100/100 Moo 1, Tambon Thungyai,
 Truwanthana, Bangkok, Thailand 10170
 Tel : +662 8850391
 Email : enq@tkpv.com
 Bangkok Kinok Sdn. (Ptd)
 47400 Pansing Jaya
 Tel : +603 7729 2464
 Fax : +603 7729 2464
 Email : kkv@tkpv.com

เรียน

ผู้จัดการ

มดก.โรงโม่หินสีลาไม้เจริญ

คุณ

[illegible]

Electricity	No. 0 =	PCS.	
No. 1 =	5	PCS. No. 6 =	6
No. 2 =	7	PCS. No. 7 =	6
No. 3 =	7	PCS. No. 8 =	6
No. 4 =	6	PCS. No. 9 =	6
No. 5 =	6	PCS. No. 10 =	6
Total		78	
HE	17350	mm.	176
HE	-	mm.	-
Booster	-	mm.	-
			PCS.

Neat	25400	mm.	-
	25500	mm.	-
	42400	mm.	-
	17350	mm.	-
	500	mm.	-
	100	mm.	-
	67	mm.	-
	4	mm.	-
	No. 8	-	-
Total		mm.	-
Booster	-	mm.	-
Safety Fuse	-	mm.	-
			PCS.

Name TKPV Supervisor: 2022/1

Site Supervisor: 2022/1

Moisture:

[illegible]

แบบตรวจสอบผลการปฏิบัติงาน



แบบตรวจสอบผลการปฏิบัติงาน

ประจำวันที่ 7 February 2025

ทะเบียนรถ 86-8118 สป. สถานที่ Sila Micharoen (U Thong) Crushing Plant Co., Ltd.

TKPV : _____

ชื่อ..... จิตกรรณกุล

พนักงานควบคุม

พนักงานประจำรถ

แบบประเมินผลการปฏิบัติงาน (สำหรับลูกค้า)

ลำดับ	หัวข้อ	ดี	ไม่ดี	หมายเหตุ
1	การประสานงานกับทีมงาน	✓		
2	การส่งมอบงานในการปฏิบัติงาน	✓		
3	ความเข้าใจและควบคุมดูแลในการปฏิบัติงาน	✓		
4	คุณภาพและความถูกต้องในการปฏิบัติงาน	✓		
5	มีการติดต่อและแก้ปัญหาคำถามของทีมงาน	✓		
6	การให้บริการแก่ทีมงาน	✓		
7	การปฏิบัติตามขั้นตอน Stemming	✓		
8	การดูแลความสะอาดในพื้นที่ปฏิบัติงาน	✓		
9	การติดตามผลการปฏิบัติงาน	✓		
10	การกำหนดเขตปฏิบัติงาน	✓		

ผู้ประเมิน

ลงชื่อ.....ลูกค้า

(.....)

การลงนามอนุมัติการดำเนินงานอิสระเปิด



การอนุมัติการดำเนินงานอิสระเปิด

Customer Authorisation Approval

วันที่: 7 February 2025

สถานที่: Sila Micharoen (U Thong) Crushing Plant Co., Ltd.

ชื่อผู้ปฏิบัติงาน: จิตกรรณกุล

ชื่อผู้ควบคุม: 86-8118 สป.

ทะเบียนรถ: 86-8118 สป.

เลขที่เอกสาร: 458743

การอนุมัติการดำเนินงานอิสระเปิด

1. สภาพพื้นที่ปฏิบัติงานเหมาะสม

2. แผนผังพื้นที่ปฏิบัติงาน ครบถ้วน

3. ไม่มีสิ่งกีดขวางหรือสิ่งกีดขวางอื่น ๆ

ปัญหา/ข้อสงสัย/ข้อควรระวัง:

ลายเซ็น: TKPV Supervisor ลูกค้า/Customer

การอนุมัติการดำเนินงานอิสระเปิด

4. การเตรียมพื้นที่ปฏิบัติงาน

5. ระยะเวลาในการปฏิบัติงาน

6. การตรวจสอบและควบคุม

รายงานการปฏิบัติงาน: 58743

ผลการประเมิน: 00000000

ปัญหา/ข้อสงสัย/ข้อควรระวัง:

ลายเซ็น: TKPV Supervisor ลูกค้า/Customer