

OF THE YEAR 2024

[illegible]

เดือนมกราคม 2567

Engineering Department

Change air conditioning's fan motor: Room no. 4010,4011,4025 and 5009



Engineering Department

Lift up and clean aerator pump No.1 of waste water treatment system



เดือนกุมภาพันธ์ 2567

Engineering Department

Maintenance & clean condensing unit of VRV air system 5 sets



Engineering Department

Change air conditioning's fan motor in guest room no. 5003 and 6018



เดือนมีนาคม 2567

Engineering Department

Clean air condition's Condensing unit on rooftop of guest room, total 153 Sets



Engineering Department



Engineering Department

Maintenance & clean air conditioning VRV System

Fan coil unit 25 sets / Condensing unit 5 sets

By Mahajak Company

การตรวจเช็คและทำความสะอาด Condensing Unit (CDU) และ Fan Coil Unit (FCU) ของยี่ห้อ Mitsubishi ในพื้นที่ อาคาร (โรงแรม) เมื่อวันที่ **วันที่ 27.28/03/2024 (ครึ่งปี/2024)**

Date	No.	ITEM	CDU / FCU	Model	Serial No.	ขนาด BTU.	สถานที่ติดตั้ง	FLOOR.	หมายเหตุ
28-Mar-24	1	1	CDU B1,B2/1	FDK560KE6	U562003603F	172,000	CDU Room	1	OK
27-Mar-24	2	1.1	FCU B1/1	FDK22KE6	B56002039GK	7,500	Server Room	B1	OK
27-Mar-24	3	1.2	FCU B1/2	FDK56KE6	B56002023GK	19,100	สาขาโอดี Office	B1	OK
27-Mar-24	4	1.3	FCU B1/3	FDK56KE6	U718011465K	19,100	CCTV Room	B1	OK
27-Mar-24	5	1.4	FCU B1/4	FDK71KE6	U718011485K	24,200	HK Office	B1	OK
27-Mar-24	6	1.5	FCU B1/5	FDK71KE6	U718011455K	24,200	Finance Office	B1	OK
27-Mar-24	7	1.6	FCU B1/6	FDK71KE6	U718011375K	24,200	Finance Office	B1	OK
27-Mar-24	8	1.7	FCU B1/7	FDK71KE6	U718011515K	24,200	Centean	B1	OK
27-Mar-24	9	1.10	FCU B2/3	FDK22KE6	U228059725K	7,500	PABX Room	B2	OK
27-Mar-24	10	1.11	FCU B2/4	FDK22KE6	U228059665K	7,500	EN Office	B2	OK
27-Mar-24	11	1.12	FCU B2/5	FDK36KE6	U360002565K	12,300	EN Chief Office	B2	OK
28-Mar-24	12	2	CDU 1/1	FDK560KE6	U562003273F	385,600	CDU Room	1	OK
27-Mar-24	13	2.1	FCU 1/1	FDUM56KE6	D56102618MK	19,100	Front Office	1	OK
27-Mar-24	14	2.2	FCU 1/3	FDU280KE6	-	99,500	Lobby	1	OK
27-Mar-24	15	2.3	FCU 1/4	FDU280KE6	-	99,500	Lobby	1	OK
27-Mar-24	16	2.4	FCU 1/7	FDU224KE6	B22100818MK	76,400	ร้านขายอาหารโอดี	1	OK
27-Mar-24	17	2.5	FCU 1/8	FDU224KE6	B22100826MK	76,400	ร้านขายอาหารโอดี	1	OK
27-Mar-24	18	2.6	FCU -K-1	FDU280KE6	-	99,500	Kitchen	1	OK
28-Mar-24	19	3	CDU 2/2	FDK560KE6	240000312UF	232,000	CDU Room	1	OK
28-Mar-24	20	3.1	FCU 2/1	FDUM112KE6	911200051PK	38,200	Executive Office	2	OK
28-Mar-24	21	3.2	FCU 2/2	FDUM56KE6	D56102618MK	19,100	@- Biz Room	2	OK
28-Mar-24	22	3.3	FCU 2/5	FDUM90KE6	990200552PK	30,700	Store Function Room	2	OK
28-Mar-24	23	3.4	FCU 2/6	FDUM90KE6	990200M45PK	30,700	Forgey Function Room	2	OK
28-Mar-24	24	3.5	FCU 2/7	FDUM90KE6	990200759PK	30,700	Forgey Function Room	2	OK
28-Mar-24	25	3.6	FCU 2/8	FDUM71KE6	D719001915K	24,200	VICTORY 1	2	OK
28-Mar-24	26	3.7	FCU 2/9	FDUM71KE6	PD002A301G	24,200	VICTORY 2	2	OK
28-Mar-24	27	3.8	FCU 2/10	FDUM112KE6	911200049PK	38,200	VICTORY 1	2	OK
28-Mar-24	28	3.9	FCU 2/11	FDUM112KE6	911200050PK	38,200	VICTORY 2	2	OK
28-Mar-24	29	4	CDU 2/3	FDU680KE6	268200014HF	136,500	AHU Room	2	OK

Engineering Department

Fix air conditioning in guest room no. 5002 and 8037
changed air conditioning's compressor



Engineering Department

Lift up and clean aerator pump no.1 of waste water treatment system

Before



After



Engineering Department

Clean B2 car parking floor



เดือนเมษายน 2567

Engineering Department

Change air conditioning's fan motor in guest room no. 4003 and 8003



Engineering Department

Repair refrigerant leakage from heat pump system no.1 (compressor 1)



เดือนพฤษภาคม 2567

Engineering Department

Change air conditioning's fan motor in guest room no. 4014,5020 and 5021



Engineering Department

Fix air conditioning in guest room no. 5020,5035 and 6001
changed air conditioning's compressor



Engineering Department

Install new signal cable of CCTV at 4th floor corridor

Before




After



Engineering Department

Change new the Head end amplifier of TV signal
due to Head end amplifier is damaged .

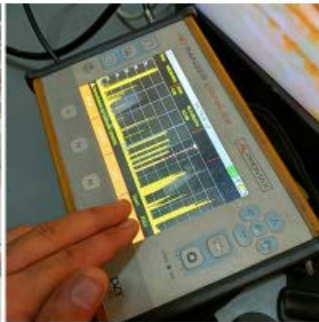

Engineering Department

Replace new parts for Auto door lobby
(Replace new the track, wheels and, belt.

