

ภาคผนวก

ภาคผนวกที่	1	มาตรการป้องกันและลดผลกระทบสิ่งแวดล้อม
ภาคผนวกที่	2	ผลการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม
ภาคผนวกที่	3	เอกสารการขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน
ภาคผนวกที่	4	เอกสารสอบเทียบอุปกรณ์เครื่องมือห้องปฏิบัติการ
ภาคผนวกที่	5	แผนฉุกเฉิน
ภาคผนวกที่	6	แบบบันทึกการตรวจสอบถังดับเพลิง
ภาคผนวกที่	7	แบบบันทึกการตรวจสอบไฟฉุกเฉิน
ภาคผนวกที่	8	แบบบันทึกการตรวจสอบ fire alarm
ภาคผนวกที่	9	แบบบันทึกการตรวจสอบ Fire exit sign / emergency light unit
ภาคผนวกที่	10	ภาพประกอบทำความสะอาดเครื่องปรับอากาศ

ภาคผนวกที่ 1

มาตรการติดตามตรวจสอบและลดผลกระทบสิ่งแวดล้อม
(ระยะดำเนินการ)

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ

องค์ประกอบทางสิ่งแวดล้อม และคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม
1. ทรัพยากรกายภาพ 1.1 ลักษณะภูมิประเทศ	- เมื่อเปิดดำเนินการ สภาพภูมิประเทศของพื้นที่จะเปลี่ยนจากเดิมที่มีลักษณะเป็นที่ราบ ไปเป็นพื้นที่ราบลึกระดับพื้นดินเดิม 2.4 เมตร ที่มีอาคารชุด 5 ชั้น ดาดฟ้า (มีชั้นใต้ดิน) จำนวน 1 อาคาร และพื้นที่สีเขียว โครงการประกอบกิจการเพื่อการอยู่อาศัย ซึ่งสอดคล้องกับการประกอบกิจการโดยรอบ	- จัดพื้นที่ว่างกว่าร้อยละ 40.78 ของพื้นที่โครงการ - รักษาภูมิประเทศเดิมไว้ให้มากที่สุด	-
1.2 การชะล้างพังทลายของดิน	- ในระยะดำเนินการ สภาพทั่วไปของพื้นที่เป็นที่ราบลึกระดับจากพื้นดินเดิม 2.4 เมตร ที่มีอาคารชุด และพื้นที่สีเขียว	- จัดให้มีพื้นที่สีเขียวที่มีพืชคลุมดินกว่าร้อยละ 38.84 ของพื้นที่ที่ช่วยสร้างร่มรื่นและดูดซับน้ำฝน	-
1.3 คุณภาพอากาศ	- โครงการเป็นอาคารชุดสำหรับพักอาศัยและเพื่อการพักผ่อน ผลกระทบที่เกิดขึ้นเกี่ยวกับคุณภาพอากาศ มีสาเหตุมาจากยานพาหนะเป็นสำคัญ โดยปัญหาจากยานพาหนะที่มีต่อคุณภาพอากาศที่ระบายก๊าซคาร์บอนไดออกไซด์	- จัดให้มีการปลูกไม้ยืนต้น 145 ตารางเมตร ประมาณ 29 ต้น - จัดให้มีพื้นที่สีเขียวที่มีพืชคลุมดินกว่าร้อยละ 38.84 ของพื้นที่โครงการ	-
1.4 เสียงและความสั่นสะเทือน	- เนื่องจากโครงการมีลักษณะอาคารชุดพักอาศัย จึงไม่มีแหล่งกำเนิดเสียงและความสั่นสะเทือนที่สำคัญที่จะทำให้เกิดผลกระทบในระยะดำเนินการ	-	-
2. ทรัพยากรชีวภาพ 2.1 ทรัพยากรชีวภาพบนบก	- การดำเนินการอยู่ภายในพื้นที่โครงการเท่านั้น จึงไม่มีกิจกรรมใดๆ ที่มีผลกระทบต่อทรัพยากรชีวภาพบนบกในระยะดำเนินการ	- ควบคุมให้กิจกรรมต่างๆ อยู่ในโครงการเท่านั้น	-
2.2 ทรัพยากรชีวภาพในน้ำ	- ไม่มีการปล่อยน้ำเสียและน้ำฝนลงสู่แหล่งน้ำธรรมชาติซึ่งเป็นที่อยู่อาศัยของสัตว์น้ำ	- บำบัดน้ำเสียให้ได้ตามมาตรฐาน ลงสู่บ่อตรวจสอบคุณภาพน้ำโครงการ ก่อนออกสู่ทางระบายน้ำสาธารณะต่อไป	-
3. คุณค่าการใช้ประโยชน์ของมนุษย์ 3.1 การใช้ที่ดิน			
3.1.1 รูปแบบการใช้ที่ดิน	- โครงการเป็นอาคารชุดพักอาศัย จึงสอดคล้องกับการใช้ประโยชน์ที่ดินโดยรอบที่ส่วนใหญ่เป็นที่อยู่อาศัย การท่องเที่ยว และพาณิชยกรรม	-	-

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อม และคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม
3.1.2 ข้อกำหนดผังเมืองรวม เกาะภูเก็ต	- พื้นที่บริเวณโครงการตั้งอยู่ในพื้นที่ตามกฎกระทรวงผังเมืองรวมเกาะภูเก็ต ออกตามความในพระราชบัญญัติการผังเมือง พ.ศ. 2518 ซึ่งได้กำหนดที่ดินบริเวณโครงการเป็นที่ดินประเภทที่อยู่อาศัย (สีส้ม) บริเวณหมายเลข 2.26 (รูปที่ 3-1 และภาคผนวก ง) ซึ่งมีข้อกำหนดในสาระสำคัญ คือ ให้ใช้ประโยชน์ที่ดินเพื่อการอยู่อาศัย การท่องเที่ยว สถาบันราชการ การสาธารณูปโภค และสาธารณูปการ เป็นส่วนใหญ่ สำหรับการใช้ประโยชน์เพื่อกิจการอื่นให้ใช้ได้ไม่เกินร้อยละ 50 ของแปลงที่ดินที่ยื่นขออนุญาต ที่ดินประเภทนี้ ห้ามใช้ประโยชน์เพื่อกิจการตามที่กำหนด ดังต่อไปนี้ 1) โรงงานทุกจำพวกตามกฎหมายว่าด้วยโรงงาน 2) สถานที่บรรจุก๊าซและสถานที่เก็บก๊าซตามกฎหมายว่าด้วยการบรรจุก๊าซปิโตรเลียมเหลว 3) สถานที่ที่ใช้ในการเก็บน้ำมันเชื้อเพลิงตามกฎหมายว่าด้วยการควบคุมน้ำมันเชื้อเพลิง 4) เลี้ยงม้า โค กระบือ สุกร แพะ แกะ ห่าน เป็ด ไก่ ภู จระเข้ หรือสัตว์ป่าตามกฎหมายว่าด้วยการสงวนและคุ้มครองสัตว์ป่าเพื่อการค้า 5) สุสานและฌาปนสถานตามกฎหมายว่าด้วยสุสานและฌาปนสถาน 6) โรงฆ่าสัตว์ 7) ไซโลเก็บผลิตผลทางการเกษตร 8) กำจัดมูลฝอย 9) ซั้วขายเศษวัสดุ - เมื่อพิจารณาตามข้อกำหนดตามกฎหมายกระทรวงฯ ดังกล่าว พบว่าโครงการมีการใช้ประโยชน์ที่ดินเพื่อการอยู่อาศัย มีพื้นที่ว่างร้อยละ 40.78 ของพื้นที่โครงการ และการใช้ประโยชน์ที่ดินของโครงการไม่ได้อยู่ในข้อห้ามการใช้ประโยชน์ที่ดินตามที่กฎหมายกำหนด ดังนั้น การใช้ประโยชน์ที่ดินของโครงการจึงสอดคล้องกับการใช้ประโยชน์ที่ดินตามที่กำหนดไว้	-	-
3.1.3 เขตพื้นที่และมาตรการคุ้มครองสิ่งแวดล้อม	- พื้นที่โครงการตั้งอยู่ในบริเวณที่ 3 มีมาตรการคุ้มครองสิ่งแวดล้อม คือ ให้มีได้เฉพาะอาคารที่มีความสูงไม่เกิน 16 เมตร และต้องมี (ก) ที่ว่างอันปราศจากสิ่งปกคลุมของอาคารไม่น้อยกว่าร้อยละ 30 ของพื้นที่ดินที่ขออนุญาตก่อสร้างอาคารนั้น สำหรับอาคารที่พักอาศัย (ข) ที่ว่างอันปราศจากสิ่งปกคลุมไม่น้อยกว่าร้อยละ 10 สำหรับอาคารพาณิชย์หรืออาคารอื่น เว้นแต่อาคารและที่ว่างอันปราศจากสิ่งปกคลุมของอาคารที่อยู่ในเขตงานก่อสร้างระบบกำจัดมูลฝอยแบบเดาเผาของเทศบาลเมืองภูเก็ต ให้เป็นไปตามที่เทศบาลเมืองภูเก็ต จังหวัดภูเก็ต กำหนด - โครงการประกอบด้วยอาคารชุด 5 ชั้น คาดฟ้า (มีชั้นใต้ดิน) จำนวน 1 อาคาร มีระดับความสูงจากพื้นดินถึงส่วนที่สูงที่สุดของอาคาร 16 เมตร มีที่ว่างอันปราศจากสิ่งปกคลุมร้อยละ 40.78 ดังนั้น การใช้ประโยชน์พื้นที่ของโครงการจึงสอดคล้องตามประกาศกระทรวงทรัพยากรธรรมชาติและสิ่งแวดล้อม ดังกล่าว	-	-

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อม และคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไข ผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบ ผลกระทบสิ่งแวดล้อม
3.1.4 กฎกระทรวงฉบับที่ 15 (พ.ศ.2529) ออกตามความ ในพระราชบัญญัติควบคุม อาคาร พ.ศ.2522	- จากการตรวจสอบพื้นที่ตามกฎหมายกระทรวงฉบับที่ 15 (พ.ศ.2529) ออกตามความในพระราชบัญญัติควบคุมอาคาร พ.ศ.2522 โดยเทศบาลเมืองปาดอง พบว่า พื้นที่โครงการตั้งอยู่ในบริเวณที่ 4 (รูปที่ 3-3 และภาคผนวก ง) - บริเวณที่ 4 หมายความว่า พื้นที่ในบริเวณระหว่างบริเวณที่ 2 กับบริเวณที่ 3 และพื้นที่ในบริเวณที่วัดจากสุดแนวเขตในบริเวณที่ 2 ไปทางทิศเหนือและทิศใต้ ตลอดแนวบริเวณที่ 3 กว้าง 150 เมตร เป็นบริเวณที่ห้ามมิให้บุคคลใดก่อสร้างอาคาร ดังต่อไปนี้ 1) อาคารที่ทางเข้าออกตั้งแต่ตัวอาคารถึงทางสาธารณะมีความกว้างน้อยกว่า 3.50 เมตร 2) โรงงานตามกฎหมายว่าด้วยโรงงาน 3) สถานที่เลี้ยงสัตว์ทุกชนิดที่มีพื้นที่ทุกชั้นในหลังเดียวกันหรือหลายหลังเกิน 10 ตารางเมตร 4) โรงซ่อม สร้าง หรือบริการรถยนต์ที่ขับเคลื่อนตัวด้วยเครื่องยนต์ทุกชนิด 5) สถานที่บรรจุก๊าซ สถานที่เก็บก๊าซ และสถานบริการตามกฎหมายว่าด้วยการบรรจุก๊าซปิโตรเลียมเหลว 6) สถานที่เก็บและจำหน่ายน้ำมันเชื้อเพลิงตามกฎหมายว่าด้วยการเก็บรักษาน้ำมันเชื้อเพลิง 7) ศาสนสถานและสถานศึกษา 8) อาคารที่สร้างด้วยวัสดุไม้ถาวรหรือไม่ทนไฟเป็นส่วนใหญ่ เว้นแต่เป็นอาคารประเภทบ้านเดี่ยวชั้นเดียวที่มีความสูงไม่เกิน 6 เมตร และต้องมีระยะห่างจากอาคารอื่นโดยรอบไม่น้อยกว่า 5 เมตร 9) สถานที่เก็บสินค้า อาคารหรือส่วนหนึ่งส่วนใดของอาคารที่มีลักษณะในทำนองเดียวกันที่ใช้เป็นที่เก็บ พัก หรือขนถ่ายสินค้าหรือสิ่งของเพื่อประโยชน์ทางการค้าหรืออุตสาหกรรม ที่มีพื้นที่ทุกชั้นในหลังเดียวกันหรือหลายหลังเกิน 200 ตารางเมตร 10) อาคารที่มีที่ว่างในที่ดินแปลงที่ก่อสร้างอาคารน้อยกว่าร้อยละ 30 ของที่ดินแปลงนั้น	-	-

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อม และคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบ ผลกระทบสิ่งแวดล้อม
3.2 การคมนาคมขนส่ง	- ปริมาณการจราจรเพิ่มขึ้นจากก่อนมีโครงการเพียงเล็กน้อย ถนนบางลำ มีสภาพการจราจรเบาบาง ผู้ขับขี่มีอิสระในการเลือกใช้ความเร็ว ดังนั้นผลกระทบที่เกิดขึ้นต่อการคมนาคมจึงอยู่ในระดับต่ำ	- ติดตั้งเครื่องหมายจราจรทางเข้าออกและที่จอดรถ - จัดเจ้าหน้าที่อำนวยความสะดวกบริเวณทางเข้าออกและที่จอดรถ - ห้ามจอดรถตรงทางเข้าออกโครงการและไหล่ทาง - จัดที่จอดรถยนต์ภายในพื้นที่โครงการจำนวน 24 คัน โดยขนาดพื้นที่จอดรถและจำนวนที่จอดรถยนต์ เป็นไปตามที่กฎหมายกำหนด	- การอำนวยความสะดวกในการเข้าออกโครงการ
3.3 การใช้น้ำ	- ปริมาณน้ำใช้ในโครงการคาดว่าจะประมาณ 34.56 ลูกบาศก์เมตร/วัน ปริมาณน้ำใช้ในชั่วโมงสูงสุดเท่ากับ 3.69 ลูกบาศก์เมตร/ชั่วโมง	- กักเก็บน้ำประปาในถังเก็บน้ำใต้ดินใต้ที่จอดรถ ขนาด 100 ลูกบาศก์เมตร จำนวน 1 ถัง ก่อนบ่มขึ้นไปยังถังเก็บน้ำคาดฟ้า จำนวน 6 ถัง ปริมาตรถังละ 4 ลูกบาศก์เมตร แล้วจึงแจกจ่ายไปยังแต่ละส่วนของอาคาร รวมปริมาตรกักเก็บน้ำของโครงการทั้งสิ้น 124 ลูกบาศก์เมตร ซึ่งน้ำส่วนนี้จะนำมาใช้เป็นน้ำสำรองสำหรับดับเพลิงด้วย - ประชาสัมพันธ์ให้ร่วมกันประหยัดน้ำ - ตรวจสอบการจ่ายน้ำและเส้นท่อให้อยู่ในสภาพดีอยู่เสมอ หากพบว่าชำรุดให้แก้ไขทันที - ใช้สุขภัณฑ์ในห้องน้ำประเภทประหยัดน้ำ	- ตรวจสอบการจ่ายน้ำและเส้นท่อให้อยู่ในสภาพดีอยู่เสมอ หากพบว่าชำรุดให้แก้ไขทันที
3.4 การระบายน้ำ	- การก่อสร้างโครงการไม่ได้กีดขวางการระบายน้ำของชุมชนแต่อย่างใด ชุมชนยังคงระบายน้ำได้ตามปกติ	- น้ำเสียที่ผ่านการบำบัดจนได้มาตรฐานแล้วจะปล่อยสูบ่อพักน้ำซึ่งมีเครื่องสูบน้ำทั้ง (Submersible Sump Pump) ติดตั้งอยู่ เครื่องสูบน้ำจะบิมน้ำออกสูบ่อพักน้ำชั้นที่ 1 ก่อนระบายออกสู่ท่อระบายน้ำตามแนวซอยไวคิงและออกสู่ท่อระบายน้ำสาธารณะและเข้าสู่ระบบบำบัดน้ำเสียรวมของเทศบาลปาดองต่อไป - ส่วนน้ำฝนจากชั้นคาดฟ้าและชั้นอื่น ๆ จะถูกรวบรวมลงสูบ่อพักน้ำชั้นที่ 1 ก่อนระบายออกสู่ท่อระบายน้ำตามแนวซอยไวคิงและออกสู่ท่อระบายน้ำสาธารณะเช่นกัน	- ตรวจสอบท่อระบายน้ำของโครงการเป็นประจำทุก 6 เดือน

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อมและคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม
3.5 การจัดการน้ำเสีย	- น้ำเสียเกิดขึ้นประมาณ 34.56 ลูกบาศก์เมตร/วัน (คิดจากน้ำเสียร้อยละ 100 ของปริมาณน้ำใช้) และอาจก่อให้เกิดผลกระทบต่อแหล่งน้ำใกล้เคียงได้ หากไม่มีการบำบัดก่อนปล่อยออกสู่แหล่งรับน้ำภายนอก	- จัดให้มีถังบำบัดน้ำเสีย HICLEAR รุ่น BIC-40DC จำนวน 1 ชุด ระบบดังกล่าวเป็นระบบบำบัดน้ำเสียชนิดผสมระหว่างระบบเกรอะ-กรองไร้อากาศและเติมอากาศผ่านผิวดักกลาง - น้ำเสียที่ผ่านการบำบัดแล้ว (ค่า BODออก 20 มิลลิกรัม/ลิตร) - ตรวจสอบสภาพการทำงานของระบบบำบัด หากส่วนใดเสียหายต้องรีบแก้ไขทันที - สูบตะกอนไปกำจัด ทุก 2 ปี	- เก็บตัวอย่างน้ำหลังการบำบัดน้ำเสียรวมของโครงการ ตามวิธีการวิเคราะห์ของ Standard Methods หรือตามคู่มือวิเคราะห์น้ำเสียของสมาคมวิศวกรรมสิ่งแวดล้อมแห่งประเทศไทย
3.6 การจัดการมูลฝอย	- ขยะมูลฝอยที่เกิดขึ้นจากโครงการเป็นขยะชุมชนทั่วไป ได้แก่ ถุงพลาสติก เศษอาหาร เศษกระดาษและเศษผ้า โดยคาดว่าจะปริมาณขยะที่เกิดขึ้นจากโครงการประมาณ 366 ลิตร/วัน	- โครงการจะจัดให้มีถังขยะขนาด 50 ลิตร จำนวน 2 ถัง แยกเป็นขยะเปียก และขยะแห้ง ไว้บริเวณโถงบันไดของอาคารทุกชั้น สำหรับภายในห้องพักทุกห้องจัดให้มีถังขยะขนาด 15 ลิตร จำนวน 2 ถัง แยกเป็นขยะเปียกและขยะแห้ง ส่วนห้องน้ำรวมจะจัดถังขยะขนาด 10 ลิตร จำนวน 1 ถัง/ห้อง - ขยะที่รีไซเคิลได้จะขายให้แก่ร้านรับซื้อของเก่า - จุดที่พักขยะรวมของโครงการตั้งอยู่ด้านข้างอาคาร ซึ่งประกอบด้วยถังขยะขนาด 240 ลิตร จำนวน 6 ถัง แยกเป็นขยะเปียก 3 ถัง และขยะแห้ง 3 ถัง รวมปริมาตรกักเก็บ 1,440 ลิตร รองรับขยะได้นานประมาณ 3 วัน - สำหรับน้ำชะขยะ จะถูกรวบรวมเข้าสู่ระบบบำบัดน้ำเสียรวมต่อไป - โครงการจะขอรับความอนุเคราะห์จากเทศบาลเมืองปาดอง ให้เข้ามาเก็บขนทุกวัน	- ตรวจสอบความสามารถในการรองรับของถังขยะ การรื้อซึมของถังขยะ - ตรวจสอบปริมาณมูลฝอยตกค้าง
3.7 การระบายอากาศ	- สำหรับความร้อนหรืออุณหภูมิที่สูงขึ้นจากกิจกรรมการดำเนินโครงการนั้น จะเป็นความร้อนที่เกิดขึ้นจากระบบปรับอากาศ	- ปลุกต้นไม้ยืนต้น และพืชคลุมดินให้มากที่สุด บริเวณภายนอกอาคาร ซึ่งจะช่วยลดความร้อนที่จะเข้ามาในอาคาร นอกจากนี้ การปลุกต้นไม้จะช่วยลดแสงจ้า (Glare) ได้ โดยรวมของอาคารจากทั้งทางพื้นโดยใช้พืชคลุมดิน และจากท้องฟ้าโดยใช้ไม้ยืนต้น ซึ่งโครงการพิจารณาการจัด Landscape เพื่อช่วยลดความร้อนที่จะเข้ามาสู่อาคาร	-
3.8 ไฟฟ้า	- จะรับบริการไฟฟ้าจากการไฟฟ้าส่วนภูมิภาค ซึ่งมีความสามารถในการรองรับการใช้ไฟฟ้าที่เพิ่มขึ้น ดังนั้นจึงไม่มีผลกระทบด้านนี้	- ติดตั้งหม้อแปลงก่อนจ่ายไฟฟ้าไปยังแต่ละส่วนของโครงการ - เลือกใช้อุปกรณ์ไฟฟ้าต่างๆ ที่เป็นชนิดประหยัดพลังงาน	-

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อม และคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม
4. คุณภาพชีวิต 4.1 สังคมและเศรษฐกิจ	- การจ้างงานพนักงานจะส่งผลกระทบด้านบวกต่ออาชีพและรายได้ของคนในท้องถิ่นเพียงเล็กน้อย เนื่องจากการจ้างงานพนักงานไม่มาก	- จ้างแรงงานในท้องถิ่นเป็นพนักงานเป็นอันดับแรก - ส่งเสริม สนับสนุน กิจกรรมทางสังคมต่างๆ ของท้องถิ่น เพื่อสร้างความสัมพันธ์อันดีกับชุมชน	-
4.2 ความคิดเห็นของประชาชน ต่อผลกระทบจากโครงการ	- ประชาชนมีความเห็นต่อระดับของผลกระทบต่างๆ โดยรวมในระดับมีปัญหาน้อย เมื่อพิจารณาทางด้านพบว่าทำให้ที่ดินบริเวณใกล้เคียงมีราคาสูงขึ้น เป็นผลกระทบที่มีคะแนนเฉลี่ยสูงสุด จัดอยู่ในระดับความคิดเห็นว่ามีผลกระทบน้อย รองลงไปได้แก่ ทำให้เกิดน้ำเสียมากขึ้น ทำให้ปริมาณขยะมากขึ้น และทำให้การค้าขายของร้านค้าปลีกและธุรกิจบริการต่างๆ ดีขึ้น จัดอยู่ในระดับความคิดเห็นว่ามีผลกระทบน้อย	- นำข้อมูลความคิดเห็นไปประกอบในการกำหนดมาตรการป้องกัน แก้ไข ผลกระทบจากโครงการ เพื่อให้การกำหนดมาตรการมีความสอดคล้องกับความคิดเห็นของประชาชนมากที่สุด	-
4.3 ความคิดเห็นของประชาชน ต่อระดับความสำคัญของมาตรการป้องกัน แก้ไขผลกระทบจากโครงการ	- ประชาชนมีความคิดเห็นต่อระดับความสำคัญของมาตรการต่างๆ โดยรวมอยู่ในระดับสำคัญมาก เมื่อพิจารณาทางด้านพบว่ามาตรการที่ต้องติดตั้งบำบัดน้ำเสียให้มีคุณภาพตามที่กฎหมายกำหนด เป็นมาตรการที่มีคะแนนเฉลี่ยสูงสุด จัดอยู่ในระดับความสำคัญมาก รองลงไปได้แก่ ใช้สุขภัณฑ์ในห้องน้ำห้องส้วมประเภทประหยัดน้ำ มาตรการต้องติดตั้งระบบป้องกันอัคคีภัยตามที่กฎหมายกำหนด และใช้อุปกรณ์ไฟฟ้าประเภทประหยัดไฟ จัดอยู่ในระดับความสำคัญระดับมากเช่นเดียวกัน	- นำข้อมูลความคิดเห็นไปรวมไว้ในตารางมาตรการป้องกัน แก้ไข ผลกระทบจากโครงการ เพื่อให้การกำหนดมาตรการมีความสอดคล้องกับความคิดเห็นของประชาชนมากที่สุด	-
4.4 อาชีวอนามัยและความปลอดภัย	- เนื่องจากโครงการเป็นอาคารชุดพักอาศัย ที่มีความเสี่ยงต่อการเกิดอันตรายหรืออุบัติเหตุต่างๆ อย่างไรก็ตามเพื่อให้เกิดความปลอดภัยกับผู้อยู่อาศัยและเป็นไปตามที่กฎหมายกำหนด	- ติดตั้งระบบป้องกันอัคคีภัยไว้ทุกชั้นของอาคาร (ตามหัวข้อ 4.5) - เตรียมความพร้อมด้านการประสานงานกับโรงพยาบาล - จัดยามรักษาความปลอดภัยไว้ตลอด 24 ชั่วโมง - สระว่ายน้ำในโครงการจะมีมาตรการดูแลเป็นระยะ ๆ เพื่อสุขอนามัยที่ดีของผู้ที่ใช้บริการ แสดงในภาคผนวก ญ	-

ตารางที่ 6-2 สรุปผลกระทบ มาตรการป้องกันและแก้ไขผลกระทบ และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่คาดว่าจะเกิดขึ้นจากโครงการ ในระยะดำเนินการ (ต่อ)

องค์ประกอบทางสิ่งแวดล้อมและคุณค่าต่าง ๆ	ผลกระทบต่อสิ่งแวดล้อมที่สำคัญ	มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม	มาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม
4.5 การป้องกันอัคคีภัย	- เนื่องจากโครงการเป็นอาคารชุดพักอาศัย อาจมีกิจกรรมที่ทำให้เกิดเพลิงไหม้ได้	- โครงการได้ติดตั้งเครื่องตรวจจับความร้อน (Heat Detector: H) เป็นแบบผสม ตรวจจับได้ 100 ตารางเมตร และเครื่องตรวจจับควัน (Smoke Detector: S) เป็นแบบ Photoelectric ตรวจจับได้ 150 ตารางเมตร รวมทั้งติดตั้งอุปกรณ์ส่งสัญญาณเป็นแบบ Alarm Bell ให้ระดับเสียงดังไม่น้อยกว่า 94 dB ที่ระยะห่าง 1 เมตร - โครงการจะติดตั้งตู้ดับเพลิง (Fire Hose Cabinet: FHC) ซึ่งภายในจะประกอบด้วยถังดับเพลิงชนิดหัวขนาด 4.5 กิโลกรัม ชั้นละ 1 จุด และสามารถนำไปใช้งานได้สะดวก รวมทั้งอยู่ในสภาพที่ใช้งานได้ตลอดเวลา - นอกจากนี้จะติดป้ายบอกชั้นและป้ายแสดงทางหนีไฟบริเวณผนังทางเดินของอาคารห้องพักชั้นละ 1 จุด และโครงการยังจัดให้มีระบบไฟฟ้าฉุกเฉิน และยังมี การป้องกันไฟ และควันลามด้วย - สำรองน้ำสำหรับดับเพลิงไว้ 24 ลูกบาศก์เมตร	- สภาพการใช้งานของระบบป้องกันอัคคีภัยทุกชนิด หากพบว่าชำรุดต้องเปลี่ยนใหม่ทันที
4.6 ระบบป้องกันฟ้าผ่า	- เนื่องจากโครงการเป็นอาคารชุดพักอาศัยสูง 5 ชั้น คาดฟ้า (มีชั้นใต้ดิน) ระดับความสูงจากพื้นดินถึงส่วนที่สูงที่สุดของอาคาร 16 เมตร ซึ่งมีความเสี่ยงในการเกิดฟ้าผ่า	- โครงการได้ติดตั้งระบบป้องกันฟ้าผ่า เป็นแบบ Early Streamer Emission System โดยได้ติดตั้งระบบป้องกันฟ้าผ่าทั้งหมด 4 จุด บนชั้นคาดฟ้า เพื่อป้องกันการเกิดฟ้าผ่า โดยระบบป้องกันฟ้าผ่าเป็นไปตามที่กฎหมายกำหนด	- ตรวจสอบสภาพการใช้งานของระบบป้องกันฟ้าผ่า หากพบว่าชำรุดต้องเปลี่ยนใหม่ทันที
4.7 ทัศนียภาพ	- อาจเกิดผลกระทบด้านทัศนียภาพต่อผู้ที่สัญจรผ่านไปมา และสภาพแวดล้อมรอบๆ - เนื่องจากโครงการตั้งอยู่ห่างจากแหล่งโบราณสถานของจังหวัดภูเก็ต จึงไม่ก่อให้เกิดผลกระทบด้านทัศนียภาพต่อแหล่งโบราณสถาน	- จัดพื้นที่สีเขียวบริเวณพื้นที่ว่าง ซึ่งช่วยลดความกระด้างจากโครงสร้างของอาคาร และลดผลกระทบด้านทัศนียภาพของผู้ที่สัญจรผ่านไปมา - ใช้สีหลังคาและตัวอาคาร ที่มีความกลมกลืนกับสภาพแวดล้อมโดยรอบ	-

ภาคผนวกที่ 2

ผลการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม

ภาคผนวกที่ 2.1

ผลการตรวจวิเคราะห์คุณภาพน้ำผ่านการบำบัด (EFFLUENT)



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,T. Patong,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		A.Kathu, Phuket 83150
SAMPLING DATE	: 02/06/2025	SAMPLE NO.	: 6806-037
SAMPLING CONDITION	: Wastewater Treatment	SAMPING TIME	: 11.55 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-12/06/2025		(MS. JUTAPORN JUTAMAST ๖-176-๖-0006)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/06/2025
		REPORTED DATE	: 14/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด "ก่อนลงท่อสาธารณะ"	STANDARD
pH at 25 °C	-	Electrometric	7.32	5.5 - 9.0
BOD ₅	mg/l	5-Days, BOD Test Azide Modification	4.0	≤ 40
Total Suspended Solids	mg/l	Dried at 103-105 °C	6.0	≤ 50
Total Dissolved Solids	mg/l	Dried at 180 °C	388	≤ 1,300
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	8.89	≤ 40

PHYSICAL APPEARANCE 1. Sample : turbid, lightly SS

2. Container : normal [PE 2.0 L (2 bottles)]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติและสิ่งแวดล้อม พ.ศ. 2567

เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคารบางประเภทและบางขนาด (ประเภท ค.)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,T. Patong,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		A.Kathu, Phuket 83150
SAMPLING DATE	: 02/06/2025	SAMPLE NO.	: 6806-037
SAMPLING CONDITION	: Wastewater Treatment	SAMPING TIME	: 11.55 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-12/06/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/06/2025
		REPORTED DATE	: 14/06/2025

PARAMETER	UNIT	METHOD	EFFLUENT	STANDARD
Sulfide	mg/l as S ²⁻	Iodometric	ND	≤ 1
Grease & Oil	mg/l	Partition-Gravimetric	ND	≤ 20
Settleable Solids	ml/l	Volumetric	ND	-
Ammonia-Nitrogen	mg/l as NH ₃ -N	Distillation, Titrimetric	7.21	-
Organic - Nitrogen	mg/l	Macro-Kjeldahl	1.68	-

PHYSICAL APPEARANCE 1. Sample : turbid, lightly SS

2. Container : normal [PE 2.0 L , G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติและสิ่งแวดล้อม พ.ศ. 2548

เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคารบางประเภทและบางขนาด (ประเภท ค.)

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

ภาคผนวกที่ 2.2

ผลการตรวจวิเคราะห์คุณภาพน้ำสระว่ายน้ำ (SWIMMING POOL)



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong, Kathu, Phuket 83150
SAMPLING DATE	: 02/01/2025	SAMPLE NO.	: 6801-034
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 11.52 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-09/01/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/01/2025
		REPORTED DATE	: 10/01/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong, Kathu, Phuket 83150
SAMPLING DATE	: 03/02/2025	SAMPLE NO.	: 6802-078
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 00.233 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 03-14/02/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 03/02/2025
		REPORTED DATE	: 15/02/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong,Kathu, Phuket 83150
SAMPLING DATE	: 03/03/2025	SAMPLE NO.	: 6803-059
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 11.30 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 03-13/03/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 03/03/2025
		REPORTED DATE	: 15/03/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบ โดยวิธีทางห้องปฏิบัติการ)
2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบ โดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong,Kathu, Phuket 83150
SAMPLING DATE	: 01/04/2025	SAMPLE NO.	: 6804-036
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.05 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 01-10/04/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 01/04/2025
		REPORTED DATE	: 11/04/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK
1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบ โดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สุวิทย์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong,Kathu, Phuket 83150
SAMPLING DATE	: 02/05/2025	SAMPLE NO.	: 6805-017
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 11.12 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-09/05/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สุวิทย์	RECEIVED DATE	: 02/05/2025
		REPORTED DATE	: 10/05/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



Request No. 6806-006

Report No. 6806-079

TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		Patong, Kathu, Phuket 83150
SAMPLING DATE	: 02/06/2025	SAMPLE NO.	: 6806-039
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 09.08 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-12/06/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/06/2025
		REPORTED DATE	: 14/06/2025

PARAMETER	UNIT	METHOD	Swimming Pool	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
E.Coli	MPN/100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE

1. Sample : clear
2. Container : normal [G 0.25 L]

STANDARD

คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK

- 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
- 2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

ภาคผนวกที่ 2.3

ผลการตรวจวิเคราะห์คุณภาพน้ำใช้



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,T. Patong,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		A.Kathu, Phuket 83150
SAMPLING DATE	: 02/06/2025	SAMPLE NO.	: 6806-038
SAMPLING CONDITION	: WATER	SAMPING TIME	: 09.09 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-12/06/2025		(MS. JUTAPORN JUTAMAST ๖-176-๖-0006)
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/06/2025
		REPORTED DATE	: 14/06/2025

PARAMETER	UNIT	METHOD	น้ำใช้ในโครงการ (Pool Bar)	STANDARD
Total Dissolved Solids	mg/l	Dried at 180 °C	98.0	≤ 600

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 0.5 L]

STANDARD

มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ.2567

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY



TEST REPORT

CUSTOMER	: นิติบุคคลอาคารชุด บางลา สวีทส์	ADDRESS	: 68/1 Bangla Rd.,T. Patong,
SAMPLING SOURCE	: Bangla Suites Condominium Juristic Person		A.Kathu, Phuket 83150
SAMPLING DATE	: 02/06/2025	SAMPLE NO.	: 6806-038
SAMPLING CONDITION	: WATER	SAMPING TIME	: 09.09 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 02-12/06/2025	(MS. JUTAPORN JUTAMAST)	
FILE NAME	: นิติบุคคลอาคารชุด บางลา สวีทส์	RECEIVED DATE	: 02/06/2025
		REPORTED DATE	: 14/06/2025

PARAMETER	UNIT	METHOD	น้ำใช้ในโครงการ (Pool Bar)	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	< 1.8	ND
Fecal coliform bacteria	ใน 100 ml	MPN Test	< 1.8	-
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear 2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ.2567

REMARK

- 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
- 2) Total coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)
- 3) Fecal coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

ภาคผนวกที่ 3

เอกสารขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน

ที่ อก ๐๓๒๒/ ๑๗๕๖๕



กรมโรงงานอุตสาหกรรม
ถนนพระรามที่ ๖ แขวงทุ่งพญาไท
เขตราชเทวี กรุงเทพฯ ๑๐๕๐๐

๒๘ ธ.ค. ๒๕๖๖

เรื่อง ต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน

เรียน กรรมการผู้จัดการ บริษัท เข้าเทิร์นไทยคอนซัลติ้ง จำกัด

อ้างถึง คำขอต่ออายุของห้องปฏิบัติการวิเคราะห์เอกชน ลงวันที่ ๑๐ พฤศจิกายน ๒๕๖๖

สิ่งที่ส่งมาด้วย เอกสารแนบท้ายหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน
บริษัท เข้าเทิร์นไทยคอนซัลติ้ง จำกัด จำนวน ๑ แผ่น

ตามหนังสือที่อ้างถึง บริษัท เข้าเทิร์นไทยคอนซัลติ้ง จำกัด ขอต่ออายุหนังสือรับขึ้นทะเบียน
ห้องปฏิบัติการวิเคราะห์เอกชน เลขทะเบียน ว-๑๗๖ สถานที่ตั้ง เลขที่ ๕๙/๔๕ หมู่ที่ ๕ ตำบลศรีสุนทร อำเภอถลาง
จังหวัดภูเก็ต ต่อกรมโรงงานอุตสาหกรรม นั้น

กรมโรงงานอุตสาหกรรมพิจารณาแล้ว ให้บริษัท เข้าเทิร์นไทยคอนซัลติ้ง จำกัด ต่ออายุหนังสือ
รับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน โดยมีองค์ประกอบดังนี้

ก. ผู้ควบคุมดูแลห้องปฏิบัติการวิเคราะห์

๑) นายพิมุข สอนมี

ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๑

๒) นายศิริพงศ์ พะสริ

ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๒

๓) นางเพ็ญภา จันทรเพ็ญ

ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๓

๔) นางสาวพรวิษา จินรัตน์

ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๔

ข. เจ้าหน้าที่ประจำห้องปฏิบัติการวิเคราะห์

๑) นางสาวกรรณิกา แก้วสามเขียว

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๑

๒) นางสาวศิริรัตน์ นิเทศนพกุล

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๒

๓) นางสาวจุฑาทิพย์ ชูถึง

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๓

๔) นางสาวปรีชญา หมุกแก้ว

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๔

๕) นางสาวบุษยา ประกอบแสง

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๕

๖) นางสาวจุฑาภรณ์ จุฑามาศย์

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๖


๗) นางสาวกรรณนิการ์ ประทุมเพชร

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๗

๘) นางสาวสุธาสินี ละเมาะ

ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๘

ค. ขอบข่ายสารมลพิษที่ได้รับขึ้นทะเบียนให้วิเคราะห์ในน้ำเสีย ตามสิ่งที่ส่งมาด้วย




หนังสือ....



หนังสือฉบับนี้จะหมดอายุในวันที่ ๑ ธันวาคม ๒๕๖๙ หากประสงค์จะต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกซน ให้ยื่นคำขอต่ออายุพร้อมเอกสารประกอบคำขอต่อกรมโรงงานอุตสาหกรรม ภายใน ๓๐ วัน ก่อนวันสิ้นอายุของหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกซน ทั้งนี้สามารถยื่นคำขอผ่านระบบอิเล็กทรอนิกส์ได้ที่หน้าเว็บไซต์กรมโรงงานอุตสาหกรรม

จึงเรียนมาเพื่อทราบ



ศูนย์วิจัยและเตือนภัยมลพิษโรงงานภาคใต้

โทร. ๐ ๗๔๓๒ ๕๐๒๙, ๐ ๗๔๘๙ ๐๖๓๔ ต่อ ๕๒๐๑

ไปรษณีย์อิเล็กทรอนิกส์ sirw@diw.mail.go.th


เอกสารแนบท้ายหนังสือรับต่ออายุขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน
บริษัท เช่าเทิร์นไทยคอนสตรัคติ้ง จำกัด เลขทะเบียน ว-๑๗๖
ที่ กก ๐๓๒๒/ ลงวันที่

ขอข่ายสารมลพิษที่ได้รับการขึ้นทะเบียนจากกรมโรงงานอุตสาหกรรม จำนวน ๙ รายการ
น้ำเสีย จำนวน 9 รายการ

ลำดับที่	สารมลพิษ	วิธีวิเคราะห์
1	Biochemical Oxygen Demand	5-Day BOD Test, Azide Modification Method
2	Chemical Oxygen Demand	Closed Reflux, Titrimetric Method
3	Oil & Grease	Liquid-Liquid, Partition-Gravimetric Method
4	pH	Electrometric Method
5	Sulfide	Iodometric Method
6	Temperature	Laboratory and Field Method
7	Total Dissolved Solids	Dried at 180 °C
8	Total Kjeldahl Nitrogen	Macro-Kjeldahl, Titrimetric Method
9	Total Suspended Solids	Dried at 103-105 °C

เอกสารอ้างอิง

APHA, AWWA, WEF. Standard Methods for the Examination of Water and Wastewater. 24th ed.
Washington, DC: APHA, 2023.



ภาคผนวกที่ 4

เอกสารสอบเทียบอุปกรณ์เครื่องมือห้องปฏิบัติการ



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : V25-0477

CSR No. : 250252

Page : 1 of 3

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : pH Meter

Manufacturer : SI Analytics

Model : lab 845

Serial No. : 21021943

ID. No. : -

Resolution : 0.01 pH

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : $(25 \pm 3)^{\circ}\text{C}$

Relative Humidity : $(55 \pm 15) \%$

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED BY

APPROVED SIGNATORY

Calibrated By : Mr. Alongkorn Chewaisarakul
(Calibration Technician)

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .





CERTIFICATE NO. : V25-0477

CSR No. : 250252

Page : 2 of 3

Equipment : pH Meter
Manufacturer : SI Analytics
Model : lab 845
Serial No. : 21021943
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Nominal Value/Model	Serial No.	Cert. No.		Traceability
pH Calibration Standard	4.00	1027602	1027602	15-09-2025	CPA Chem
pH Calibration Standard	6.98	1027603	1027603	15-09-2025	CPA Chem
pH Calibration Standard	10.01	1027604	1027604	15-09-2025	CPA Chem
Temperature/Electrical Calibrator	MC2-TE	10548	CAL0252-25P0013	26-01-2026	RKT

CALIBRATION METHOD :

In-house method : CA.WI.11.117 based on direct measurement by using standard voltage calibrator

In-house method : CA.WI.11.117 based on direct measurement by using certified reference material (CRM)

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

CPA Chem : CPA chem Ltd. (ANAB Cert No. AR-1835)

RKT : Rockertek (Thailand) Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0069)

CALIBRATION RESULTS :

Function : Electrical Measurement

Applied Voltage (mV)	pH meter Reading (mV)	Correction (mV)	Uncertainty (± mV)	Coverage Factor (k)
177.48	178	-0.52	0.60	2.00
0.00	1	-1.00	0.59	2.00
-177.48	-177	-0.48	0.60	2.00

Function : Chemical Measurement

Standard Buffer Solutions (pH)	pH meter Reading (pH)	Correction (pH)	Uncertainty (± pH)	Coverage Factor (k)
4.007	4.01	-0.003	0.013	2.09
6.976	6.98	-0.004	0.019	2.02
10.010	9.96	0.050	0.058	2.25

Calibration curve - % off set - mV

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration on



CERTIFICATE No. : V25-0477

CSR No. : 250252

Page : 2 of 2

Equipment : pH Meter
Manufacturer : SI Analytics
Model : lab 845
Serial No. : 21021943
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	376	220608721	SDTH-002/1124	14-11-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.180 comparison with standard thermometer

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment () After Adjustment

Cal Point	Standard Temperature	UUC Reading	Correction	Uncertainty
(°C)	(°C)	(°C)	(°C)	(±°C)
25	25.00	25.0	0.00	0.25

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report

This result of calibration was found accurate as shown on date and place of calibration of

--End--

PSE.CA.AP.11.017-161124 R.04



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0653

CSR No. : 250252

Page : 1 of 4

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Hot Air Oven

Manufacturer : Binder

Model : FD56

Serial No. : 20210000003365

ID. No. : -

Resolution : 1 °C

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : (30 ± 15) °C


Relative Humidity : (60 ± 20) %

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

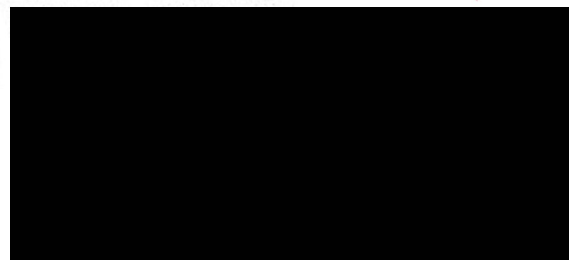

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .





CERTIFICATE No. : T25-0653

CSR No. : 250252

Page : 2 of 4

Equipment : Hot Air Oven
Manufacturer : Binder
Model : FD56
Serial No. : 20210000003365
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)


TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram

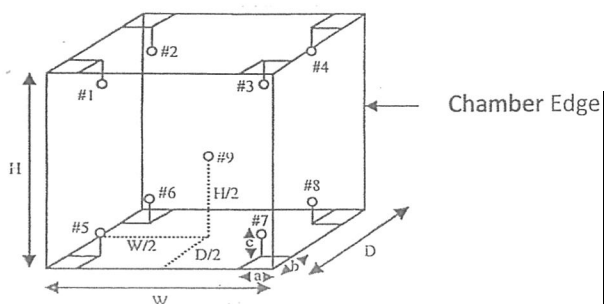

COPY

Dimension of the chamber : $W \times H \times D = 40 \times 40 \times 33$ cm
Sensor Installation : $a \times b \times c = 5 \times 5 \times 5$ cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.



CERTIFICATE NO. : T25-0653

CSR No. : 250252

Page : 3 of 4

Equipment : Hot Air Oven
Manufacture : Binder
Model : FD56
Serial No. : 20210000003365
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the hot air oven and associates are reported in the manner as shown below

Cal Point (°C)	Measured Standard Temperature (°C) at Spread Locations									Uncertainty (± °C)
	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	
104	103.823	104.225	103.823	104.015	103.778	104.033	104.085	103.758	103.776	0.67

Hot Air Oven Performance Result

The performance of the hot air oven are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
104	104	104	0.11	0.49	0.63

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the rep

This result of calibration was found accurate as shown on date and place of calibration




CERTIFICATE NO. : T25-0653

CSR No. : 250252

Page : 4 of 4

Report Graph

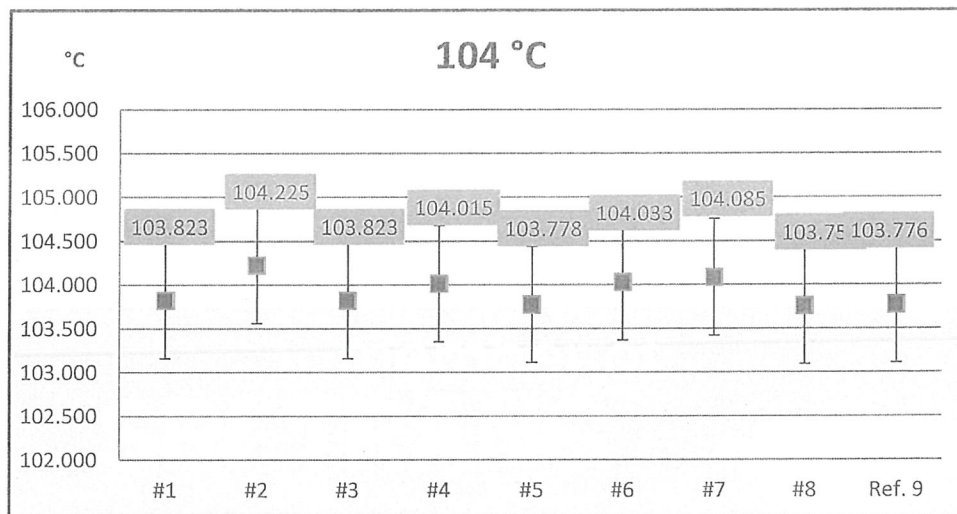

COPY

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0654

CSR No. : 250252

Page : 1 of 3

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : COD Reactor

Manufacturer : Lovibond

Model : RD125

Serial No. : 0423/00542

ID. No. : -

Resolution : -

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : $(30 \pm 15) ^\circ\text{C}$

Relative Humidity : $(60 \pm 20) \%$

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 3-Mar-2025

COPY

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED BY :

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .



d080723



CERTIFICATE No. : T25-0654

CSR No. : 250252

Page : 2 of 3

Equipment : COD Reactor
Manufacturer : Lovibond
Model : RD125
Serial No. : 0423/00542
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	02-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 1994 (re-approved 2011)

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. (NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram



COPY

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

d080723



CERTIFICATE NO. : T25-0654

CSR No. : 250252

Page : 3 of 3

Equipment : COD Reactor
Manufacture : Lovibond
Model : RD125
Serial No. : 0423/00542
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the COD Reactor and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#1	#2	#3	#4	#5	#6	#7	#8	#9	(± °C)
150	151.299	147.200	147.791	148.604	150.268	149.030	149.150	148.082	151.746	0.18

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#10	#11	#12	#13	#14	#15	#16	#17	#18	(± °C)
150	151.831	148.283	146.341	150.289	150.245	150.111	150.150	149.029	151.111	0.18

Cal Point	Measured Standard Temperature (°C) at Spread Locations						Uncertainty
(°C)	#19	#20	#21	#22	#23	#24	(± °C)
150	149.287	150.834	148.796	149.018	151.437	151.266	0.18

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration

-- End --

d080723



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



CALIBRATION CERTIFICATE

CERTIFICATE No. : M25-0359

CSR No. : 250252

Page : 1 of 3

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Electronic Balance

Manufacturer : Sartorius

Model : PRACTUM224-1S

Serial No. : 0035106544

ID. No. : -

Capacity : 220 g

Resolution : 0.0001 g

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : (30 ± 10) °C

Relative Humidity : (50 ± 20) %

Barometric Pressure : (1010 ± 10) hPa

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED BY :

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

Calibrated By : Mr. Bowornnan Langlea
(Mechanical Supervisor)

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .



@PSE-CAL

PSE.CA.AP.11.021-161124 R.05



CERTIFICATE No. : M25-0359

CSR No. : 250252

Page : 2 of 3

Equipment : Electronic Balance
Manufacturer : Sartorius
Model : PRACTUM224-1S
Serial No. : 0035106544
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Norminal Value	Serial No.	Cert. No.	Due Date	Traceability
Standard Weight Set	1 mg ~ 500 g	-	M2412021S	02-12-2025	TCS

CALIBRATION METHOD :

In-house method : CA.WI.11.015 based on UKAS LAB 14 : 2022

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

TCS : Thai Calibration Services Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0189)

CALIBRATION RESULTS :

(/) Without Adjustment () After Adjustment

DETERMINATION OF THE STANDARD DEVIATION OF WEIGHT MACHINE (N=10)

Nominal Value (g)	Standard Deviation (g)
200	0.00013

COPY

EFFECT OF OFF CENTER LOADING AT 100 g

Position					Maximum Difference (g)
1	2	3	4	5	
99.9999	99.9997	100.0001	100.0002	100.0001	0.0003



The uncertainties are for a confidence probability of approximately 95 % .



CERTIFICATE NO. : M25-0359

CSR No. : 250252

Page : 3 of 3

Equipment : Electronic Balance
Manufacturer : Sartorius
Model : PRACTUM224-1S
Serial No. : 0035106544
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

EFFECT OF TARE AT 100 g

Nominal Value (g)	UUC* Reading (g)	Correction (g)
20	20.0002	-0.00020
40	40.0001	-0.00012
60	60.0001	-0.00007
80	80.0001	-0.00007
100	100.0001	-0.00001

ERROR OF INDICATION FROM NOMINAL VALUE

Nominal Value (g)	UUC* Reading (g)	Correction (g)	Uncertainty ($\pm$ g)	Coverage Factor (k)
* Unload	0.0000	0.00000	0.00031	2.28
0.01	0.0100	0.00000	0.00031	2.28
0.05	0.0500	0.00000	0.00031	2.28
0.1	0.1001	-0.00009	0.00031	2.28
0.5	0.5001	-0.00010	0.00032	2.28
1	1.0001	-0.00011	0.00032	2.28
2	1.9997	0.00030	0.00032	2.28
5	4.9998	0.00021	0.00032	2.28
10	10.0000	0.00001	0.00032	2.28
20	20.0001	-0.00010	0.00031	2.25
40	40.0000	-0.00002	0.00032	2.23
60	60.0001	-0.00007	0.00032	2.20
80	80.0000	0.00003	0.00033	2.18
100	99.9999	0.00019	0.00033	2.18
120	120.0000	0.00008	0.00034	2.14
140	139.9999	0.00017	0.00036	2.11
160	159.9999	0.00022	0.00037	2.10
180	180.0000	0.00011	0.00039	2.07
200	200.0001	0.00001	0.00039	2.07

UUC : Unit Under Calibration

The table as per (*) marked are not NSC-ONSC accreditation scope.

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

COPY



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sitranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



CALIBRATION CERTIFICATE

CERTIFICATE No. : M25-0360

CSR No. : 250252

Page : 1 of 3

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Electronic Balance

Manufacturer : Sartorius

Model : PRACTUM2101-1S

Serial No. : 0033508410

ID. No. : -

Capacity : 2100 g

Resolution : 0.1 g

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : $(30 \pm 10) ^\circ\text{C}$

Relative Humidity : $(50 \pm 20) \%$

Barometric Pressure : (1010 ± 10) hPa

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED BY :

APPROVED SIGNATORY

Calibrated By : Mr. Bowornnan Langlea
(Mechanical Supervisor)

() MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .





CERTIFICATE No. : M25-0360

CSR No. : 250252

Page : 2 of 3

Equipment : Electronic Balance
Manufacturer : Sartorius
Model : PRACTUM2101-1S
Serial No. : 0033508410
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Normal Value	Serial No.	Cert. No.	Due Date	Traceability
Standard Weight Set	1 mg ~ 500 g	-	M2412021S	02-12-2025	TCS

CALIBRATION METHOD :

In-house method : CA.WI.11.015 based on UKAS LAB 14 : 2022

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement

according to the International System of Unit (SI) through :

TCS : Thai Calibration Services Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0189)

CALIBRATION RESULTS :


(/) Without Adjustment () After Adjustment

DETERMINATION OF THE STANDARD DEVIATION OF WEIGHT MACHINE (N=10)

Nominal Value (g)	Standard Deviation (g)
500	0.12

EFFECT OF OFF CENTER LOADING AT 200 g

Position					Maximum Difference (g)
1	2	3	4	5	
199.6	200.4	197.4	195.9	202.0	3.7

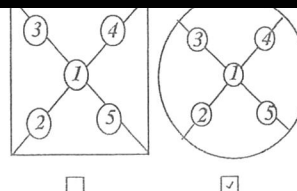

The uncertainties are for a confidence probability of approximately 95 % .



CERTIFICATE NO. : M25-0360

CSR No. : 250252

Page : 3 of 3

Equipment : Electronic Balance
Manufacturer : Sartorius
Model : PRACTUM2101-1S
Serial No. : 0033508410
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

EFFECT OF TARE AT 200 g

Nominal Value (g)	UUC* Reading (g)	Correction (g)
40	40.3	-0.30
80	81.1	-1.10
120	120.9	-0.90
160	159.9	0.10
200	200.1	-0.10

ERROR OF INDICATION FROM NOMINAL VALUE

Nominal Value (g)	UUC* Reading (g)	Correction (g)	Uncertainty ($\pm$ g)	Coverage Factor (k)
* Unload	0.0	0.00	0.28	2.25
1	1.0	0.00	0.28	2.25
2	2.0	0.00	0.28	2.25
5	5.0	0.00	0.28	2.25
10	10.0	0.00	0.28	2.25
50	49.8	0.20	0.28	2.25
100	99.8	0.20	0.28	2.25
150	149.8	0.20	0.28	2.25
200	199.6	0.40	0.28	2.25
250	249.5	0.50	0.28	2.25
300	299.5	0.50	0.28	2.25
350	349.4	0.60	0.28	2.25
400	398.7	1.30	0.28	2.25
450	448.5	1.50	0.28	2.25
500	499.0	1.00	0.28	2.25

COPY

UUC : Unit Under Calibration

The table as per (*) marked are not NSC-ONSC accreditation scope.

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0655

CSR No. : 250252

Page : 1 of 4

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Refrigerator

Manufacturer : SANDEN INTERCOOL

Model : SEA-0405

Serial No. : SEA0405-191200194

ID. No. : -

Resolution : 1 °C

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : (30 ± 15) °C

Relative Humidity : (60 ± 20) %

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .



@PSE-CAL

PSE.CA.AP.11.015-161124 R.04



CERTIFICATE No. : T25-0655

CSR No. : 250252

Page : 2 of 4

Equipment : Refrigerator
Manufacturer : SANDEN INTERCOOL
Model : SEA-0405
Serial No. : SEA0405-191200194
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)


TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. (NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram

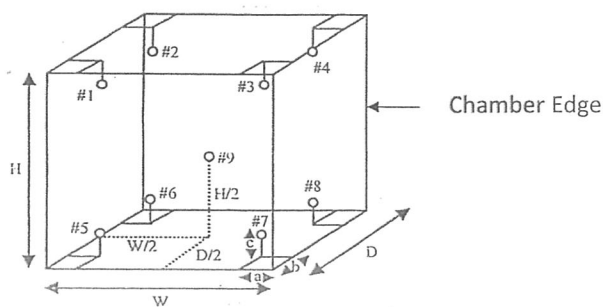

Dimension of the chamber : $W \times H \times D = 53 \times 130 \times 43$ cm
Sensor Installation : $a \times b \times c = 5 \times 5 \times 5$ cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.



CERTIFICATE NO. : T25-0655

CSR No. : 250252

Page : 3 of 4

Equipment : Refrigerator
Manufacture : SANDEN INTERCOOL
Model : SEA-0405
Serial No. : SEA0405-191200194
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the refrigerator and associates are reported in the manner as shown below

Cal Point (°C)	Measured Standard Temperature (°C) at Spread Locations									Uncertainty (± °C)
	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	
4	4.970	4.632	4.119	3.822	4.508	4.076	4.555	4.308	4.126	1.4

Refrigerator Performance Result

The performance of the refrigerator are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
4	4	4	0.98	1.6	2.9

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.




CERTIFICATE NO. : T25-0655

CSR No. : 250252

Page : 4 of 4

Report Graph

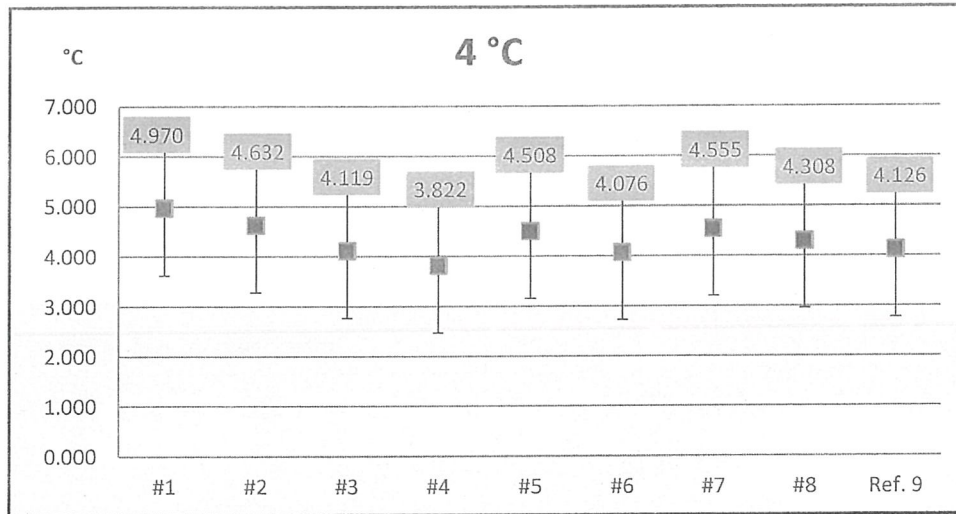

COPY

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0656

CSR No. : 250252

Page : 1 of 4

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Incubator

Manufacturer : ACCUPLUS

Model : I250

Serial No. : 0408-0415-0034

ID. No. : -

Resolution : 0.1 °C

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : (30 ± 15) °C

Relative Humidity : (60 ± 20) %

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .



@PSE-CAL

PSE.CA.AP.11.015-161124 R.04



CERTIFICATE No. : T25-0656

CSR No. : 250252

Page : 2 of 4

Equipment : Incubator
Manufacturer : ACCUPLUS
Model : I250
Serial No. : 0408-0415-0034
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)


TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram

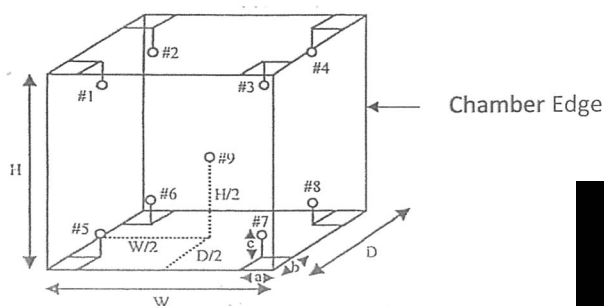

COPY

Dimension of the chamber : $W \times H \times D = 78 \times 100 \times 45$ cm
Sensor Installation : $a \times b \times c = 5 \times 5 \times 5$ cm

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.



CERTIFICATE NO. : T25-0656

CSR No. : 250252

Page : 3 of 4

Equipment : Incubator
Manufacture : ACCUPLUS
Model : I250
Serial No. : 0408-0415-0034
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the incubator and associates are reported in the manner as shown below

Cal Point (°C)	Measured Standard Temperature (°C) at Spread Locations									Uncertainty (± °C)
	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	
20	20.204	20.344	20.218	20.310	19.964	20.077	20.086	19.786	20.102	0.36

Incubator Performance Result

The performance of the incubator are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
20	20	20	0.16	0.47	0.79

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the re

This result of calibration was found accurate as shown on date and place of calibration only.




CERTIFICATE NO. : T25-0656

CSR No. : 250252

Page : 4 of 4

Report Graph

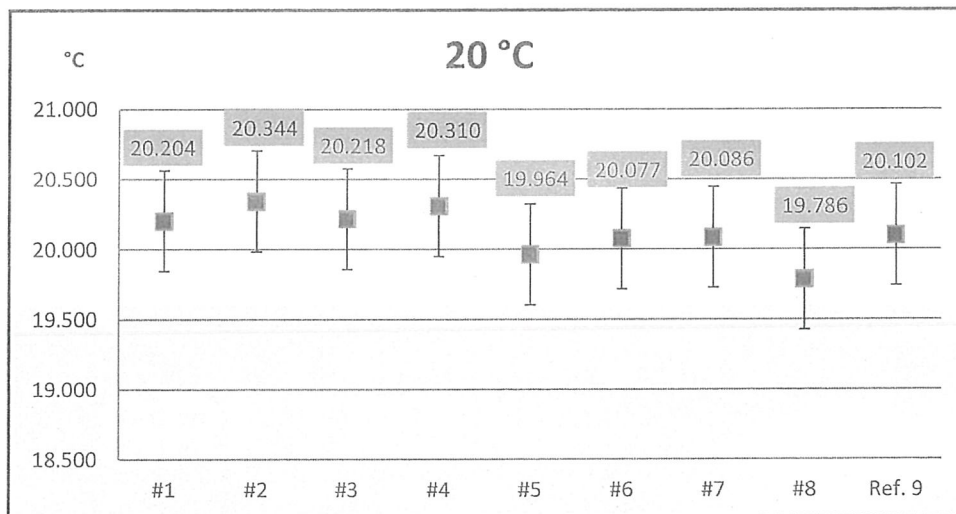

COPY

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --



PREMIER SYSTEM ENGINEERING CO., LTD.

123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250

E-mail : pse-cal@sriranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9



NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0657

CSR No. : 250252

Page : 1 of 4

Customer : Southern Thai Consulting Co., Ltd.
59/45 Moo5 Srisoontorn, Talang, Phuket
83110

Equipment : Water Bath

Manufacturer : Memmert

Model : WNB 22

Serial No. : L522.1030

ID. No. : -

Resolution : 0.1 °C

Instrument Condition : Good Condition

Location of Calibration : Customer Laboratory

Ambient Temperature : $(30 \pm 10) ^\circ\text{C}$

Relative Humidity : $(50 \pm 20) \%$

Date of Received : 1-Mar-2025

Date of Calibration : 1-Mar-2025

Date of Issued : 4-Mar-2025

COPY

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
() MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .





CERTIFICATE No. : T25-0657

CSR No. : 250252

Page : 2 of 4

Equipment : Water Bath
Manufacturer : Memmert
Model : WNB 22
Serial No. : L522.1030
ID. No. : -
Date of Received : 1-Mar-2025
Date of Calibration : 1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003W/0824	02-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.161 based on ASTM E715 : 80 (re-approved 2022)

TRACEABILITY :


This Calibration Certificate is traceable to national standards which realize the unit of measurement according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

(/) Without Adjustment () After Adjustment

Sensor Installation Diagram

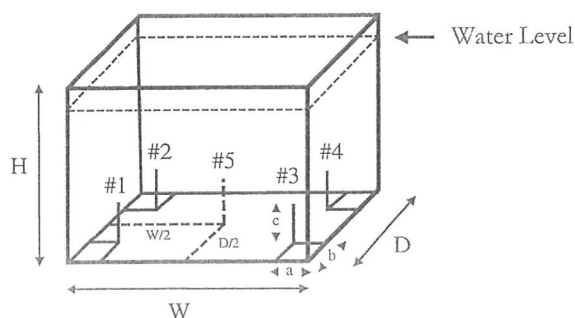

COPY

Dimension of the chamber : $W \times H \times D = 35 \times 29 \times 22$ cm
Sensor Installation : $a \times b \times c = 5 \times 5 \times 5$ cm

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.



CERTIFICATE NO. : T25-0657

CSR No. : 250252

Page : 3 of 4

Equipment : Water Bath
Manufacture : Memmert
Model : WNB 22
Serial No. : L522.1030
ID. No. : -
Date of Received : 1-Mar-2025
Date of Received : 1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment

() After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the water bath and associates are reported in the manner as shown below

Cal Point (°C)	Measured Standard Temperature (°C) at Spread Locations					Uncertainty (± °C)
	#1	#2	#3	#4	#5	
85	84.58	84.80	84.57	84.60	84.77	0.35
95	94.85	95.05	94.85	95.08	95.15	0.44

Water Bath Performance Result

The performance of the water bath are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Water Bath Stability (± °C)	Water Bath Uniformity (± °C)	Overall Variation (± °C)
85	85.0	85.0	0.11	0.26	0.40
95	95.0	95.0	0.25	0.37	0.69

UUC : Unit Under Calibration

The uncertainty is not combine uniformity of the water bath

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration on

COPY





CERTIFICATE NO. : T25-0657

CSR No. : 250252

Page : 4 of 4

Report Graph

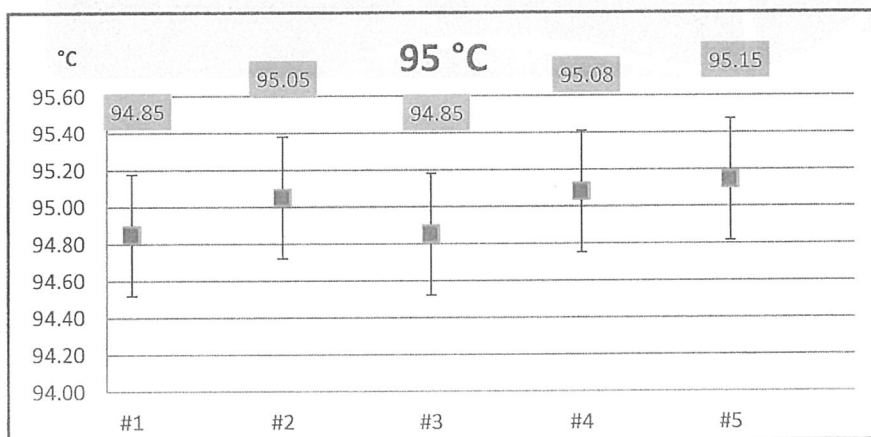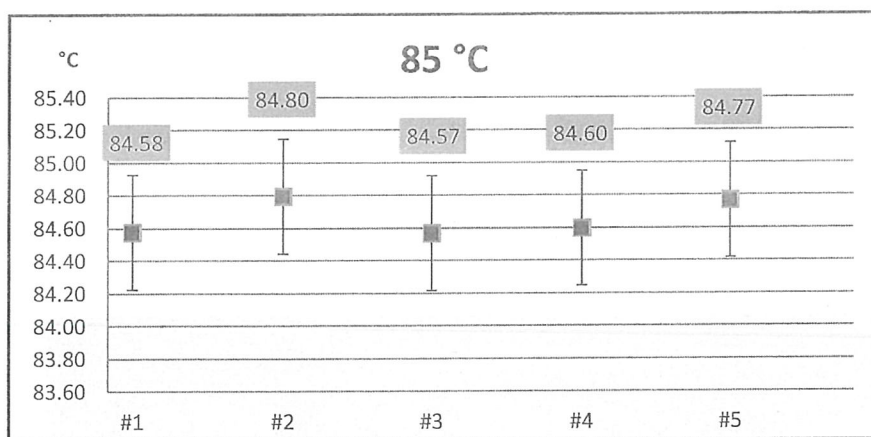

COPY

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

Certificate of Calibration

Number of Page(s)

1 of 3

Certificate No. BSCC-UV-081/25
Equipment UV/Vis Spectrophotometer
Model UV-1800
Manufacturer SHIMADZU
Serial No. A11635305233 CD
ID No. UV-03
Date of receipt 5 March 2025
Date of calibration 5 March 2025
Date of issue 7 March 2025

Customer name Southern Thai Consulting Co.,Ltd.

Address 59/45 Moo 5, Srisoontorn, Talang, Phuket 83110

Temperature (24.2-26.8) °C (On site)
Humidity (54.6-64.0) %RH (On site)

Equipment condition Good Operation

Calibration Location Laboratory

Calibration Procedure In-house method WI-UV-702-01 based on ASTM E275-01

Traceability Wavelength Accuracy is traceable to certificate No. 118114 and 118119
Photometric Accuracy is traceable to certificate No. 118970 and 119006
Stray Light is traceable to certificate No. 118111
The above certificate are traceable to SI unit through Starna Scientific Ltd.
(UKAS accredited calibration laboratory NO. 0659)

Calibrated by Mr.Sarunkorn Pukaothong

COPY

Approved by



Mr.Pannaphong Phanmekakul
Technical Manager

The above results are valid exclusively for the calibrated item(s) as mention in this report / certificate.
Advertising the report / Certificate and publicity of the results are prohibited and also shall not be reproduced
except in full, without written approval of the Bara Scientific Co., Ltd.

Certificate of Calibration

Certificate No. **BSCC-UV-081/25**

Number of Page(s) 2 of 3

Calibration Results:


1.Wavelength Accuracy

Certified Wavelength (nm)	UUC (nm)	Error (nm)	Uncertainty ($\pm$ nm)
360.89	360.81	-0.08	0.18
418.53	418.50	-0.03	0.18
513.39	513.39	0.00	0.18
572.99	573.12	0.13	0.18
879.41	879.40	-0.01	0.18

2.Photometric Accuracy (UV)

Wavelength (nm)	Certified Absorbance (A)	UUC (A)	Error (A)	Uncertainty ($\pm$ A)
235	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
257	0.0000	0.0001	0.0001	0.0075
	0.8616	0.8587	-0.0029	0.0075
313	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
350	0.0000	0.0001	0.0001	0.0075
	0.6393	0.6382	-0.0011	0.0075

*CNR = Customer not request



The above results are valid exclusively for the calibrated item(s) as mention in this report / certificate.
Advertising the report / Certificate and publicity of the results are prohibited and also shall not be reproduced
except in full, without written approval of the Bara Scientific Co., Ltd.

Certificate of Calibration

Certificate No. **BSCC-UV-081/25**

Number of Page(s) **3 of 3**

Calibration Results:

3. Photometric Accuracy (Visible)

Wavelength (nm)	Certified Absorbance (A)	UUC (A)	Error (A)	Uncertainty ($\pm A$)
420.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
440.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
465.0	0.0000	0.0000	0.0000	0.0042
	0.5188	0.5186	-0.0002	0.0042
	0.6627	0.6627	0.0000	0.0042
	0.9424	0.9425	0.0001	0.0042
546.1	0.0000	0.0000	0.0000	0.0042
	0.5199	0.5199	0.0000	0.0042
	0.6989	0.6988	-0.0001	0.0042
	0.9972	0.9974	0.0002	0.0042
590.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
635.0	0.0000	0.0000	0.0000	0.0042
	0.5611	0.5614	0.0003	0.0042
	0.7637	0.7636	-0.0001	0.0042
	1.0942	1.0944	0.0002	0.0042

*CNR = Customer not request

4. Stray Light*

Standard cut-off wavelength (nm)	Unit Under Calibration	
	Wavelength (nm)	Transmission (%)
201.15 $\pm$ 0.11nm	200.90	0.9820

The Stray light transmission reference is less than 1.0%T and Stray light absorbance reference is greater than 2.00A

*Stray Light not NSC-ONSC Accredited.

The measurement uncertainty is base on a standard uncertainty multiplied by a coverage factor k=2 providing a level of confidence of approximately 95%.

End of Certificate

The above results are valid exclusively for the calibrated item(s) as mention in this report / certificate.
Advertising the report / Certificate and publicity of the results are prohibited and also shall not be reproduced
except in full, without written approval of the Bara Scientific Co., Ltd.

CERT.No.: HS-W037F

Certificate of Calibration

Calibration Date : 18 Jun 25

Model : YSI Pro20i

Submitted by : SOUTHERN THAI CONSULTING CO.,LTD.

S/N : 23D101243

59/45 Moo 5 T.Srisoontorn, A.Talang Phuket 83110

Probe : -

S/N : -

ID NO. : -

Avg Room Temp 25 °C

Air Temp ref : S/N. F8065C26

Avg Water Temp 25 °C

Barometric ref : S/N. F8065C26

Air Pressure : 760.00 mmHg

Water Temp ref : -

Salinity : 0 ppt

ID NO. HS001

Technician : Kittipong M.

Calibration Details

Calibration Point	100% air sat. (@25 °C, DO = 8.26 mg/l)	(status)	(status)
Measurement 1 (mg/l)	8.26	(PASS)	-
Measurement 2 (mg/l)	8.26	(PASS)	-
Measurement 3 (mg/l)	8.25	(PASS)	-
Measurement 4 (mg/l)	8.25	(PASS)	-
Measurement 5 (mg/l)	8.24	(PASS)	-
Measurement 6 (mg/l)	8.24	(PASS)	-
Measurement 7 (mg/l)	8.24	(PASS)	-
Measurement 8 (mg/l)	8.25	(PASS)	-
Measurement 9 (mg/l)	8.27	(PASS)	-
Measurement 10 (mg/l)	8.29	(PASS)	-

Mean Measurement	8.25	mg/l	-
Inaccuracy	0.01	mg/l	-

Overall Status (PASS)

Manufacturer Specification


Accuracy = +/- 0.2 mg/l

- 1) This certificate is issued based on the result that are found as shown on date and place of test only.
- 2) The calibration procedure followed in accordance with Harikul Science Co., Ltd.
- 3) This result shall not be used for advertising purpose.



Technician Signature

(Kittipong Maekwong)




Laboratory Manager

(Supreecha Sumaritam)