

ภาคผนวกที่ 3 รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม  
(ตั้งแต่เดือน มกราคม-มิถุนายน 2568)

## รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



บริษัท วิศวกรรมเคมี จำกัด  
Thai Chemical & Engineering Co., Ltd.

จัดทำที่ : บ.วิศวกรรมเคมี จำกัด

วันที่ 18 พฤษภาคม 2568

บริษัท หัวหิน วิลเลจ จำกัด (โรงแรมอนันตราหัวหิน)

43/1 ถนน เพชรเกษม อำเภอ หัวหิน

จ.ประจวบคีรีขันธ์ 77110

เรื่อง รายงานผลวิเคราะห์คุณภาพประจำเดือน มีนาคม 2568

เรียน คุณโอเรเลียง ชีมี้อง

เอกสารแนบ ผลวิเคราะห์คุณภาพน้ำประจำเดือน

ตามที่บริษัท วิศวกรรมเคมี จำกัด ได้รับมอบหมายให้เก็บตัวอย่างน้ำ เพื่อทำการวิเคราะห์คุณภาพน้ำภายในโรงแรม และระบบหล่อเย็น ที่โรงแรม อนันตรา รีสอร์ท แอนด์ สปา หัวหิน โดยทำการเก็บตัวอย่างน้ำประจำเดือน มีนาคม 2568 ตั้งแต่วันที่ 24 มีนาคม 2568 ตัวอย่างน้ำดังนี้

### ผลวิเคราะห์เชื้อในระบบ

ตัวอย่างน้ำ	Legionella CFU/Liter	Legionella CFU/ml	Total Coliform	มาตรฐาน Total Coliform	E.Coli	มาตรฐาน E.Coli
1.) บ่อน้ำดิบ	Not Detected	Not Detected	7.8	< 2.2	7.8	Negative
2.) บ่อประปา 5 เหลี่ยม	Not Detected	Not Detected	< 2	< 2.2	Negative	Negative
3.) เครื่องทำน้ำแข็ง จุด 1	400	0.4	< 2	< 2.2	Negative	Negative
4.) เครื่องทำน้ำแข็ง จุด 2	Not Detected	Not Detected	< 2	< 2.2	Negative	Negative
5.) เครื่องทำน้ำแข็ง จุด 3	19,000	19	< 2	< 2.2	Negative	Negative
6.) น้ำเย็นห้องพักแขก 403	400	0.4	< 2	< 2.2	Negative	Negative
7.) น้ำร้อนห้องพักแขก 403	Not Detected	Not Detected	< 2	< 2.2	Negative	Negative
8.) น้ำประปาห้องครัว (Main)	Not Detected	Not Detected	< 2	< 2.2	Negative	Negative
9.) น้ำประปาห้องครัว (Sea Fire Salt)	Not Detected	Not Detected	< 2	< 2.2	Negative	Negative
10.) ถาด Cooling	6,900	6.9	< 2	< 2.2	Negative	Negative
11.) Main Pool	Not Detected	Not Detected	< 2	<10	Negative	Negative
12.) Lagoon Pool	Not Detected	Not Detected	< 2	<10	Negative	Negative

**“สร้างความพึงพอใจให้ลูกค้า พัฒนาคุณภาพบริการและผลิตภัณฑ์ สร้างสรรค์บุคลากร”**

1048/2 ถนนสุขุมวิท 66/1 แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 Tel: (66) 0 2744 9911 Fax: (66) 0 2393 0165

1048/2 Sukhumvit 66/1 Road, Prakanong Tai, Prakanong, Bangkok 10260 www.tcesolutions.com E-mail: contact@tcesolutions.com

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



บริษัท วิศวกรรมเคมี จำกัด  
Thai Chemical & Engineering Co., Ltd.

ระดับความรุนแรงของเชื้อ Legionella

CFU/ml			ระดับความ น่ากังวล	สิ่งที่ควรปฏิบัติ
น้ำจากหอหล่อเย็น Cooling Tower	น้ำสำหรับ อุปโภค / บริโภค	เครื่องทำความชื้น / เครื่องทำให้เกิดหมอก		
< 1	-	-	ต่ำ	ทบทวนแผนการบำรุงรักษา ให้มีการปฏิบัติอยู่เป็นประจำ
1 – 9	< 1	-	น้อย	วิเคราะห์ติดตามผลอย่าง ต่อเนื่อง
10 - 99	1 – 9	<1	ปานกลาง	ทบทวนและตรวจสอบลักษณะ ของอาคารที่อาจเสี่ยงต่อการ ติดเชื้อ
100 - 999	10 – 99	1 – 9	ค่อนข้างสูง	ทำความสะอาดระบบโดยใช้ สารเคมีที่มีความสามารถในการ ฆ่าเชื้อจุลินทรีย์
≥1,000	>100	>10	มีความรุนแรงสูง	ใช้สารเคมีซึ่งมีความสามารถ ฆ่าเชื้อจุลินทรีย์ชนิดนี้ ใน กระบวนการทำความสะอาด โดยทันที

**“สร้างความพึงพอใจให้ลูกค้า พัฒนาคุณภาพบริการและผลิตภัณฑ์ สร้างสรรค์บุคลากร”**

1048/2 ถนนสุขุมวิท 66/1 แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 Tel : (66) 0 2744 9911 Fax : (66) 0 2393 0165  
1048/2 Sukhumvit 66/1 Road, Prakanong Tai, Prakanong, Bangkok 10260 www.tcesolutions.com E-mail : contact@tcesolutions.com

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



ISO/IEC 17025  
Accreditation No.1007/43

Test Report 6187997

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
43/1 Phetkasem Rd,  
Hua Hin, Prachuap Khiri Khan 77110 Thailand

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1756/68 = บ่อน้ำดิบ  
Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512901  
Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.

Qty.Submitted : 1 bottle x 1 L.  
Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
SGS (Thailand) Ltd.

Jirapan Vilaipol  
Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

5889710  
\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*  
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained herein reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.  
Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited | Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187996

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1757/68 = บ่อประปา 5 เหลี่ยม  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512902  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

Jirapan Vilaipol  
 Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.

Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.

Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.

WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

5889709

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



ISO/IEC 17025  
Accreditation No.1007/43

Test Report 6187995

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
43/1 Phetkasem Rd,  
Hua Hin, Prachuap Khiri Khan 77110 Thailand

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1758/68 = เครื่องทำน้ำแข็ง จุด 1  
Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512903  
Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.

Qty.Submitted : 1 bottle x 1 L.

Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	400	CFU/Liter

Signed for and on behalf of  
SGS (Thailand) Ltd.

Jirapan Vilaipol  
Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.

Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.

Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.

WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was/were drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group



รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



ISO/IEC 17025  
Accreditation No.1007/43

Test Report 6187994

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1759/68 = เครื่องฟบน้ำแข็ง จด 2  
Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512904  
Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.

Qty.Submitted : 1 bottle x 1 L.

Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
SGS (Thailand) Ltd.

Jirapan Vilaipol  
Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

5889707  
\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*  
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.  
Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187993

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1760/68 = เครื่องทำน้ำแข็ง ชุด 3  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512905  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	19,000	CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

Jirapan Vilaipol  
 Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

5889706  
 "Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information."  
 This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
 Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
 Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.  
 Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
 WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited | Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 ☎ +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group



รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187992

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1761/68 = น้ำเย็นห้องรับแขก No.403  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512906  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature.

Qty.Submitted : 1 bottle x 1 L.

Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	400	CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

**Jirapan Vilaipol**  
**Microbiology Laboratory Manager**

\*\*\*\*\* End of Report \*\*\*\*\*

\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*  
 This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
 Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
 Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.  
 Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
 WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was/were drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187991

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1762/68 = น้ำร้อนห้องรับแขก No.403  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512907  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

**Jirapan Vilaipol**  
**Microbiology Laboratory Manager**

\*\*\*\*\* End of Report \*\*\*\*\*

\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liable for the veracity or lack thereof of such information.\*

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.

Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.

Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.

WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

5889704

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



ISO/IEC 17025  
Accreditation No.1007/43

Test Report 6187990

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
43/1 Phetkasem Rd,  
Hua Hin, Prachuap Khiri Khan 77110 Thailand

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1763/68 = ภาต Cooling  
Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512908  
Sample Condition : Water appears yellowish contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Sediment is showing at the bottom of the bottle.

Qty.Submitted : 1 bottle x 1 L.

Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
Legionella spp.	ISO 11731 : 2017	6,900	CFU/Liter

Signed for and on behalf of  
SGS (Thailand) Ltd.

Jirapan Vilaipol  
Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

5889703  
\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*  
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
Publish or advertisement of the result of this document is prohibited, unless prior written approval of the Company.  
Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited | Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187989

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1764/68 = Main Pool  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512909  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Suspended particulate matter showing.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

Jirapan Vilaipol  
 Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

\*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.\*

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.

Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.

Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.

WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is(are) said to be extracted.

5899702

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187988

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1765/68 = Lagoon Pool  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512910  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature. Suspended particulate matter showing.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

Jirapan Vilaipol  
 Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

5889701  
 "Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information."  
 This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
 Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
 Publish or advertisement of the result of this document is prohibited, unless prior written approval of the Company.  
 Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
 WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group



รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



ISO/IEC 17025  
Accreditation No.1007/43

Test Report 6187987

Date : 9-Apr-2025

Page 1 of 1

Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)  
43/1 Phetkasem Rd,  
Hua Hin, Prachuap Khiri Khan 77110 Thailand

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1766/68 = น้ำประปาห้องครัว Main  
Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512911  
Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature.

Qty.Submitted : 1 bottle x 1 L.

Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	Not detected**	Per Liter

Remark: \*\* Limit of detection = 100 CFU/Liter

Signed for and on behalf of  
SGS (Thailand) Ltd.

Jirapan Vilaipol  
Microbiology Laboratory Manager

\*\*\*\*\* End of Report \*\*\*\*\*

"Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liable for the veracity or lack thereof of such information."

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.

Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

Publication or advertisement of the result of this document is prohibited, unless prior written approval of the Company.

Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.

WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was(were) drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group



รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน มกราคม ถึง มีนาคม 2568



Test Report 6187986

Date : 9-Apr-2025

Page 1 of 1

**Client : Hua Hin Village Co.,Ltd (Anantara Resort & Spa)**  
**43/1 Phetkasem Rd,**  
**Hua Hin, Prachuap Khiri Khan 77110 Thailand**

The following sample(s) was/were submitted and identified by client as:

Sample Name : P.1767/68 = น้ำประปาห้อง Sea Fire Salt  
 Sample Description : Water

The following sample(s) was/were identified by SGS as:

SGS Sample No. : 6512912  
 Sample Condition : Water appears transparent contained in a glass bottle sealed with a plastic lid and kept at a cool temperature.  
 Qty.Submitted : 1 bottle x 1 L.  
 Date Received : 25-Mar-2025 Date Commenced : 26-Mar-2025

Test Items	Method	Results	Units
<i>Legionella spp.</i>	ISO 11731 : 2017	330	CFU/Liter

Signed for and on behalf of  
 SGS (Thailand) Ltd.

Jirapan Vilaipol  
 Microbiology Laboratory Manager


\*\*\*\*\* End of Report \*\*\*\*\*

5889699  
 \*Any holder of this document is advised that should client or third party information be supplied with respect to the goods or sample, SGS may, at its discretion, attached or indicate such information to the report but SGS makes no warranties or accepts no liability for the veracity or lack thereof of such information.  
 This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request.  
 Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained herein reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.  
 Publish or advertisement of the result or this document is prohibited, unless prior written approval of the Company.  
 Unless otherwise stated the results shown in this test report refer only to the sample(s) received and such sample(s) are retained for 15 days only.  
 WARNING: The sample(s) to which the findings recorded herein (the "Findings") relate was/were drawn and / or provided by the Client or by a third party acting at the Client's direction. The Findings constitute no warranty of the sample's representativeness of any goods and strictly relate to the sample(s). The Company accepts no liability with regard to the origin or source from which the sample(s) is/are said to be extracted.

SGS (Thailand) Limited | Laboratory Services 10, 10/1-4 and 12 Soi Rama III S.59, Chong Nonsi, Yan Nawa, Bangkok 10120  
 t +66 (0)2 683 05 41 www.sgs.com

Member of the SGS Group

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<p align="center"><b>บริษัท วิศวกรรมเคมี จำกัด</b>  <b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b></p>			
<p align="center">1048/2 ซ.สุขุมวิท 66/1 อ.สุขุมวิท บางนา-คลองเตย เขตคลองเตย กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165          1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165</p>				
<p align="center"><b>ANALYSIS REPORT</b></p>				
REF. NO.	WP/PK 3132/68	June 13, 2025		
APPLICANT	: Anantara Hua Hin Resort & Spa			
COMMODITY	: น้ำประปา ห้องครัว 1			
SAMPLING DATE	: June 09, 2025	Received Date : June 10, 2025		
ANALYSIS RESULT (S)	:			
<p align="center">.....</p>				
Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique
Remark :				
<p align="center">คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน</p>				
<p align="center">This report applies to client's self-drawn sample only.</p>				
TR/lc	<p>Analyzed by..... <u>นางสาว อรุณรัตน์</u> .....</p>			
	<p>Approved by..... <u>ศ.ดร.วิทย์ พงษ์ผาสุข</u> .....</p>			

F-QC-04-08 Rev. 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568



บริษัท วิศวกรรมเคมี จำกัด  
THAI CHEMICAL & ENGINEERING CO., LTD.

1048/2 ซ.สุขุมวิท 66/1 ถนนสุขุมวิท แขวงคลองเตยใต้ เขตคลองเตย กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165  
1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165

ANALYSIS REPORT

REF. NO. WP/PK 3124/68 June 13, 2025

APPLICANT : Anantara Hua Hin Resort & Spa  
COMMODITY : บ่อประปา 5 เครื่อง

SAMPLING DATE : June 09, 2025 Received Date : June 10, 2025  
ANALYSIS RESULT (S) :

Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique

Remark :

คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน




This report applies to client's self-drawn sample only.

TR/c

Analyzed by .....นางสาว ลลพเหล็ก.....

Approved by .....ศิวพรรัตน์ พงศ์ผาสุก.....

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<p style="text-align: center;"><b>บริษัท วิศวกรรมเคมี จำกัด</b>  <b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b>          1048/2 ซ.สุขุมวิท 66/1 อ.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165          1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165</p>																		
<b>ANALYSIS REPORT</b>																			
REF. NO.	WP/PK 3131/68		June 13, 2025																
APPLICANT	:	Anantara Hua Hin Resort & Spa																	
COMMODITY	:	Lagoon Pool																	
SAMPLING DATE	:	June 09, 2025	Received Date :	June 10, 2025															
ANALYSIS RESULT (S)	:																		
<table border="1"> <thead> <tr> <th>Items</th> <th>Unit</th> <th>Result</th> <th>Standard</th> <th>Analysis Method</th> </tr> </thead> <tbody> <tr> <td>Total Coliform</td> <td>MPN/100 ml</td> <td>&lt; 2</td> <td>&lt; 10</td> <td>Multiple tube technique</td> </tr> <tr> <td>E.Coli</td> <td>MPN/100 ml</td> <td>Negative</td> <td>Negative</td> <td>Multiple tube technique</td> </tr> </tbody> </table>	Items	Unit	Result	Standard	Analysis Method	Total Coliform	MPN/100 ml	< 2	< 10	Multiple tube technique	E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique				
Items	Unit	Result	Standard	Analysis Method															
Total Coliform	MPN/100 ml	< 2	< 10	Multiple tube technique															
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique															
Remark :																			
<p>คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน</p>																			
<p><b>This report applies to client's self-drawn sample only.</b></p>																			
TR/lc																			
Analyzed by		Approved by																	

F-QC-04-08 Rev. 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568



บริษัท วิศวกรรมเคมี จำกัด  
THAI CHEMICAL & ENGINEERING CO., LTD.

1048/2 ซ.สุขุมวิท 66/1 ต.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165  
1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165

ANALYSIS REPORT

REF. NO. WP/PK 3130/68 June 13, 2025

APPLICANT : Anantara Hua Hin Resort & Spa  
COMMODITY : ภาชนะ Cooling

SAMPLING DATE : June 09, 2025 Received Date : June 10, 2025  
ANALYSIS RESULT (S) :

Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique

Remark :

คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน

This report applies to client's self-drawn sample only.

TR/le

Analyzed by ภาณุชาติ กานต์เหล็ก

Approved by ศิริณารัตน์ พลสมการรัตน์

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568



บริษัท วิศวกรรมเคมี จำกัด

THAI CHEMICAL & ENGINEERING CO., LTD.

1048/2 ซ.สุขุมวิท 66/1 อ.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165

1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165

ANALYSIS REPORT

REF. NO. WP/PK 3125/68

June 13, 2025

APPLICANT : Anantara Hua Hin Resort & Spa

COMMODITY : เครื่องทำน้ำแข็ง จุด 1

SAMPLING DATE : June 09, 2025

Received Date : June 10, 2025

ANALYSIS RESULT (S) :

Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique

Remark :

คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน

This report applies to client's self-drawn sample only.

TR/IC

Analyzed by กมลชนา สายสุเมธกิจ

Approved by ศุภณัฐ วัฒนวิจิตรกุล



รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568



บริษัท วิศวกรรมเคมี จำกัด  
THAI CHEMICAL & ENGINEERING CO., LTD.

1048/2 ซ.สุขุมวิท 66/1 อ.สุขุมวิท แขวงคลองเตยเหนือ เขตวัฒนา กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165  
1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165

ANALYSIS REPORT

REF. NO. WP/PK 3126/68 June 13, 2025

APPLICANT : Anantara Hua Hin Resort & Spa  
COMMODITY : เครื่องทำน้ำแข็ง ชุด 2

SAMPLING DATE : June 09, 2025 Received Date : June 10, 2025  
ANALYSIS RESULT (S) :

Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique

Remark :

คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน

This report applies to client's self-drawn sample only.


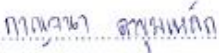

TR/le

Analyzed by.....นิพนธ์ ชาญณรงค์.....

Approved by.....วิมลพรรัตน์ พลสมภรณ์.....


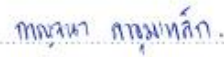

F-QC-04-08 Rev.: 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<p><b>บริษัท วิทวกรรมเคมี จำกัด</b></p> <p><b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b></p> <p>1048/2 ซ.สุขุมวิท 66/1 อ.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165</p> <p>1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165</p>																
ANALYSIS REPORT																	
REF. NO.	WP/PK 3127/68	June 13, 2025															
APPLICANT	: Anantara Hua Hin Resort & Spa																
COMMODITY	: เครื่องทำน้ำแข็ง จูต 3																
SAMPLING DATE	: June 09, 2025	Received Date : June 10, 2025															
ANALYSIS RESULT (S)	:																
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <thead> <tr> <th style="width: 25%;">Items</th> <th style="width: 15%;">Unit</th> <th style="width: 15%;">Result</th> <th style="width: 15%;">Standard</th> <th style="width: 30%;">Analysis Method</th> </tr> </thead> <tbody> <tr> <td>Total Coliform</td> <td>MPN/100 ml</td> <td>&lt; 2</td> <td>&lt; 2.2</td> <td>Multiple tube technique</td> </tr> <tr> <td>E.Coli</td> <td>MPN/100 ml</td> <td>Negative</td> <td>Negative</td> <td>Multiple tube technique</td> </tr> </tbody> </table>			Items	Unit	Result	Standard	Analysis Method	Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique	E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique
Items	Unit	Result	Standard	Analysis Method													
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique													
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique													
Remark :																	
<p>คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน</p>																	
<p><b>This report applies to client's self-drawn sample only.</b></p>																	
TR/le																	
Analyzed by.....		Approved by 															

F-QC-04-08 Rev. 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<p style="text-align: center;"><b>บริษัท วิทวกรรมเคมี จำกัด</b>  <b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b>          1048/2 ซ.สุขุมวิท 66/1 จ.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165          1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165</p>																	
<b>ANALYSIS REPORT</b>																		
REF. NO.	WP/PK 3128/68		June 13, 2025															
APPLICANT	: Anantara Hua Hin Resort & Spa																	
COMMODITY	: บัณฑิตห้องพัก No.814																	
SAMPLING DATE	: June 09, 2025	Received Date : June 10, 2025																
ANALYSIS RESULT (S)	:																	
<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: center;">Items</th> <th style="text-align: center;">Unit</th> <th style="text-align: center;">Result</th> <th style="text-align: center;">Standard</th> <th style="text-align: center;">Analysis Method</th> </tr> </thead> <tbody> <tr> <td>Total Coliform</td> <td style="text-align: center;">MPN/100 ml</td> <td style="text-align: center;">&lt; 2</td> <td style="text-align: center;">&lt; 2.2</td> <td>Multiple tube technique</td> </tr> <tr> <td>E.Coli</td> <td style="text-align: center;">MPN/100 ml</td> <td style="text-align: center;">Negative</td> <td style="text-align: center;">Negative</td> <td>Multiple tube technique</td> </tr> </tbody> </table>		Items	Unit	Result	Standard	Analysis Method	Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique	E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique		
Items	Unit	Result	Standard	Analysis Method														
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique														
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique														
Remark :																		
คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน																		
This report applies to client's self-drawn sample only.																		
TR/c																		
Analyzed by.....		Approved by.....																
																		

F-QC-04-08 Rev. 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568



บริษัท วิศวกรรมเคมี จำกัด  
THAI CHEMICAL & ENGINEERING CO., LTD.

1048/2 ซ.สุขุมวิท 66/1 ต.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165  
1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL: 0-2744-9911 FAX: 0-2393-0165

ANALYSIS REPORT

REF. NO. WT/PK 3133/68 June 13, 2025

APPLICANT : Anantara Hua Hin Resort & Spa  
COMMODITY : น้ำประปา ห้องครัว 2

SAMPLING DATE : June 09, 2025 Received Date : June 10, 2025  
ANALYSIS RESULT (S) :

Items	Unit	Result	Standard	Analysis Method
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique

Remark :

คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน


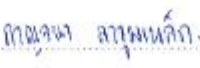

This report applies to client's self-drawn sample only.

TR/lc

Analyzed by..... กณฐนา ภรณ์เหล็ก.....


Approved by..... สันติพรรัตน์ วัฒนมาตร์.....

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<b>บริษัท วิทวกรรมเคมี จำกัด</b> <b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b>																
	1048/2 ซ. สุขุมวิท 66/1 จ. สุขุมวิท เขตวัฒนา กรุงเทพมหานคร 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165 1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165																
<b>ANALYSIS REPORT</b>																	
REF. NO.	WP/PK 3129/68	June 13, 2025															
APPLICANT	: Anantara Hua Hin Resort & Spa																
COMMODITY	: น้ำร้อนห้องรับแขก No.814																
SAMPLING DATE	: June 09, 2025	Received Date : June 10, 2025															
ANALYSIS RESULT (S)	:																
<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Items</th> <th>Unit</th> <th>Result</th> <th>Standard</th> <th>Analysis Method</th> </tr> </thead> <tbody> <tr> <td>Total Coliform</td> <td>MPN/100 ml</td> <td>&lt; 2</td> <td>&lt; 2.2</td> <td>Multiple tube technique</td> </tr> <tr> <td>E.Coli</td> <td>MPN/100 ml</td> <td>Negative</td> <td>Negative</td> <td>Multiple tube technique</td> </tr> </tbody> </table>			Items	Unit	Result	Standard	Analysis Method	Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique	E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique
Items	Unit	Result	Standard	Analysis Method													
Total Coliform	MPN/100 ml	< 2	< 2.2	Multiple tube technique													
E.Coli	MPN/100 ml	Negative	Negative	Multiple tube technique													
Remark :																	
คุณภาพน้ำอยู่ในเกณฑ์มาตรฐาน																	
This report applies to client's self-drawn sample only.																	
TR/le																	
Analyzed by.....	Approved by.....																
																	

FOC-04-08 Rev. 3

รายงานผลวิเคราะห์คุณภาพน้ำของโรงแรม ประจำเดือน เมษายน ถึง มิถุนายน 2568

	<p align="center"><b>บริษัท วิศวกรรมเคมี จำกัด</b>  <b>THAI CHEMICAL &amp; ENGINEERING CO., LTD.</b></p>																		
<p align="center">1048/2 ซ.สุขุมวิท 66/1 ต.สุขุมวิท แขวงพระโขนงใต้ เขตพระโขนง กรุงเทพฯ 10260 โทร. 0-2744-9911 แฟกซ์ 0-2393-0165          1048/2 Soi Sukhumvit 66/1, Sukhumvit Rd., Prakanong Tai, Prakanong, Bangkok 10260 TEL. 0-2744-9911 FAX 0-2393-0165</p>																			
<p align="center"><b>ANALYSIS REPORT</b></p>																			
REF. NO.	WP/PK 3123/68	June 13, 2025																	
APPLICANT	: Anantara Hua Hin Resort & Spa																		
COMMODITY	: บ่อน้ำดิบ																		
SAMPLING DATE	: June 09, 2025	Received Date : June 10, 2025																	
ANALYSIS RESULT (S)	:																		
<table border="1"> <thead> <tr> <th>Items</th> <th>Unit</th> <th>Result</th> <th>Standard</th> <th>Analysis Method</th> </tr> </thead> <tbody> <tr> <td>Total Coliform</td> <td>MPN/100 ml</td> <td>4.5</td> <td>&lt; 2.2</td> <td>Multiple tube technique</td> </tr> <tr> <td>E.Coli</td> <td>MPN/100 ml</td> <td>4.5</td> <td>Negative</td> <td>Multiple tube technique</td> </tr> </tbody> </table>	Items	Unit	Result	Standard	Analysis Method	Total Coliform	MPN/100 ml	4.5	< 2.2	Multiple tube technique	E.Coli	MPN/100 ml	4.5	Negative	Multiple tube technique				
Items	Unit	Result	Standard	Analysis Method															
Total Coliform	MPN/100 ml	4.5	< 2.2	Multiple tube technique															
E.Coli	MPN/100 ml	4.5	Negative	Multiple tube technique															
Remark :																			
<p align="center"><b>This report applies to client's self-drawn sample only.</b></p>																			
TR/IC	<p>Analyzed by.....<u>กนกวรรณ อามะพันธ์</u>.....</p>																		
	<p>Approved by.....<u>ศุภณัฐ วัฒนวิเศษกุล</u>.....</p>																		

F-QC-04-08 Rev. 3