

ภาคผนวก ก-2

หนังสือแจ้งการก่อสร้าง ดัดแปลง รื้อถอนอาคาร ตามมาตรา 39 ตร
ตามหนังสือเลขที่ 512563 ลงวันที่ 6 มีนาคม 2563

อาคารประเภทควบคุมการใช้ ตามมาตรา ๓๒
ความมั่นคง

โดยมีเงื่อนไขขอรับใบอนุญาตตามมาตรา ๓๑ หรือ

จำนวนบัญชี ๑๖ เลขที่ ๕๐

ลงวันที่ ๑๖ มีนาคม ๒๕๖๔



แบบ ยผ-๔

ใบรับหนังสือแจ้งการก่อสร้าง ดัดแปลง รื้อถอนอาคาร ตามมาตรา ๓๑ หรือ

เลขที่ ๕๖/๒๕๖๔

ได้รับแจ้งจาก บริษัท สยาม สยามวิทย์ ๕๕ จำกัด โดย นายปิติพงษ์ ไตรบุรุษ และ นางงดพร ศิวขาว
เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครองอาคาร อยู่บ้านเลขที่ ๕๕๖ หมู่ที่ ๕
ตรอก/ซอย ถนน ตำบล/แขวง สาโรงเหนือ
อำเภอ/เขต เมืองสมุทรปราการ จังหวัด สมุทรปราการ ดังข้อความต่อไปนี้

ข้อ ๑ ทดการ

☒ ก่อสร้างอาคาร

☒ ดัดแปลงอาคาร

☒ รื้อถอนอาคาร

ที่บ้านเลขที่ ๕๕๖ ตรอก/ซอย สุขุมวิท ๕๕ ถนน สุขุมวิท
หมู่ที่ ๕ ตำบล/แขวง คลองตันเหนือ อำเภอ/เขต วัฒนา
จังหวัด กรุงเทพมหานคร โทรศัพท์/โทรเลข/โทรสาร เลขที่ ๕๕๕๕
เป็นที่ดินของ บริษัท รรณวรินทร์แอนด์อสังหาริมทรัพย์ จำกัด

ข้อ ๒ เป็นอาคาร

๒.๑ ชนิด คีทสอรับ จำนวน ๑ หลัง เพื่อใช้เป็นโรงแรม (๒๕๑ ห้อง)
เนื้อที่รวมกัน ๑๐๕๒๐.๐๐ ตารางเมตร ที่จอดรถ ที่กั้นรถ และทางเข้าออก
ของรถ จำนวน ๑๐๕ คัน มีพื้นที่ ๓.๑๒๐.๐๐ ตารางเมตร

๒.๒ ชนิด โรง ก.ส.ล. จำนวน ๑ แห่ง เพื่อใช้ กับแนวเขตโครงการ
ความยาว ๑๕๕.๐๐ เมตร ที่จอดรถ ที่กั้นรถ และทางเข้าออกของรถ จำนวน ๑๐๕ คัน
มีพื้นที่ ๓.๑๒๐.๐๐ ตารางเมตร

๒.๓ ชนิด หอระบายน้ำ จำนวน ๑ แห่ง เพื่อใช้ ระบบย่อยน้ำโครงการ
ความยาว ๑๕๗.๐๐ เมตร ที่จอดรถ ที่กั้นรถ และทางเข้าออกของรถ จำนวน ๑๐๕ คัน
มีพื้นที่ ๓.๑๒๐.๐๐ ตารางเมตร

EIA = โครงการโรงแรม วัน สุขุมวิท ๕๕

ข้อ ๓ โดยมี

ข้อ ๓ โดยมี

- | | |
|---|--|
| ☒ นายศรัทธา ตั้งสฤติธรรม ว-สค.๔๘๔ | เป็นสถาปนิกผู้ออกแบบ |
| ☒ นายบุญเชษฐ์ แจ่มกลาง ส-สค.๓๖๑๕ | เป็นสถาปนิกผู้ควบคุมงาน |
| ☒ นายกิตติ บุญแสง วย.๒๑๔๖ | เป็นวิศวกรผู้ออกแบบและคำนวณโครงสร้าง |
| ☒ นายวุฒิชัย พลเยี่ยม สย.๑๒๐๘๖ | เป็นวิศวกรผู้ควบคุมงานโครงสร้าง |
| ☒ นายธันวา ต้นเสถียร วก.๙๗๙ | เป็นวิศวกรผู้ออกแบบระบบปรับอากาศ
อากาศและระบบระบายอากาศและระบบ
ป้องกันเพลิงไหม้ |
| ☒ นายขจรพงษ์ สหธิโสภาอาภรณ์ สก.๒๕๔๕ | เป็นวิศวกรผู้ควบคุมงานระบบปรับอากาศ
อากาศและระบบระบายอากาศและระบบ
ป้องกันเพลิงไหม้ |
| ☒ นายวีรศักดิ์ พันเสริมศักดิ์ วส.๑๘ | เป็นวิศวกรผู้ออกแบบระบบบำบัดน้ำเสีย
และการระบายน้ำทิ้ง |
| ☒ นายธันวา ต้นเสถียร สส.๑๐๔ | เป็นวิศวกรผู้ควบคุมงานระบบบำบัดน้ำเสีย
และการระบายน้ำทิ้ง |
| ☒ นายวีรศักดิ์ พันเสริมศักดิ์ วส.๑๘ | เป็นวิศวกรผู้ออกแบบระบบประปา |
| ☒ นายธันวา ต้นเสถียร วก.๗๙๗ | เป็นวิศวกรผู้ควบคุมงานระบบประปา |
| ☒ นายธันวา ต้นเสถียร สส.๑๐๔ | เป็นวิศวกรผู้ออกแบบระบบลิฟต์ |
| ☒ นายขจรพงษ์ สหธิโสภาอาภรณ์ สก. | เป็นวิศวกรผู้ควบคุมงานระบบลิฟต์ |
| ☒ นายกอบชัย แยมศรวล วฟก.๙๔๓ | เป็นวิศวกรผู้ออกแบบระบบไฟฟ้า |
| ☒ นายชัยวัฒน์ เหลืองอบอ่อน สฟก.๓๔๗๓ | เป็นวิศวกรผู้ควบคุมงานระบบไฟฟ้า |
| ☒ นายเอกลักษณ์ ยอดทองสิน วย.๑๙๘๐ | เป็นวิศวกรผู้ดำเนินการตรวจสอบงานออกแบบ
และคำนวณส่วนต่างๆ ของโครงสร้างอาคาร |

ข้อ ๔ กำหนดแล้วเสร็จใน ๗๓๐ วัน โดยจะเริ่มขึ้นก่อสร้างอาคาร/ตัดแปลงอาคาร/รื้อถอนอาคาร
วันที่ ๖ มีนาคม ๒๕๖๓ และจะแล้วเสร็จวันที่ ๖ มีนาคม ๒๕๖๕

ข้อ ๕ ค่าธรรมเนียมในการตรวจแบบก่อสร้าง / คัดแปลง

- | | |
|---|---------------|
| (๑) อาคาร จำนวนเงิน | ๘๕,๗๐๕.๐๐ บาท |
| (๒) ทอระบายน้ำ รั้ว เขื่อน กว้างหรืออื่นๆ จำนวนเงิน | ๓๖๒.๐๐ บาท |
| (๓) ทางวิ่งหรือที่จอดรถยนต์ภายนอกอาคาร จำนวนเงิน | ๑,๕๘๖.๐๐ บาท |
| (๔) บ่อบำบัดน้ำเสีย จำนวนเงิน | ๒๐.๐๐ บาท |
| (๕) ค่าธรรมเนียมไปรับแจ้งก่อสร้าง จำนวนเงิน | ๒๐.๐๐ บาท |
| รวมทั้งสิ้น จำนวนเงิน | ๘๘,๖๗๓.๐๐ บาท |

ข้อ ๖ ผู้แจ้ง

ข้อ ๕. ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวง ข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา ๕๑ มาตรา ๕๒ หรือมาตรา ๕๓ แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๖๒ และกฎหมายอื่นที่เกี่ยวข้อง

ข้อ ๖. ในกรณีที่ผู้แจ้งไม่ก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารตามที่ได้ออกใบรับแจ้งไว้ในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้รับแจ้งให้ก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารตามใบรับแจ้งออกต่อไป และให้ใบรับแจ้งเป็นอันยกเลิก

ข้อ ๗. ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้รับแจ้งตามมาตรา ๕๑ ๕๒ หรือฉบับแต่วันที่ได้รับแจ้งก่อสร้าง ดัดแปลง หรือรื้อถอนอาคาร แล้วแต่กรณี เจ้าพนักงานท้องถิ่นตรวจพบเหตุไม่ถูกต้องของเจ้าพนักงานท้องถิ่นซึ่งมีอำนาจสั่งให้ผู้แจ้งดำเนินการ ดังต่อไปนี้

(๑) กรณีที่ผู้แจ้งได้แจ้งขอมลหรือยื่นเอกสารและหลักฐานตาม มาตรา ๕๑ ๕๒ หรือฉบับถูกต้อง เจ้าพนักงานท้องถิ่นจะมีหนังสือแจ้งข้อบกพร่องให้ผู้แจ้งดำเนินการแก้ไขข้อมูล เอกสารและหลักฐานให้ถูกต้อง ครบถ้วน ทั้งนี้ ภายในสิบห้าวันนับแต่วันที่ได้รับแจ้ง ในกรณีที่ผู้แจ้งไม่ดำเนินการแก้ไขให้แล้วเสร็จภายในระยะเวลาที่กำหนด และมีการก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารแล้ว เจ้าพนักงานท้องถิ่นจะดำเนินการตามกฎหมายมาตรา ๕๑ (๑) และหากอาคารได้ก่อสร้าง หรือดัดแปลง จนแล้วเสร็จตามที่ได้ออกใบรับแจ้งแล้ว เจ้าพนักงานท้องถิ่นจะดำเนินการตาม มาตรา ๕๑ (๒) จนกว่าจะดำเนินการแก้ไขให้ถูกต้อง

(๒) กรณีที่แผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณ ของอาคาร ที่ผู้แจ้งได้อื่นไว้ตาม มาตรา ๕๑ ๕๒ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัตินี้ กฎกระทรวง หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัตินี้ หรือกฎหมายอื่นที่เกี่ยวข้องของ เจ้าพนักงานท้องถิ่นจะมีหนังสือแจ้งข้อบกพร่องให้ผู้แจ้งแก้ไขแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณ ให้ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัตินี้ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัตินี้ หรือกฎหมายอื่นที่เกี่ยวข้อง ภายในระยะเวลาที่เจ้าพนักงานท้องถิ่นกำหนดแต่ต้องไม่น้อยกว่าสามสิบวัน

(๓) กรณีการก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารที่ได้แจ้งไว้ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัตินี้ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัตินี้ หรือกฎหมายอื่นที่เกี่ยวข้อง เจ้าพนักงานท้องถิ่นจะมีหนังสือแจ้งข้อบกพร่องให้ผู้แจ้งดำเนินการก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารดังกล่าว ให้ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัตินี้ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัตินี้ หรือกฎหมายอื่นที่เกี่ยวข้องภายในระยะเวลาที่เจ้าพนักงานท้องถิ่นกำหนดแต่ต้องไม่น้อยกว่าสามสิบวัน และในระหว่างระยะเวลาที่ผู้แจ้งดำเนินการแก้ไขตามหนังสือแจ้งข้อบกพร่อง ให้ผู้แจ้งระงับการก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารในส่วนที่ไม่ถูกต้องนั้นจนกว่าจะได้ปฏิบัติให้ถูกต้อง เว้นแต่เป็นการกระทำ เพื่อแก้ไขให้เป็นไปตามข้อเท็จจริงของเจ้าพนักงานท้องถิ่น ในกรณีที่ผู้แจ้งไม่ดำเนินการแก้ไขให้แล้วเสร็จภายในระยะเวลาที่เจ้าพนักงานท้องถิ่นได้กำหนดไว้ในหนังสือแจ้งข้อบกพร่อง ให้ผู้แจ้งแจ้งไม่ประสงค์จะก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารตามที่ได้ออกใบรับแจ้งออกต่อไป และให้เจ้าพนักงานท้องถิ่นมีคำสั่งยกเลิกใบรับแจ้ง ที่ได้ออกไว้และมีอำนาจดำเนินการตามกฎหมาย มาตรา ๕๑ (๑) และ (๒) และมาตรา ๕๒ แล้วแต่กรณี

(๔) ถ้าเจ้าพนักงานท้องถิ่นมีได้มีหนังสือแจ้งข้อบกพร่องให้ผู้แจ้งดำเนินการก่อสร้าง ดัดแปลง หรือรื้อถอนอาคาร แล้วแต่กรณี ให้ถือว่าอาคารก่อสร้าง ดัดแปลง หรือรื้อถอนอาคารดังกล่าวได้ขออนุญาตถูกต้องแล้ว เจ้าพนักงานท้องถิ่นมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง

(๕๑) กรณีเกี่ยวกับ

(၄၆) - ပုံနှိပ်ရေးနှင့် ပုံနှိပ်ရေးကုမ္ပဏီများ

(៤៣) ក្នុងកិច្ចសន្យាសហប្រតិបត្តិការរវាងក្រុមហ៊ុនប្រើប្រាស់ប្រព័ន្ធប្រតិបត្តិការកម្មវិធី

[illegible]

14210300-3: 14210300-3 14210300-3 14210300-3 14210300-3

กรมส่งเสริมการค้าระหว่างประเทศ กระทรวงพาณิชย์

[illegible]

សេចក្តីផ្តើម

संस्कृत-विश्व-विद्यालय, काशी

[illegible]

॥ श्रीगणेशाय नमः ॥

ภาคผนวก ก-3

ใบขออนุญาตเปลี่ยนแปลงการใช้อาคาร อ.5



ใบรับรองการก่อสร้าง การดัดแปลง หรือการเคลื่อนย้ายอาคารประเภทควบคุมการใช้

เลขที่ ๑๘ / ๒๕๖๖

ใบรับรองฉบับนี้แสดงว่า บริษัท วัน สุขุมวิท ๕๕ จำกัด โดย นายปิติพงษ์ ไตรนุรักษ์ และนายปิติ จารุกำจร
☒ เจ้าของอาคาร ☐ ผู้ครอบครองอาคาร อยู่บ้านเลขที่ ๔๙๖ ตรอก/ซอย
ถนน หมู่ที่ ๙ ตำบล/แขวง อำเภอ/เขต กรุงเทพมหานคร
จังหวัด สมุทรปราการ รหัสไปรษณีย์ ๑๐๒๗๐ ได้ทำการ ก่อสร้างอาคาร
เป็นไปโดยถูกต้องตามใบรับแจ้ง (ยผ.๔) เลขที่ ๕๑/๒๕๖๓ ลงวันที่ ๖ มีนาคม ๒๕๖๓
ซึ่งอาคารดังกล่าวเป็นอาคารประเภทควบคุมการใช้ เจ้าพนักงานท้องถิ่นจึงออกใบรับรองให้ ดังต่อไปนี้

ข้อ ๑ เป็นอาคาร

(๑) ชนิด ตึก ๓๒ ชั้น จำนวน ๑ หลัง เพื่อใช้เป็น โรงแรม (๒๔๑ ห้อง) ภัตตาคาร
ห้องประชุม จอดรถยนต์ (ระบบเคลื่อนย้ายรถด้วยเครื่องจักรกล) พื้นที่อาคาร/ความยาว ๒๒,๔๒๖.๐๐ ตารางเมตร
โดยมีที่จอดรถ ที่กัลบลด และทางเข้าออกของรถ จำนวน ๑๖๙ คัน

(๒) ชนิด จำนวน เพื่อใช้เป็น
พื้นที่อาคาร/ความยาว โดยมีที่จอดรถ ที่กัลบลด และทางเข้าออกของรถ จำนวน คัน
ที่บ้านเลขที่ ตรอก/ซอย สุขุมวิท ๕๕ ถนน สุขุมวิท หมู่ที่
ตำบล/แขวง คลองตันเหนือ อำเภอ/เขต วัฒนา จังหวัด กรุงเทพมหานคร รหัสไปรษณีย์ ๑๐๑๑๐
โดยมี บริษัท วัน สุขุมวิท ๕๕ จำกัด เป็นเจ้าของอาคาร หรือ
..... เป็นผู้ครอบครองอาคาร ในที่ดิน ☒ โฉนดที่ดิน
☐ น.ส. ๓ ☐ น.ส. ๓ ก. ☐ ส.ค. ๑ ☐ อื่น ๆ เลขที่ ๘๕๕๔
เป็นที่ดินของ บริษัท วรรณรินแลนด์แอสโซซิเอท จำกัด

ข้อ ๒ ผู้ได้รับใบรับรองต้องปฏิบัติตามเงื่อนไข ดังต่อไปนี้

(๑) ผู้ได้รับใบรับรองต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวง
ซึ่งออกตามความในมาตรา ๘ (๑๑) แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๖๒ หรือข้อบัญญัติท้องถิ่นซึ่ง
ออกตามความในมาตรา ๙ หรือมาตรา ๑๐ แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๖๒

(๒) ต้องปฏิบัติตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมฯ ตามหนังสือ ที่ กท ๑๑๐๔/๒๒๑
ลงวันที่ ๒๓ มกราคม ๒๕๖๓

(๓) ผู้ได้รับใบรับรองยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายว่าด้วยโรงแรม
และกฎหมายอื่นในส่วนที่เกี่ยวข้องต่อไป

ออกให้ ณ วันที่ เดือน พ.ศ. ๒๕๖๖


(ลายมือชื่อ) ผู้อนุญาต
(นายรัชชชัย นาคศักดิ์ศรี)
(.....ผู้อำนวยการสำนักการโยธา.....)

EIA = โครงการโรงแรม วัน สุขุมวิท ๕๕ ตำแหน่งปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

หมายเหตุ ๑. ข้อความใดที่ไม่ต้องการให้ขีดฆ่า

เจ้าพนักงานท้องถิ่น

๒. ใส่เครื่องหมาย✓ในช่อง□หน้าข้อความที่ต้องการ

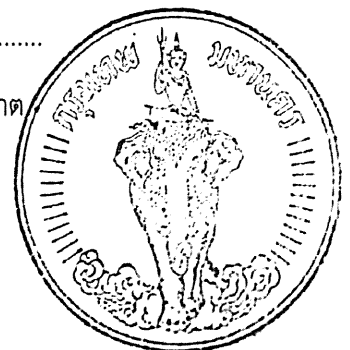

คำเตือน

๑. ห้ามเจ้าของหรือผู้ครอบครองอาคารใช้หรือยินยอมให้บุคคลใดใช้อาคารเพื่อกิจการอื่น นอกจากที่ระบุไว้ในใบรับรองฉบับนี้
๒. ห้ามเจ้าของหรือผู้ครอบครองอาคารเปลี่ยนการใช้อาคารประเภทควบคุมการใช้สำหรับกิจการหนึ่งไปใช้เป็นอาคารประเภทควบคุมการใช้สำหรับอีกกิจการหนึ่ง เว้นแต่จะได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น
๓. ห้ามเจ้าของหรือผู้ครอบครองอาคารที่ต้องมีพื้นที่หรือสิ่งก่อสร้างขึ้นเพื่อใช้เป็นที่พักจอดรถ ที่กักเก็บรถ และทางเข้าออกของรถตามที่กำหนดไว้ในกฎกระทรวง ดัดแปลงหรือใช้ที่จอดรถ ที่กักเก็บรถ และทางเข้าออกของรถนั้นเพื่อการอื่นไม่ว่าทั้งหมดหรือบางส่วน เว้นแต่จะได้รับใบอนุญาตจากเจ้าพนักงานท้องถิ่น
๔. ผู้ได้รับใบรับรองต้องแสดงใบรับรองฉบับนี้ไว้ในที่เปิดเผยและเห็นได้ง่าย ณ อาคารนั้น



ที่ กท ๐๙๐๓/๐๕๑๘/๕๕

สำนักการโยธา

๑๑๑ ถนนมิตรไมตรี เขตดินแดง กทม. ๑๐๔๐๐

- ๙ ก.พ. ๒๕๖๖

เรื่อง แจ้งผลการพิจารณา

เรียน กรรมการผู้จัดการ บริษัท วัน สุขุมวิท ๕๕ จำกัด

อ้างถึง ๑. คำร้องเลขรับที่ ท.๒๐๔ ลงวันที่ ๑๓ ธันวาคม ๒๕๖๕

๒. หนังสือแจ้งให้เจ้าพนักงานท้องถิ่นตรวจสอบการก่อสร้างอาคาร ตามแบบ ตส.๒ เลขรับที่ ๖
ลงวันที่ ๑๑ มกราคม ๒๕๖๖

ตามคำร้องที่อ้างถึง ๑ เจ้าพนักงานท้องถิ่นพิจารณาการขอแก้ไขแบบแปลนอาคารรายนี้ สามารถดำเนินการได้ตามกฎกระทรวง ฉบับที่ ๑๒ (พ.ศ. ๒๕๒๘) ข้อ ๓ โดยเป็นการแก้ไขแบบแปลนภายในอาคารที่ได้รับอนุญาต ไม่เป็นการเปลี่ยนแปลง ต่อเติม เพิ่มลด หรือขยายซึ่งลักษณะขอบเขต แบบ รูปทรง สัดส่วน หรือเนื้อที่ของส่วนต่าง ๆ ของอาคารที่ไม่เป็นโครงสร้างของอาคารอันเป็นการเพิ่มน้ำหนักให้แก่โครงสร้างของอาคารส่วนหนึ่งส่วนใดเกินร้อยละสิบ และต้องดำเนินการตามแบบแปลนที่ได้ยื่นแจ้งขอแก้ไขไว้เท่านั้น และตามหนังสือที่อ้างถึง ๒ เจ้าพนักงานท้องถิ่นได้พิจารณาตามพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๖๒ จึงขอให้ท่านไปขอรับใบรับรอง ตามแบบ อ.๕ ได้ที่ สำนักงานควบคุมอาคาร สำนักการโยธา ศาลาว่าการกรุงเทพมหานคร และต้องชำระค่าธรรมเนียม ดังต่อไปนี้

- ค่าธรรมเนียมใบรับรอง เป็นเงิน ๑๐๐.๐๐ บาท (หนึ่งร้อยบาทถ้วน)
- รวมเป็นเงินทั้งสิ้น ๑๐๐.๐๐ บาท (หนึ่งร้อยบาทถ้วน)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

(นายรัชชัย นภาคัดศรี)

ผู้อำนวยการสำนักการโยธา

ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร
เจ้าพนักงานท้องถิ่น

สำนักงานควบคุมอาคาร

โทร. ๐ ๒๒๐๓ ๒๔๐๐ ต่อ ๒๐๕๕

โทรสาร ๐ ๒๒๐๓ ๒๔๕๙

ภาคผนวก ก-4

แจ้งเปลี่ยนชื่อโครงการจาก "โครงการโรงแรม วัน สุขุมวิท 59

(One Sukhumvit 59 Hotel)"

เป็น "โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท

(InterContinental Bangkok Sukhumvit)

ที่ ONE59 01/2566

กองประเมินผลกระทบสิ่งแวดล้อม
เลขที่ ๕๖ ๕๒3 อ.พ. 2566
เวลา ๑๑.๐๙ ผู้รับ

บริษัท วัน สุขุมวิท 59 จำกัด
เลขที่ 496 หมู่ที่ 9 ตำบลสำโรงเหนือ
อำเภอเมืองสมุทรปราการ
จังหวัดสมุทรปราการ

สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม
ทรัพยากรธรรมชาติและสิ่งแวดล้อม
เลขที่ 4543 ๒๓ มี.ค. ๒๕๖๖
เวลา ๙.๒๕ ผู้รับ

20 มีนาคม 2566

เรื่อง แจ้งเปลี่ยนแปลงชื่อโครงการจาก “โครงการ โรงแรม วัน สุขุมวิท 59 (One Sukhumvit 59 Hotel)” เป็น
“โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit)”

เรียน เลขาธิการสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม

อ้างถึง หนังสือสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ที่ ทส 1010.5/2025 ลงวันที่
13 กุมภาพันธ์ 2563

- สิ่งที่แนบมาด้วย 1. หนังสือสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ที่ ทส 1010.5/2025 ลงวันที่ 13 กุมภาพันธ์ 2563 จำนวน 1 ชุด
2. สำเนาหนังสือจดทะเบียนบริษัท สำเนาบัตรประชาชน และสำเนาทะเบียนบ้านของกรรมการผู้มีอำนาจลงนาม จำนวน 1 ชุด

ตามที่ สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ได้มีมติให้ความเห็นชอบรายงาน
วิเคราะห์ผลกระทบสิ่งแวดล้อม โครงการ โรงแรม วัน สุขุมวิท 59 (One Sukhumvit 59 Hotel) ตั้งอยู่ที่ ถนน สุขุมวิท 59
และถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร ด้วยการพัฒนาที่ผ่านมา ดำเนินการโดย บริษัท
วัน สุขุมวิท 59 จำกัด เจ้าของโครงการได้ปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและมาตรการ
ติดตามตรวจสอบผลกระทบสิ่งแวดล้อมที่เสนอไว้ในรายงานขออย่างเคร่งครัด ตามหนังสือที่อ้างถึง

ในการนี้ บริษัท วัน สุขุมวิท 59 จำกัด ซึ่งเป็นผู้พัฒนาโครงการนั้นได้เปลี่ยนแปลงชื่อโครงการจาก “โครงการ
โรงแรม วัน สุขุมวิท 59 (One Sukhumvit 59 Hotel)” เป็น “โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท
(InterContinental Bangkok Sukhumvit)” และใคร่ขอเรียนแจ้งสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและ
สิ่งแวดล้อม เพื่อดำเนินการใด ๆ ที่เกี่ยวข้องกับโครงการมีความถูกต้องสอดคล้องกันและสามารถสืบค้นได้ในระบบ
ต่อไป

จึงเรียนมาเพื่อโปรดทราบและพิจารณาดำเนินการต่อไป

ศูนย์จัดการ
เลขที่ 612 วันที่ 23/3/66
1410

ขอแสดงความนับถือ

บริษัท วัน สุขุมวิท 59 จำกัด

เลขานุการกรม
๒๓ มี.ค. ๒๕๖๖

ผู้ประสานงานโครงการ

๑ ๑ ๑ ๑ ๒๕๖๖



ทะเบียนเลขที่ ๑๓๒๗

ใบอนุญาตเลขที่ ๔๓/๒๕๖๖

กระทรวงมหาดไทย

ใบอนุญาตประกอบธุรกิจโรงแรม

ใบอนุญาตฉบับนี้ให้ไว้เพื่อแสดงว่า บริษัท วัน สุขุมวิท 59 จำกัด

ได้รับอนุญาตให้ประกอบธุรกิจโรงแรมตามมาตรา ๑๕ แห่งพระราชบัญญัติ
โรงแรม พ.ศ. ๒๕๕๗ โดยใช้ชื่อภาษาไทยว่า อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท

ชื่อภาษาต่างประเทศ (ถ้ามี) InterContinental Bangkok Sukhumvit

โรงแรมประเภท ๓ จำนวนห้องพัก ๒๔๑ ห้อง

สถานที่ตั้ง เลขที่ ๑๐ ซอยสุขุมวิท ๕๙ (บุญชนะ)

แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร

ตั้งแต่วันที่ ๑๓ เดือน มีนาคม พ.ศ. ๒๕๖๖ ถึง วันที่ ๑๒ เดือน มีนาคม พ.ศ. ๒๕๗๑

ออกให้ ณ วันที่ ๑๓ เดือน มีนาคม พ.ศ. ๒๕๖๖

ตำแหน่งผู้ต้อง



(นายสมชัย เลิศประสิทธิพันธ์)

รองอธิบดี ปลัดกระทรวงมหาดไทย

อธิบดีกรมการปกครอง

นายทะเบียน

ประทับตราประจำตำแหน่งเป็นสำคัญ

ONE SUKHUMVIT 59
COMPANY LIMITED

ภาคผนวก ก-5

แจ้งเปลี่ยนชื่อบริษัทจาก บริษัท วัน สุขุมวิท 59 จำกัด
เป็น บริษัท สุขุมวิท 59 จำกัด

บริษัท วัน สุขุมวิท 59 จำกัด
One Sukhumvit 59 Company Limited

วันที่ 14 สิงหาคม 2568

เรียน กรรมการผู้จัดการ/ผู้จัดการฝ่ายบัญชีและการเงิน

เรื่อง การเปลี่ยนชื่อและที่อยู่นิติบุคคลของบริษัท

ข้าพเจ้า บริษัท วัน สุขุมวิท 59 จำกัด ("บริษัทฯ") ขอเรียนแจ้งท่านว่าบริษัทฯ ได้ดำเนินการเปลี่ยนแปลงข้อมูลนิติบุคคลของบริษัท และที่อยู่สำหรับการออกไปกำกับภาษี โดยมีรายละเอียดการเปลี่ยนแปลงและมีผลใช้บังคับดังนี้

รายการ	เดิม	ใหม่	วันที่มีผลใช้บังคับ
ชื่อบริษัทภาษาไทย	บริษัท วัน สุขุมวิท 59 จำกัด	บริษัท สุขุมวิท 59 จำกัด	15 สิงหาคม 2568
ชื่อบริษัท ภาษาอังกฤษ	One Sukhumvit 59 Co., Ltd.	Sukhumvit 59 Co., Ltd.	15 สิงหาคม 2568
ที่อยู่ของบริษัท	สาขาที่ 00001 เลขที่ 10 ซอยสุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร รหัสไปรษณีย์ 10110	สำนักงานใหญ่ เลขที่ 10 ซอยสุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวง คลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร รหัสไปรษณีย์ 10110	15 สิงหาคม 2568

ดังนั้น หากท่านมีความประสงค์จะออกหนังสือหรือส่งเอกสารใด ๆ ที่เกิดขึ้นอันเนื่องจากนิติสัมพันธ์ทางธุรกิจการค้า ซึ่งรวมถึงการออกไปกำกับภาษี การเรียกชำระเงิน บริษัทฯ ใครขอความกรุณาฯ ท่านดำเนินการแก้ไขข้อมูลให้สอดคล้องกับวันที่มีผลบังคับใช้

อย่างไรก็ตาม เลขทะเบียนนิติบุคคล เลขประจำตัวผู้เสียภาษีอากร รวมถึงรายละเอียดการติดต่อสื่อสารอื่น ๆ เช่น หมายเลขโทรศัพท์ หมายเลขโทรสาร อีเมลไม่มีการเปลี่ยนแปลง

บริษัทฯ ยังคงใช้บัญชีธนาคารเดิมในการทำธุรกรรมกับท่าน ท่านสามารถชำระหนี้โดยการโอนเงินเข้าบัญชีธนาคารของบริษัทฯ โดยใช้เลขที่บัญชีเดิมได้ตามปกติ โดยบริษัทฯ อยู่ระหว่างประสานงานเพื่อทำการเปลี่ยนชื่อบัญชีจาก บริษัท วัน สุขุมวิท 59 จำกัด เป็น บริษัท สุขุมวิท 59 จำกัด

บริษัท วัน สุขุมวิท 59 จำกัด
One Sukhumvit 59 Company Limited

ทั้งนี้ บริษัทฯ จะดำเนินการส่งหนังสือรับรองฉบับใหม่ที่ได้เปลี่ยนแปลง ชื่อ และที่อยู่ของบริษัทฯ และสำเนาคำขอ
แจ้งการเปลี่ยนแปลงทะเบียนภาษีมูลค่าเพิ่ม (ภ.พ.09) เมื่อบริษัทฯ ดำเนินการจดทะเบียนเปลี่ยนแปลงต่อหน่วยงานที่
เกี่ยวข้องเรียบร้อยแล้ว

หากมีข้อสงสัย กรุณาติดต่อฝ่ายจัดซื้อและฝ่ายบัญชีของบริษัทฯ โทรศัพท์หมายเลข 02-7605999 ต่อ 5407, 5402
จึงเรียนมาเพื่อทราบและดำเนินการ

ขอแสดงความนับถือ



บริษัท วัน สุขุมวิท 59 จำกัด

ภาคผนวก ก-6

สำเนาหนังสือส่งรายงานฯ

ระหว่างเดือนมกราคม ถึงมิถุนายน พ.ศ. 2568

ที่ ENG25071.....

เรื่อง ขอนำส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568)

เรียน ผู้อำนวยการเขตวัฒนา

สิ่งที่ส่งมาด้วย 1. รายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568) จำนวน 1 เล่ม

2. แผนที่สีตีพิมพ์ จำนวน 1 แผ่น

ตามที่คณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม โครงการ ด้านอาคาร การจัดสรรที่ดิน และบริการชุมชน กรุงเทพมหานคร ได้เห็นชอบรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ตั้งอยู่ห้วงมุมถนนซอยสุขุมวิท 59 และถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร เมื่อวันที่ 13 กุมภาพันธ์ พ.ศ. 2563 ตามหนังสือที่ ทส.1010.5/2025 โดยได้กำหนดให้โครงการจะต้องจัดส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมต่อหน่วยงานราชการที่เกี่ยวข้อง เป็นประจำทุก 6 เดือน นั้น

บัดนี้ ทางผู้จัดการ โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท ได้จัดทำรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบด้านสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568) เสร็จสิ้นเป็นที่เรียบร้อยแล้ว ทางบริษัทฯ จึงใคร่ขอนำส่งรายงานดังกล่าวให้กับหน่วยงานของท่านและดำเนินการตามขั้นตอนต่อไป

จึงเรียนมาเพื่อโปรดพิจารณา

ขอแสดงความนับถือ

ผู้จัดการ โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท

'29 ก.ค. 2568

ที่ ENG 25072

สรส.
เลขที่รับ 143
ลงวันที่ ๒๐ ก.ค. ๖๘

เรื่อง ขอนำส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568)

เรียน นายทะเบียนโรงแรม กรุงเทพฯ

สิ่งที่ส่งมาด้วย 1. รายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568) จำนวน 2 เล่ม
2. แผ่นซีดีรอม จำนวน 2 แผ่น

ตามที่คณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม โครงการด้านอาคาร การจัดสรรที่ดิน และบริการชุมชน กรุงเทพมหานคร ได้เห็นชอบรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ตั้งอยู่ห้วงมุมถนนซอยสุขุมวิท 59 และถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร เมื่อวันที่ 13 กุมภาพันธ์ พ.ศ. 2563 ตามหนังสือที่ ทส.1010.5/2025 โดยได้กำหนดให้โครงการจะต้องจัดส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมต่อหน่วยงานราชการที่เกี่ยวข้อง เป็นประจำทุก 6 เดือน นั้น

บัดนี้ ทางผู้จัดการโครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท ได้จัดทำรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบด้านสิ่งแวดล้อม โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit) ครั้งที่ 1/2568 (เดือนมกราคม ถึงมิถุนายน พ.ศ. 2568) เสร็จสิ้นเป็นที่เรียบร้อยแล้ว ทางบริษัทฯ จึงใคร่ขอนำส่งรายงานดังกล่าวให้กับหน่วยงานของท่านและดำเนินการตามขั้นตอนต่อไป

จึงเรียนมาเพื่อโปรดพิจารณา

ขอแสดงความนับถือ



ผู้จัดการโครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท

ได้รับต้นฉบับแล้ว

วันที่ ๒๐ ก.ค. ๖๘



ภาคผนวก ข

เอกสารประกอบผลการปฏิบัติตามมาตรการป้องกันและ
แก้ไขผลกระทบสิ่งแวดล้อม

ภาคผนวก ข-1

กฎระเบียบการเข้าพัก

กฎระเบียบของโรงแรม

เพื่อความปลอดภัยและความสะดวกสบายในการเข้าพักของแขกทุกท่าน โรงแรมได้จัดทำกฎระเบียบขึ้นตามข้อกำหนดและเงื่อนไขของโรงแรม แขกผู้เข้าพักทุกท่านจะต้องปฏิบัติตามกฎระเบียบดังกล่าว โรงแรมขอสงวนสิทธิ์ในการปฏิเสธการให้บริการแก่ผู้ที่ไม่ปฏิบัติตามกฎระเบียบ และอาจดำเนินการเพิ่มเติมตามความจำเป็น

1. กรุณาแสดงบัตรประจำตัวประชาชนที่เคาน์เตอร์ต้อนรับเมื่อเช็คอิน (บัตรประชาชนสำหรับผู้ที่พำนักในประเทศไทย)
2. ห้ามนำสิ่งของต่อไปนี้เข้าห้องพัก: อาวุธทุกประเภท, สารพิษ, หรือสิ่งของที่ติดไฟได้
3. ห้ามนำสัตว์เลี้ยง (ยกเว้นสุนัขนำทาง) และอาหารบางประเภทเข้ามาในโรงแรม (กรุณาติดต่อทีมงานต้อนรับเพื่อสอบถามรายการอาหารที่ห้ามนำเข้า)
4. ห้ามเล่นการพนันและใช้ยาเสพติดในโรงแรม ผู้ที่ฝ่าฝืนจะต้องรับผิดชอบตามกฎหมายของเวียดนามอย่างเต็มที่
5. ห้ามทำอาหารหรือสูบบุหรี่ในห้องพัก โรงแรมขอเรอามิน โยบทยพ่นที่ปลอดนุหรืในห้องพักและพื้นที่ส่วนกลางโดยเด็ดขาด และอาหารบางประเภทห้ามรับประทานในห้องพักและบริเวณโรงแรม โปรดทราบว่าโรงแรมจะเรียกเก็บค่าปรับ 5,000 บาท สำหรับผู้ที่ละเมิดกฎนี้
6. แขกผู้เข้าพักต้องรับผิดชอบต่อความเสียหายใดๆ ที่เกิดขึ้นกับทรัพย์สินของโรงแรม
7. ทรัพย์สินมีค่าของท่าน เช่น เครื่องประดับ เงินสด และอุปกรณ์อิเล็กทรอนิกส์ส่วนบุคคล ควรเก็บไว้ในตู้เซฟที่มีให้ในห้องพักหรือฝากไว้ที่เคาน์เตอร์ต้อนรับ โรงแรมจะไม่รับผิดชอบต่อการสูญหาย หากแขกผู้เข้าพัก ไม่ปฏิบัติตามกฎนี้
8. โรงแรมจะรับผิดชอบต่อการสูญหายหรือความเสียหายของทรัพย์สินของแขกในกรณีดังต่อไปนี้:
 - 8.1 การสูญหายหรือความเสียหายนั้นเกิดขึ้นภายในโรงแรม
 - 8.2 ทรัพย์สินที่สูญหายหรือเสียหาย ได้แก่ เงิน ทอง ธนบัตร เอกสาร เครื่องประดับ หรือของมีค่าอื่นๆ โรงแรมอินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท จะรับผิดชอบต่อทรัพย์สินดังกล่าวไม่เกิน 5,000 บาท ยกเว้นกรณีที่แขกได้ฝากทรัพย์สินไว้และแจ้งมูลค่าทรัพย์สินให้โรงแรมทราบอย่างชัดเจน
9. โรงแรมขอสงวนสิทธิ์ไม่รับผิดชอบในกรณีการสูญหายหรือความเสียหายที่เกิดจาก:
 - 9.1 เหตุสุดวิสัย
 - 9.2 ลักษณะของทรัพย์สินเอง หรือ
 - 9.3 ความผิดพลาดของแขก ผู้ติดตามของแขก หรือบุคคลที่แขกเชิญเข้ามา
10. เพื่อความปลอดภัย โปรดอย่าเปลี่ยนห้องพักหรือเคลื่อนย้ายทรัพย์สินส่วนตัวภายในโรงแรมโดยไม่แจ้งเคาน์เตอร์ต้อนรับ
11. ในกรณีเกิดไฟไหม้ โปรดสงบสติอารมณ์และใช้บันไดที่ใกล้ที่สุดเพื่อออกทางออกฉุกเฉิน ห้ามใช้ลิฟต์
12. เวลาเช็คอินคือ 15:00 น. และเวลาเช็คเอาท์คือ 12:00 น.

HOTEL REGULATIONS

To help ensure a safe and comfortable stay for our guests, the Hotel has developed a set of Regulations, based on the Terms and Conditions of the Hotel. All guests are asked to follow these Regulations. The Hotel reserves the right to refuse to allow any guest who fails to observe the Regulations to stay at the Hotel or use its facilities. Please note that the Hotel reserves the right to take other action as required.

1. Please ensure that you show a valid identification at the Front Desk upon check in. (ID Card for Thai Residents)
2. The following items are prohibited in the guest rooms: any weapons, toxic or flammable items.
3. You are not allowed to bring pets (aside to guide dogs) and many types of foods into the hotel (please check with our reception team for a certain item).
4. It is prohibited to gamble and use drugs in the hotel. Guests will be held fully responsible for any violations of the Vietnamese Law.
5. It is prohibited to cook or smoke in any guest room are committed to providing a smoking-free environment in nonsmoking guestrooms and public spaces. Our hotel enforces a strict non-smoking policy and also certain foods are forbidden to be eaten in our guest rooms and within the hotel. Please note that mandatory fines THB 5,000 are imposed for any breaches of these regulations.
6. Guests are responsible for any damage to hotel facilities.
7. Your valuables such as jewelry, money and personal electronic equipment must be kept in the safety box provided in the room or deposited at the Front Desk. The hotel will not be responsible for any loss if guests do not follow this regulation.
8. Hotel will be responsible for any loss or damage to the property of the Hotel's guests in the event of the following:
 - 1.1) Such loss or damage occurred in the hotel.
 - 1.2) Such loss or damage property as referred to in 1.1) are money, gold, notes, bills, jewelry, or other valuables. InterContinental Bangkok Sukhumvit's responsibility for the loss or damage to the property referred to above shall be limited to Baht 5,000. Unless the guest has deposited and clearly stated the value of his/her property to the Hotel.
9. Hotel reserves the right not be responsible for such loss or damage if caused by:
 - 1.3) Force majeure.
 - 1.4) The nature of the property, or
 - 1.5) The fault of the guest, guest's attendants or a person whom he/she has received or invited in.
10. For security reasons please do not change your room or relocate any personal belongings in the hotel without informing the Front Desk.
11. In case of fire please remain calm and take the nearest stairs to the emergency exit. Please do not use the elevators.
12. Our check-in time is from 15:00 hrs. and the check-out time is at 12:00 hrs.

ภาคผนวก ข-2

เอกสารรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ทส.1 ทส.2
ช่วงเดือนกรกฎาคม ถึงธันวาคม พ.ศ. 2568

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน กรกฎาคม พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ บริษัท วัน สุขุมวิท 59 จำกัด เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเดิมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ) ท่อระบายน้ำสาธารณะ

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด จ้างบริษัทสูบน้ำออก

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 7,021.500 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 2,741.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,193.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | | |
|-------|--------|----------|
| | ปริมาณ | หน่วย |
| 1. EM | 1.000 | กิโลกรัม |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบลำตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 0.00 กิโลกรัม
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน สิงหาคม พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ บริษัท วัน สุขุมวิท 59 จำกัด เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

1. ระบบบำบัดน้ำเสียแบบบ่อเติมอากาศ (Aerated Lagoon หรือ AL)

190.00 ลบ.ม./วัน

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเติมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ) ท่อระบายน้ำสาธารณะ

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด จ้างบริษัทสูบน้ำออก

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 7,021.500 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 2,968.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,374.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | | |
|-------|--------|----------|
| | ปริมาณ | หน่วย |
| 1. EM | 1.000 | กิโลกรัม |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบลำตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 0.00 กิโลกรัม
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป

จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน กันยายน พ.ศ. 2568
ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ นายชาคริต โพธิสารรัตน์ เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

1. ระบบบำบัดน้ำเสียแบบบ่อเติมอากาศ (Aerated Lagoon หรือ AL)

190.00 ลบ.ม./วัน

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเติมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ) ท่อระบายน้ำสาธารณะ

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด จ้างบริษัทสูบน้ำออก

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 6,795.000 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 2,536.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,029.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | | |
|-------|--------|----------|
| | ปริมาณ | หน่วย |
| 1. EM | 1.000 | กิโลกรัม |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบลำตัวตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 0.00 กิโลกรัม
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน ตุลาคม พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ นายชาคริต โพธิ์สารรัตน์ เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

1. ระบบบำบัดน้ำเสียแบบบ่อเติมอากาศ (Aerated Lagoon หรือ AL)

190.00 ลบ.ม./วัน

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเติมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ) ท่อระบายน้ำสาธารณะ

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด จ้างบริษัทสูบน้ำออก

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 7,021.500 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 2,753.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,202.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | | |
|-------|--------|----------|
| | ปริมาณ | หน่วย |
| 1. EM | 1.000 | กิโลกรัม |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบลำตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 12,000.00 ลบ.ม.
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน พฤศจิกายน พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

1. ระบบบำบัดน้ำเสียแบบบ่อเติมอากาศ (Aerated Lagoon หรือ AL)

190.00 ลบ.ม./วัน

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเติมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ) ท่อระบายน้ำสาธารณะ

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด แจ้งบริษัทสูบออก

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 6,795.000 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 3,681.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,945.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | |
|-------|--------------|
| 1. EM | ปริมาณ หน่วย |
| | 0.500 ลิตร |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 0.00 กิโลกรัม
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

ชื่อแหล่งกำเนิดมลพิษ : วัน สุขุมวิท 59 จำกัด

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ : 10 (บุญชนะ)

หมู่ที่ :

ซอย : สุขุมวิท 59

ถนน : สุขุมวิท 59

แขวง/ตำบล : คลองตันเหนือ

เขต/ตำบล : เขตวัฒนา

จังหวัด : กรุงเทพมหานคร

โทรศัพท์ :

โทรสาร :

มี : เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท : โรงแรม

ประเภทย่อย : ประเภท ก ตั้งแต่ 200 ห้องขึ้นไป จำนวนห้อง : 241

สังกัด : < สังกัด >

ใบอนุญาตเลขที่ (ถ้ามี) : 43/2566

ออกให้โดย : กรมการปกครอง

หมดอายุ : 12/03/2571

ในการนี้ ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษสำหรับ เดือน ธันวาคม พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา 80 แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. 2535 ในฐานะ

ลงชื่อ นายชาคริต โพธิ์สารรัตน์ เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ลงชื่อ _____ ผู้ควบคุมระบบบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

ลงชื่อ _____ ผู้รับจ้างให้บริการบำบัดน้ำเสีย

ใบอนุญาตเลขที่ _____ หมดอายุ _____

ออกให้โดย _____

2. ข้อมูลเกี่ยวกับระบบน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(1) ประเภท / ชนิดของระบบบำบัดน้ำเสีย

ความสามารถในการบำบัดน้ำเสีย

1. ระบบบำบัดน้ำเสียแบบแอกทิเวเตดสลัดจ์ (Activated Sludge Process)

190.00 ลบ.ม./วัน

(2) การทำงานของระบบบำบัดน้ำเสีย

[X] แบบต่อเนื่อง 24 ชั่วโมง/วัน

[] แบบไม่ต่อเนื่อง (ระบุ)

(3) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย

[X] เครื่องสูบน้ำ

[X] ระบบเติมอากาศ

[X] เครื่องกวน/ผสมน้ำเสีย

[] เครื่องกวน/ผสมสารเคมี

[X] เครื่องสูบลำโพง

[] อื่นๆ

[] อื่นๆ

[] อื่นๆ

(4) แหล่งรองรับน้ำทิ้ง (ระบุ)

(5) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด

3. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

- (1) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 7,021.500 หน่วย
- (2) ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.) 3,244.000 ลบ.ม.
- (3) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2,595.000 ลบ.ม.
- (4) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย
- | | | |
|-------|------------------------------------|-----|
| [X] | ระบายทุกวัน | |
| [] | ระบายบางวัน (ระบุจำนวนวันที่ระบาย) | วัน |
| [] | ไม่ระบายเลย | |
- (5) ปริมาณสารเคมี หรือสารสกัดชีวภาพที่ใช้
- | | |
|----|----------------|
| 1. | ปริมาณ หน่วย |
| | 0.000 กิโลกรัม |
- (6) การทำงานของระบบบำบัดน้ำเสีย
- | | | |
|-----------------------|------------|-------------|
| ระบบบำบัดน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบน้ำ | [X] ปกติ | [] ผิดปกติ |
| ระบบเติมอากาศ | [X] ปกติ | [] ผิดปกติ |
| เครื่องกวน/ผสมน้ำเสีย | [X] ปกติ | [] ผิดปกติ |
| เครื่องสูบลำตะกอน | [X] ปกติ | [] ผิดปกติ |
- (7) ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด 0.00 กิโลกรัม
- (8) ปัญหา อุปสรรค และแนวทางแก้ไข

- คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖
๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

ภาคผนวก ข-3

เอกสารแต่งตั้งเจ้าหน้าที่ดูแลระบบบำบัดน้ำเสีย



ประกาศ

เรื่อง แต่งตั้งเจ้าหน้าที่ดูแลระบบบำบัดน้ำเสีย

โครงการ อินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท (InterContinental Bangkok Sukhumvit)

ของ บริษัท สุขุมวิท 59 จำกัด

ด้วยบริษัท วัน สุขุมวิท 59 จำกัด ได้คำนึงถึงผลกระทบทางด้านสิ่งแวดล้อม และประชาชนที่อาศัยอยู่ข้างเคียงโครงการฯ จึงจัดให้มีเจ้าหน้าที่ที่มีความรู้ความชำนาญดูแลรักษาและควบคุมระบบบำบัดน้ำเสียของโครงการฯ ให้ทำงานได้อย่างต่อเนื่องและมีประสิทธิภาพ เพื่อสิ่งแวดล้อมโดยรอบของโครงการฯ ทางบริษัทจึงได้แต่งตั้ง  ปฏิบัติหน้าที่ดังกล่าว ตั้งแต่วันที่ 26 สิงหาคม พ.ศ. 2568 เป็นต้นไป

ประกาศ ณ วันที่ 26 สิงหาคม พ.ศ. 2568



ตำแหน่งผู้จัดการทั่วไป โรงแรมอินเตอร์คอนติเนนตัล กรุงเทพฯ สุขุมวิท

ภาคผนวก ข-4

ใบเสร็จสูบกากตะกอน ช่วงเดือนกรกฎาคม ถึงธันวาคม พ.ศ. 2568

ใบกำกับภาษี/ใบเสร็จรับเงิน

ต้นฉบับ (เอกสารออกเป็นชุด)

(สำนักงานใหญ่)
279/1 ถนนริมทางรถไฟสายแปดริ้ว แขวงทุ่งพญาไท เขตราชเทวี กรุงเทพฯ
10400
เลขประจำตัวผู้เสียภาษี 5103700009275
โทร. 0641644446

เลขที่ INV2025070015
วันที่ 31/07/2025
ผู้ขาย
อ้างอิง BL2025070014

ลูกค้า

บริษัท วัน สุขุมวิท 59 จำกัด (00001)
เลขที่ 10 ซอย สุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา
จังหวัด กรุงเทพมหานคร 10110
เลขประจำตัวผู้เสียภาษี 0115561027556

#	รายละเอียด	จำนวน	ราคาต่อหน่วย	ส่วนลด	มูลค่า
1	สุบกากบ่อปฏิฐและบ่อไขมัน -(กรกฎาคม 2568)-	1	5,500.00		5,500.00

(ห้าพันแปดร้อยแปดสิบห้าบาทถ้วน)

รวมเป็นเงิน 5,500.00 บาท
ภาษีมูลค่าเพิ่ม 7% 385.00 บาท
จำนวนเงินรวมทั้งสิ้น 5,885.00 บาท
หักภาษี ณ ที่จ่าย 3% 165.00 บาท
ยอดชำระ 5,720.00 บาท

การชำระเงินจะสมบูรณ์เมื่อบริษัทได้รับเงินเรียบร้อยแล้ว ☐ เงินสด ☐ เช็ค ☐ โอนเงิน ☐ บัตรเครดิต

ธนาคาร เลขที่ วันที่ จำนวนเงิน

ในนาม บริษัท วัน สุขุมวิท 59 จำกัด

ในนาม นาย สุไลมาน แอนนาร์

ผู้จ่ายเงิน

วันที่

ผู้รับเงิน

วันที่

31/07/2025

ใบกำกับภาษี/ใบเสร็จรับเงิน

ต้นฉบับ (เอกสารออกเป็นชุด)

(สำนักงานใหญ่)
279/1 ถนนริมทางรถไฟสายแปดริ้ว แขวงทุ่งพญาไท เขตราชเทวี กรุงเทพฯ
10400
เลขประจำตัวผู้เสียภาษี 5103700009275
โทร. 0641644446
บริการดูดส้วม.net

เลขที่ INV2025080016
วันที่ 28/08/2025
ผู้ขาย
อ้างอิง BL2025080016

ลูกค้า

บริษัท สุขุมวิท 59 จำกัด (สำนักงานใหญ่)
เลขที่ 10 ซอย สุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา
จังหวัด กรุงเทพมหานคร 10110
เลขประจำตัวผู้เสียภาษี 0115561027556

#	รายละเอียด	จำนวน	ราคาต่อหน่วย	ส่วนลด	มูลค่า
1	สื่อกากบ่อปฏิรูปและบ่อไขมัน -(สิงหาคม 2568)-	1	5,500.00		5,500.00

(ห้าพันแปดร้อยแปดสิบห้าบาทถ้วน)

รวมเป็นเงิน 5,500.00 บาท
ภาษีมูลค่าเพิ่ม 7% 385.00 บาท
จำนวนเงินรวมทั้งสิ้น 5,885.00 บาท

หักภาษี ณ ที่จ่าย 3% 165.00 บาท
ยอดชำระ 5,720.00 บาท

การชำระเงินจะสมบูรณ์เมื่อบริษัทได้รับเงินเรียบร้อยแล้ว ☐ เงินสด ☐ เช็ค ☐ โอนเงิน ☐ บัตรเครดิต

ธนาคาร เลขที่ วันที่ จำนวนเงิน

ในนาม บริษัท สุขุมวิท 59 จำกัด

ในนาม นาย สุไลมาน แอนนาร์

ผู้จ่ายเงิน

วันที่

ผู้รับเงิน

วันที่

ใบกำกับภาษี/ใบเสร็จรับเงิน

ต้นฉบับ (เอกสารออกเป็นชุด)

(สำนักงานใหญ่)
279/1 ถนนริมทางรถไฟสายแปดริ้ว แขวงทุ่งพญาไท เขตราชเทวี กรุงเทพฯ
10400
เลขประจำตัวผู้เสียภาษี 5103700009275
โทร. 0641644446
บริการดูดส้วม.net

เลขที่ INV2025090008
วันที่ 30/09/2025
ผู้ขาย
อ้างอิง BL2025090009

ลูกค้า

บริษัท สุขุมวิท 59 จำกัด (สำนักงานใหญ่)
เลขที่ 10 ซอย สุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา
จังหวัด กรุงเทพมหานคร 10110
เลขประจำตัวผู้เสียภาษี 0115561027556

#	รายละเอียด	จำนวน	ราคาต่อหน่วย	ส่วนลด	มูลค่า
1	สุกากบ่อปฏิภูมและบ่อไขมัน -(ก้นยายน 2568)-	1	5,500.00		5,500.00

(ห้าพันแปดร้อยแปดสิบห้าบาทถ้วน)

รวมเป็นเงิน 5,500.00 บาท
ภาษีมูลค่าเพิ่ม 7% 385.00 บาท
จำนวนเงินรวมทั้งสิ้น 5,885.00 บาท

หักภาษี ณ ที่จ่าย 3% 165.00 บาท
ยอดชำระ 5,720.00 บาท

การชำระเงินจะสมบูรณ์เมื่อบริษัทได้รับเงินเรียบร้อยแล้ว ☐ เงินสด ☐ เช็ค ☐ โอนเงิน ☐ บัตรเครดิต

ธนาคาร เลขที่ วันที่ จำนวนเงิน

ในนาม บริษัท สุขุมวิท 59 จำกัด

ในนาม นาย สุไลมาน แอนวาร์

ผู้จ่ายเงิน

วันที่

ผู้รับเงิน

วันที่

30/09/2025

ใบกำกับภาษี/ใบเสร็จรับเงิน

ต้นฉบับ (เอกสารออกเป็นชุด)

(สำนักงานใหญ่)

279/1 ถนนริมทางรถไฟสายแปดริ้ว แขวงทุ่งพญาไท เขตราชเทวี กรุงเทพฯ
10400
เลขประจำตัวผู้เสียภาษี 5103700009275
โทร. 0641644446
บริการดูดส้วม.net

เลขที่ INV2025100009
วันที่ 31/10/2025
ผู้ขาย
อ้างอิง BL2025100007

ลูกค้า

บริษัท สุขุมวิท 59 จำกัด (สำนักงานใหญ่)
เลขที่ 10 ซอย สุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา
จังหวัด กรุงเทพมหานคร 10110
เลขประจำตัวผู้เสียภาษี 0115561027556

#	รายละเอียด	จำนวน	ราคาต่อหน่วย	ส่วนลด	มูลค่า
1	สุกกาบ่อปฏิภูมและบ่อไขมัน -(ตุลาคม 2568)-	1	5,500.00		5,500.00

(ห้าพันแปดร้อยแปดสิบห้าบาทถ้วน)

รวมเป็นเงิน 5,500.00 บาท
ภาษีมูลค่าเพิ่ม 7% 385.00 บาท
จำนวนเงินรวมทั้งสิ้น 5,885.00 บาท
หักภาษี ณ ที่จ่าย 3% 165.00 บาท
ยอดชำระ 5,720.00 บาท

การชำระเงินจะสมบูรณ์เมื่อบริษัทได้รับเงินเรียบร้อยแล้ว ☐ เงินสด ☐ เช็ค ☐ โอนเงิน ☐ บัตรเครดิต

ธนาคาร เลขที่ วันที่ จำนวนเงิน

ในนาม บริษัท สุขุมวิท 59 จำกัด

ในนาม นาย สุไลมาน แอนนาร์

ผู้จ่ายเงิน

วันที่

ผู้รับเงิน

วันที่

31/10/2025

ใบกำกับภาษี/ใบเสร็จรับเงิน

ต้นฉบับ (เอกสารออกเป็นชุด)

(สำนักงานใหญ่)
279/1 ถนนริมทางรถไฟสายแปดริ้ว แขวงทุ่งพญาไท เขตราชเทวี กทม 10400
เลขประจำตัวผู้เสียภาษี 5103700009275
โทร. 0641644446
บริการลูกค้า.net

เลขที่ INV2025110006
วันที่ 27/11/2025
ผู้ขาย
อ้างอิง BL2025110004

ลูกค้า

บริษัท สุขุมวิท 59 จำกัด (สำนักงานใหญ่)
เลขที่ 10 ซอย สุขุมวิท 59 (บุญชนะ) ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา
จังหวัด กรุงเทพมหานคร 10110
เลขประจำตัวผู้เสียภาษี 0115561027556

#	รายละเอียด	จำนวน	ราคาต่อหน่วย	ส่วนลด	มูลค่า
1	สุบกากบ่อปฏิฐและบ่อไขมัน -(พฤศจิกายน 2568)-	1	5,500.00		5,500.00

(ห้าพันแปดร้อยแปดสิบห้าบาทถ้วน)

รวมเป็นเงิน 5,500.00 บาท
ภาษีมูลค่าเพิ่ม 7% 385.00 บาท
จำนวนเงินรวมทั้งสิ้น 5,885.00 บาท
หักภาษี ณ ที่จ่าย 3% 165.00 บาท
ยอดชำระ 5,720.00 บาท

การชำระเงินจะสมบูรณ์เมื่อบริษัทได้รับเงินเรียบร้อยแล้ว ☐ เงินสด ☐ เช็ค ☐ โอนเงิน ☐ บัตรเครดิต

ธนาคาร เลขที่ วันที่ จำนวนเงิน

ในนาม บริษัท สุขุมวิท 59 จำกัด

ในนาม นาย สุไลมาน แอนวาร์

ผู้จ่ายเงิน

วันที่

ผู้รับเงิน

วันที่

ภาคผนวก ข-5

เอกสารการสอบอุปกรณ์ประจำสระว่ายน้ำ
และตรวจวัด pH คลอรีนในสระว่ายน้ำ
ช่วงเดือนกรกฎาคม ถึงธันวาคม พ.ศ. 2568

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	✓		✓		✓		
	M							
	L							
CDU Roof Top		✓		✓		✓		
Elevator Room		✓		✓		✓		
Air 1+2		✓				✓		
AIR 3+4 279		✓		✓		✓		
Booster Pump Room				A		A		
Hotwater Room	(tank 1)	68 c'	c'	67.6 c'	c'	67 c'	c'	
	(tank2)	60 c'	c'	61.1 c'	c'	61 c'	c'	
Pool pump room (salt cell)	No.1	2000		3000		3000		
	No.2	2900		2900		2900		
	No.3	3000		3900		3900		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.3		1.5		1.0		
	PH	7.5		8.6		7.6		
It room		✓		✓		✓		
Canteen room		✓		✓		✓		
Linen shoot		✓		✓		✓		
Gennaretor		A		A		A		
AIR 1/1				✓		✓		
AIR 1/2								
AIR 2/1		✓						
AIR 2/2								
Oil Gannaretor		940 L	L	940 L	L	940 L	L	100% den.
CDU Floor 12		✓		✓		✓		
Pe AHU Floor 12		✓		✓		✓		
sound system	Ch-1	✓		✓		✓		
	Ch-2	✓		✓		✓		
	Ch-3	✓		✓		✓		
	Ch-4	✓		✓		✓		
GAS	Power	ON		ON		ON		
	IN LINE	26		25		20		
	L Rack	90		100		100		
	R Rack	100		110		110		
	Temp(c')	65		64		66		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	A		A		A		
Oil Fire pump		685 L	L	685 L	L	685 L	L	100% den.
Under ground Tank	H	✓		✓		✓		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	ON		ON		ON		
	EQP-2	A		A		A		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	FFP-1	A		A		A		
	FFP-2	A		A		A		
	SDJ-1	A		A		A		
Alarm system		✓		✓		✓		
CCTV Room		✓		✓		✓		
Auto Parking	SUV	✓		✓		✓		
	Sedan	✓		✓		✓		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	✓		✓		✓		
	M							
	L							
CDU Roof Top		✓		✓		✓		
Elevator Room		✓		✓		✓		
AIR 1+2		✓		✓		✓		
AIR 3+4		✓		✓		✓		
Booster Pump Room		A		A		A		
Hotwater Room	(tank 1)	69 c'	c'	61 c'	c'	59.7 c'	c'	
	(tank2)	60 c'	c'	60 c'	c'	60.2 c'	c'	
Pool pump room (salt cell)	No.1	2800		2900		3000		
	No.2	2800		2800		3000		
	No.3	2700		3800		3000		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.5		1.0		3.0		
	PH	7.6		8.6		7.6		
It room		✓		✓		✓		
Canteen room		✓		✓		✓		
Linen shoot		✓		✓		✓		
Gennaretor		A		A		A		
AIR 1/1		✓		✓		✓		
AIR 1/2		✓						
AIR 2/1		✓						
AIR 2/2		✓						
Oil Gannaretor		915 L	L	915 L	L	915 L	L	
CDU Floor 12		✓		✓		✓		
Pe AHU Floor 12		✓		✓		✓		
sound system	Ch-1	✓		✓		✓		
	Ch-2	✓		✓		✓		
	Ch-3	✓		✓		✓		
	Ch-4	✓		✓		✓		
GAS	Power	ON		ON		ON		
	IN LINE	96		25		27		
	L Rack	90		100		90		
	R Rack	0		0		0		
	Temp(c')	61		63		65		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	A		A		A		
Oil Fire pump		625 L	L	635 L	L	625 L	L	
Under ground Tank	H	✓		✓		✓		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	M		M		M		
	EQP-2	A		OL		OL		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EFP-1	A		M		A		
	EFP-2	A		A		A		
	SDJ-1	A		A		A		
Alarm system		✓		✓		✓		
CCTV Room		✓		✓		✓		
Auto Parking	SUV	✓		✓		✓		
	Sedan	✓		✓		✓		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

A=Auto

M=Manual

O=OFF

Duty ENG

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
AIR 1+2		/		/		/		
AIR 3+4								
Booster Pump Room								
Hotwater Room	(tank 1)	0		0		0		
	(tank 2)	61 c'	c'	61 c'	c'	58 c'	c'	
Pool pump room (salt cell)	No.1	3100		3100		3000		
	No.2	3000		3000		3000		
	No.3	4100		4100		4100		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.5		1.5		1.5		
	PH	7.6		7.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		/		/		/		
AIR 1/1		/		/		/		
AIR 1/2		/		/		/		
AIR 2/1		/		/		/		
AIR 2/2		/		/		/		
Oil Gannaretor		900 L	L	900 L	L	900 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	96		96		96		
	L Rack	73		75		76		
	R Rack	80		80		90		
	Temp(c')	62		64		65		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	A		A		A		
Oil Fire pump		620 L	L	620 L	L	620 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	A		A		A		
	EQP-2	A		A		A		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EFP-1	M		M		M		
	EFP-2	M		M		M		
	SDJ-1	A		A		A		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

A=Auto

M=Manual

O=OFF

Duty ENG

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
Air 1+2		1		1		/		
AIR 3+4		4		4		/		
Booster Pump Room				OFF		OFF		
Hotwater Room	(tank 1)	62.2 c'	c'	61.3 c'	c'	60.2 c'	c'	
	(tank 2)	59.2 c'	c'	61.5 c'	c'	57.8 c'	c'	
Pool pump room (salt cell)	No.1	2800		2900		2		
	No.2	2700		2800		3		
	No.3	3600		3600		3		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.6		1.5		1.0		
	PH	8.2		8.2		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		A		A		A		
AIR 1/1						/		
AIR 1/2				/				
AIR 2/1								
AIR 2/2		/		/				
Oil Gannaretor		890 L	L	845 L	L	885 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	26		26		26		
	L Rack	420		420		420		
	R Rack	65		75		70		
	Temp(c')	65		62		65		
Fire Pump	Jocky			A		A		
	ELECTRIC			A		A		
	Engine			OFF		OFF		
Oil Fire pump		662 L	L	660 L	L	660 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	A		A		A		
	EQP-2	A		A		A		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EFP-1	A		A		A		
	EFP-2	A		A		A		
	SDJ-1	A		A		A		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
Air 1+2		/		/		/		
AIR 3+4		/		/		/		
Booster Pump Room		/		/		/		
Hotwater Room	(tank 1)	54 c'	c'	50 c'	c'	53 c'	c'	
	(tank2)	53 c'	c'	51 c'	c'	55 c'	c'	
Pool pump room (salt cell)	No.1	2000		3100		3100		
	No.2	2200		3000		3000		
	No.3	2200		3000		3000		
Pool pump	No.1	A		A		A		019 021704512
	No.2	A		A		A		
	CL	1.0		1.5		0.6		
	PH	7.8		7.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		/		/		/		
AIR 1/1		/		/		/		
AIR 1/2		/		/		/		
AIR 2/1		/		/		/		
AIR 2/2		/		/		/		
Oil Gannaretor		920 L	L	920 L	L	920 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	ON		ON		ON		
	L Rack	0		100		90		
	R Rack	75		75		80		
	Temp(c')	64		64		65		
Fire Pump	Jocky	/		/		/		
	ELECTRIC	/		/		/		
	Engine	/		/		/		
Oil Fire pump		700 L	L	700 L	L	700 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	/		/		/		
	No.2	/		/		/		
	No.3	/		/		/		
Treatment system	EQP-1	/		/		/		
	EQP-2	/		/		/		
	EQJ-1	/		/		/		
	AEJ-1	/		/		/		
	AEJ-2	/		/		/		
	SLP-1	/		/		/		
	EFP-1	/		/		/		
	EFP-2	/		/		/		
	SDJ-1	/		/		/		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

Q=OFF

Remark

A=Auto

M=Manual

Q=OFF

Duty ENG

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
AIR 1+2		/		/		/		
AIR 3+4								
Booster Pump Room		0		0		0		
Hotwater Room	(tank 1)	69 c'	c'	55 c'	c'	59 c'	c'	
	(tank 2)	60 c'	c'	55 c'	c'	58 c'	c'	
Pool pump room (salt cell)	No.1	3100		3100		3100		
	No.2	9000		3300		2800		
	No.3	-		0		-		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	2.9		1.3		1.5		
	PH	7.7		2.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		A		A		A		
AIR 1/1								
AIR 1/2		/		/		/		
AIR 2/1		/						
AIR 2/2								
Oil Gannaretor		900 L	L	900 L	L	900 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	27		28		29		
	L Rack	0		85		75		
	R Rack	0		85		85		
	Temp(c')	65		64		67		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	0		0		0		
Oil Fire pump		680 L	L	680 L	L	680 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	0		A		0		
	No.2	0		A		0		
	No.3	0		A		0		
Treatment system	EQP-1	0		A		0		
	EQP-2	0		A		0		
	EQJ-1	0		A		0		
	AEJ-1	0		0		0		
	AEJ-2	0		0		0		
	SLP-1	0		A		0		
	FFP-1	0		A		0		
	FFP-2	0		A		0		
	SDJ-1	0		0		0		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

ภาคผนวก ข-6

เอกสารตรวจสอบการทำงานของระบบไฟฟ้า
ช่วงเดือนกรกฎาคม ถึงธันวาคม พ.ศ. 2568

INTERCONTINENTAL

Date 31/1/25

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	995			397	395		
		S	996			401	400		
		T	994			398	395		
	AMPERE	R	437			580	480		
		S	409			544	487		
		T	431			550	446		
	POWER FACTOR		1.00			1.0	1		
	TRANSFORMER TEMP(C.) 1		49			48	47		
	TRANSFORMER TEMP(C.) 2		45			49	45		
	TRANSFORMER TEMP(C.) 3		46			42	46		
WATT -HOURMTER KWH		1.23 kWh			4.2355 kWh	1.236			
MDB NO 2.	VOLTAGE MDB 2	R	999			397	394		
		S	996			400	399		
		T	994			397	394		
	AMPERE	R	415			567	362		
		S	388			516	301		
		T	408			560	335		
	POWER FACTOR		1.00			1.0	1		
	TRANSFORMER TEMP(C.) 1		44			45	46		
	TRANSFORMER TEMP(C.) 2		45			49	47		
	TRANSFORMER TEMP(C.) 3		43			49	46		
WATT -HOURMTER KWH		1.27 kWh			4.4014 kWh	1.402			
EMDB 1.	IN COMING	R	994			398	395		
		S	997			401	400		
		T	994			397	394		
	AMPERE	R	39			43	42		
		S	46			46	43		
		T	30			30	31		
	WATT -HOURMTER KWH		821.65 kWh			821.93 kWh	822.05		
	OUT GOING	R	993			397	392		
		S	996			401	399		
		T	994			395	393		
	AMPERE	R	30			45	39		
		S	41			46	42		
		T	31			30	31		
	WATT -HOURMTER KWH		798.01 kWh			828.29 kWh	798.40		
EMDB 2.	IN COMING	R	994			397	395		
		S	997			401	400		
		T	994			397	395		
	AMPERE	R	45			68	57		
		S	46			78	45		
		T	52			76	42		
	WATT -HOURMTER KWH		88.61 kWh			88.93 kWh	89.107		
	OUT GOING	R	993			397	395		
		S	996			401	398		
		T	994			395	397		
	AMPERE	R	79			56	74		
		S	79			44	62		
		T	83			93	64		
	WATT -HOURMTER KWH		490.02 kWh			490.32 kWh	476.52		
Check by									

Duty ENG

31/2/25

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	✓		✓		✓		
	M							
	L							
CDU Roof Top		✓		✓		✓		
Elevator Room		✓		✓		✓		
Air 1+2		✓		✓		✓		
AIR 3+4		✓		✓		✓		
Booster Pump Room				A		A		
Hotwater Room	(tank 1)	62 c'	c'	61.6 c'	c'	61 c'	c'	
	(tank 2)	60 c'	c'	61.1 c'	c'	61 c'	c'	
Pool pump room (salt cell)	No.1	3000		3000		3000		
	No.2	2900		2900		2900		
	No.3	3000		3000		3000		
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.5		1.5		1.0		
	PH	7.5		8.6		7.6		
It room		✓		✓		✓		
Canteen room		✓		✓		✓		
Linen shoot		✓		✓		✓		
Gennaretor		A		A		A		
AIR 1/1				✓		✓		
AIR 1/2		✓						
AIR 2/1		✓						
AIR 2/2								
Oil Gannaretor		940 L	L	940 L	L	940 L	L	100% den.
CDU Floor 12		✓		✓		✓		
Pe AHU Floor 12		✓		✓		✓		
sound system	Ch-1	✓		✓		✓		
	Ch-2	✓		✓		✓		
	Ch-3	✓		✓		✓		
	Ch-4	✓		✓		✓		
GAS	Power	ON		ON		ON		
	IN LINE	96		95		90		
	L Rack	90		100		100		
	R Rack	100		110		110		
	Temp(c')	65		64		66		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	A		A		A		
Oil Fire pump		685 L	L	685 L	L	685 L	L	100% den.
Under ground Tank	H	✓		✓		✓		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	A		A		A		
	EQP-2	A		A		A		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EPF-1	A		A		A		
	EPF-2	A		A		A		
	SDJ-1	A		A		A		
Alarm system		✓		✓		✓		
CCTV Room		✓		✓		✓		
Auto Parking	SUV	✓		✓		✓		
	Sedan	✓		✓		✓		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

INTERCONTINENTAL

Date: 31/8/25

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	995			396	399		
		S	999			398	401		
		T	997			394	398		
	AMPERE	R	590			460	433		
		S	511			428	398		
		T	553			461	444		
	POWER FACTOR		1.00			1.0	1.0		
	TRANSFORMER TEMP(C.) 1		44			45	45		
	TRANSFORMER TEMP(C.) 2		47			42	47		
	TRANSFORMER TEMP(C.) 3		45			46	46		
MDB NO 2.	WATT -HOURMTER KWH		1.16 GWh			4.4639 GWh	4.46 GWh		
	VOLTAGE MDB 2	R	995			397	397		
		S	997			392	402		
		T	996			393	397		
	AMPERE	R	428			487	361		
		S	281			409	329		
		T	437			461	373		
	POWER FACTOR		1.00			1.0	1.0		
	TRANSFORMER TEMP(C.) 1		49			44	44		
	TRANSFORMER TEMP(C.) 2		47			48	48		
	TRANSFORMER TEMP(C.) 3		46			42	47		
EMDB 1.	WATT -HOURMTER KWH		1.16 GWh			4.609 GWh	4.61 GWh		
	IN COMING	R	996			396	398		
		S	999			398	402		
		T	996			393	398		
	AMPERE	R	44			51	43		
		S	47			48	34		
		T	98			31	25		
	WATT -HOURMTER KWH		842.13 MWh			842.48 MWh	842.55 MWh		
	OUT GOING	R	991			396	398		
		S	997			396	402		
		T	996			392	396		
EMDB 2.	AMPERE	R	46			52	41		
		S	86			46	44		
		T	98			30	34		
	WATT -HOURMTER KWH		997.19 MWh			998.96 MWh	798.84 MWh		
	IN COMING	R	996			393	398		
		S	999			396	402		
		T	996			393	397		
	AMPERE	R	120			102	112		
		S	109			109	110		
		T	109			102	102		
EMDB 2.	WATT -HOURMTER KWH		119.76 MWh			114.40 MWh	114.51 MWh		
	OUT GOING	R	395			393	398		
		S	399			390	402		
		T	394			396	396		
	AMPERE	R	53			109	34		
		S	59			109	33		
		T	50			102	23		
	WATT -HOURMTER KWH		495.12 MWh			495.18 MWh	495.97 MWh		
	Check by								

9/8/25

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		✓		
	M							
	L							
CDU Roof Top		/		/		✓		
Elevator Room		/		/		✓		
Air 1+2				/		✓		
AIR 3+4		/		/		✓		
Bootster Pump Room		A		A		A		
Hotwater Room	(tank 1)	69 c'	c'	61 c'	c'	59.7 c'	c'	
	(tank2)	60 c'	c'	60 c'	c'	60.2 c'	c'	
Pool pump room (salt cell)	No.1	2800		2900		2024		
	No.2	2800		2800				
	No.3	2700		3800				
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.5		1.0		3.0		
	PH	7.6		7.6		7.6		
It room		/		/		✓		
Canteen room		/		/		✓		
Linen shoot		/		/		✓		
Gennaretor		A		A		A		
AIR 1/1				/		✓		
AIR 1/2								
AIR 2/1		/						
AIR 2/2								
Oil Gannaretor		915 L	L	915 L	L	915 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	96		25		27		
	L Rack	90		100		90		
	R Rack	0		0		0		
	Temp(c')	61		63		65		
Fire Pump	Jocky	A		A		A		
	ELECTRIC	A		A		A		
	Engine	A		A		A		
Oil Fire pump		625 L	L	685 L	L	625 L	L	
Under ground Tank	H	/		/		✓		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	M		M		M		
	EQP-2	A		OL		OL		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EFP-1	A		A		A		
	EFP-2	A		M		A		
	SDJ-1	A		A		A		
Alarm system		/		/		/		
CCTV Room		/		/		✓		
Auto Parking	SUV	/		/		✓		
	Sedan	/		/		✓		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

A=Auto

M=Manual

O=OFF

Duty ENG

INTERCONTINENTAL

Date: 30/11/15

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	397		395		398		
		S	399		400		400		
		T	397		396		392		
	AMPERE	R	483		522		403		
		S	471		575		388		
		T	500		594		414		
	POWER FACTOR		1.00		1		1.0		
	TRANSFORMER TEMP(C.) 1		44		44		46		
	TRANSFORMER TEMP(C.) 2		47		40		48		
	TRANSFORMER TEMP(C.) 3		45		41		42		
WATT - HOURMTER KWH		1.69 kWh		4.672		4.67552m			
MDB NO 2.	VOLTAGE MDB 2	R	396		394		396		
		S	399		395		400		
		T	396		395		392		
	AMPERE	R	421		427		432		
		S	397		392		392		
		T	424		453		422		
	POWER FACTOR		1.00		1		1.0		
	TRANSFORMER TEMP(C.) 1		43		43		45		
	TRANSFORMER TEMP(C.) 2		46		41		48		
	TRANSFORMER TEMP(C.) 3		45		40		48		
WATT - HOURMTER KWH		179 kWh		4.740		4.7929m			
EMDB 1.	IN COMING	R	396		396		396		
		S	399		399		401		
		T	396		396		392		
	AMPERE	R	471		52		45		
		S	397		65		43		
		T	424		51		35		
	WATT - HOURMTER KWH		861.94 kWh		862.1A		862.39m		
	OUT GOING	R	390		395		392		
		S	399		399		400		
		T	395		394		392		
AMPERE	R	48		52		43			
	S	52		54		43			
	T	47		44		35			
WATT - HOURMTER KWH		848.14 kWh		848.2A		848.59m			
EMDB 2.	IN COMING	R	396		395		396		
		S	399		399		401		
		T	396		395		392		
	AMPERE	R	16		10		34		
		S	24		12		40		
		T	27		13		33		
	WATT - HOURMTER KWH		138.68 kWh		138.88		139.21m		
	OUT GOING	R	396		395		392		
		S	399		398		400		
		T	395		394		392		
AMPERE	R	64		30		38			
	S	40		62		39			
	T	67		62		34			
WATT - HOURMTER KWH		510.14 kWh		520.37		520.20m			
Check by									

6/05

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
Air 1+2		/		/		/		
AIR 3+4								
Booster Pump Room								
Hotwater Room	(tank 1)	0		0		0		
	(tank 2)	61 c'	c'	61 c'	c'	58 c'	c'	
Pool pump room (salt cell)	No.1	3100		3100		3000		
	No.2	3000		3100		3000		
	No.3	4100		4100		4100		
Pool pump	No.1	0		0		0		
	No.2	0		0		0		
	CL	1.5		1.5		1.5		
	PH	7.6		7.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		/		/		/		
AIR 1/1				/		/		
AIR 1/2				/		/		
AIR 2/1		/						
AIR 2/2								
Oil Gannaretor		900 L	L	900 L	L	900 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	02		02		02		
	IN LINE	06		06		06		
	L Rack	75		75		75		
	R Rack	80		80		80		
	Temp(c')	62		64		62		
Fire Pump	Jocky	0		0		0		
	ELECTRIC	0		0		0		
	Engine	0		0		0		
Oil Fire pump		630 L	L	630 L	L	630 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	0		0		0		
	No.2	0		0		0		
	No.3	0		0		0		
Treatment system	EQP-1	0		0		0		
	EQP-2	0		0		0		
	EQJ-1	0		0		0		
	AEJ-1	0		0		0		
	AEJ-2	0		0		0		
	SLP-1	0		0		0		
	EFP-1	M		0		0		
	EFP-2	M		0		0		
	SDJ-1	0		0		0		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

A=Auto

M=Manual

O=OFF

Duty ENG

INTERCONTINENTAL

Date: 31/10/2025

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	397		398		394		
		S	400		402		395		
		T	396		399		392		
	AMPERE	R	394		589		492		
		S	396		581		477		
		T	382		608		490		
	POWER FACTOR		1.00		1.0		1.0		
	TRANSFORMER TEMP(C.) 1		43		44		42		
	TRANSFORMER TEMP(C.) 2		46		46		45		
	TRANSFORMER TEMP(C.) 3		44		45		43		
WATT -HOURMTER KWH		4.884		4.890 GWh		4.896Wh			
MDB NO 2.	VOLTAGE MDB 2	R	395		399		393		
		S	398		400		396		
		T	397		397		392		
	AMPERE	R	401		548		433		
		S	370		480		362		
		T	371		539		427		
	POWER FACTOR		1.00		1.0		1.0		
	TRANSFORMER TEMP(C.) 1		41		41		41		
	TRANSFORMER TEMP(C.) 2		45		46		46		
	TRANSFORMER TEMP(C.) 3		44		45		45		
WATT -HOURMTER KWH		4.9903		4.992 GWh		4.996Wh			
EMDB 1.	IN COMING	R	397		399		393		
		S	399		402		396		
		T	397		399		392		
	AMPERE	R	31		38		43		
		S	43		44		44		
		T	28		32		31		
	WATT -HOURMTER KWH		882.26		882.41 MWh		882.63MWh		
	OUT GOING	R	395		399		394		
		S	399		401		395		
		T	395		397		392		
	AMPERE	R	31		55		42		
		S	42		57		43		
		T	28		47		30		
	WATT -HOURMTER KWH		838.69		838.55 MWh		838.76MWh		
EMDB 2.	IN COMING	R	397		399		393		
		S	399		402		395		
		T	397		398		392		
	AMPERE	R	63		92		71		
		S	63		76		65		
		T	59		72		64		
	WATT -HOURMTER KWH		164.94		165.15 MWh		165.45MWh		
	OUT GOING	R	395		398		395		
		S	399		402		395		
		T	396		397		392		
	AMPERE	R	81		80		25		
		S	83		63		22		
		T	81		60		27		
	WATT -HOURMTER KWH		546.48		546.68 MWh		546.99MWh		
Check by									

Duty ENG 31/10/25

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
AIR 1+2		1		1		/		
AIR 3+4		4		4		/		
Booster Pump Room				OFF		OFF		
Hotwater Room	(tank 1)	62.2 c'	c'	61.3 c'	c'	60.2 c'	c'	
	(tank 2)	59.2 c'	c'	61.5 c'	c'	57.8 c'	c'	
Pool pump room (salt cell)	No.1	2800		2900		2		
	No.2	2700		2800		3000		
	No.3	3600		3600				
Pool pump	No.1	A		A		A		
	No.2	A		A		A		
	CL	1.5		1.5		1.0		
	PH	8.2		8.2		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		A		A		A		
AIR 1/1						/		
AIR 1/2				/				
AIR 2/1								
AIR 2/2		/		/				
Oil Gannaretor		890 L	L	885 L	L	885 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	26		26		26		
	L Rack	4200		4200		4200		
	R Rack	65		75		70		
	Temp(c')	65		62		65		
Fire Pump	Jocky			A		A		
	ELECTRIC			A		A		
	Engine			OFF		OFF		
Oil Fire pump		662 L	L	660 L	L	660 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	A		A		A		
	No.2	A		A		A		
	No.3	A		A		A		
Treatment system	EQP-1	A		A		A		
	EQP-2	A		A		A		
	EQJ-1	A		A		A		
	AEJ-1	A		A		A		
	AEJ-2	A		A		A		
	SLP-1	A		A		A		
	EFP-1	A		A		A		
	EFP-2	A		A		A		
	SDJ-1	A		A		A		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

INTERCONTINENTAL

Date 30/11/95

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	394		397		396		
		S	396		398		397		
		T	393		396		395		
	AMPERE	R	354		075		344		
		S	361		354		304		
		T	375		385		388		
	POWER FACTOR		1.00		1		1.0		
	TRANSFORMER TEMP(C.) 1		41		41		43		
	TRANSFORMER TEMP(C.) 2		44		43		46		
	TRANSFORMER TEMP(C.) 3		42		44		46		
WATT -HOURMTER KWH		5.070 kWh		5.095		5.073 kWh			
MDB NO 2.	VOLTAGE MDB 2	R	394		396		395		
		S	395		396		397		
		T	393		395		394		
	AMPERE	R	242		306		383		
		S	208		245		328		
		T	221		394		386		
	POWER FACTOR		1.00		1		1.0		
	TRANSFORMER TEMP(C.) 1		40		41		43		
	TRANSFORMER TEMP(C.) 2		45		43		47		
	TRANSFORMER TEMP(C.) 3		44		44		46		
WATT -HOURMTER KWH		5.160 kWh		5.164		5.162 kWh			
EMDB 1.	IN COMING	R	395		397		396		
		S	396		397		398		
		T	394		397		395		
	AMPERE	R	28		34		50		
		S	40		42		42		
		T	27		29		30		
	WATT -HOURMTER KWH		901.82 kWh		901.57		901.83 kWh		
	OUT GOING	R	395		396		396		
		S	395		398		397		
		T	394		397		395		
AMPERE	R	98		44		39			
	S	43		42		42			
	T	20		28		30			
WATT -HOURMTER KWH		457.88 kWh		857.65		882.84 kWh			
EMDB 2.	IN COMING	R	395		397		396		
		S	396		399		398		
		T	394		397		395		
	AMPERE	R	22		102		88		
		S	21		86		80		
		T	19		85		76		
	WATT -HOURMTER KWH		189.02 kWh		189.26		189.52 kWh		
	OUT GOING	R	394		395		395		
		S	396		397		397		
		T	394		396		394		
AMPERE	R	49		83		90			
	S	27		62		82			
	T	26		63		79			
WATT -HOURMTER KWH		570.61 kWh		520.85		521.16 kWh			
Check by									

11/25

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
AIR 1+2		/		/		/		
AIR 3+4		/		/		/		
Booster Pump Room		/		/		/		
Hotwater Room	(tank 1)	54 c'	c'	50 c'	c'	53 c'	c'	
	(tank 2)	53 c'	c'	51 c'	c'	53 c'	c'	
Pool pump room (salt cell)	No.1	2000		3100		3100		
	No.2	2000		3000		3000		
	No.3	2000		3000		3000		
Pool pump	No.1	0		0		A		010 012/04 172
	No.2	0		0		A		
	CL	1.0		1.5		0.6		
	PH	7.8		7.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		/		/		/		
AIR 1/1		/		/		/		
AIR 1/2		/		/		/		
AIR 2/1		/		/		/		
AIR 2/2		/		/		/		
Oil Gannaretor		920 L	L	920 L	L	920 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	01		28		22		
	L Rack	0		100		90		
	R Rack	75		75		80		
	Temp(c')	64		64		65		
Fire Pump	Jocky	/		/		/		
	ELECTRIC	/		/		/		
	Engine	/		/		/		
Oil Fire pump		700 L	L	700 L	L	700 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	0		0		A		
	No.2	0		0		A		
	No.3	0		0		A		
Treatment system	EQP-1	0		0		A		
	EQP-2	0		0		A		
	EQJ-1	0		0		A		
	AEJ-1	0		0		A		
	AEJ-2	0		0		A		
	SLP-1	0		0		A		
	EFP-1	0		0		A		
	EFP-2	0		0		A		
	SDJ-1	0		0		0		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

Q=OFF

Remark

Duty ENG

A=Auto

M=Manual

Q=OFF

INTERCONTINENTAL

Date: 31/12/25

DESCRIPTION			Morning Shift		Afternoon Shift		Night Shift		Remark
TIME			08.00 AM	11.00 AM	15.00PM	19.00PM	23.00PM	03:00AM	
MDB NO 1.	VOLTAGE MDB 1	R	398		396		396		
		S	396		398		398		
		T	393		396		395		
	AMPERE	R	411		520		391A		
		S	382		502		302A		
		T	394		535		355		
	POWER FACTOR		1.00		1.0		1.0		
	TRANSFORMER TEMP(C.) 1		42		42		43		
	TRANSFORMER TEMP(C.) 2		45		46		46		
	TRANSFORMER TEMP(C.) 3		43		45		46		
	WATT -HOURMTER KWH		5.970 kWh		5.948 kWh		5.0793		
MDB NO 2.	VOLTAGE MDB 2	R	393		394		396		
		S	398		392		397		
		T	399		394		391		
	AMPERE	R	496		544		383		
		S	379		490		328		
		T	409		539		386		
	POWER FACTOR		1.00		1.0		1.0		
	TRANSFORMER TEMP(C.) 1		41		41		43		
	TRANSFORMER TEMP(C.) 2		46		42		49		
	TRANSFORMER TEMP(C.) 3		45		45		46		
	WATT -HOURMTER KWH		5.950 kWh		5.353 kWh		5.1621		
EMDB 1.	IN COMING	R	394		396		396		
		S	396		398		398		
		T	393		393		395		
	AMPERE	R	50		36		50		
		S	40		42		42		
		T	31		26		30		
	WATT -HOURMTER KWH		921.09 kWh		921.21 kWh		901.83		
	OUT GOING	R	393		396		396		
		S	396		392		397		
		T	393		395		395		
	AMPERE	R	56		39		37		
		S	51		42		42		
		T	46		25		30		
	WATT -HOURMTER KWH		877.00 kWh		872.19 kWh		887.88		
EMDB 2.	IN COMING	R	394		396		396		
		S	396		398		396		
		T	393		393		395		
	AMPERE	R	49		49		88		
		S	31		33		80		
		T	28		39		71		
	WATT -HOURMTER KWH		214.06 kWh		214.31 kWh		189.59		
	OUT GOING	R	395		395		396		
		S	395		392		392		
		T	393		395		394		
	AMPERE	R	18		24		90		
		S	30		18		82		
		T	21		18		79		
	WATT -HOURMTER KWH		595.99 kWh		595.92 kWh		591.16		
Check by									

12/25

DESCRIPTION		Morning Shift		Afternoon Shift		Night Shift		Remark
		Normal	Abnormal	Normal	Abnormal	Normal	Abnormal	
Roof Tank	H	/		/		/		
	M							
	L							
CDU Roof Top		/		/		/		
Elevator Room		/		/		/		
Air 1+2		/		/		/		
AIR 3+4								
Booster Pump Room		0		0		0		
Hotwater Room	(tank 1)	61 c'	c'	55 c'	c'	59 c'	c'	
	(tank2)	60 c'	c'	55 c'	c'	58 c'	c'	
Pool pump room (salt cell)	No.1	3100		3100		3100		
	No.2	9000		3300		2800		
	No.3	-		0		-		
Pool pump	No.1	0		0		0		
	No.2	0		0		0		
	CL	2.9		1.5		1.5		
	PH	7.7		8.8		7.8		
It room		/		/		/		
Canteen room		/		/		/		
Linen shoot		/		/		/		
Generator		0		0		0		
AIR 1/1								
AIR 1/2		/		/		/		
AIR 2/1		/						
AIR 2/2								
Oil Gannaretor		900 L	L	900 L	L	900 L	L	
CDU Floor 12		/		/		/		
Pe AHU Floor 12		/		/		/		
sound system	Ch-1	/		/		/		
	Ch-2	/		/		/		
	Ch-3	/		/		/		
	Ch-4	/		/		/		
GAS	Power	ON		ON		ON		
	IN LINE	27		27		27		
	L Rack	0		85		75		11A5W2 Rack L.
	R Rack	0		85		85		
	Temp(c')	65		64		62		
Fire Pump	Jocky	0		0		0		
	ELECTRIC	0		0		0		
	Engine	0		0		0		
Oil Fire pump		680 L	L	680 L	L	680 L	L	
Under ground Tank	H	/		/		/		
	M							
	L							
Transfer pump(Run)	No.1	0		0		0		
	No.2	0		0		0		
	No.3	0		0		0		
Treatment system	EQP-1	0		0		0		
	EQP-2	0		0		0		
	EQJ-1	0		0		0		
	AEJ-1	0		0		0		
	AEJ-2	0		0		0		
	SLP-1	0		0		0		
	EFJ-1	0		0		0		
	EFJ-2	0		0		0		
	SDJ-1	0		0		0		
Alarm system		/		/		/		
CCTV Room		/		/		/		
Auto Parking	SUV	/		/		/		
	Sedan	/		/		/		
Chacker By								

A=Auto

M=Manual

O=OFF

Remark

Duty ENG

A=Auto

M=Manual

O=OFF

ภาคผนวก ข-7

การตรวจสอบระบบป้องกันและเตือนอัคคีภัย

SUMMARY EMERGENCY LIGHT CHECKLIST IN JULY 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical room, FML, Pantry and other areas)		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in the way.

Inspected by: Mr. Chaekki Kunpichayadecha (Occupational health & Safety Supervisor)

DATE: 06 July 2025

EMERGENCY LIGHT CHECKLIST IN JULY 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		

	-	FML	1	✓		×	battery expired.
	-	Fire exit ST.2	1	✓	✓		
26	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓		×	battery expired.
	-	FML	1	✓		×	battery expired.
	-	Fire exit ST.2	1	✓	✓		
25	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓		×	battery expired.
	-	FML	1	✓		×	battery expired.
	-	Fire exit ST.2	1	✓	✓		
24	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
23	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
22	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓		×	battery expired.
21	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
20	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
19	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1		✓		Cannot check because there was a rack obstruct the way.
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
18	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
17	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		
	-	Pantry Room	1	✓	✓		
	-	FML	1	✓	✓		
	-	Fire exit ST.2	1	✓	✓		
16	-	Fire exit ST.1	1	✓	✓		
	-	Electrical Room	1	✓	✓		

	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		

5	Fire exit ST.1	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
4	- Fire exit ST.1	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
TOTAL		187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		

	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

EMERGENCY LIGHT CHECKLIST IN AUGUST 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	- Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓			×	battery expired.
	- Fire exit ST.2	1	✓		✓		

26	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
25	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
24	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
23	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
22	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
21	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
20	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
19	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
18	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
17	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
16	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		

	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
5	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
4	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room 1	1	✓		✓		
	-	Electrical Room 2	1	✓		✓		

	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
	TOTAL	187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		

	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

SUMMARY EMERGENCY LIGHT CHECKLIST IN AUGUST 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in 1

DATE: 06 August 2025

EMERGENCY LIGHT CHECKLIST IN SEPTEMBER 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	- Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓			×	battery expired.
	- Fire exit ST.2	1	✓		✓		

26	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
25	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
24	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
23	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
22	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
21	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
20	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
19	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
18	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
17	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
16	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		

	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
5	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
4	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room 1	1	✓		✓		
	-	Electrical Room 2	1	✓		✓		

	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
	TOTAL	187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		

	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

SUMMARY EMERGEMCY LIGHT CHECKLIST IN SEPTEMBER 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in 1

DATE: 5 September 2025

EMERGENCY LIGHT CHECKLIST IN OCTOBER 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	- Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓			×	battery expired.
	- Fire exit ST.2	1	✓		✓		

26	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
25	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
24	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
23	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
22	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
21	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
20	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
19	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
18	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
17	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
16	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		

	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
5	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
4	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room 1	1	✓		✓		
	-	Electrical Room 2	1	✓		✓		

	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
	TOTAL	187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		

	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

SUMMARY EMERGEMCY LIGHT CHECKLIST IN OCTOBER 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in 1

DATE: 5 October 2025

EMERGENCY LIGHT CHECKLIST IN NOVEMBER 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	- Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓			×	battery expired.
	- Fire exit ST.2	1	✓		✓		

26	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
25	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
24	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
23	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
22	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
21	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
20	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
19	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
18	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
17	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
16	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		

	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
5	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
4	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room 1	1	✓		✓		
	-	Electrical Room 2	1	✓		✓		

	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
	TOTAL	187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		

	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

SUMMARY EMERGENCY LIGHT CHECKLIST IN NOVEMBER 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in 1

DATE: 25 November 2025

EMERGENCY LIGHT CHECKLIST IN DECEMBER 2025.

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
MC2	Front of Water Tank Entrance	1	✓		✓		
MC1	- Pump Room	1	✓			×	battery expired.
	- Pressurized Room	1	✓		✓		
	- Front of Pressurized Room	1	✓		✓		
	- Lift Machine Room	1	✓		✓		
34	- Fire exit ST.1	1	✓		✓		
	- Hot Water Plant Room	1	✓		✓		
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
33	- Fire exit ST.1	1	✓			×	battery expired.
	- Electrical Room						
	- Fire exit ST.2	1	✓			×	battery expired.
32	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31.5	- Fire exit ST.1	1	✓		✓		
	- Pump Room	1	✓		✓		
	- Pump Corridor 1	1	✓		✓		
	- Pump Corridor 2	1	✓		✓		
	- Pump Corridor 3	1	✓		✓		
	- Pump Corridor 4	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
31	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
30	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
29	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓				Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
28	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
27	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- Pantry Room	1	✓		✓		
	- FML	1	✓			×	battery expired.
	- Fire exit ST.2	1	✓		✓		

26	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
25	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	FML	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
24	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
23	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
22	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
21	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
20	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
19	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1		✓			Cannot check because there was a rack obstruct the way.
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
18	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
17	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
16	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
15	-	Fire exit ST.1	1	✓		✓		

	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
14	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Fire exit ST.2	1	✓			×	battery expired.
12	-	Fire exit ST.1	1	✓		✓		
	-	Front of fire exit ST.1	1	✓		✓		
	-	Uniform Room	1	✓		✓		
	-	Fresh Air Room	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	Pantry Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	WC-Male	1	✓		✓		
	-	Locker-Male	1	✓		✓		
	-	Front of WC-Female	1	✓		✓		
	-	WC-Female 1	1	✓		✓		
	-	WC-Female 2	1	✓		✓		
	-	Locker-Female	1	✓		✓		
	-	FB Store	1		✓			Cannot check because there was a rack obstruct the way.
	-	Pressurized fan room -ST.2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
11	-	Fire exit ST.1	1	✓		✓		
	-	Canteen	1	✓		✓		
	-	CDU-Canteen 1	1	✓			×	battery expired.
	-	CDU-Canteen 2	1	✓		✓		
	-	CDU-Canteen 3	1	✓		✓		
	-	Electrical Room	1	✓		✓		
	-	FML	1	✓		✓		
	-	Pantry Room	1	✓			×	battery expired.
	-	Housekeeping Office	1	✓			×	battery expired.
	-	Corridor 1	1	✓		✓		
	-	Corridor 2	1	✓		✓		
	-	CDU HK 1	1	✓		✓		
	-	CDU HK 2	1	✓			×	battery expired.
	-	Chef Office	1	✓		✓		
	-	MDB Room 1	1	✓		✓		
	-	MDB Room 2	1	✓		✓		
	-	MDB Room 3	1	✓		✓		
	-	Generator Room	1	✓		✓		
	-	CDU-MDB 1	1	✓		✓		
	-	CDU-MDB 2	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
9	-	Fire exit ST.1	1	✓			×	battery expired.
	-	Fire exit ST.2	1	✓		✓		
7	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
5	-	Fire exit ST.1	1	✓		✓		
	-	Fire exit ST.2	1	✓		✓		
4	-	Fire exit ST.1	1	✓		✓		
	-	Electrical Room 1	1	✓		✓		
	-	Electrical Room 2	1	✓		✓		

	- FML	1	✓		✓		
	- Butcher Room	1	✓		✓		
	- Cold Kitchen	1	✓		✓		
	- Bakery Kitchen	1	✓		✓		
	- Kitchen Corridor	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
3	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room 1	1	✓		✓		
	- Electrical Room 2	1	✓		✓		
	- Kitchen Room	1	✓		✓		
	- Staff only Entrance	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
2	- Fire exit ST.1	1	✓		✓		
	- FML	1	✓		✓		
	- Electrical Room	1	✓			x	battery expired.
	Rogues Kitchen 1	1	✓			x	battery expired.
	Rogues Kitchen 2	1	✓			x	battery expired.
	Rogues Kitchen 3	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
1/L	- Fire exit ST.1	1	✓		✓		
	- Electrical Room	1	✓		✓		
	- RMU-Automated Parking	1	✓		✓		
	- RMU-Purchasing Room	1	✓		✓		
	- Receiving Room	1	✓		✓		
	- FML	1	✓		✓		
	- Fire exit ST.2	1	✓		✓		
B	- Fire exit ST.1	1	✓		✓		
	- Pump Room 1	1	✓		✓		
	Pump Room 2	1	✓		✓		
	- Pump Room 3	1	✓		✓		
	TOTAL	187	184	3	163	24	

AUTOMATED PARKING

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
10	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
9	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
8	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
7	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		

	- AP/NO.5	1	✓		✓		
6	- AP/NO.1	1	✓		✓		
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓			×	battery expired.
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
5	- AP/NO.1	1	✓			×	battery expired.
	- AP/NO.2	1	✓		✓		
	- AP/NO.3	1	✓		✓		
	- AP/NO.4	1	✓		✓		
	- AP/NO.5	1	✓		✓		
	TOTAL	30	30		28	2	

OFFICE

FLOOR	LOCATION	QUANTITY	CHECK		STATUS		REMARK
			YES	NO	WORK	NOT WORK	
12	FB Office	1	✓		✓		
12	Finance Office	1	✓		✓		
12	Reservation office	1	✓		✓		
12	Meeting Room	1	✓			×	battery expired.
11	Kitchen Office	1	✓		✓		
11	Chef Office	1	✓		✓		
	TOTAL	6	6		5	1	

SUMMARY EMERGEMCY LIGHT CHECKLIST IN DECEMBER 2025

PORTABLE EMERGENCY LIGHT		TOTAL	STATUS	
Building (Exactly Area)		Quantity	Work	Not Work
Hotel Building (Fire exit stairs, Electrical		187	163	24
Automated Parking		30	28	2
Department Office		6	5	1
Total		223	196	27

REMARK: 2 emergency light cannot check because there is shelf in 1

DATE: 24 December 2025

ภาคผนวก ข-8

การอบรมและฝึกซ้อมตามแผนป้องกันและระงับเหตุอัคคีภัย
ประจำปี พ.ศ. 2568



กรุงเทพมหานคร



ได้รับใบอนุญาตจากกรมสวัสดิการและคุ้มครองแรงงาน ใบอนุญาตเลขที่ ๐๑๐๒-๐๒-๒๕๖๗-๐๑๕๑
ขอรับรองว่า

โรงแรมอินเตอร์คอนติเนนตัล กรุงเทพ สุขุมวิท

ตั้งอยู่เลขที่ ๑๐ ซอยสุขุมวิท ๕๙ ถนนสุขุมวิท แขวงคลองตันเหนือ เขตวัฒนา กรุงเทพมหานคร ๑๐๑๑๐

ได้ดำเนินการฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ

ตามกฎหมายกำหนดมาตรฐานในการบริหาร จัดการ และดำเนินการด้านความปลอดภัย อาชีวอนามัย
และสภาพแวดล้อมในการทำงานเกี่ยวกับการป้องกันและระงับอัคคีภัย พ.ศ. ๒๕๕๕ ลงวันที่ ๗ ธันวาคม พ.ศ. ๒๕๕๕

มีผู้เข้ารับการฝึกอบรม จำนวน ๑๐๖ คน

เมื่อวันที่ ๗ พฤษภาคม ๒๕๖๘

ให้ไว้ ณ วันที่ ๓๐ พค. ๒๕๖๘

ผู้อำนวยการสำนักป้องกันและบรรเทาสาธารณภัย
ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

ภาคผนวก ข-9

แผนฉุกเฉิน

Fire Emergency SC017-2023

SOP REFERENCE:	SC017-2023
DEPARTMENT:	SECURITY
EFFECTIVE DATE:	
ISSUED BY HOD:	APPROVE BY GM:
APPROVED BY GM	

CONDITIONS	PROCEDURES
- Purpose: - Procedures:	- A fire is potentially the most devastating event that can happen at a hotel. To minimize the impact, it is important that all staff know what steps to take in the event of a fire emergency. - To brief staff on the steps to take in the event of a fire emergency. 1. Instructions for person discover fire. If you are the first person to discover a fire, you can remember what do by using C.A.R.E.: • Contain the fire by closing doors. • Activate the alarm by going to the nearest pull station. • Report the location of the fire using a house phone, guestroom phone, or radio. • Evacuate.

	2. How to operate fire extinguisher. To use a fire extinguisher, remember P.A.S.S.: • Pull the pin. • Aim the nozzle at the base of the fire. • Squeeze the handle. • Sweep the nozzle from side to side. 3. Action when the fire alarm sounds. • Respond to all fire alarms as if they are real. Hesitating for even a moment can have devastating consequences. • Control the spread of smoke by closing all doors, including laundry chutes. • Clear the corridors by removing all housekeeping, maintenance, and service carts. Place them in service areas or vacant rooms. • Help evacuate the area. Provide aid to guests with disabilities. Assist guests with directions to the nearest exits. • Implement departmental procedures. • Meet at the rally point. 3.1 Fire Emergency Action Cards.
--	---

CRISIS MANAGER ACTION CARD

Action by GM / DOO / Chief Engineer

EMERGENCY PROCEDURES – IN CASE OF EMERGENCY

- Upon notification of General alarms sounding, go to the Control Room on L floor.
- Ensure that the hotel has started evacuating.
- Contact Mr. Prin Pathanatham on 097- 462 4498.
- Await arrival of fire brigade and have them taken to cause of the alarm by member of the search party.
- Standby at Control Room until guests and employees have evacuated to the Hotel Assembly point – at The Hotel Main Entrance.
- Assess the status of fire and if necessary, implement Mutual Aid Agreement to evacuate guests to Mutual Aid Hotel Contract.
- Obtain a copy of the Hotel reports including number of guest's in-house, in-house guest list, and arrivals report by name.
- Assign employees to assist guests at Mutual Aid Hotel if necessary.
- Account for guests by using the guest in house report.
- Account for employees by using the employee ID cards and attendance record.
- Contact Hotel where guests will be relocated and **implement Mutual Aid Agreement.**

Primary Mutual Aid Hotel / Business	Secondary Mutual Aid Hotel / Business
N/A	N/A
Contact Information	Contact Information
N/A	N/A

- Contact the transportation company for guest relocation and pick up point – which evacuation point. (Front Driveway)

Primary Transportation Company	Secondary Transportation Company
N/A	N/A
Contact Information	Contact Information

- | | |
|-----|-----|
| N/A | N/A |
|-----|-----|
- Assist in guest relocation and delegate front office team to go with guests and keep records of guests who have gone with staff.
 - Provide emergency response kit to hotel personnel responsible for tracking relocation of guests.
 - Assist Fire Department as needed.
- NOTE:** Reset the fire alarm ONLY when directed to do so by the fire department.

POST EMERGENCY

- GM to notify company management of conditions at the hotel.
- Notify insurance company and the appropriate IHG Corporate contacts.
- Establish an operations center.
- Contact Key Contractors from List
- If necessary, establish a manual recordkeeping system for tracking guest transactions.
- Establish security for the property.
- Replace utilities with temporary sources for lights and electricity.
- Re-establish a communications system (radios, cellular phones, etc.)
- Recall key employees.
- Advise One Stop Service with information on what should be told to guests, employees, relatives, media, etc.
- Secure guest records, hotel money and keys.

CONTROL ROOM ACTION CARD**Action by Security Officer****EMERGENCY PROCEDURES**

- Remain calm but act quickly.
- Acknowledge the fire panel.
- Radio to Emergency Response Team and advise the location of the activated alarm.
- Await report from search party who will give the situation of the activated alarm.

In the event of fire

- Press the hotel evacuate fire button for the whole building.
- Play evacuation announcement.
- Call the fire brigade and provide advice on the hotel status and location of the fire.

Fire Brigade Number

199 or 02-258 2094 Klong Toei Fire

- Radio ERT using Code **One (1)** and location of fire.
- Call Operator using emergency line **XXXX** and advise operator of location and status of fire.
- Radio ERT and advise hotel assembly point location.
- Check with Operator on disabled guests in house and advise the ERT.
- Check the elevators monitor panel confirm the return of all elevators to their lowest floor, if this fails then switch of manual call down button in main fire alarm cabinet – check via intercom system if anyone is trapped in the lift, if so radio engineering.

Security Guard Duties

- One officer to prepare employee assembly color Department Board and take these to the Hotel assembly point and then man the main entrance controlling traffic, keep cars away from entering the hotel driveway, do not allow any cars to drive enter the building.
- Two officers ask them to standby at the emergency exit stairways and direct guests & employees to the hotel assembly point – ENSURE they are aware of the Hotel assembly point in use.
- One officer to standby at Staff Entrance to prevent unauthorized person to enter the building.
-
- Await further feedback from ERT and the arrival of a Crisis Manager from CMT/ ERT.
- Greet Fire Department and provide reports, floor plans, schematic, and keys.
- Assist Fire Department as needed.
- Await instructions to evacuate to the fire assembly point.

In the event of a false alarm

5

- Reset the fire panel.
- Register within the Security Logbook.

POST EMERGENCY

- Request information from the CMT/ ERT on incident and prepare fire incident report.
- Attends debrief meeting if applicable.
- Ensure Disaster Control Room is back to normal operating status.

SEARCH PARTY ACTION CARD**Action by ERT (Duty Manager, Security Officer, Engineer)****DAY & NIGHT ACTION CARD**

- Remain calm but act quickly.
- Obtain portable fire extinguisher. (PFE)
- Under the direction of the Control Room proceed to the location of the alarm.
- Look for cause of the alarm (fire, guest, child, broken sprinkler, etc.)
- Using radio, report back to the Control Room.

If a fire is visible...

- If it is safe to do so, attempt to extinguish the fire with a fire extinguisher.
- If the fire cannot be safely extinguished, evacuate and seal off the area by closing doors.
- Report back to the Control Room.
- Assist guests by pointing out exits.
- Check with the Control room if any register disabled / special need guests are in house currently and if so escort to the fire staircase, then Radio to Control Room on location of guest for back up.

Hotel Assembly Point

Front of the Hotel

6

- Depending on where the fire is and is not life threatening, once all guests have been evacuated from rooms, facilities, or outlets, evacuate to hotel assembly point, and assist with guest comfort.

If alarm source is behind a closed door...

- Determine if the door is hot by feeling the door and handling it with the back of your hand.
- If smoke is visible or the door is hot, seal off the area.
- If the door is cool and there is no sign of smoke, enter the room and locate the source of the alarm.
- Report back to the Control Room.
- If a fire is visible, attempt to extinguish the fire with a PFE if it is safe to do so.
- Check with the operator if any register disabled / special need guests are in house currently and if so, evacuate to hotel assembly point.
- Depending on where the fire is and is not life threatening, all guests have been evacuated from rooms, outlets, or facilities, evacuated to hotel assembly point, and assist with guest comfort.

Hotel Assembly Point

Front of the Hotel

- Once all guests have been evacuated from rooms, outlets, or facilities, evacuate to hotel assembly point.
- If the fire cannot be extinguished in a safe manner, evacuate and seal off the area by closing the door.

No sign of fire...

- Search the area to determine the cause of the alarm.
- Report to the Control Room.

POST EMERGENCY

- Report to the Control Room for debrief.

FIRE COMMANDER ACTION CARD

Action by Duty Manager

7

DAY & NIGHT ACTION CARD

- Remain calm but act quickly.
- Upon notification of code 1 activation proceed to the location of fire alarm.
- To ensure to bring the Radio Walkie Talkie and phone.
- Start investigation upon the arrival at the scene.
- Report your finding to the Control Room if there is a real fire or false alarm.
- Prepare Fire Fighting equipment, Fire extinguisher, Fire hose and wait till Fire Fighting arrive to take over, then proceed to the Control Room.
- Once arrive at the Control Room keep communicating with Fire Fighting Team via radio walkie talkie.
- Inform GM and DOO.
- Instruct the Control Room to play Audio communication (Under Control) / if fire is not under control play Audio message (Evacuation)
- Proceed to assembly point once all are evacuated.

If a fire is visible...

- If it is safe to do so, attempt to extinguish the fire with a fire extinguisher.
- If the fire cannot be safely extinguished, evacuate and seal off the area by closing doors.
- Check with the Control Room if any register disabled / special need guests are in house currently and if so escort. to the fire staircase, then Radio to the Control Room on location of guest for back up.
- Radio to Crisis Squad (HEAT TEAM) if need to back up, go to meet with them if not return to Lobby and put on a high visibility jacket from behind Reception and assist guest in evacuating to the Hotel Assembly point /Stand by at Lobby.

Hotel Assembly Point

The Hotel Main Entrance

- Depending on where the fire is and is not life threatening, all guests to be advised to evacuate to the hotel assembly point and assist with guest comfort.
- Determine the shelter for guest relocation if needed (Primary Mutual Aid Hotel.)

If alarm source is behind a closed door...

8

- Determine if the door is hot by feeling the door and handling it with the back of your hand.
- If the door is cool and there is no sign of smoke, enter the room and locate the source of the alarm.
- Report back to the Control Room.
- If a fire is visible, attempt to extinguish the fire with a PFE if it is safe to do so.
- Check with the operator if any register disabled / special need guests are in house currently and if so, evacuate to hotel assembly point.
- Ensure Fire brigade have been called and coordinate with security to clear the traffic for the fire man truck and check with engineering to prepare fire pump, water hose, lift,
- Depending on where the fire is and is not life threatening, all guests have been evacuated from rooms, outlets or facilities, evacuated to hotel assembly point and assist with guest comfort.

Hotel Assembly Point

The Hotel Main Entrance

- Once all guests have been evacuated from rooms, outlets, or facilities, evacuate to hotel assembly point.
- If the fire cannot be extinguished in a safe manner, evacuate the guest to **Primary Mutual Aid Hotel** in the contract and seal off the area by closing the door.
- Ensure all have evacuated from the building to a safer location.
- Report any injury and casualty to GM.

No sign of fire.

- Search the area to determine the cause of the alarm.
- Report to the Control Room.
-

POST EMERGENCY

- Report to the Control Room for debrief.
- Request information from the CMT/ ERT on incident and prepare fire incident report.
- Ensure incident and incident report is formulated and send to IHG within 24 hours.
- Summary of the casualty incident report.

COMMUNICATOR ACTION CARD

Action by Call Center

EMERGENCY PROCEDURES

- Remain calm, but act quickly when Emergency Phone **XXXX** rings, answer putting other guests on hold.
- On advice from the Control Room that the hotel is in an emergency call the MOD.
 - Nature of crisis (e.g., fire, bomb)
 - Status of crisis (e.g., evacuating, investigating)
- After inform MOD call the CMT team advising them of the following information
 - Nature of crisis (e.g., fire, bomb)
 - Status of crisis (e.g., evacuating, investigating)
 - Senior Manager on site (MOD / GRM)
- Determine locations of disabled guests or guests with special needs by calling their rooms and asking them to await assistance.
- Contact the Control Room and advice status of disabled guests.
- Answer all internal guest phone calls and inquiries as a priority using pre-determined verbiage.
 - 'The Hotel fire alarms have activated; please can I ask you to make your way via the nearest fire exit down to the ground floor and assembly in the front of the Hotel. Thank you for your cooperation'!
 - ขณะนี้ไม่มีสัญญาณแจ้งเตือนเหตุเพลิงไหม้เกิดขึ้น ขอให้ท่านรีบออกไปนอกอาคารโดยใช้ทางหนีไฟที่ใกล้ที่สุด จุฬารวมพลของโรงแรมจะอยู่บริเวณด้านหน้าของโรงแรม ขอขอบคุณในความร่วมมือ
- Answer all external guest phone calls using pre-determined verbiage.
 - Thank you for calling InterContinental Bangkok Sukhumvit, at present our fire alarms have been activated and we are investigating at the present time. For more information, please provide us with your contact number so we can update further situation, thank you for your understanding.
 - โรงแรมอินเตอร์คอนติเนนตัล แบงคอก สุขุมวิท ตัวขณะนี้ มีสัญญาณแจ้งเตือนเหตุเพลิงไหม้ภายในอาคาร เจ้าหน้าที่ของเรากำลังทำการตรวจสอบอยู่ เราสามารถแจ้งสถานะการณให้ท่านทราบถ้าท่านไม่เฮอร์โทรกับทางโรงแรม, ขออภัยในความไม่สะดวก

Then cut the caller off and attend to internal calls.

- Document all rooms you can communicate with.
- Print occupancy report, guest in house list.
- Before evacuation switch operator console to night mode.
- Proceed to Front Desk to transfer telephone console to the Control Room by pressing **# X** and followed by extension **XXXX**. (To cancel the transfer line press **# X XXXX** on the same telephone)
- Go down to the control room with Printed occupancy report, guest in house list.
- Call occupied rooms which you have not yet spoken with if answered inform guest to evacuate immediately.

POST EMERGENCY

- Request information from the Crisis Manager (GM/MOD) on how to respond to guest inquiries.
- All media inquiries should be directed to the General Manager and Director of Sales & Marketing or MARCOM Manager.
- Obtain forms for logging all telephone calls and relaying messages.
- Prepare a 24-hour work schedule and recall operators to work as needed.

CRISIS SQUAD ACTION CARD

Action by Engineering

EMERGENCY PROCEDURES

- Remain calm but act quickly.
- Upon receiving walkie-talkie message of Code One (1).
- **If you are on the L floor**, put on firefighting personal protection clothing (fire suit) and collect equipment including oxygen tank, mask, gloves, boots, and helmet. Collect fire trolley Proceed to the location given or indicated on the fire panel together with security officer via fire lift number **5 Fire Man lift**.
 - On the fire trolley is a floor plan showing each floor layout, smoke detectors, zones, fire extinguishers and fire hydrants.
- **If you are anywhere else** in the Hotel, go straight to the activated zone.
 - At every fire hydrant cupboard is a floor plan showing floor layout, smoke detectors, zones, fire extinguishers and fire hydrants.

UPON FINDING INCIDENT

- Ensure the electrical power has been cut off before fighting the fire, only fight the fire if it's small.
- Try to contain fire within a limited area.
- One member should report to the control room for fire brigade assistance if needed.
- Evacuate and seal off areas if no longer safe to fight the fire.
- Go to the hotel assembly point.

POST EMERGENCY

- Cooperate with local authorities.
- Coordinate temporary restoration of services to property and equipment.
- Work with utility companies and key contractors to restore hotel services.
- Contact waste disposal agency to arrange for removal of damaged goods.
- Assist in setting up the telephone system in the operations center.

SQUAD COMMUNICATOR ACTION CARD

Action by Chief Engineer

DAY & NIGHT ACTION CARD

- Remain calm but act quickly.
- Upon receiving notification from the ERT team proceed to the Control Room.
- Always communicate with Squad Team with a clear message.
- Liaise between fire commander, ERT and wait for instruction Through Walkie Talkie.
- Inform, report situation at the scene to CMT.
- Ensure the equipment works promptly.
- Ensure the fire exits door is not obstructed.
- Proceed to assembly point once all are evacuated.
- Coordinate with security to prepare for fire brigade if needed.

Hotel Assembly Point

The Hotel Main Entrance

- Depending on where the fire is and is not life threatening, all guests to be advised to evacuate to the hotel assembly point and assist with guest comfort.

POST EMERGENCY

- Report to the Control Room for debrief.
- Cooperate with local authorities.
- Coordinate temporary restoration of services to property and equipment.
- Contact waste disposal agency to arrange for removal of damaged goods.
- Assist in setting up the telephone system in the operations center.

GUEST COMMUNICATOR ACTION CARD

Action by: Service Excellence Team, FOM, DOSM, DFB

EMERGENCY PROCEDURES

- Upon notification of General alarms sounding
- Remain calm but act quickly.
- Print the Downtime Reports:
 - Guest in house by room / name.
 - Reservation Report. (3 Days)

13

- Audit Reports.

- Secure cash, valuables, and confidential information in safety box.
- Go down to the Control Room and obtain an emergency supplies box, fluorescent jacket, and loud hailer.
- Go to the Hotel Assembly point – The front of the hotel.
- Wearing the jacket and assisting guests in assembly point then read out the following message ensuring that each area of the assembly point can hear you.
 - The Hotel fire alarms have been activated, our fire search team is currently investigating, and we are awaiting the arrival of the fire brigade. Thank you for your cooperation.
 - ขณะนี้สัญญาณเตือนภัยขึ้นที่ห้องคั่นหน้าของโรงแรมกำลังตรวจสอบและรอเจ้าหน้าที่ดับเพลิง ขอขอบคุณในความร่วมมือ

Repeat this message several times.

- Ensure guests who are cold have dressing gown or space blanket from the emergency supplies box.
- Undertake a guest roll call, using the guest in house report by guest name order.
- Record all guests that are present and those missing.
- Advise Fire Commander of number of guests missing.
- Advise Crisis Manager of any issues with guests.
- A notification from Crisis Manager to evacuate guests to a mutual aid hotel.

In the event of controllable fire or a false alarm

- Read out the following message ensuring that each area of the assembly point can hear you.
 - The fire brigade has deemed the Hotel safe and secure for your return. Thank you for your cooperation.
 - หน่วยดับเพลิงแจ้งว่าโรงแรมปลอดภัยและให้ทุกคนกลับเข้าไปในโรงแรมได้ขอขอบคุณในความร่วมมือ

Repeat this message several times.

- Assist guests back into the Hotel and standby as guest Ambassador.
- If necessary, arrange hot drinks or water.

Mutual aid hotel-1 and Mutual aid hotel-2

- Contact Transport Company to arrange mini vans at Hotel Assembly Point (The Front of the Hotel) alternatively put

14

- groups of guests in taxis and sends to Mutual aid hotel-1 with employee escort if possible.
- At the Mutual aid hotel-1 make the way to the Hotel lower ground floor lobby and then to the prearranged holding area – if one is not automatically available use the lower ground foyer.
- Take records of guests being sent to the Mutual aid Hotel-1.
- Retake guest roll call and advise Crisis Manager of any missing guests.
- Make guests as comfortable as possible and await further instructions from the Crisis Manager.
- Look after guest comfort and InterContinental Bangkok will provide refreshments.
- Depending on the situation guests may need to stay at InterContinental Bangkok, make suitable arrangements.

Mutual aid Hotel-2

- Contact Transport Company to arrange mini vans at Hotel Assembly Point (The Front of the Hotel) alternatively put groups of guests in taxis and sends to Indigo Bangkok Wireless Road with employee escort if possible.
- At the Indigo Hotel make way to the Hotel lower ground floor lobby and then to the prearranged holding area – if one is not automatically available use lower ground foyer.
- Take records of guests being sent to Hotel Indigo Bangkok Wireless Road.
- Retake guest roll call and advise Crisis Manager of any missing guests.
- Make guests as comfortable as possible and await further instructions from the Crisis Manager.
- Look after guest comfort and Hotel Indigo Bangkok Wireless Road will provide refreshments.
- Depending on the situation guests may need to stay at Indigo Bangkok Wireless Road, make suitable arrangements.

Primary Mutual Aid Hotel / Business	Secondary Mutual Aid Hotel / Business
N/A	N/A
Contact Information	Contact Information
N/A	N/A

- Contact transportation company for guest relocation and pick up point – which evacuation point (The front of the

15

hotel)

Primary Transportation Company	Secondary Transportation Company
N/A	N/A
Contact Information	Contact Information
Company Contact Number	N/A

POST EMERGENCY

Action by: Service Excellence Team, FOM, DOSM, Dir. Rest. & Bars

DAY & NIGHT ACTION CARD

- Remain calm but act quickly.
- Upon notification of general alarm sounding.
- Proceed to the Control Room.
- To wait for further instruction from GM, CMT, Fire commander.
- Upon evacuation order ensure guests in all area evacuation via nearest staircase with guidance from staff, meet guest at assembly point.
- Check if there is any need of assistance from disabled guest, wheelchair or elderly guest and other guest.
- Assign with Service Excellence Team, RDM, DOSM, FBM
 - Undertake a guest roll call using guest in house report.
 - Record all guests that are present and those missing.
 - Advise fire commander of number of guests missing.
 - On notification from Crisis Manager to evacuate guest to a mutual aid hotel.
- Once all evacuation proceeds to assembly point.

16

Hotel Assembly Point	The Hotel Main Entrance
----------------------	-------------------------

- Depending on where the fire is and is not life threatening, once all guests have been evacuated from their room, outlets, or facilities, evacuate to hotel assembly point and assist with guest comfort.
- Check if all guests have evacuated and ensure roll call has started.
- Assisting guests with relocation if needed.
- Ensure what method to relocate guest to mutual hotel as per stated in the agreement.

In the event of controllable fire or false alarm.

- Read out the following message ensuring that each area of the assembly point can hear.
- The fire brigade has deemed the hotel safe and secure for your return, thank you for your cooperation.

EMPLOYEE COMMUNICATOR ACTION CARD

Action by Concierge & Porter

EMERGENCY PROCEDURES

- Upon notification of General alarms sounding.
- Remain calm but act quickly.
- Under direction of the Control Room proceed to the location of the alarm together with security officer via fire lift number 5 (service lift)
- Look for cause of the alarm. (Fire, guest, child, broken sprinkler, etc.)
- Using radio, report back to the Disaster Control Room.
- If a fire is visible, attempt to extinguish the fire with a PFE if it is safe to do so.
- If the fire cannot be safely extinguished, evacuate and seal off the area by closing doors.

- Report back to the Disaster Control Room.
- Assist guests by pointing out exits.
- Check with control room if any register disables / Special need guests are in house currently and if so, escort to the fire staircase, then radio to DCR on location of guest for back up.
- Go to the hotel assembly point.
- On notification from Crisis Manager to evacuate guests and employees to mutual aid hotels whilst assisting the guests - prepare team to assist the guests to relocate to mutual aid hotel and record which employees are leaving.

Mutual aid hotel-1 and Mutual aid hotel-2

- Contact Transport Company to arrange mini vans at Hotel Assembly Point alternatively put groups of guests in taxis and sends to Mutual aid hotel-1 with employee escort if possible.
 - Mutual aid hotel-1 make way to the Hotel lower ground floor lobby and then to the prearranged holding area – if one is not automatically available use lower ground foyer.
 - Take records of guests being sent to the Mutual aid Hotel-1.
 - Retake employee roll call and advise Crisis Manager of any further missing employees.
 - Ensure the employees are as comfortable as possible and await further instructions from the Crisis Manager, the Mutual aid hotel-1 will provide refreshments.
- Depending on the situation, a core group of employees may need to be relocated to Mutual aid hotel-1 to assist with the InterContinental Sukhumvit Bangkok guests.
- Make a record of names if any employees are sent or go home.

Mutual aid Hotel-2

- As per InterContinental Bangkok allow ensure employees help guests with transport to Mutual aid Hotel-2.

POST EMERGENCY

- Arrange with P&C (HR) to contact all employees to advise them of the status of the crisis.
- Prepare information for debrief meeting.
- Return items to Control Room.

EMPLOYEE SUPPORT COORDINATOR ACTION CARD

Action by P&C(HR), HOD

DAY & NIGHT ACTION CARD

- Upon notification of general alarms sounding.
- Remain calm but act quickly.
- Proceed to the Control Room and wait for further instruction from fire commander, ERT and FFT.
- Resume to work if it is a false alarm.
- Proceed to assembly point to coordinate with department heads once evacuation announcement has been activated.
- Ensure each department undertakes roll call and all staff have evacuated to assembly point.
- At the assembly point check if any staff need any medical assistance.
- Contact the Control Room to provide first-aider or medical ambulance for any injuries.
- Communicate with Human Resource Department and staff need count, report missing person, injury, or number of casualties to the Control Room.

Hotel Assembly Point

The Hotel Main Entrance

- Depending on where the fire is and is not life threatening, all guests will be advised to evacuate to the hotel assembly point and assist with guest comfort.

POST EMERGENCY

- Arrange with HR / DH to contact all employees to advise them of the status of the crisis.
- Prepare information for debrief meeting.
- Return items to Disaster Control Room.

FIRST AIDER ACTION CARD

Action by Security

ELEVATOR FAILURE PROCEDURE / ELEVATOR EMERGENCIES

SOP REFERENCE:	SC004-2023
DEPARTMENT:	SECURITY
EFFECTIVE DATE:	
ISSUED BY HOD:	APPROVE BY GM:
APPROVED BY GM	

CONDITIONS	PROCEDURES
Purpose:	When an incident occurs, the priority in this situation is to get the passenger out safely from the elevator.
Procedure:	The following steps in case of an elevator trap: - Any associate hearing an alarm ringing from an elevator should immediately attempt to determine: - The elevator that the alarm is coming from. - Whether the elevator doors are open or closed. - Whether any persons are trapped in the elevator and determine if anyone needs medical attention. - The floor number the elevator is on. - The associate should then immediately contact the Operator and report the incident. • FOR THE SAFETY OF THE PASSENGERS AND ASSOCIATES, ONLY AN AUTHORIZED ELEVATOR MECHANIC SHOULD ATTEMPT TO RELEASE PASSENGERS FROM AN INOPERATIVE ELEVATOR.

Why is this task important for you and our guests?

Answers:

- To ensure the hotel guests' safety.
- To ensure the staff member safety.

STEPS	HOW/ STANDARDS	TRAINING QUESTIONS
	- The OTS upon being notified of an elevator failure, call the elevator to determine if any guests or associates are trapped inside. - If the elevator is empty, report the incident to Engineering. Engineers turn off the lights, lock the elevator, and place a barricade in front. - Contact the elevator maintenance company to immediately dispatch a mechanic. - The engineer meets the mechanic upon arrival to inform him of all known details. - If the elevator has passengers inside, advise them to remain calm and let them know help is on the way. Maintain phone contact with the passengers to reassure them. - Determine if any passengers need medical attention. If so, immediately contact local emergency services to be contacted by the operator. - Confirm which elevator is inoperative and notify the Emergency Response Team as well as RDM. - Call Security with the details of the elevator failure. - Ask passengers if they would like anyone to be notified that they are delayed. - Engineering and Security make a report of the situation at the end.	- How many elevators are in the hotel. - When the elevator was stuck who responsibility. - The elevator stuck who open the elevator door.

ภาคผนวก ข-10

เอกสารการตรวจสอบอุปกรณ์ที่ใช้ระบายอากาศ
ช่วงเดือนกรกฎาคม ถึงธันวาคม พ.ศ. 2568

Hood Exhaust Duct System

InterContinental Bangkok Sukhumvit59

August 9, 2025

BY NEW SRIFAMAHAMEK CO.,LTD.



บริษัท นิวศรีฟ้าหม่อม จำกัด

455,457,459,461 ถนนกาญจนาภิเษก แขวงทุ่งครุ เขตภาษีเจริญ กรุงเทพมหานคร 10120

Tel. (089)490-2226, (081)445-4715, (081)354-1153, (02) 286-7781, (02) 676-0635 Fax. (02) 287-0995

E-Mail : newsnfa1994@gmail.com, newsnfa@hotmail.com

เลขทะเบียน 0-1055-37084-89-8

To : **Inter Continental Bangkok Sukhumvit 59 *No.2***

ATTN : Khun. Charkit / E-mail : Charkit.Phothisarat@ihg.com

Cc : Khun. Kann / E-mail : kannika.patipanjums@ihg.com

Re : รายงานการทำความสะอาด Hood Exhaust Duct System

Work Report

วันที่	เวลา	สถานที่	หมายเหตุ
9 / 08 / 2025	22.00 - จนดึก	Main kitchen - Set 1 Hood 4 M. , 6 Exhausts Duct - Set 2 Hood 5 M. , 1 Exhausts Duct Bakery Kitchen - Hood 2 Set 1 M. , 6 Exhausts Duct ทำความสะอาด Hood (กระโหลก) ภายใน-นอก รวมถึง Filter ทั้งหมด - ตรวจสอบ Exhaust Duct Line (มีตัว Blower - ตรวจสอบระบบก่อนเปิดใช้งานอีกครั้ง (ไม่รวมท่อแนวตั้ง) - 2 Blowers Exhaust (บนฝ้า)	

ทางเจ้าหน้าที่ของบริษัทฯ ได้เข้าทำความสะอาด Hood Exhaust Duct System

ตามรายการข้างต้นเป็นที่เรียบร้อยแล้ว

จึงเรียนมาเพื่อทราบ

9 / 08 / 2025 ผู้รายงาน

[Redacted signature]


Bakery Kitchen



ภาพ ก่อน ทำความสะอาด



ภาพ หลัง ทำความสะอาด

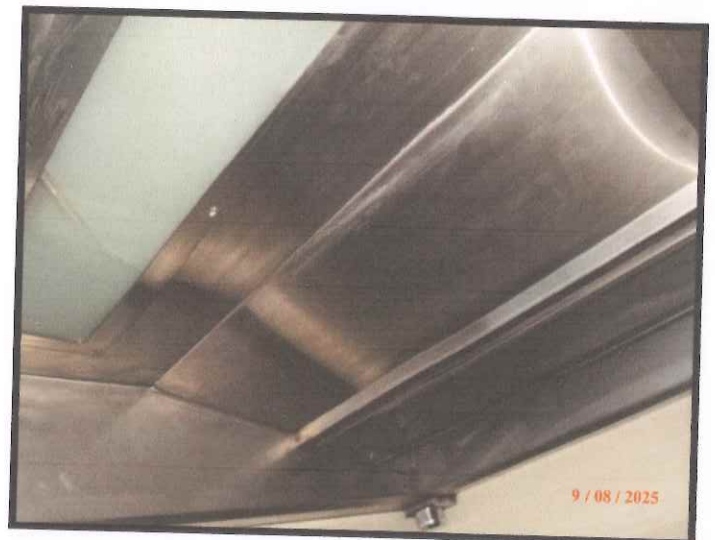

Bakery Kitchen



ภาพ ก่อน ทำความสะอาด

ภาพ หลัง ทำความสะอาด



Bakery Kitchen



ภาพ ก่อน ทำความสะอาด

ภาพ หลัง ทำความสะอาด



Main Kitchen

ภาพ ก่อน ทำความสะอาด





ภาพ หลัง ทำความสะอาด



Main Kitchen

ภาพ ก่อน ทำความสะอาด

ภาพ หลัง ทำความสะอาด

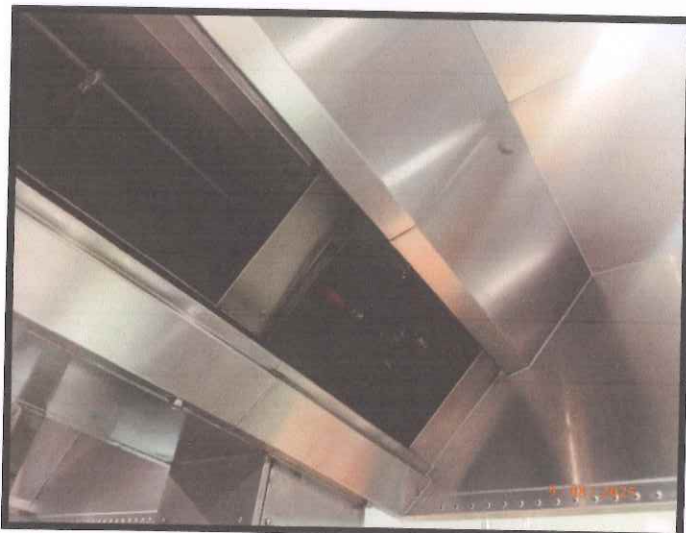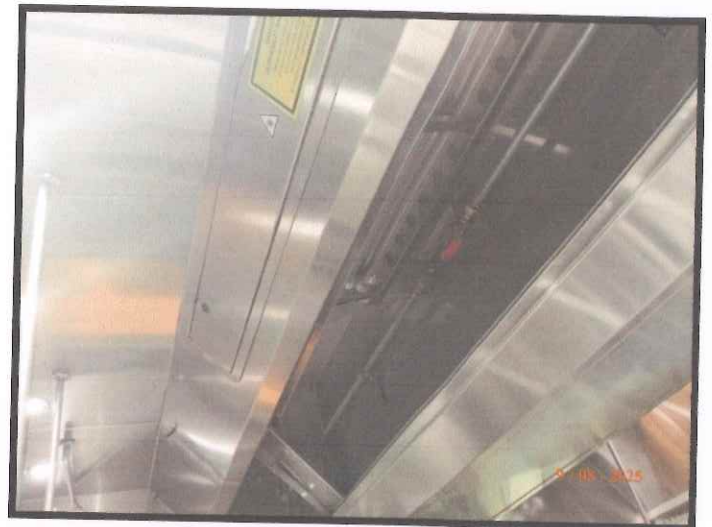




Main Kitchen



ภาพ ก่อน ทำความสะอาด



ภาพ หลัง ทำความสะอาด

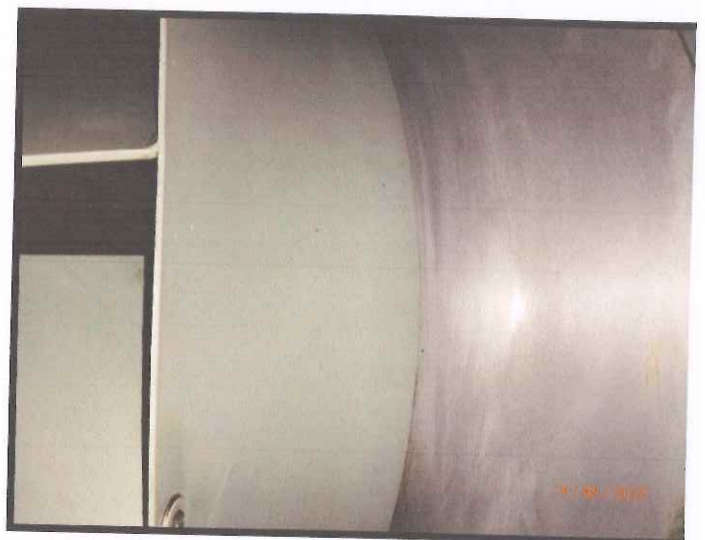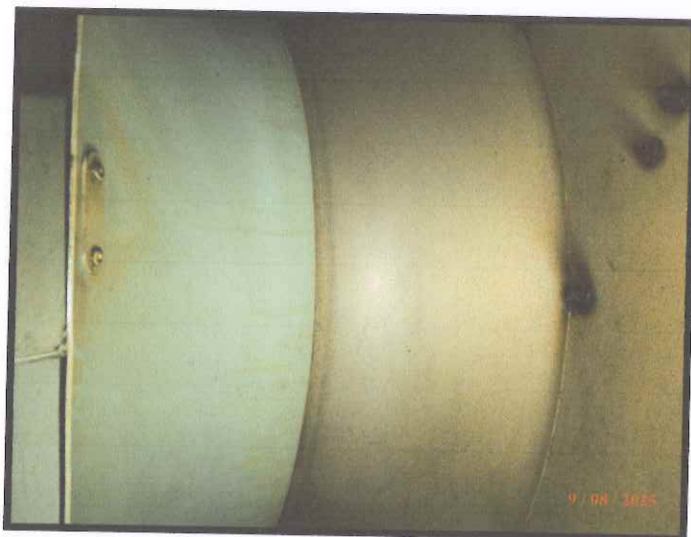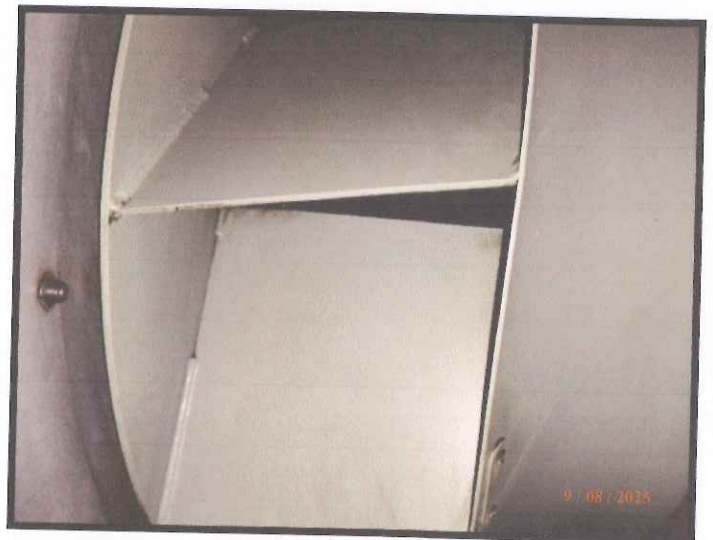



Main Kitchen




ภาพ ก่อน ทำความสะอาด




ภาพ หลัง ทำความสะอาด

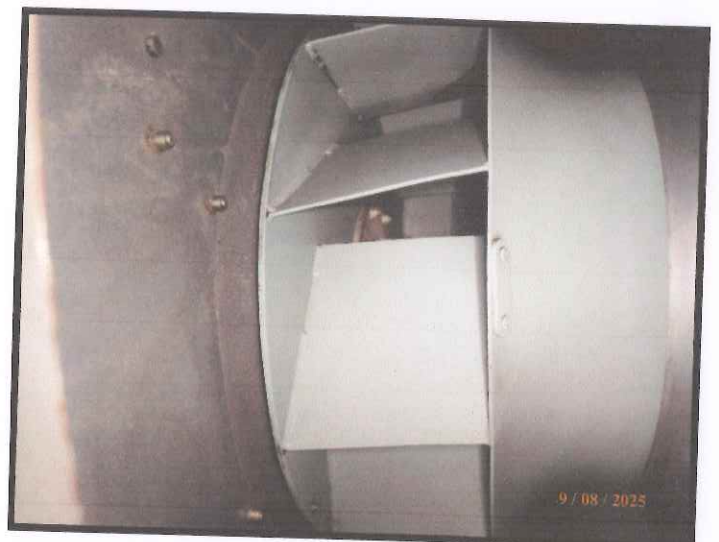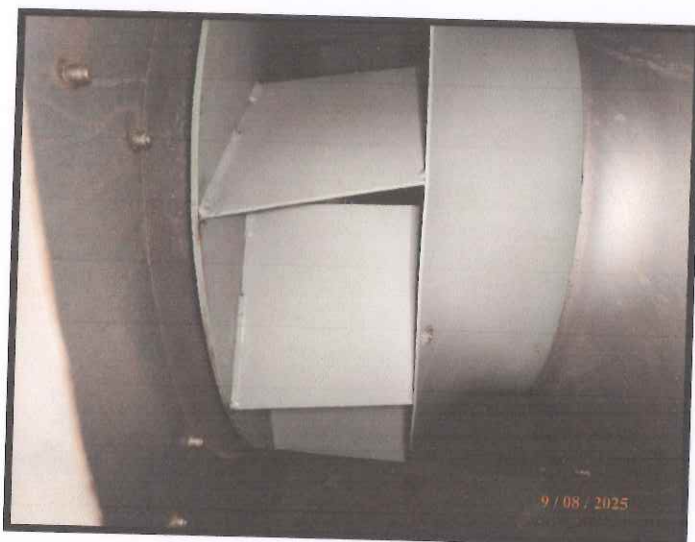

Show Kitchen

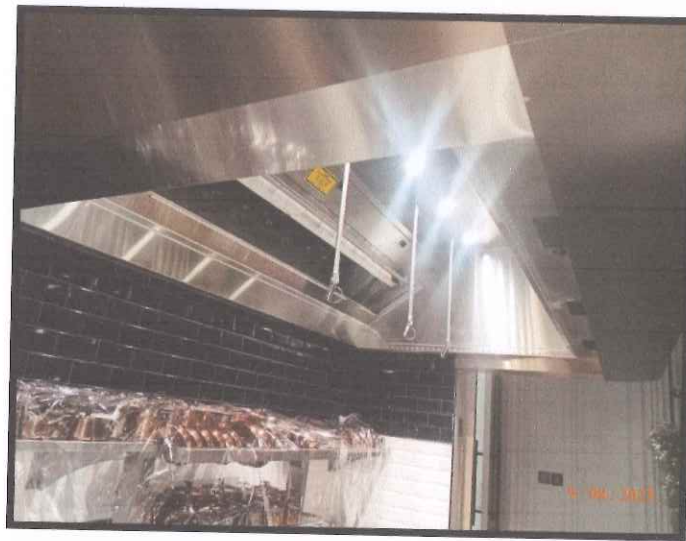

ภาพ ก่อน ทำความสะอาด

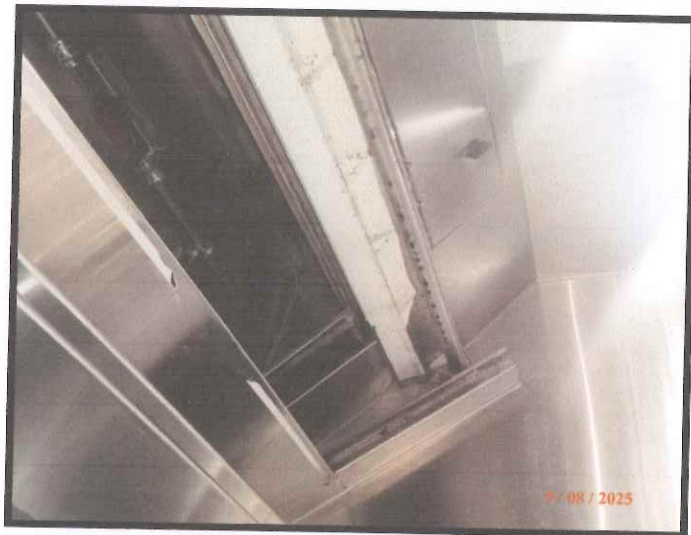

ภาพ หลัง ทำความสะอาด





Show Kitchen

ภาพ ก่อน ทำความสะอาด



ภาพ หลัง ทำความสะอาด

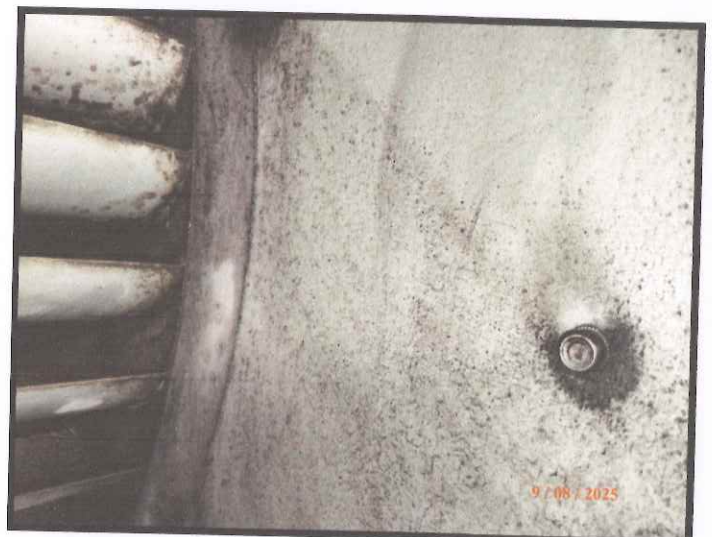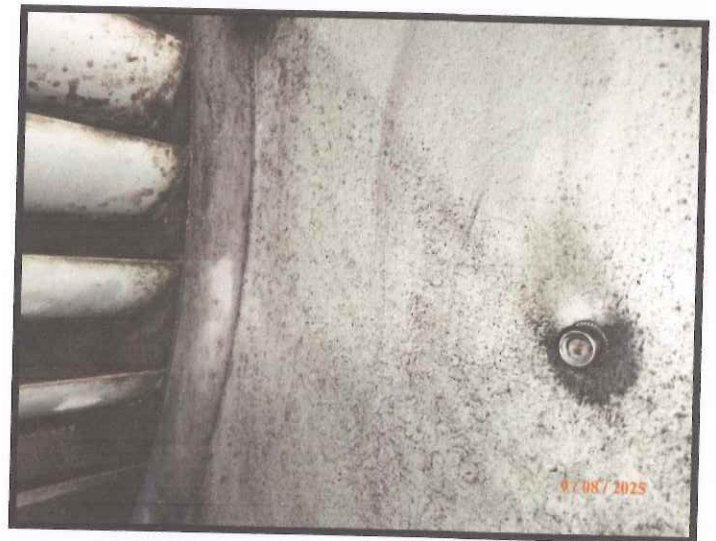

Preventive Maintenance Report

DESCRIPTION	EXHAUST FAN
WD SERIAL NO/TAG NO.	22045806
MODEL :	HITACHI TFO-K 1.1kW 380V 4P
LOCATION(/Location/Level/Control Box No.)	FL.11 / EF-11-1
CYCLE CHECK	
MAINTENANCE DATE/ DAY	29/12/25

No	รายการตรวจเช็คและบำรุงรักษา	บันทึกค่าที่วัดได้	ผลจากกระตรวจเช็คสภาพ		ความถี่ CYCLE CHECK
	Description	Measuring Data	ปกติ YES	แก้ไข NO	
1	ตรวจสอบใบพัดและการสั่นสะเทือน		✓		
2	ทำความสะอาดใบพัด		✓		
3	ตรวจสอบ Pulley	✓	✓		
4	ตรวจสอบ Alignment และความตึงสายพาน	N	✓		
5	ตรวจสอบทิศทางการหมุน		✓		
6	ตรวจสอบลูกปืนพัดลม		✓		
7	ตรวจสอบลูกปืนพัดลม		✓		
8	เปลี่ยนลูกปืนพัดลม		N/A		
9	ตรวจสอบสภาพสปริงพัดลม		✓		
10	ตรวจสอบสภาพ Casing พัดลม		✓		
11	ตรวจสอบกระแสไฟฟ้า (Current) (9.8A)	R-S = 9.1A, S-T = 9.1A, R-T = 9.2A	✓		
12	ตรวจสอบแรงดันไฟฟ้า (Voltage)	R-S = 216V, S-T = 217V, R-T = 216V	✓		
13	ตรวจสอบลูกปืนมอเตอร์		✓		
14	เปลี่ยนลูกปืนมอเตอร์		N/A		
15	เติมน้ำมันลูกปืนมอเตอร์		N/A		
16	วัดรอบความเร็วมอเตอร์พัดลม (1420 RPM)	1463 RPM	✓		
17	ตรวจสอบการทำงาน Thermostat		✓		

Summary



Insulation Test Report

DESCRIPTION				Exhaust Fan			
WD SERIAL NO/TAG NO.				99045806			
MODEL :				HITACHI TFC-K 1.1kw 380 AP			
LOCATION(/Location/Level/Control Box No.)				FL.11 / EF-11-1			
CYCLE CHECK							
MAINTENANCE DATE/ DAY				23 / 12 / 25			

PHASE - PHASE	RESULTS	PASS	FAIL	PHASE - GROUND	RESULTS	PASS	FAIL
		✓				✓	
		BEFORE	AFTER			BEFORE	AFTER
R-S		150 MΩ		R-G		OL	
S-T		900 MΩ		S-G		OL	
R-T		900 MΩ		R-G		OL	
R-N		OL		N-G		900 MΩ	
S-N		OL					
T-N		OL					

Summary

