

เอกสารแนบ 1

สำเนาหนังสือแจ้งผลการพิจารณารายงานการประเมินผลกระทบสิ่งแวดล้อม

จึงเรียนมาเพื่อโปรดพิจารณาดำเนินการในส่วนที่เกี่ยวข้องต่อไป

สำนักวิเคราะห์ผลกระทบสิ่งแวดล้อม
โทรศัพท์ 0-2265-6500 ต่อ 6814
โทรสาร 0-2265-6616



สำนักงานนโยบายและแผน
ทรัพยากรธรรมชาติและสิ่งแวดล้อม
60/1 ซอยพืชรัตนา 7 ถนนพระรามที่ 6
กรุงเทพฯ 10400

18 มิถุนายน 2551

เรื่อง รายงานการวิเคราะห์ผลกระทบบนสิ่งแวดล้อมโครงการโรงแม่จันเตา

เรียน ผู้ว่าราชการกรุงเทพมหานคร

ข้าพเจ้านี้ชื่อ สันติ มาจากหมู่บ้านและแผนกพยาบาลการรวมชาติและสังเขตลุ่มที่ ๒๓ 1009.5/2801
 ลงวันที่ 10 เมษายน 2551

สิ่งที่ส่งมาด้วย 1.สำเนาหนังสือบริษัท อีอาร์เอ็ม-สยาม จำกัด ลงวันที่ 11 เมษายน 2551

2.มาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อมที่โครงการต้องดำเนินการร่วมกับหน่วยงานของรัฐ ให้ศึกษา จัดทำ ต้องยึดถือปฏิบัติอย่างเคร่งครัด

3. แนวทางการเสนอรายงานผลการปฏิบัติงานตามภารกิจทั้งและแก่ที่ผลกระทบบ้าง
ซึ่งแต่ละกลุ่มและแต่ละภาคการศึกษามีความแตกต่างอย่างมาพอสมควร

ตามหนังสือที่อ้างถึง สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ได้แจ้งผลการพิจารณารายงานการวิจัยโครงการที่คณะกรรมการสิ่งแวดล้อมแห่งชาติ ของบริษัท โออิชิ จำกัด ตั้งอยู่ที่ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร จัดทำรายงานฯ โดยบริษัท โออิชิ เอ็ม-สยาม จำกัด ซึ่งคณะกรรมการผู้ชำนาญการพิจารณารายงานการวิจัยโครงการได้ลงมติเห็นชอบร่างโครงการลงทุน ในการประดิษฐ์ 6/2551 เมื่อวันที่ 4 มีนาคม 2551 มีมติไม่ เห็นชอบรายงานฯ ต่อมาบริษัท โออิชิ เอ็ม-สยาม จำกัด ได้เสนอรายงานฯ นี้แจ้งเพิ่มเติมให้สำนักงาน ดำเนินการตามขั้นตอนการพิจารณาโครงการฯ ดังรายละเอียดตามสิ่งที่ส่งมาด้วย 1

เอกสารแบบ 2
สำเนาใบรับหนังสือแจ้งความประสงค์จะก่อสร้างอาคาร ตัดแปลง
หรือรื้อถอนอาคาร (กทม.6)

๗
ความมาก

โดยไม่ยื่นคำขอรับใบอนุญาตตามมาตรา 39 ทวิ

แบบ กทม.6

ตามแบบ กทม.1 เลขที่ 328

ลงวันที่ 19 มิถุนายน 2551

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง ดัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร
หรือเปลี่ยนแปลงการใช้อาคาร โดยไม่ยื่นคำขอรับใบอนุญาต ตามมาตรา 39 ทวิ

เลขที่ 328 / 2551

ได้รับแจ้งจาก บริษัท โอ๊คทรี จำกัด โดย

เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครอง

ดรอกร/ซอย ถนน รัชดาภิเษก ตำบล/แขวง จันทน์เกษม

อำเภอ/เขต จตุจักร จังหวัด กรุงเทพมหานคร ดังข้อความต่อไปนี้

ข้อ 1 ขอแจ้งความประสงค์จะทำการ ก่อสร้างอาคาร

ที่บ้านเลขที่ หมู่ที่ ดรอกร/ซอย ถนน สาทร

ตำบล/แขวง สีลม อำเภอ/เขต บางรัก กรุงเทพมหานคร

ในที่ดินโฉนด

เป็นที่ดินของ

โดยไม่ยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

จตุรภณด์

ข้อ 2 เป็นอาคาร

ชั้นใต้ดิน 2 ชั้น

พาณิชย์-สำนักงาน-ห้องประชุม-

2.1 ชนิด ดึก 28 ชั้น

จำนวน 1 หลัง เพื่อใช้เป็น

โรงแรม (267 ห้อง)-ภัตตาคาร-

พื้นที่ 38,061.00

ม.²

ที่จอดรถ ที่กัณฑ์ และทางเข้า-ออกของรถ จำนวน 243 คัน

พื้นที่ 1,200.00

ม.²

2.2 ชนิด

จำนวน

หลัง เพื่อใช้เป็น

พื้นที่

ม.²

ที่จอดรถ ที่กัณฑ์ และทางเข้า-ออกของรถ จำนวน คัน

พื้นที่

ม.²

2.3 ชนิด

จำนวน

หลัง เพื่อใช้เป็น

พื้นที่

ม.²

ที่จอดรถ ที่กัณฑ์ และทางเข้า-ออกของรถ จำนวน คัน

พื้นที่

ม.²

19, ส.ย. 2551

19, ส.ย. 2551

19, ส.ย. 2551

19, ส.ย. 2551

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลนและรายการคำนวณที่แนบมาพร้อมนี้

ข้อ 3 โดยมี

- (1).....เป็นสถาปนิกผู้ออกแบบ
- (2).....เป็นสถาปนิกผู้ควบคุมงาน
- (3).....เป็นวิศวกรผู้ออกแบบโครงสร้าง
- (4).....เป็นวิศวกรผู้ควบคุมงาน โครงสร้าง
- (5).....เป็นวิศวกรผู้ออกแบบระบบปรับอากาศ
อากาศและระบบระบายอากาศและระบบ
ป้องกันเพลิงไหม้
- (6).....เป็นวิศวกรผู้ควบคุมงานระบบปรับอากาศ
อากาศและระบบระบายอากาศและระบบ
ป้องกันเพลิงไหม้
- (7).....เป็นวิศวกรผู้ออกแบบระบบบำบัด
น้ำเสียและการระบายน้ำทิ้ง
- (8).....เป็นวิศวกรผู้ควบคุมงานระบบบำบัด
น้ำเสียและการระบายน้ำทิ้ง
- (9).....เป็นวิศวกรผู้ออกแบบระบบลิฟต์/ไฟฟ้า
- (10).....เป็นวิศวกรผู้ควบคุมงานระบบลิฟต์/ไฟฟ้า

ข้อ 4 กำหนดแล้วเสร็จงาน 730 วัน โดยจะเริ่มตั้งแต่ก่อสร้างอาคาร/ดัดแปลงอาคาร/รื้อถอนอาคาร/
เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคาร เมื่อ 19 มิถุนายน 2551 และจะแล้วเสร็จเมื่อ 19 มิถุนายน 2553

ข้อ 5 ค่าธรรมเนียมในการตรวจแบบ.....	152,244.00	บาท
ค่าธรรมเนียมต่อระบายน้ำ รื้อ เชื้อน กำแพงหรืออื่นๆ.....	216.00	บาท
ค่าธรรมเนียมหรือที่จอดรถยนต์ภายนอกอาคาร.....	600.00	บาท
ค่าธรรมเนียมใบอนุญาต.....	20.00	บาท
รวมทั้งสิ้น.....	153,080.00	บาท

วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551

ข้อ 6 ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

6.1 ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและหรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา 8 (1) มาตรา 9 หรือมาตรา 10 แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ.2522 แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ.2535

6.2 จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่นและฝุ่นละอองที่กระจายอันเนื่องมาจากการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กันตัวอาคารสูงตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้าน รอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้างไม่น้อยกว่า 2.00 เมตร ตลอดแนวอาคารด้านที่มีระยะราววัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดินข้างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษาให้อยู่ในสภาพดีตลอดเวลาก่อนการก่อสร้าง

6.3 จะต้องจัดให้มีปดองชั่วคราวสำหรับทั้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละออง มลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุให้เกิดความเดือดร้อนรำคาญและเป็นภัยอันตรายแก่สุขภาพ ชีวิตและทรัพย์สิน ของประชาชนที่อยู่ในบริเวณใกล้เคียง

ข้อ 7 ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา 39 ทวิ หรือนับแต่วันที่เริ่มการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี ถ้าเจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคารที่ได้แจ้งไว้ ผิดแบบแปลน แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคารที่ได้ยื่นไว้ ตามมาตรา 39 ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าว หรือกฎหมายอื่นที่เกี่ยวข้อง เจ้าพนักงานท้องถิ่นยังคงมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

ข้อ 8 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

8.1 การกระทำดังกล่าวเป็นการรุกล้ำที่สาธารณะ

8.2 การกระทำดังกล่าวเกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้า หรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือ

วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551

8.3 การกระทำดังกล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง คัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือ
เปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตาม
พระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ 9 ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้อง
ต่อไปด้วย

ข้อ 10 ห้ามทำการก่อสร้าง คัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจาก
ที่ได้แจ้งไว้

ข้อ 11 ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่งความลึก และ
ขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อ ประปา สายเคเบิล เป็นต้น
และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดอันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ 12 เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ลึกจนอาจเป็นอันตรายแก่อาคาร
ถนน หรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีค้ำยัน เข็มพิค หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัย
และต้องตรวจสอบแก้ไขค้ำยัน เข็มพิค และฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

ข้อ 13 ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อมและแผนการติดตาม
ตรวจสอบคุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจาก
สำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ พส. 1009.5/4515 ลงวันที่ 18
มิถุนายน 2551 อย่างเคร่งครัด

ออกให้ ณ วันที่

โดยราชการแทนผู้อำนวยการสำนักงาน
ปลัดราชการแทนผู้ว่าราชการกรุงเทพมหานคร
เจ้าพนักงานท้องถิ่น

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.1 เลขรับที่ 328
ลงวันที่ 19 เดือน มิถุนายน พ.ศ. 2551
ราย บริษัท โอ๊คทรี จำกัด

วันที่ 19, ต.ย. 2551
วันที่ 19, ต.ย. 2551
วันที่ 19, ต.ย. 2551
วันที่ 19, ต.ย. 2551

คำเตือน

1. ถ้าผู้แจ้งฯจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งฯกับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และมีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว

2. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งก่อสร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้าออกของรถตามที่กำหนดไว้ในใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้าออกของรถไว้ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กักเก็บรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

3. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุมการใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด 30 วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551
วันที่ 19 มิ.ย. 2551

ด่วนมาก

โดยไมยื่นคำขอรับใบอนุญาตตาม มาตรา 39 ทวิ

แบบ กทม.6 เดิมเลขที่ 328/2551

ลงวันที่ 19 มิถุนายน 2551

ตามแบบ กทม.1 เลขที่ 274

ลงวันที่ 7 กรกฎาคม 2553

แบบ กทม.6

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง คัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร

หรือเปลี่ยนแปลงการใช้อาคาร โดยไมยื่นคำขอรับใบอนุญาต ตามมาตรา 39 ทวิ

เลขที่ 274 / 2553

ได้รับแจ้งจาก บริษัท โอ๊คทรี จำกัด โดย

เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครองอาคาร อยู่บนเลขที่

ตรอก/ซอย ถนน รัชดาภิเษก ตำบล/แขวง จันทน์เกษม

อำเภอ/เขต จตุจักร จังหวัด กรุงเทพมหานคร ดังข้อความต่อไปนี้

ข้อ 1 ขอแจ้งความประสงค์จะทำการ ก่อสร้างอาคาร (แก้ไขแบบแปลน)

ที่บ้านเลขที่ หมู่ที่ ตรอก/ซอย ถนน สาทร

ตำบล/แขวง สัตตม อำเภอ/เขต บางรัก กรุงเทพมหานคร

ในที่ดินโฉนดที่ดิน

เป็นที่ดินของ

โดยไมยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

ข้อ 2 เป็นอาคาร ชั้นใต้ดิน 2 ชั้น

2.1 ชนิด ตึก 28 ชั้น จำนวน 1 หลัง เพื่อใช้เป็น โรงแรม (237 ห้อง)-ภัตตาคาร

พื้นที่ 37,446.00 ม.² ที่จอดรถ ที่กั๊ปรด และทางเข้า-ออกของรถ จำนวน 243 คัน

พื้นที่ 1,200.00 ม.²

2.2 ชนิด จำนวน หลัง เพื่อใช้เป็น

พื้นที่ ม.² ที่จอดรถ ที่กั๊ปรด และทางเข้า-ออกของรถ จำนวน คัน

พื้นที่ ม.²

2.3 ชนิด จำนวน หลัง เพื่อใช้เป็น

พื้นที่ ม.² ที่จอดรถ ที่กั๊ปรด และทางเข้า-ออกของรถ จำนวน คัน

พื้นที่ ม.²

ผู้ว่า
หัว

วันที่ 7 ก.ค. 2553
วันที่ 7 ก.ค. 2553
วันที่ 7 ก.ค. 2553

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลนและรายการคำนวณที่แนบมา

พร้อมนี้

ข้อ 3 โดยมี

- (1).....เป็นสถาปนิกผู้ออกแบบ
- (2).....เป็นสถาปนิกผู้ควบคุมงาน
- (3).....เป็นวิศวกรผู้ออกแบบโครงสร้าง
- (4).....เป็นวิศวกรผู้ควบคุมงานโครงสร้าง
- (5).....เป็นวิศวกรผู้ออกแบบระบบปรับอากาศและระบบระบายอากาศและระบบป้องกันเพลิงไหม้
- (6).....เป็นวิศวกรผู้ควบคุมงานระบบปรับอากาศและระบบระบายอากาศ
- (7).....เป็นวิศวกรผู้ควบคุมงานระบบป้องกันเพลิงไหม้
- (8).....เป็นวิศวกรผู้ออกแบบระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง
- (9).....เป็นวิศวกรผู้ควบคุมงานระบบบำบัดน้ำเสียและการระบายน้ำทิ้ง
- (10).....เป็นวิศวกรผู้ออกแบบระบบลิฟท์/ไฟฟ้า
- (11).....เป็นวิศวกรผู้ควบคุมงานระบบลิฟท์
- (12).....เป็นวิศวกรผู้ควบคุมงานระบบไฟฟ้า
- (13).....เป็นวิศวกรผู้ตรวจสอบงานออกแบบและคำนวณส่วนต่างๆ ของ โครงสร้างอาคาร

วันที่ 7 / 10 / 2553
วันที่ 7 / 10 / 2553
วันที่ 7 / 10 / 2553
วันที่ 7 / 10 / 2553

ข้อ 4 กำหนดแล้วเสร็จงาน... 730... วัน โดยจะเริ่มต้นก่อสร้างอาคาร/คัดแปลงอาคาร/รื้อถอนอาคาร/
เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคาร เมื่อ... 7 กรกฎาคม 2553... และแล้วเสร็จเมื่อ... 7 กรกฎาคม 2555...

ข้อ 5 ค่าธรรมเนียมในการตรวจแบบ.....	149,784.00	บาท
ค่าธรรมเนียมทอระบายน้ำ รั้ว เขื่อน กำแพงหรืออื่น ๆ	216.00	บาท
ค่าธรรมเนียมทางวิ่งหรือที่จอดรถยนต์ภายนอกอาคาร.....	600.00	บาท
ค่าธรรมเนียมใบอนุญาต.....	20.00	บาท
รวมทั้งสิ้น.....	150,620.00	บาท

ข้อ 6 ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

6.1 ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและหรือ
ข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา 8 (11) มาตรา 9 หรือมาตรา 10 แห่งพระราชบัญญัติควบคุม
อาคาร พ.ศ.2522 แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ.2535

6.2 จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่นและ
ฝุ่นละอองฟุ้งกระจายอันเนื่องมาจากการก่อสร้าง คัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กันตัวอาคารสูง
ตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้าน รอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้าง
ไม่น้อยกว่า 2.00 เมตร ตลอดแนวอาคารด้านที่มีระยะราววัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดิน
ข้างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษาให้อยู่ในสภาพดี
ตลอดเวลาการก่อสร้าง

6.3 จะต้องจัดให้มีปล่องชั่วคราวสำหรับทิ้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละออง
มลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุ
ให้เกิดความเดือดร้อนรำคาญและเป็นอันตรายแก่สุขภาพ ชีวิตและทรัพย์สิน ของประชาชนที่อยู่ในบริเวณ
ใกล้เคียง

ข้อ 7 ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา 39 ทวิ หรือนับแต่วันที่เริ่ม
การก่อสร้าง คัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี [ถ้า]
เจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง คัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้
อาคารที่ได้แจ้งไว้ ผิดทั้งบริเวณ แบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคารที่
ได้ยื่นไว้ ตามมาตรา 39 ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือ
ข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าว หรือกฎหมายอื่นที่เกี่ยวข้อง เจ้าพนักงานท้องถิ่นยังคง
มีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

วันที่ - 7 ก.ค. 2553
วันที่ - 7 ก.ค. 2553
วันที่ - 7 ก.ค. 2553
วันที่ - 7 ก.ค. 2553

ข้อ 8 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

8.1 การกระทำได้กล่าวเป็นการรื้อถอนที่สาธารณะ

8.2 การกระทำได้กล่าวที่เกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้า หรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือ

8.3 การกระทำได้กล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง ดัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือเปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ 9 ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้องต่อไปด้วย

ข้อ 10 ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจากที่ได้แจ้งไว้

ข้อ 11 ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่งความลึก และขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อ ประปา สายเคเบิล เป็นต้น และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดอันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ 12 เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ดิถังจนอาจเป็นอันตรายแก่อาคาร ถนน หรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีลำยัน เข็มพืด หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัยและต้องตรวจสอบแก้ไขลำยัน เข็มพืด และฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

ข้อ 13 ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อมและแผนการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจากสำนักนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ ทส. 1009.5/4515 ลงวันที่ 18 มิถุนายน 2551 อย่างเคร่งครัด

ออกให้ ณ วันที่

ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร
เจ้าพนักงานท้องถิ่น

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.1 เลขรับที่ ...274...

ลงวันที่ ..7..... เดือน ..กรกฎาคม..... พ.ศ. 2553.....

ราช ..บริษัท ไอทีริ จำกัด.....

7 ก.ค. 2553

7 ก.ค. 2553

7 ก.ค. 2553

7 ก.ค. 2553

คำเตือน

1. ถ้าผู้แจ้งจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งกับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และมีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว
2. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งก่อสร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้า ออกของรถตามที่กำหนดไว้ให้ใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้าออกของรถไว้ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กักเก็บรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น
3. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุมการใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด 30 วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

วันที่ - 7 - 0 0 2553
วันที่ - 7 - 0 0 2553
วันที่ - 7 - 0 0 2553

คำนวณมาก

ฉบับนี้เป็นทำงารรับใบอนุญาตตาม มาตรา ๘๖ ขว้

แบบ กทม.๖ เดิมเลขที่ ๒๗๔/๒๕๕๓

ลงวันที่ ๗ กรกฎาคม ๒๕๕๓

ตามแบบ กทม.๑ เลขรับที่ ๒๕๘

ลงวันที่ ๒๐ พฤษภาคม ๒๕๕๔

แบบ กทม.๖

ใบรับหนังสือแจ้งความประสงค์จะก่อสร้าง ดัดแปลง รื้อถอนหรือเคลื่อนย้ายอาคาร
หรือเปลี่ยนการใช้อาคาร โดยไม่ยื่นคำขอรับใบอนุญาต ตามมาตรา ๓๔ ทวิ

เลขที่ ๒๕๔/๒๕๕๔

ได้รับแจ้งจาก.....บริษัท โอ๊คทรี จำกัด โดย.....
เจ้าของอาคารหรือตัวแทนเจ้าของอาคาร/ผู้ครอบครองอาคาร.....
หมู่ที่.....ตรอก/ซอย.....ถนน.....รัชดาภิเษก.....ตำบล/แขวง.....จันทระเกษม
อำเภอ/เขต.....จตุจักร.....จังหวัด.....กรุงเทพมหานคร.....ตั้งข้อความต่อไป
ข้อ ๑ ขอแจ้งความประสงค์จะทำการ.....ก่อสร้างและดัดแปลงอาคาร
ที่บ้านเลขที่.....หมู่ที่.....ตรอก/ซอย.....ถนน.....สาทร
ตำบล/แขวง.....สี่ลม.....อำเภอ/เขต.....บางรัก.....กรุงเทพมหานคร
ในที่ดินโฉนดที่ดิน.....
เป็นที่ดินของ.....
โดยไม่ยื่นคำขอรับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

ข้อ ๒ เป็นอาคาร.....
๒.๑ ชนิด.....ตึก ๒๕ ชั้น ชั้นใต้ดิน ๒ ชั้น จำนวน.....๑.....หลัง เพื่อใช้เป็น.....พาณิชย์ - สำนักงาน - ห้องประชุม -
พื้นที่.....๓๔,๑๕๕.๐๐ ตารางเมตร ที่จอดรถ ที่กั้บรุด และทางเข้า-ออกของรถ จำนวน.....๒๓๐.....คัน
พื้นที่.....๑,๒๐๐.๐๐ ตารางเมตร (พื้นที่ส่วนดัดแปลง ๓,๑๐๐.๐๐ ตารางเมตร)
๒.๒ ชนิด.....จำนวน.....หลัง เพื่อใช้เป็น.....
พื้นที่.....ตารางเมตร ที่จอดรถ ที่กั้บรุด และทางเข้า-ออกของรถ จำนวน.....คัน
พื้นที่.....ตารางเมตร
๒.๓ ชนิด.....จำนวน.....หลัง เพื่อใช้เป็น.....
พื้นที่.....ตารางเมตร ที่จอดรถ ที่กั้บรุด และทางเข้า-ออกของรถ จำนวน.....คัน
พื้นที่.....ตารางเมตร
๒.๔ ชนิด.....จำนวน.....หลัง เพื่อใช้เป็น.....
พื้นที่.....ตารางเมตร ที่จอดรถ ที่กั้บรุด และทางเข้า-ออกของรถ จำนวน.....คัน
พื้นที่.....ตารางเมตร
๒.๕ ชนิด.....จำนวน.....หลัง เพื่อใช้เป็น.....
พื้นที่.....ตารางเมตร ที่จอดรถ ที่กั้บรุด และทางเข้า-ออกของรถ จำนวน.....คัน
พื้นที่.....ตารางเมตร

๒๐ กรกฎาคม ๒๕๕๔
๒๐ กรกฎาคม ๒๕๕๔
๒๐ กรกฎาคม ๒๕๕๔

ตามแผนผังบริเวณ แบบแปลน รายการประกอบแบบแปลน และรายการคำนวณที่แนบมาพร้อมนี้

ข้อ ๓ โดย

- | | | |
|------|-------|--|
| (๑) | | เป็นสถาปนิกผู้ออกแบบ |
| (๒) | | เป็นสถาปนิกผู้ควบคุมงาน |
| (๓) | | เป็นวิศวกรผู้ออกแบบโครงสร้าง |
| (๔) | | เป็นวิศวกรผู้ควบคุมงานโครงสร้าง |
| (๕) | | เป็นวิศวกรผู้ออกแบบระบบปรับอากาศ |
| | | อากาศและระบบระบายอากาศและ |
| | | ระบบป้องกันเพลิงไหม้ |
| (๖) | | เป็นวิศวกรผู้ควบคุมงานระบบปรับอากาศ |
| | | อากาศและระบบระบายอากาศ |
| (๗) | | เป็นวิศวกรผู้ควบคุมงานระบบป้องกันเพลิงไหม้ |
| (๘) | | เป็นวิศวกรผู้ออกแบบระบบบำบัด |
| | | น้ำเสียและการระบายน้ำทิ้ง |
| (๙) | | เป็นวิศวกรผู้ควบคุมงานระบบบำบัด |
| | | น้ำเสียและการระบายน้ำทิ้ง |
| (๑๐) | | เป็นวิศวกรผู้ออกแบบระบบลิฟต์ |
| (๑๑) | | เป็นวิศวกรผู้ควบคุมงานระบบลิฟต์ |
| (๑๒) | | เป็นวิศวกรผู้ออกแบบระบบไฟฟ้า |
| (๑๓) | | เป็นวิศวกรผู้ควบคุมงานระบบไฟฟ้า |
| (๑๔) | | เป็นวิศวกรผู้ตรวจสอบงานออกแบบและ |
| | | คำนวณส่วนต่างๆ ของโครงสร้างอาคาร |

ข้อ ๔ กำหนดแล้วเสร็จงาน.....๗๓๐.....วัน โดยจะเริ่มต้นก่อสร้างอาคาร/ดัดแปลงอาคาร/รื้อถอนอาคาร/
เคลื่อนย้ายอาคาร/เปลี่ยนการใช้อาคารเมื่อ ๒๐ พฤษภาคม ๒๕๕๕ และจะแล้วเสร็จเมื่อ ๒๐ พฤษภาคม ๒๕๕๖

ข้อ ๕ ค่าธรรมเนียมในการตรวจแบบ.....	๑๒,๕๐๐.๐๐	บาท
ค่าธรรมเนียมใบอนุญาต.....	๑๐.๐๐	บาท
รวมทั้งสิ้น.....	๑๒,๕๑๐.๐๐	บาท

ข้อ ๖ ผู้แจ้งต้องปฏิบัติตามเงื่อนไขดังต่อไปนี้

๖.๑ ผู้แจ้งต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวงและ หรือ
ข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา ๘ (๑๑) มาตรา ๙ หรือมาตรา ๑๐ แห่งพระราชบัญญัติควบคุมอาคาร
พ.ศ.๒๕๒๒ แก้ไขเพิ่มเติม โดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ ๒) พ.ศ. ๒๕๓๕

วันที่ ๒๐ พ.ค. ๒๕๕๕
วันที่ ๒๐ พ.ค. ๒๕๕๕
วันที่ ๒๐ พ.ค. ๒๕๕๕

๖.๒ จะต้องใช้ผ้าใบหรือวัสดุอื่นหรือเทียบเท่าหรือดีกว่า เพื่อป้องกันวัสดุก่อสร้างร่วงหล่น และฝุ่นละอองฟุ้งกระจายอันเนื่องมาจากการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร กันตัวอาคารสูงตลอดตั้งแต่ระดับดิน โดยยึดติดกับนั่งร้านรอบนอกอาคาร ให้มีความสูงกว่าความสูงของอาคารขณะก่อสร้างไม่น้อยกว่า ๒.๐๐ เมตร ตลอดแนวอาคารด้านที่มีระยะราบวัดจากแนวอาคารด้านนอกถึงที่สาธารณะหรือที่ดินต่างเจ้าของหรือผู้ครอบครองน้อยกว่าความสูงอาคารที่ได้รับอนุญาตและจะต้องรักษาให้อยู่ในสภาพดีตลอดเวลาการก่อสร้าง

๖.๓ จะต้องจัดให้มีปล่องชั่วคราวสำหรับทิ้งของและต้องจัดให้มีมาตรการป้องกันฝุ่นละอองมลพิษและเสียงดังอันเกิดจากการก่อสร้าง รวมทั้งวัสดุและอุปกรณ์ที่ใช้ในการก่อสร้างร่วงหล่น อันเป็นเหตุให้เกิดความเดือดร้อนรำคาญและเป็นอันตรายแก่สุขภาพ ชีวิต และทรัพย์สินของประชาชนที่อยู่ในบริเวณใกล้เคียง

ข้อ ๗ ภายในหนึ่งร้อยยี่สิบวันนับแต่วันที่ได้ออกใบรับแจ้ง ตามมาตรา ๓๙ ทวิ หรือนับแต่วันที่เริ่มการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเริ่มใช้อาคารที่ได้แจ้งไว้แล้วแต่กรณี ถ้าเจ้าพนักงานท้องถิ่นได้ตรวจพบว่าการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคารที่ได้แจ้งไว้ แผนผังบริเวณแบบแปลน รายการประกอบแบบแปลน หรือรายการคำนวณของอาคาร ที่ได้ยื่นไว้ ตามมาตรา ๓๙ ทวิ ไม่ถูกต้องตามบทบัญญัติแห่งพระราชบัญญัติควบคุมอาคารฯ กฎกระทรวงหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติดังกล่าวหรือกฎหมายอื่นที่เกี่ยวข้องเจ้าพนักงานท้องถิ่นยังคงมีอำนาจสั่งให้ผู้แจ้งดำเนินการแก้ไขให้ถูกต้อง หรือครบถ้วนภายในเจ็ดวันนับแต่วันที่ได้รับแจ้งคำสั่งดังกล่าว

ข้อ ๘ ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือเปลี่ยนการใช้อาคาร ดังนี้

๘.๑ การกระทำดังกล่าวเป็นการรบกวนที่สาธารณะ

๘.๒ การกระทำดังกล่าวที่เกี่ยวกับระยะหรือระดับระหว่างอาคารกับถนน ตรอก ซอย ทางเท้าหรือที่สาธารณะ เป็นการฝ่าฝืนกฎกระทรวง ประกาศหรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคารหรือ

๘.๓ การกระทำดังกล่าวที่เกี่ยวกับบริเวณห้ามก่อสร้าง ดัดแปลง รื้อถอน เคลื่อนย้าย และใช้หรือเปลี่ยนการใช้อาคารชนิดหรือประเภทใดเป็นการฝ่าฝืนกฎกระทรวง ประกาศ หรือข้อบัญญัติท้องถิ่นที่ออกตามพระราชบัญญัติควบคุมอาคาร หรือกฎหมายอื่นที่เกี่ยวข้อง

ข้อ ๙ ผู้แจ้งฯ ยังคงมีหน้าที่ต้องขออนุญาตเกี่ยวกับอาคารนั้น ตามกฎหมายอื่นในส่วนที่เกี่ยวข้อง ต่อไปด้วย

ข้อ ๑๐ ห้ามทำการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคาร หรือใช้อาคารให้ผิดไปจากที่ได้แจ้งไว้จากที่ได้แจ้งไว้

ข้อ ๑๑ ก่อนเริ่มลงมือก่อสร้างอาคาร ผู้ดำเนินการต้องสำรวจรายละเอียด ตำแหน่ง ความลึก และขนาดของโครงสร้างใต้ดิน ฐานรากอาคารข้างเคียง หรือสิ่งก่อสร้างอื่นๆ เช่น ท่อประปา สายเคเบิล เป็นต้น และวางมาตรการอย่างหนึ่งอย่างใดเพื่อป้องกันมิให้เกิดอันตรายต่อสุขภาพ ชีวิต ร่างกาย หรือทรัพย์สิน

ข้อ ๑๒ เมื่อมีการขุดดินในบริเวณที่ใกล้หรือชิดอาคาร ถนนหรือกำแพง ลีกร่นอาจเป็นอันตรายแก่อาคาร ถนนหรือกำแพงนั้น ผู้ดำเนินการต้องจัดให้มีค้ำยัน เข็มพิค หรือฐานรากเสริมตามความจำเป็น เพื่อความปลอดภัย และต้องตรวจสอบแก้ไขค้ำยัน เข็มพิคและฐานรากดังกล่าวให้มีสภาพมั่นคงและปลอดภัยอยู่เสมอ

ข้อ ๑๓ ผู้แจ้งฯ ต้องปฏิบัติตามมาตรการป้องกันแก้ไขผลกระทบสิ่งแวดล้อม และแผนการติดตามตรวจสอบ
คุณภาพสิ่งแวดล้อม ตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อม ที่ได้รับความเห็นชอบจากสำนักงานนโยบาย
และแผนทรัพยากรธรรมชาติและสิ่งแวดล้อม ตามหนังสือที่ ทส ๑๐๐๙.๕/๔๕๑๕ ลงวันที่ ๑๘ มิถุนายน ๒๕๕๑
อย่างเคร่งครัด

ออกให้ ณ วันที่ ๒๐ พ.ค. ๒๕๕๕


ผู้อำนวยการแทนผู้ว่าราชการกรุงเทพมหานคร

ตามหนังสือแจ้งความประสงค์ฯ ตามแบบ กทม.๑ เลขรับที่ ๒๕๕
ลงวันที่ ๒๐ เดือน พฤษภาคม พ.ศ. ๒๕๕๕
ราย บริษัท โอ๊คทรี จำกัด


วันที่ ๒๐ พ.ค. ๒๕๕๕
วันที่ ๒๐ พ.ค. ๒๕๕๕
วันที่ ๒๐ พ.ค. ๒๕๕๕
วันที่ ๒๐ พ.ค. ๒๕๕๕

คำเตือน

๑. ถ้าผู้แจ้งฯจะบอกเลิกตัวผู้ควบคุมงานที่ระบุชื่อไว้ในใบแจ้ง หรือผู้ควบคุมงานจะบอกเลิกการเป็นผู้ควบคุมงาน ให้มีหนังสือแจ้งให้เจ้าพนักงานท้องถิ่นทราบ ทั้งนี้ ไม่เป็นการกระทบถึงสิทธิและหน้าที่ทางแพ่งระหว่างผู้แจ้งฯ กับผู้ควบคุมงานนั้น ในการบอกเลิกตัวผู้ควบคุมงานนี้ ผู้แจ้งฯ จะต้องระงับการดำเนินการก่อสร้าง ดัดแปลง รื้อถอน หรือเคลื่อนย้ายอาคารไว้ก่อนจนกว่าจะมีผู้ควบคุมงานคนใหม่ และ มีหนังสือแจ้งพร้อมกับส่งมอบหนังสือแสดงความยินยอมของผู้ควบคุมงานคนใหม่ ให้แก่เจ้าพนักงานท้องถิ่นแล้ว

๒. ผู้แจ้งฯ ที่ต้องจัดให้มีพื้นที่ หรือสิ่งสร้างขึ้นเพื่อใช้เป็นที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้า ออกของรถตามที่กำหนดไว้ในใบแจ้งฯ ฉบับนี้ ต้องแสดงที่จอดรถยนต์ ที่กักเก็บรถ และทางเข้าออกของรถไว้ ให้ปรากฏตามแผนผังบริเวณที่ได้แจ้งให้ กรุงเทพมหานคร ทราบ การดัดแปลงหรือใช้ที่จอดรถ ที่กักเก็บรถ และทางเข้าออกของรถเพื่อการอื่นนั้นต้องได้รับอนุญาตจากเจ้าพนักงานท้องถิ่น

๓. เมื่อผู้แจ้งความประสงค์จะก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคารประเภทควบคุม การใช้ได้กระทำการตามที่ได้แจ้งเสร็จแล้ว ต้องแจ้งเป็นหนังสือให้เจ้าพนักงานท้องถิ่นทราบ ตามแบบที่เจ้าพนักงานท้องถิ่นกำหนด เพื่อทำการตรวจสอบการก่อสร้าง ดัดแปลง หรือเคลื่อนย้ายอาคาร นั้น และห้ามมิให้ใช้อาคารนั้นเพื่อกิจการดังที่ได้แจ้งไว้ ภายในกำหนด ๓๐ วัน นับตั้งแต่วันที่เจ้าพนักงานท้องถิ่นได้รับแจ้ง

เอกสารแบบ 3
สำเนาใบรับรองการก่อสร้างอาคาร ตัดแปลงอาคาร
หรือเคลื่อนย้ายอาคาร (จ.6)

อาคารโรงแรม
อาคารพาณิชย์
อาคารหอประชุม

อาคารประเภทควบคุมการใช้ ตามมาตรา 32
อาคารสำนักงานหรือที่ทำการ
การตัดแปลงอาคาร

แบบ อ. บ

000131



ค่าเดือน

ให้จัดส่งรายงานผลการตรวจสอบใหญ่ของอาคาร ตามกฎกระทรวง
ว่าด้วยหลักเกณฑ์การตรวจสอบอาคาร พ.ศ. 2548 ภายใน 30
ก่อนใบรับรองการก่อสร้างอาคารจะมีระยะเวลาครบ 1 ปี

ใบรับรองการก่อสร้างอาคาร ตัดแปลงอาคาร หรือเคลื่อนย้ายอาคาร

เลขที่ ๑๙ / ๒๕๕๕

โดย

บริษัท โอ๊คทรี จำกัด

เจ้าของอาคาร/ผู้ครอบครองอาคาร

ใบรับรองฉบับนี้แสดงว่า

อยู่บ้านเลขที่ ๑๙๘/๗ ตรอก/ซอย

ถนน

รัชดาภิเษก

หมู่ที่

ตำบล/แขวง จันทเกษม

อำเภอ เขต

จตุจักร

จังหวัด

กรุงเทพมหานคร

ตามแบบ กทม.๖

ได้ทำการ ก่อสร้างและตัดแปลง

อาคาร

เป็นไปโดยถูกต้องตามที่ได้รับอนุญาตในใบอนุญาต

เลขที่ ๒๕๘ / ๒๕๕๕

ลงวันที่

๒๐

เดือน

พฤษภาคม

พ.ศ. ๒๕๕๕

ซึ่งอาคารดังกล่าวเป็นอาคารประเภทควบคุมการใช้ เจ้าพนักงานท้องถิ่นจึงออกใบรับรองให้ดังต่อไปนี้

ข้อ ๑ เป็นอาคาร

ชั้นใต้ดิน ๒ ชั้น

(๑) ชนิด ตึก ๒๕ ชั้น

จำนวน

๑ หลัง

เพื่อใช้เป็น โรงแรม (๒๓๗ ห้อง)-ภัตตาคาร-

โดยมีที่จอดรถ ที่กัณฑ์ และทางเข้าออกของรถ จำนวน ๒๓๐ คัน

พาณิชย์-สำนักงาน-ห้องประชุม-จอดรถยนต์

(๒) ชนิด

จำนวน

เพื่อใช้เป็น

โดยมีที่จอดรถ ที่กัณฑ์ และทางเข้าออกของรถ จำนวน คัน

(๓) ชนิด

จำนวน

เพื่อใช้เป็น

โดยมีที่จอดรถ ที่กัณฑ์ และทางเข้าออกของรถ จำนวน คัน

ที่บ้านเลขที่

ตรอก/ซอย

ถนน

สาทร

หมู่ที่

ตำบล/แขวง

สีลม

อำเภอ/เขต

บางรัก

จังหวัด

กรุงเทพมหานคร

โดย บริษัท โอ๊คทรี จำกัด

เป็นเจ้าของอาคาร และ

บริษัท โอ๊คทรี จำกัด

เป็นผู้ครอบครอง

เป็นที่ดินของ

๑๐.๐๐ ไร่

ข้อ ๒ ผู้ได้รับใบรับรองต้องปฏิบัติตามเงื่อนไข ดังต่อไปนี้

(๑) ผู้ได้รับใบรับรองต้องปฏิบัติตามหลักเกณฑ์ วิธีการ และเงื่อนไขตามที่กำหนดในกฎกระทรวง

และหรือข้อบัญญัติท้องถิ่น ซึ่งออกตามความในมาตรา ๘ (๑๑) มาตรา ๙ หรือมาตรา ๑๐ แห่งพระราชบัญญัติ

ควบคุมอาคาร พ.ศ. ๒๕๒๒ แก้ไขเพิ่มเติมตามพระราชบัญญัติควบคุมอาคาร (ฉบับที่ ๒) พ.ศ. ๒๕๓๕ และ (ฉบับที่ ๓) พ.ศ. ๒๕๔๓

(๒) ต้องปฏิบัติตามเงื่อนไขแนบท้ายใบรับรองฉบับนี้

เงื่อนไขท้ายใบรับรองการก่อสร้างและตัดแปลงอาคารเลขที่ ๑๙ / ๒๕๕๕

ราย บริษัท โอ๊คทรี จำกัด

- ผู้ได้รับใบรับรองต้องปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อมและ
มาตรการติดตามตรวจสอบคุณภาพสิ่งแวดล้อมตามรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมที่ได้รับความ
เห็นชอบจากสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อมตามหนังสือที่ พส. ๑๐๐๙.๕/๔๕๑๕
ลงวันที่ ๑๘ มิถุนายน ๒๕๕๑

KE

A

TH

๕๕. ศาลากลาง จังหวัดขอนแก่น
ศาลากลางจังหวัดขอนแก่น
ศาลากลางจังหวัดขอนแก่น

ศาลากลางจังหวัดขอนแก่น
ศาลากลางจังหวัดขอนแก่น
ศาลากลางจังหวัดขอนแก่น

แสดงแจ้ง

คำเตือน

ศาลากลางจังหวัดขอนแก่นเป็นอาคารสาธารณะและสถานที่สำคัญ

๕๕. ศาลากลางจังหวัดขอนแก่น ห้ามเจ้าของหรือผู้ครอบครองอาคารใช้หรือยินยอมให้บุคคลใดใช้อาคารเพื่อกิจการอื่น นอกจาก

กิจการของราชการหรือราชการส่วนท้องถิ่น

๒. ห้ามเจ้าของหรือผู้ครอบครองอาคาร เปลี่ยนการใช้อาคารบางประเภท ควบคุมการใช้สำหรับ
กิจการหนึ่งไปใช้เป็นอาคารประเภทควบคุมการใช้สำหรับอีกกิจการหนึ่ง เว้นแต่จะได้รับอนุญาตจากเจ้าพนักงาน
ท้องถิ่น

๓. ห้ามเจ้าของหรือผู้ครอบครองอาคารที่ต้องมีพื้นที่หรือสิ่งก่อสร้างขึ้นเพื่อใช้เป็นที่จอดรถ ที่กลับรถ
และทางเข้าออกของรถตามที่กำหนดไว้ในกฎกระทรวง ดัดแปลง หรือใช้ที่จอดรถ ที่กลับรถ และทางเข้าออกของ
รถนั้นเพื่อการใช้งานไม่ว่าทั้งหมดหรือบางส่วน เว้นแต่จะได้รับใบอนุญาตจากเจ้าพนักงานท้องถิ่น

๔. ผู้ได้รับใบรับรองต้องแสดงใบรับรองฉบับนี้ไว้ในที่เปิดเผยและเห็นได้ง่าย ณ อาคารนั้น

เอกสารแนบ 4
สำเนาใบอนุญาตประกอบธุรกิจโรงแรม (ร.ร.2)
และบันทึกการแจ้งเปลี่ยนชื่อโรงแรม



ทะเบียนเลขที่.....๓๘๐

ใบอนุญาตเลขที่.....๔/๒๕๖๖

กระทรวงมหาดไทย

ใบอนุญาตประกอบธุรกิจโรงแรม

ใบอนุญาตฉบับนี้ให้ไว้เพื่อแสดงว่า บริษัท โอ๊คทรี จำกัด

ได้รับอนุญาตให้ประกอบธุรกิจโรงแรมตามมาตรา ๑๕ แห่งพระราชบัญญัติ
โรงแรม พ.ศ. ๒๕๕๗ โดยใช้ชื่อภาษาไทยว่า โซ แบงคอก

ชื่อภาษาต่างประเทศ (ถ้ามี)..... SO BANGKOK

โรงแรมประเภท.....๓ จำนวนห้องพัก.....๒๓๗ ห้อง

สถานที่ตั้ง.....เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม

เขตบางรัก กรุงเทพมหานคร

ตั้งแต่วันที่ ๓๑ เดือน มกราคม พ.ศ. ๒๕๖๖ ถึง วันที่ ๓๐ เดือน มกราคม พ.ศ. ๒๕๗๑

ออกให้ ณ วันที่ ๒๕ เดือน ธันวาคม พ.ศ. ๒๕๖๕



รองอธิบดีกรมการปกครอง-อธิบดีกรมการทะเบียน

อธิบดีกรมการปกครอง

นายทะเบียนโรงแรมกรุงเทพมหานคร
ประทับตราประจำตำแหน่งเป็นสำคัญ

ที่ มท ๐๓๐๗.๖/ ๓๐๓๒๖



กรมการปกครอง

ถนนรัชฎางค์ กทม. ๑๐๒๐๐

๖ ธันวาคม ๒๕๖๕

เรื่อง ขอต่อยาอายุใบอนุญาตประกอบธุรกิจโรงแรม “โซ แบงคอก”

เรียน ผู้ประกอบธุรกิจโรงแรม “โซ แบงคอก”

อ้างถึง แบบคำขอต่อยาอายุใบอนุญาตประกอบธุรกิจโรงแรม (แบบ ร.ร. ๑/๑) เลขที่รับ ๑๔๑/๒๕๖๕
ลงวันที่ ๑๑ พฤศจิกายน ๒๕๖๕

สิ่งที่ส่งมาด้วย แบบบันทึกช่วยจำในการประกอบธุรกิจโรงแรม

จำนวน ๑ ชุด

ตามที่ บริษัท โอ๊คทรี จำกัด โดย นายวรุฒ ตันติพิภพ และนางทศพร อังสุวรังษี กรรมการผู้มีอำนาจลงนามผูกพันบริษัท ผู้ประกอบธุรกิจโรงแรม “โซ แบงคอก” ได้ยื่นคำขอต่อยาอายุใบอนุญาตประกอบธุรกิจโรงแรมดังกล่าว ต่อนายทะเบียนโรงแรมกรุงเทพมหานคร ความละเอียดตามอ้างถึง นั้น

กรมการปกครองขอเรียนว่า นายทะเบียนโรงแรมกรุงเทพมหานครได้พิจารณาอนุญาตให้ท่าน ต่อยาอายุใบอนุญาตประกอบธุรกิจโรงแรมดังกล่าวแล้ว ดังนั้น จึงขอให้ท่านไปรับใบอนุญาตประกอบธุรกิจโรงแรมข้างต้น พร้อมกับชำระค่าธรรมเนียมการต่อยาอายุใบอนุญาต ณ ส่วนการรักษาสงบเรียบร้อย ๓ สำนักการสอบสวนและนิติการ กรมการปกครอง (วังไชยา) ถนนนครสวรรค์ แขวงสี่แยกมหานาค เขตดุสิต กรุงเทพมหานคร ทั้งนี้ ขอความร่วมมือในการใช้บันทึกช่วยจำฯ เพื่อเป็นประโยชน์ในการบริหารจัดการโรงแรมต่อไป รายละเอียดปรากฏตามสิ่งที่ส่งมาด้วย อนึ่ง เนื่องจากโรงแรมดังกล่าวเป็นโครงการหรือกิจการที่มีการจัดทำรายงานการประเมินผลกระทบสิ่งแวดล้อม ดังนั้น ขอให้จัดทำรายงานผลการปฏิบัติตามมาตรการที่กำหนดไว้ในรายงานการประเมินผลกระทบสิ่งแวดล้อมเสนอต่อนายทะเบียนโรงแรมกรุงเทพมหานคร ในฐานะเจ้าหน้าที่ซึ่งมีอำนาจอนุญาตด้วย รวมทั้งขอให้ถือปฏิบัติตามเงื่อนไขที่คณะกรรมการผู้ชำนาญการพิจารณารายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมด้านโครงการบริการชุมชน ได้มีมติเห็นชอบรายงานการวิเคราะห์ผลกระทบสิ่งแวดล้อมดังกล่าว ซึ่งสำนักงานนโยบายและแผนทรัพยากรธรรมชาติและสิ่งแวดล้อมได้แจ้งให้ทราบแล้วด้วย

จึงเรียนมาเพื่อทราบและดำเนินการ

ขอแสดงความนับถือ



ผู้อำนวยการสำนักงาน

บริหารการแทน

อธิบดีกรมการปกครอง

นายทะเบียนโรงแรมกรุงเทพมหานคร

สำนักการสอบสวนและนิติการ

ส่วนการรักษาสงบเรียบร้อย ๓

โทร./โทรสาร ๐ ๒๓๕๖ ๙๕๑๘

MR-05



Change
For Good
กระทรวงมหาดไทย

อินทรา
บำบัดทุกข์ บำรุงสุข

น.4/2

ที่ มท ๐๓๐๗.๖/๖๐๖๖๔



กรมการปกครอง
ถนนรัชฎาภิเศก กทม. ๑๐๒๐๐

๒๖ กันยายน ๒๕๕๙

เรื่อง บริษัท โอ๊คทรี จำกัด ขอเปลี่ยนชื่อโรงแรม

เรียน ผู้ประกอบธุรกิจโรงแรม โซฟิเทล โซ แบงคอก

ตามที่ บริษัท โอ๊คทรี จำกัด โดย นายวีรวัฒน์ องค์กรวิสิทธิ์ และ นางกิงพร สฟโซคชัย สำนักงานใหญ่ ตั้งอยู่เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ผู้ประกอบธุรกิจโรงแรม โซฟิเทล โซ แบงคอก ตั้งอยู่เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร เป็นโรงแรมประเภท ๓ มีจำนวนห้องพัก ๒๓๗ ห้อง ออกให้ ณ วันที่ ๓๑ มกราคม ๒๕๕๖ ได้รับอนุญาตให้ประกอบธุรกิจโรงแรมตั้งแต่วันที่ ๓๑ มกราคม ๒๕๕๖ จนถึงวันที่ ๓๐ มกราคม ๒๕๖๑ ได้ยื่นคำขอเปลี่ยนชื่อโรงแรมจาก “โซฟิเทล โซ แบงคอก” เป็น “โซ โซฟิเทล แบงคอก” และเปลี่ยนชื่อจากภาษาอังกฤษ “SOFTEL SO BANGKOK” เป็น “SO SOFTEL BANGKOK” นั้น

นายทะเบียนโรงแรมกรุงเทพมหานครพิจารณาอนุญาตให้เปลี่ยนชื่อโรงแรมของผู้ประกอบธุรกิจ โรงแรมได้ตามคำขอ จึงขอให้ท่านไปรับใบอนุญาตประกอบธุรกิจโรงแรม ณ ส่วนรักษาความสงบเรียบร้อย ๓ สำนักงานการสอบสวนและนิติการ กรมการปกครอง (วังไชยา) ถนนนครสวรรค์ เขตดุสิต กรุงเทพมหานคร

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ



ผู้อำนวยการส่วนรักษาความสงบเรียบร้อย ๓ ปฏิบัติราชการแทน

ผู้อำนวยการสำนักงานการสอบสวนและนิติการ ปฏิบัติราชการแทน

อธิบดีกรมการปกครอง

นายทะเบียนโรงแรมกรุงเทพมหานคร

สำนักงานการสอบสวนและนิติการ
ส่วนรักษาความสงบเรียบร้อย ๓
โทร./โทรสาร ๐-๒๓๕๖-๙๕๕๙

เอกสารแบบ 5
สำเนาหนังสือรับรองจดทะเบียนบริษัท

ที่ 10031220049630



สำนักงานทะเบียนหุ้นส่วนบริษัทกลาง
กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์

หนังสือรับรอง

ขอรับรองว่าบริษัทนี้ ได้จดทะเบียนเป็นนิติบุคคล ตามประมวลกฎหมายแพ่งและพาณิชย์
เมื่อวันที่ 31 มีนาคม 2548 ทะเบียนนิติบุคคลเลขที่ 0105548045937

ปรากฏข้อความในรายการตามเอกสารทะเบียนนิติบุคคล ณ วันออกหนังสือนี้ ดังนี้

1. ชื่อบริษัท บริษัท โอเคทรี จำกัด

2. กรรมการของบริษัทมี 6 คน ตามรายชื่อต่อไปนี้

1.

3.

5.

3. จำนวนหรือชื่อกรรมการซึ่งลงชื่อผูกพันบริษัทได้

ตราสำคัญ

ของบริษัท/

4.ทุนจดทะเบียน 850,000,000.00 บาท / แปดร้อยห้าสิบล้านบาทถ้วน/

5. สำนักงานใหญ่ ตั้งอยู่เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร/

6. วัตถุที่ประสงค์ของบริษัทมี 29 ข้อ ดังปรากฏในสำเนาเอกสารแนบท้ายหนังสือรับรองนี้ จำนวน 2 แผ่น โดยมีลายมือชื่อ

นายทะเบียนซึ่งรับรองเอกสารเป็นสำคัญ

ออกให้ ณ วันที่ 15 เดือน ธันวาคม พ.ศ. 2565

นายทะเบียน

คำเตือน : ผู้ใช้ควรตรวจสอบข้อความที่ปรากฏในหนังสือรับรองฉบับนี้ทุกครั้ง



กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์
Department of Business Development
Ministry of Commerce

ก้าวสู่ปารัฐกิจ
สู่ยุคดิจิทัล

Leading Business
Towards Digital
Transformation



จัดพิมพ์ เมื่อเวลา 10:38 น.

Ref:6510031220049630

1/4

ที่ 10031220049630



สำนักงานทะเบียนหุ้นส่วนบริษัทกลาง
กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์

หนังสือรับรอง

ขอคารทราบ ประกอบหนังสือรับรอง ฉบับที่ 10031220049630

- นิติบุคคลนี้ได้ส่งงบการเงินปี 2564
- หนังสือรับรองเฉพาะข้อความที่ห้าง/บริษัทได้นำมาจดทะเบียนไว้เพื่อผลทางกฎหมายเท่านั้น ข้อเท็จจริงเป็นสิ่งที่ควรหาไว้พิจารณาฐานะ
- นายทะเบียนอาจเพิกถอนการจดทะเบียน ถ้าปรากฏว่าข้อความอันเป็นสาระสำคัญที่จดทะเบียน ไม่ถูกต้อง หรือเป็นเท็จ



กรมพัฒนาธุรกิจการค้า กระทรวงพาณิชย์
Department of Business Development
Ministry of Commerce

ก้าวสู่อนาคต
สู่ยุคดิจิทัล

Leading Business
Towards Digital
Transformation



วัตถุประสงค์ของ ห้างหุ้นส่วน/บริษัท นี้ มี.....29.....ข้อ ดังนี้

(16) ประกอบกิจการพัฒนา ซื้อขาย แลกเปลี่ยน เช่า ให้เช่า ยืม ให้ยืม จำนำส่วนอง เจ้าขอ ขอ ทรัพย์สินใด ๆ ทั้ง

สินทรัพย์และอสังหาริมทรัพย์ เพื่อดำเนินการตามวัตถุประสงค์ของบริษัทดังกล่าวข้างต้นตลอดจนเพื่อเป็นการชำระหนี้ของ
ลูกหนี้ต่อบริษัท ทั้งภายในขอบเขตแห่งวัตถุประสงค์ของบริษัท และมีไว้เป็นการค้ำประกันค่าเช่าค่าตอบแทนหรือกิจการเครดิตฟองซิเอร์
นอกจากนี้เจ้าผู้ค้ำประกันบุคคลหรือนิติบุคคลในการปฏิบัติการชำระหนี้ใดๆ หรือการปฏิบัติงานของบริษัท ตามกฎหมายว่าด้วย
คนเช่าเมือง

(17) บริษัทมีอำนาจออกหุ้นโดยราคาสูงกว่ามูลค่าหุ้นที่ตราไว้

(18) ทำการจัดตั้งสำนักงานสาขาหรือแต่งตั้งตัวแทน ทั้งภายในและภายนอกประเทศ

(19) เข้าเป็นหุ้นส่วนจำกัดความรับผิดชอบในห้างหุ้นส่วน และเป็นผู้ถือหุ้นในบริษัทจำกัดอื่น

(20) ประกอบกิจการค้ายารักษาและป้องกันโรคสำหรับคนและสัตว์ เครื่องเวชภัณฑ์ เคมีภัณฑ์ เครื่องมือแพทย์ และ
เภสัชกรรม ปุ๋ย ยาปราบศัตรูพืช ยาบำรุงพืชและสัตว์ทุกชนิด เครื่องมือเครื่องใช้ในทางวิทยาศาสตร์

(21) ประกอบกิจการค้ากระดาษ เครื่องเขียน แบบเรียน แบบพิมพ์ หนังสือ อุปกรณ์การเรียน เครื่องคำนวณ เครื่องพิมพ์
อุปกรณ์การพิมพ์ สิ่งพิมพ์ หนังสือพิมพ์ ตู้เก็บเอกสาร และเครื่องใช้ในสำนักงานทุกชนิด

(22) ประกอบกิจการโรงแรม ก่อตาดาคาร บาร์ ไนท์คลับ อ่างอาบน้ำ โรงภาพยนตร์ และโรงมหรสพอื่น สถานพัก
ตากอากาศ สนามกีฬา สระว่ายน้ำ

(23) ประกอบกิจการสั่งเข้ามาจำหน่ายในประเทศ และส่งออกไปจำหน่ายยังต่างประเทศ ซึ่งสินค้าตามที่กำหนดไว้
ในวัตถุประสงค์

(24) ประกอบกิจการบริการทางด้านการกฎหมาย ทางบัญชี ทางวิศวกรรม ทางสถาปัตยกรรม รวมทั้งกิจการโฆษณา

(25) ประกอบธุรกิจบริการรับค้าประกันหนี้สิน ความรับผิด และการปฏิบัติการตามสัญญาของบุคคลอื่นรวมทั้งรับบริการ
ค้ำประกันบุคคลซึ่งเดินทางเข้ามาในประเทศไทยหรือเดินทางออกไปต่างประเทศตามกฎหมายว่าด้วยคนเข้าเมือง กฎหมายว่าด้วย
ภาษีอากร และกฎหมายอื่น

(26) ประกอบธุรกิจบริการรับเป็นที่ปรึกษาให้คำแนะนำปัญหาเกี่ยวกับด้านบริหารงาน พาณิชยกรรม อุตสาหกรรม
รวมทั้งปัญหาการผลิต การตลาดและจัดจำหน่าย

(27) ประกอบกิจการประมูล เพื่อขายสินค้าและรับสร้างหาของ ตามวัตถุประสงค์ทั้งหมดให้แก่บุคคล คณะบุคคล
นิติบุคคล ส่วนราชการ และองค์กรของรัฐ

(28) ประกอบกิจการให้บริการในสถานประกอบการเพื่อสุขภาพ ประเภทสปาและกิจการนวดเพื่อสุขภาพ
หรือเพื่อเสริมความงาม

(29) ประกอบกิจการให้บริการเช่าที่พักผ่านทางอิเล็กทรอนิกส์



เอกสารแนบ 6
สำเนาเอกสารขออนุมัติการเชื่อมท่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสีย
ของกรุงเทพมหานคร



ที่ กท ๑๐๐๓/ ๗๙๘

สำนักงานจัดการคุณภาพน้ำ สำนักการระบายน้ำ
๑๒๓ ถนนมิตรไมตรี เขตดินแดง กทม. ๑๐๔๐๐

๓๑ มีนาคม ๒๕๕๔

เรื่อง ขออนุมัติการเชื่อมต่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร
โครงการ โรงแรม โซฟีเทล วิลล์ดา

เรียน กรรมการผู้จัดการบริษัท โอ๊คทรี จำกัด

อ้างถึง ๑.หนังสือเลขที่ SFV-LET-PLE No.๐๐๓/๕๓ ลงวันที่ ๑๑ พฤศจิกายน ๒๕๕๓
๒.หนังสือเลขที่ SFV-LET-PLE No.๐๐๔/๕๔ ลงวันที่ ๑๒ กุมภาพันธ์ ๒๕๕๔

ตามหนังสือที่อ้างถึง ๑.บริษัทฯ ขออนุมัติ Shop Drawing การเชื่อมต่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร โครงการ โรงแรม โซฟีเทล วิลล์ดา และตามหนังสือที่อ้างถึง ๒. บริษัทฯ ได้ส่งรายละเอียดเพิ่มเติมขั้นตอนการเชื่อมต่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร มาเพื่อพิจารณาอนุมัติรูปแบบการเชื่อมต่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร โครงการ โรงแรม โซฟีเทล วิลล์ดา นั้น

สำนักงานจัดการคุณภาพน้ำ สำนักการระบายน้ำ ได้พิจารณาแล้วและอนุมัติการเชื่อมต่อน้ำเสียลงสู่บ่อรวบรวมน้ำเสียของกรุงเทพมหานคร ของโครงการ โรงแรม โซฟีเทล วิลล์ดา

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ



สำนักการระบายน้ำ

กลุ่มงานพัฒนาระบบบำบัดน้ำเสีย

โทร. ๐ ๒๒๔๖ ๐๒๗๔

โทรสาร ๐ ๒๒๔๖ ๐๒๗๔



ที่ กท 4303/2818

สำนักงานเขตบางรัก

5 ถนนนเรศ กทม. 10500

๕ ๑ ส. ก. 2550

เรื่อง ขออนุญาตรับรองการอนุญาตเชื่อมทางสาธารณะ และระบายน้ำลงสู่ที่ระบายน้ำสาธารณะประโยชน์

เรียน นายวิวัฒน์ องค์วาสิมธุ กรรมการผู้จัดการบริษัท โอ๊คทรี จำกัด

อ้างถึง หนังสือบริษัทฯ ลงวันที่ 25 มิถุนายน 2550

ตามหนังสือที่อ้างถึง บริษัทฯ มีความประสงค์จะขออนุญาตให้เชื่อมทางสาธารณะ และระบายน้ำลงสู่ที่ระบายน้ำสาธารณะประโยชน์ ของที่ดิน โฉนดที่ดินเลขที่ 3078, 5021 และ 5022 เลขที่ดิน 97, 96 และ 95 ตำบลลิ้ม (บางรัก) อำเภอบางรัก กรุงเทพมหานคร ซึ่งตั้งอยู่บริเวณถนนสาทรเหนือและถนนพระรามที่ 4 เขตบางรัก กรุงเทพมหานคร เพื่อนำหนังสือรับรองฯ ไปใช้เป็นเอกสารประกอบการขออนุญาตก่อสร้างโครงการ โรงแรม ขนาด 281 ห้อง จำนวน 1 อาคาร นั้น

สำนักงานเขตบางรักได้พิจารณาแล้ว อนุญาต [REDACTED] ดำเนินการตามประสงค์ได้ ทั้งนี้ จะต้องปฏิบัติให้เป็นไปตามเงื่อนไข ดังต่อไปนี้

1. จะต้องปฏิบัติตามข้อบัญญัติกรุงเทพมหานคร เรื่อง การควบคุมอาคาร พ.ศ. 2544 ออกโดยอาศัยอำนาจตามความในมาตรา 9 และมาตรา 10 แห่งพระราชบัญญัติควบคุมอาคาร พ.ศ. 2522 แก้ไขเพิ่มเติมโดยพระราชบัญญัติควบคุมอาคาร (ฉบับที่ 2) พ.ศ. 2535

2. จะต้องปฏิบัติตามกฎกระทรวง ฉบับที่ 51 (พ.ศ. 2541) ออกตามความในพระราชบัญญัติควบคุมอาคาร พ.ศ. 2522

อนึ่ง เมื่อทางบริษัทฯ ได้รับใบอนุญาตให้ทำการก่อสร้างตามโครงการดังกล่าวแล้ว ก่อนที่จะทำการเชื่อมทางและระบายน้ำลงสู่ที่ระบายน้ำสาธารณะประโยชน์ จะต้องแจ้งขออนุญาตจากสำนักงานเขตบางรัก อีกครั้งหนึ่ง เมื่อสำนักงานเขตบางรักตรวจสอบและอนุญาตแล้ว จึงจะทำการตามที่ขออนุญาตได้

จึงเรียนมาเพื่อโปรดทราบ

ขอแสดงความนับถือ


ฝ่ายโยธา

โทร 0 2236 1398 ต่อ 6242

โทรสาร 0 2235 6445

[REDACTED]
ผู้อำนวยการเขตบางรัก

ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

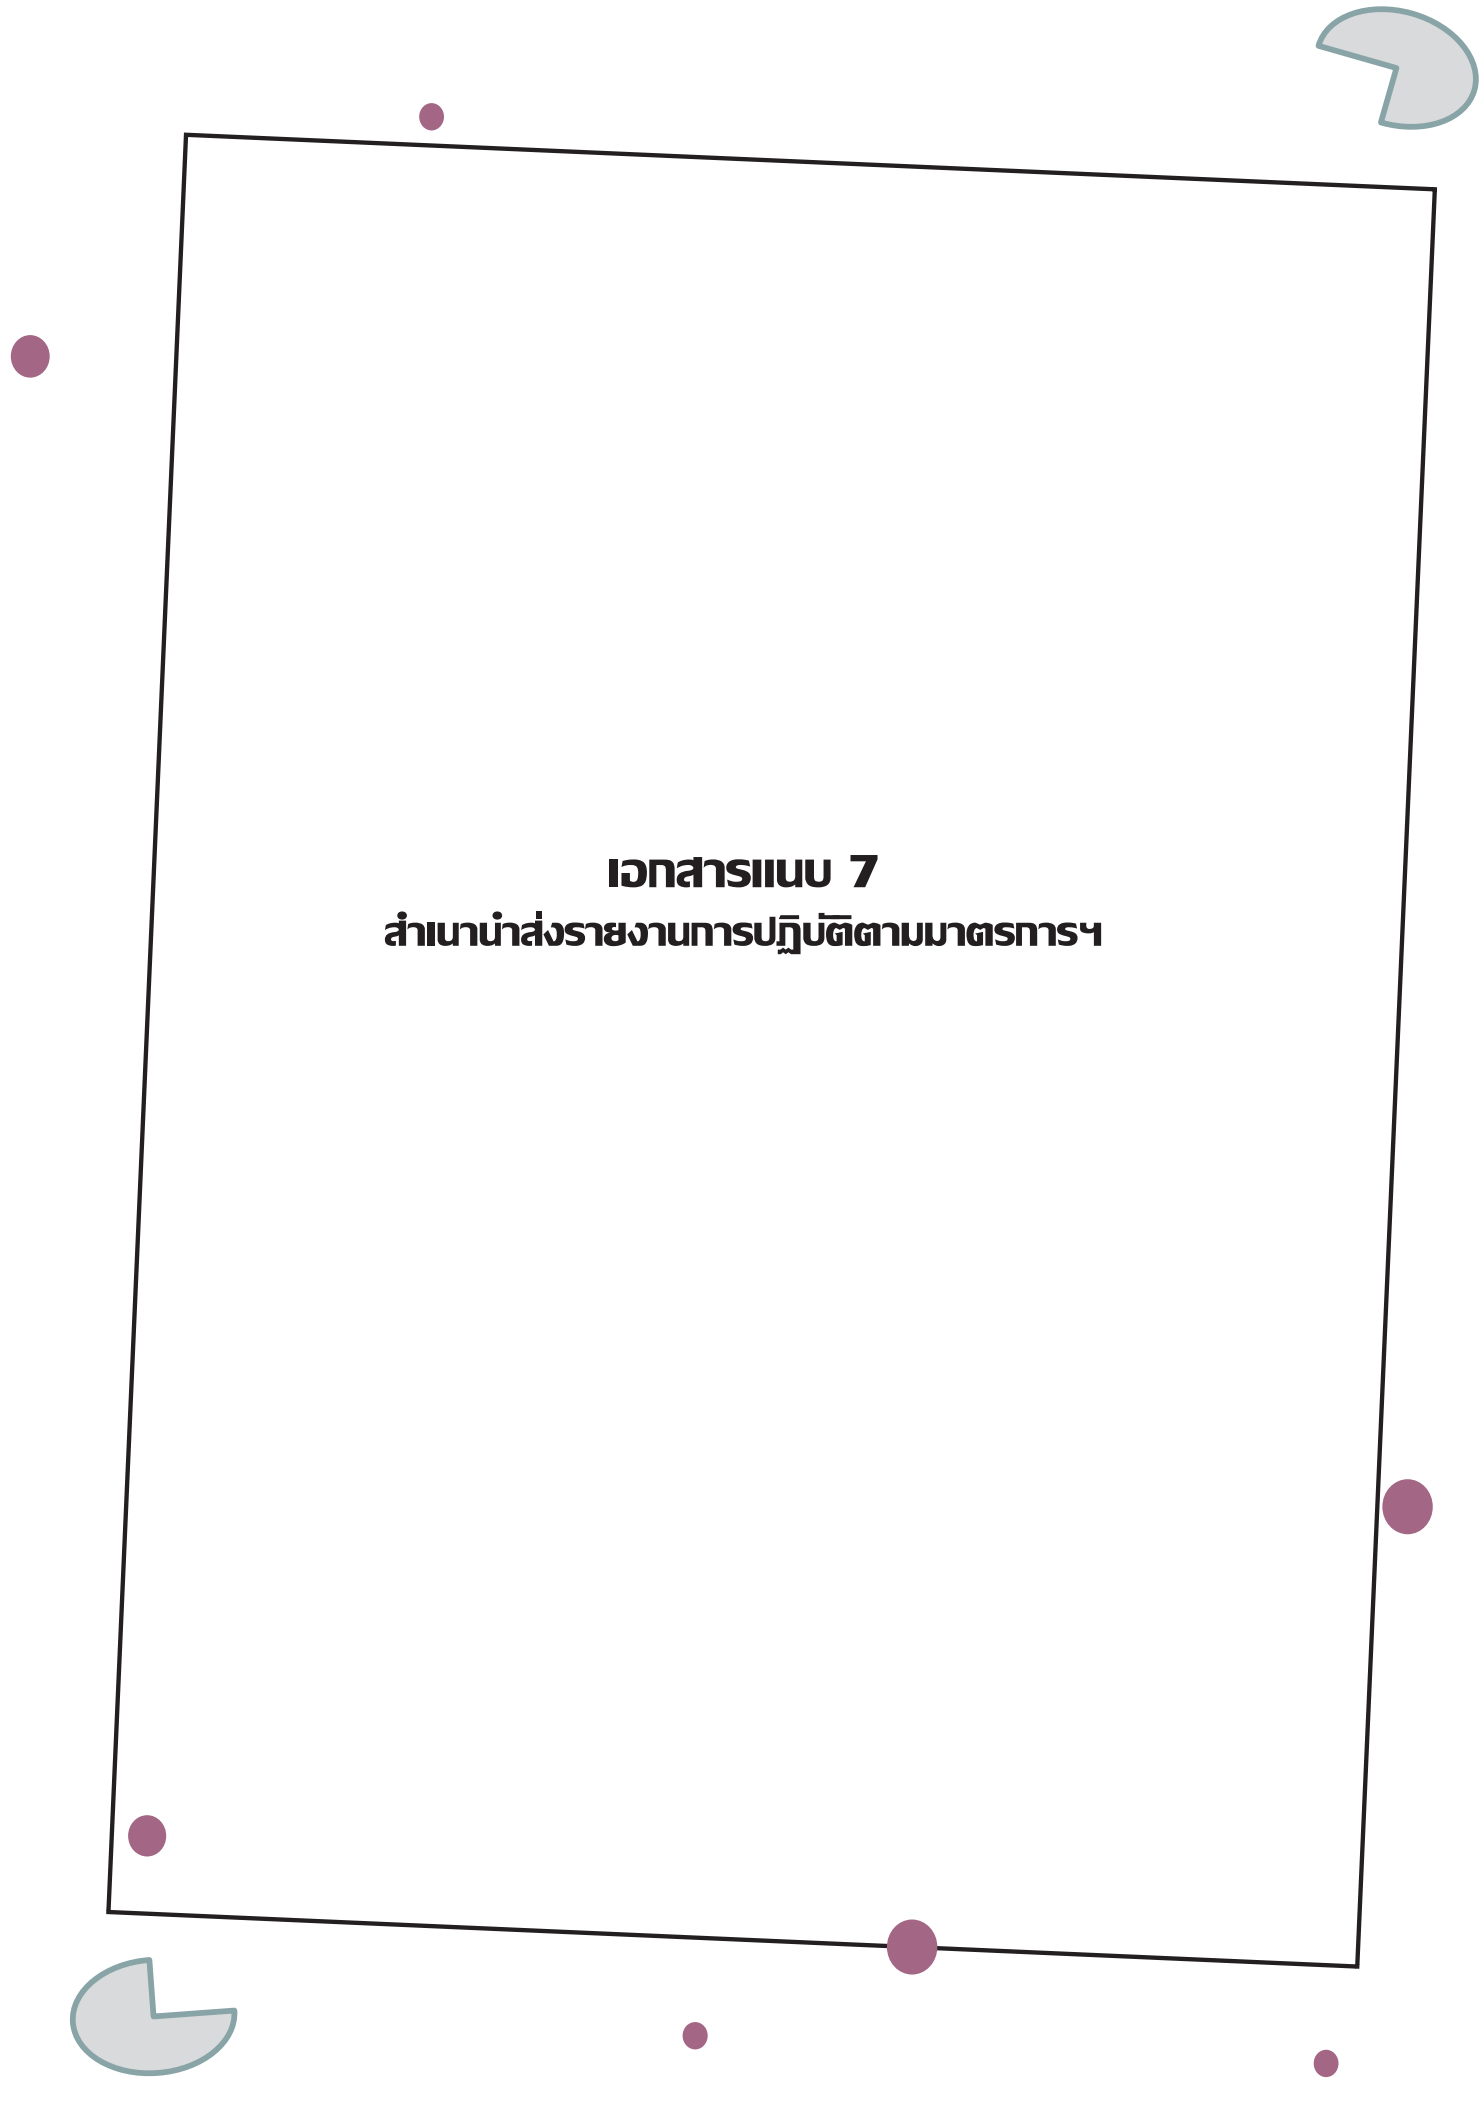

เอกสารแบบ 7

สำเนานำส่งรายงานการปฏิบัติตามมาตรการฯ

วันที่ 2 มิถุนายน 2568

เรื่อง นำส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการโรงแรม โซ แบงคอก (โรงแรมวีร์นดา) ของบริษัท โอ๊คทรี จำกัด (ระยะดำเนินการ) ฉบับประจำเดือนมกราคม-มิถุนายน พ.ศ.2568

เรียน อธิบดีกรมการปกครอง

สิ่งที่ส่งมาด้วย 1. รายงานผลการปฏิบัติตามมาตรการฯ โครงการโรงแรม โซ แบงคอก (โรงแรมวีร์นดา) ของบริษัท โอ๊คทรี จำกัด (ระยะดำเนินการ) ฉบับประจำเดือนมกราคม-มิถุนายน พ.ศ.2568

จำนวน 2 เล่ม

2. ไฟล์อิเล็กทรอนิกส์บันทึกลงแผ่นซีดี จำนวน 3 แผ่น

ข้าพเจ้า บริษัท โอ๊คทรี จำกัด ในฐานะเจ้าของโครงการโรงแรม โซ แบงคอก (โรงแรมวีร์นดา) ของบริษัท โอ๊คทรี จำกัด (ระยะดำเนินการ) ตั้งอยู่ที่ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร โดยได้มอบหมายให้บริษัท เอ บี อี เอ็น เอ็นจิเนียริง คอนซัลแตนท์ จำกัด เป็นผู้จัดทำรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมของโครงการนั้น

บัดนี้ บริษัทฯ ได้จัดทำรายงานผลการปฏิบัติตามมาตรการฯ เสร็จเรียบร้อยแล้ว ดังสิ่งที่ส่งมาด้วย

1. และ 2. จึงใคร่ขอส่งรายงานดังกล่าวมาพร้อมหนังสือฉบับนี้เพื่อให้กรมการปกครองดำเนินการตามอำนาจหน้าที่ต่อไป

จึงเรียนมาเพื่อโปรดพิจารณา

ขอแสดงความนับถือ



กรรมการผู้จัดการ

ได้รับต้นฉบับแล้ว

วันที่ 15 ก. ค. 2564

SO/ BANGKOK

วันที่ 2 มิถุนายน 2568

เรื่อง นำส่งรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อม โครงการโรงแรม โซ แบงคอก (โรงแรมวีร์ันดา) ของบริษัท โอ๊คทรี จำกัด (ระยะดำเนินการ) ฉบับประจำเดือนมกราคม-มิถุนายน พ.ศ.2568

เรียน ผู้อำนวยการเขตบางรัก

สิ่งที่ส่งมาด้วย รายงานผลการปฏิบัติตามมาตรการฯ ฉบับประจำเดือนมกราคม-มิถุนายน พ.ศ.2568
จำนวน 1 เล่ม และ CD-ROM จำนวน 1 แผ่น

ข้าพเจ้า บริษัท โอ๊คทรี จำกัด ในฐานะเจ้าของโครงการโรงแรม โซ แบงคอก (โรงแรมวีร์ันดา) ของบริษัท โอ๊คทรี จำกัด (ระยะดำเนินการ) ตั้งอยู่ที่ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร โดยได้มอบหมายให้บริษัท เอ บี อี เอ็น เอ็นจิเนียริง คอนซัลแตนท์ จำกัด เป็นผู้จัดทำรายงานผลการปฏิบัติตามมาตรการป้องกันและแก้ไขผลกระทบสิ่งแวดล้อม และมาตรการติดตามตรวจสอบผลกระทบสิ่งแวดล้อมของโครงการนั้น

บัดนี้บริษัทฯ ได้จัดทำรายงานผลการปฏิบัติตามมาตรการฯ เสร็จเรียบร้อยแล้วดังสิ่งที่ส่งมาด้วย และพร้อมกันนี้ได้จัดส่งรายงานดังกล่าวไปยังกรมการปกครองเรียบร้อยแล้ว

จึงเรียนมาเพื่อโปรดพิจารณา

ขอแสดงความนับถือ



กรรมการผู้จัดการ

รับเรื่องแล้ว

๑๕ มิ.ย. ๒๕๖๘

เอกสารแบบ 8
เอกสารบันทึกสถิติการใช้ไฟฟ้าและน้ำประปา ในปี 2568

Utility Consumption Cost for July 2025												
Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m³)	Consum / Day (m3)
1	29637	20666	12369	12455	17268	8211	1.043	0	0.962	0	278635.173	245.3
2	29657	20514	12382	12580	17276	7936	1.043	24	0.962	0	278880.471	205.88
3	29678	20236	12394	12580	17284	7654	1.067	0	0.962	0.004	279086.355	185.49
4	29698	20933	12407	0	17291	20670	1.067	0	0.966	0.137	279271.843	227.7
5	29719	19703	12407	0	17312	19966	1.067	0	1.103	0	279499.547	217.76
6	29739	20764	12407	13057	17332	7851	1.067	47	1.103	0	279717.304	285.46
7	29759	20182	12420	12936	17340	7104	1.114	2	1.103	0	280002.763	149.25
8	29780	20936	12433	12650	17347	8285	1.116	0	1.103	0	280152.011	307.09
9	29801	20459	12445	0	17355	20459	1.116	0	1.103	0	280459.101	127.94
10	29821	20485	12445	0	17376	20484	1.116	0	1.103	0	280587.039	186.2
11	29842	20420	12445	0	17396	20421	1.116	0	1.103	0	280773.241	275.51
12	29862	20580	12445	0	17417	20580	1.116	0	1.103	0	281048.748	204.53
13	29883	19847	12445	12650	17437	7197	1.116	0	1.103	0	281253.283	154.49
14	29902	20314	12458	12977	17444	7337	1.116	0	1.103	0	281407.774	346.58
15	29923	21247	12471	12687	17452	8560	1.116	0	1.103	0	281754.353	221.69
16	29944	20480	12484	12570	17460	7910	1.116	0	1.103	0	281976.045	208.98
17	29964	20643	12496	12802	17468	7841	1.116	0	1.103	0	282185.023	197.11
18	29985	20872	12509	0	17476	20872	1.116	0	1.103	0	282382.129	187.22
19	30006	20267	12509	0	17497	20266	1.116	0	1.103	0	282569.347	241.61
20	30026	20128	12509	12633	17517	7496	1.116	0	1.103	0	282810.961	372.13
21	30046	21005	12522	12920	17525	8086	1.116	6	1.103	0	283183.089	270.22
22	30067	19554	12535	12581	17533	6972	1.122	0	1.103	0	283453.312	17.57
23	30087	21664	12547	13524	17540	8140	1.122	54	1.103	0	283470.882	214.18
24	30109	21569	12561	13495	17548	8074	1.176	0	1.103	0	283685.06	424.97
25	30130	21144	12574	0	17556	21144	1.176	0	1.103	0	284110.033	142.59
26	30151	20933	12574	0	17577	20933	1.176	0	1.103	0.015	284252.618	291.32
27	30172	20188	12574	0	17598	20188	1.176	0	1.118	0	284543.934	228.93
28	30192	19704	12574	12705	17618	6999	1.176	0	1.118	0	284772.862	342.85
29	30212	20776	12587	12938	17625	7838	1.176	0	1.118	0	285115.708	147.64
30	30233	21873	12600	13269	17633	8603	1.176	0	1.118	-0.446	285263.351	217.08
31	30255	21792	12613	13642	17642	8151	1.176	0	0.672	0.38	285480.432	283.99
1	30277		12627		17650		1.176		1.052		285764.417	
		639878		257651		382228		133.00		0.09		7129.24
Utility Consumption Cost for July 2025												
	Unit price		Unit	Cost		City water used unit				7,129	Unit	
Kwh On		4.1839	257651	1,077,986.02		cost				112,365.75	Bht	
Kwh OFF		2.6037	382228	995,207.04		Operation cost(Bht/unit)		0.15		1,069.39	Bht	
Kw peak		132.93	1176	156,325.68		service charge				-	Bht	
ft		(0.1972)	639879	(126,184.14)		cost				113,435.13	Bht	
service charge		312.24		312.24		Vat		0.07		7,940.46	Bht	
Sum				2,103,646.84		Total cost				121,375.59	Bht	
VAT		0.07		147,255.28								
Grand total				2,250,902.12								

Utility Consumption Cost for August 2025

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m ³)	Consum / Day (m3)
1	30277	21522	12627	0	17650	21522	1.16	0	1.052	0.069	285764.417	251.835
2	30298	20390	12627	0	17671	20390	1.16	0	1.121	0	286016.252	282.326
3	30318	19698	12627	12749	17692	6948	1.16	0	1.121	0	286298.578	230.424
4	30338	20768	12639	12971	17699	7798	1.16	0	1.121	0	286529.002	462.551
5	30359	21715	12652	13314	17706	8402	1.16	0	1.121	0	286991.553	163.875
6	30381	19750	12666	12873	17715	6904	1.16	0	1.121	0	287155.428	334.559
7	30400	21378	12679	13067	17722	8283	1.16	0	1.121	0	287489.987	218.745
8	30422	19422	12692	0	17730	19422	1.16	0	1.121	0	287708.732	255.535
9	30441	21680	12692	0	17749	21680	1.16	0	1.121	0	287964.267	145.698
10	30463	20385	12692	12480	17771	7905	1.16	0	1.121	0	288109.965	238.922
11	30483	19652	12704	0	17779	19652	1.16	0	1.121	0	288348.887	266.405
12	30503	20468	12704	12700	17799	7768	1.16	0	1.121	0	288615.292	219.427
13	30523	21091	12717	12640	17806	8452	1.16	0	1.121	0	288834.719	447.197
14	30544	20361	12730	12651	17815	7710	1.16	0	1.121	0	289281.916	249.475
15	30565	20456	12742	0	17823	20456	1.16	0	1.121	0	289531.391	30.001
16	30585	20120	12742	0	17843	20120	1.16	0	1.121	0	289561.392	309.103
17	30605	19600	12742	12191	17863	7409	1.16	0	1.121	0	289870.495	300.613
18	30625	20232	12754	12709	17871	7522	1.16	0	1.121	0	290171.108	164.204
19	30645	21314	12767	12470	17878	8845	1.16	0	1.121	0	290335.312	270.698
20	30667	21125	12780	13267	17887	8108	1.16	0	1.121	0	290606.01	156.639
21	30688	21862	12793	13150	17895	8461	1.16	2	1.121	0	290762.649	380.119
22	30710	21877	12806	0	17904	21877	1.162	0	1.121	0	291142.768	177.258
23	30731	19837	12806	0	17925	19837	1.162	0	1.121	0	291320.026	405.556
24	30751	20829	12806	12822	17945	8007	1.162	0	1.121	0	291725.582	293.582
25	30772	19395	12819	12201	17953	7195	1.162	0	1.121	0	292019.164	174.858
26	30791	20380	12831	12622	17960	7757	1.162	0	1.121	0	292194.022	296.033
27	30812	21418	12844	12949	17968	8449	1.162	0	1.121	0	292490.055	208.825
28	30833	20894	12857	12835	17977	8080	1.162	0	1.121	0	292698.88	113.149
29	30854	20994	12869	0	17985	20993	1.162	0	1.121	0	292812.029	350.603
30	30875	20757	12869	0	18006	20758	1.162	0	1.121	0	293162.632	187.062
31	30896	20669	12869	12808	18027	7860	1.162	0	1.121	0	293349.694	115.687
1	30917		12882		18034		1.162		1.121		293465.381	
		640039		255469		384570		2		0.069		7700.96

Utility Consumption Cost for August 2025

Unit price	Unit	Cost	City water used unit	7,701	Unit
Kwh On	4.1839	255469	1,068,856.75	cost	121,404.64 Bht
Kwh OFF	2.6037	384570	1,001,304.91	Operation cost(Bht/unit)	0.15 1,155.14 Bht
Kw peak	132.93	1162	154,464.66	service charge	- Bht
ft	(0.1972)	640039	(126,215.69)	cost	122,559.79 Bht
service charge	312.24		312.24	Vat	0.07 8,579.18 Bht
Sum			2,098,722.87	Total cost	131,138.97 Bht
VAT	0.07		146,910.60		
Grand total			2,245,633.47		

Utility Consumption Cost for September 2025												
Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m³)	Consum / Day (m3)
1	30917	20567	12882	12540	18034	8028	1.104	0	0.954	0.004	293465.381	244.592
2	30937	20446	12895	12530	18042	7915	1.104	0	0.958	0	293709.973	199.683
3	30958	20037	12907	12856	18050	7183	1.104	0	0.958	0.007	293909.656	180.705
4	30978	21589	12920	13067	18057	8521	1.104	19	0.965	0.032	294090.361	228.747
5	30999	20229	12933	0	18066	20229	1.123	0	0.997	0.077	294319.108	421.559
6	31019	21595	12933	0	18086	21594	1.123	0	1.074	0	294740.667	240.24
7	31041	19971	12933	12364	18108	7608	1.123	0	1.074	0	294980.907	128.942
8	31061	20311	12946	12745	18115	7565	1.123	0	1.074	0	295109.849	297.738
9	31081	20577	12958	12601	18123	7976	1.123	0	1.074	0	295407.587	225.066
10	31102	20037	12971	12587	18131	7451	1.123	0	1.074	0	295632.653	155.762
11	31122	20398	12983	12942	18138	7457	1.123	0	1.074	0	295788.415	288.298
12	31142	21653	12996	0	18146	21652	1.123	0	1.074	0.013	296076.713	121.331
13	31164	20626	12996	0	18168	20625	1.123	0	1.087	0	296198.044	252.736
14	31185	20189	12996	12431	18188	7758	1.123	0	1.087	0	296450.780	105.933
15	31205	20064	13009	12408	18196	7656	1.123	0	1.087	0	296556.713	353.039
16	31225	19910	13021	12619	18204	7292	1.123	0	1.087	0	296909.752	189.353
17	31245	21112	13034	12912	18211	8199	1.123	0	1.087	0	297099.105	130.833
18	31266	21237	13047	12742	18219	8496	1.123	0	1.087	0	297229.938	406.088
19	31287	20829	13060	0	18228	20829	1.123	0	1.087	0	297636.026	104.345
20	31308	20465	13060	0	18248	20465	1.123	0	1.087	0.035	297740.371	216.094
21	31328	20108	13060	12336	18269	7771	1.123	0	1.122	0	297956.465	269.7
22	31349	19133	13072	12451	18277	6682	1.123	0	1.122	0	298226.165	269.31
23	31368	20484	13084	12256	18283	8228	1.123	0	1.122	0	298495.475	367.059
24	31388	20374	13097	12333	18292	8042	1.123	0	1.122	0	298862.534	142.595
25	31409	20304	13109	12540	18300	7764	1.123	0	1.122	0	299005.129	273.931
26	31429	20002	13121	0	18307	20001	1.123	0	1.122	0	299279.06	94.672
27	31449	21425	13121	0	18327	21426	1.123	0	1.122	0	299373.732	427.257
28	31470	20322	13121	12415	18349	7906	1.123	0	1.122	0	299800.989	204.03
29	31491	19947	13134	12713	18357	7235	1.123	0	1.122	0	300005.019	246.168
30	31511	20015	13147	12296	18364	7719	1.123	0	1.122	0	300251.187	351.215
1	31531		13159		18372		1.123		1.122		300602.40	
		613956		276684		337273		19		0.168		7137.02
Utility Consumption Cost for September 2025												
	Unit price		Unit	Cost		City water used unit		7,137		Unit		
Kwh On		4.1839	276684	1,157,618.19		cost			112,488.70		Bht	
Kwh OFF		2.6037	337273	878,157.71		Operation cost(Bht/unit)		0.15	1,070.55		Bht	
Kw peak		132.93	1123	149,280.39		service charge			-		Bht	
ft		(0.1572)	613957	(96,514.04)		cost			113,559.26		Bht	
service charge		312.24		312.24		Vat		0.07	7,949.15		Bht	
Sum				2,088,854.49		Total cost		121,508.40		Bht		
VAT		0.07		146,219.81								
Grand total				2,235,074.30								

Utility Consumption Cost for October 2025

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m³)	Consum / Day (m3)
1	31530.517	21139	13158.887	12754	18371.633	8384	1.042	48	1.003	0.019	300,602.4	195.063
2	31551.656	20615	13171.641	13063	18380.017	7553	1.09	30	1.022	0	300,797.5	354.164
3	31572.271	20229	13184.704	0	18387.57	20228	1.12	0	1.022	0.046	301,151.6	300.35
4	31592.5	20030	13184.704	0	18407.798	20030	1.12	0	1.068	0	301,452.0	135.249
5	31612.53	18737	13184.704	11838	18427.828	6899	1.12	0	1.068	0	301,587.2	306.061
6	31631.267	19175	13196.542	11938	18434.727	7216	1.12	0	1.068	0	301,893.3	261.32
7	31650.442	18906	13208.48	12000	18441.943	6927	1.12	0	1.068	0	302,154.6	128.085
8	31669.348	19893	13220.48	12319	18448.87	7593	1.12	0	1.068	0	302,282.7	297.127
9	31689.241	18700	13232.799	12109	18456.463	6572	1.12	0	1.068	0	302,579.8	331.197
10	31707.941	19049	13244.908	0	18463.035	19050	1.12	0	1.068	0	302,911.0	244.74
11	31726.99	19121	13244.908	0	18482.085	19121	1.12	0	1.068	0	303,155.758	209.884
12	31746.111	19249	13244.908	0	18501.206	19248	1.12	0	1.068	0	303,365.6	204.175
13	31765.36	18599	13244.908	11468	18520.454	7131	1.12	0	1.068	0	303,569.8	211.494
14	31783.959	18548	13256.376	12062	18527.585	6487	1.12	0	1.068	0	303,781.3	201.293
15	31802.507	20426	13268.438	12754	18534.072	7671	1.12	0	1.068	0	303,982.6	176.26
16	31822.933	20027	13281.192	12268	18541.743	7759	1.12	0	1.068	0	304,158.9	273.468
17	31842.96	19250	13293.46	0	18549.502	19250	1.12	0	1.068	0.064	304,432.3	296.531
18	31862.21	19952	13293.46	0	18568.752	19925	1.12	0	1.132	0	304,728.9	242.649
19	31882.162	19516	13293.46	12082	18588.677	7461	1.12	0	1.132	0	304,971.5	220.76
20	31901.678	19892	13305.542	12199	18596.138	7692	1.12	0	1.132	0	305,192.3	276.392
21	31921.57	18891	13317.741	12325	18603.83	6567	1.12	0	1.132	0	305,468.7	233.456
22	31940.461	18779	13330.066	0	18610.397	18779	1.12	0	1.132	0	305,702.1	159.112
23	31959.24	19548	13330.066	12368	18629.176	7180	1.12	0	1.132	0	305,861.2	299.738
24	31978.788	19561	13342.434	0	18636.356	19561	1.12	0	1.132	0	306,161.0	213.898
25	31998.349	19164	13342.434	0	18655.917	19164	1.12	0	1.132	0	306,374.9	234.36
26	32017.513	19927	13342.434	11788	18675.081	8139	1.12	0	1.132	0	306,609.2	352.493
27	32037.44	19245	13354.222	11787	18683.22	7457	1.12	0	1.132	0	306,961.7	159.494
28	32056.685	17935	13366.009	11835	18690.677	6102	1.12	0	1.132	0	307,121.2	237.988
29	32074.62	20704	13377.844	12269	18696.779	8434	1.12	0	1.132	0	307,359.2	250.128
30	32095.324	0	13390.113	0	18705.213	0	1.12	0	1.132	0	307,609.3	0
31	32095.324	38359	13390	12222	18705	26138	1.12	0	1.132	0	307609.331	304.09
1	32134		13402		18731		1.12		1.132		307913.424	
		603166		243448		359718		78		0.129		7311.02

Utility Consumption Cost for October 2025

Unit price	Unit	Cost	City water used unit	7,311	Unit
Kwh On	4.1839	243448	1,018,562.09	cost	115,239.66 Bht
Kwh OFF	2.6037	359718	936,597.76	Operation cost(Bht/unit)	0.15 1,096.65 Bht
Kw peak	132.93	1120	148,881.60	service charge	- Bht
ft	(0.1572)	603166	(94,817.70)	cost	116,336.31 Bht
service charge	312.24		312.24	Vat	0.07 8,143.54 Bht
Sum			2,009,535.99	Total cost	124,479.85 Bht
VAT	0.07		140,667.52		
Grand total			2,150,203.51		

Utility Consumption Cost for November 2025												
Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m³)	Consum / Day (m³)
1	32134	19010	13402	0	18731	19009	0	0	1.014	0	307913.424	399.41
2	32152.693	19495	13402	10972	18750	8523	0	1078	1.014	0	308312.835	223.95
3	32172	19920	13413	12752	18759	7167	1.078	40	1.014	0	308536.78	235.57
4	32192	17891	13426	11721	18766	6170	1.118	0	1.014	0	308772.355	210.46
5	32210	19125	13438	11754	18772	7372	1.118	0	1.014	0	308982.817	198.55
6	32229	19314	13450	12214	18780	7100	1.118	0	1.014	0	309181.37	319.89
7	32248	19111	13462	0	18787	19110	1.118	0	1.014	0.002	309501.258	181.99
8	32268	20451	13462	0	18806	20459	1.118	0	1.016	0.012	309683.245	259.4
9	32288	19417	13462	11961	18826	7449	1.118	0	1.028	0	309942.64	298.81
10	32307	19841	13474	12576	18834	7264	1.118	0	1.028	0	310241.452	188.17
11	32327	18821	13486	12257	18841	6565	1.118	0	1.028	0	310429.620	272.22
12	32346	19701	13499	11928	18848	7773	1.118	0	1.028	0	310701.836	222.44
13	32366	19718	13510	12401	18855	7317	1.118	0	1.028	0	310924.279	258.14
14	32385	18184	13523	0	18863	18184	1.118	0	1.028	0	311182.415	242.33
15	32404	19479	13523	0	18881	19479	1.118	0	1.028	0	311424.746	258.61
16	32423	18807	13523	11638	18900	7169	1.118	0	1.028	0	311683.355	251.76
17	32442	19254	13535	11720	18907	7534	1.118	0	1.028	0	311935.119	266.78
18	32461	18078	13546	11980	18915	6098	1.118	0	1.028	0	312201.898	220.6
19	32479	19200	13558	11812	18921	7388	1.118	0	1.028	0	312422.493	253.6
20	32499	19585	13570	11801	18928	7784	1.118	0	1.028	0	312676.091	258.16
21	32518	18508	13582	0	18936	18508	1.118	0	1.028	0	312934.254	368.35
22	32537	19071	13582	0	18955	19071	1.118	0	1.028	0	313302.603	382.28
23	32556	20775	13582	12221	18974	8554	1.118	0	1.028	0	313684.883	354.3
24	32576	18790	13594	11761	18982	7029	1.118	0	1.028	0	314039.18	263.62
25	32595	17650	13606	11692	18989	5958	1.118	0	1.028	0	314,302.8	215.78
26	32613	18292	13617	11449	18995	6844	1.118	0	1.028	0	314518.581	241.75
27	32631	18345	13629	11804	19002	6540	1.118	0	1.028	0	314760.332	229.1
28	32650	16950	13641	0	19009	16950	1.118	0	1.028	0	314989.434	232.5
29	32666	17337	13641	0	19026	17337	1.118	0	1.028	0	315221.932	239.46
30	32684	18584	13641	10944	19043	7639	1.118		1.028	0	315461.39	226.67
1	32702		13652		19051		0.916		1.028		315688.059	
		568704		249358		319344		1118		0.014		7774.64

Utility Consumption Cost for November 2025


	Unit price	Unit	Cost	City water used unit	7,775	Unit
Kwh On	4.1839	249358	1,043,288.94	cost	122,569.38	Bht
Kwh OFF	2.6037	319344	831,475.97	Operation cost(Bht/unit)	0.15	1,166.20 Bht
Kw peak	132.93	916	121,763.88	service charge	-	Bht
ft	(0.1572)	568702	(89,399.95)	cost	123,735.57	Bht
service charge	312.24		312.24	Vat	0.07	8,661.49 Bht
Sum			1,907,441.07	Total cost	132,397.06	Bht
VAT	0.07		133,520.88			
Grand total			2,040,961.95			

Utility Consumption Cost for December 2025

Date	Reading Meter	Total consum /day (Kwh)	On Peak Reading	Total consum /day (Kwh)	Off Peak Reading	Total consum /day (Kwh)	On Peak Demand (Kw)	Diff / day (Kw)	Off Peak Demand (Kw)	Diff / day (Kw)	Water Meter Reading (m³)	Consum / Day (m³)
1	32702.387	19256	13651.693	12483	19050.695	6774	0.916	142	0.81	0.045	315688.059	242.069
2	32721.643	20411	13664.176	13025	19057.469	7386	1.058	74	0.855	0.184	315930.128	248.02
3	32742.054	20811	13677.201	13172	19064.855	7639	1.132	0	1.039	0	316178.148	228.562
4	32762.865	18706	13690.373	0	19072.494	18706	1.132	0	1.039	0	316406.71	218.293
5	32781.571	20645	13690.373	0	19091.2	20645	1.132	0	1.039	0.018	316625.003	251.587
6	32802.216	20359	13690.373	0	19111.845	20359	1.132	0	1.057	0.048	316876.59	239.396
7	32822.575	19639	13690.373	12188	19132.204	7451	1.132	0	1.105	0	317115.986	243.658
8	32842.214	19175	13702.561	12169	19139.655	7006	1.132	0	1.105	0	317359.644	209.559
9	32861.389	19447	13714.73	0	19146.661	19446	1.132	0	1.105	0	317569.203	230.761
10	32880.836	20212	13714.73	12740	19166.107	7473	1.132	0	1.105	0	317799.964	250.835
11	32901.048	19014	13727.47	12866	19173.58	6148	1.132	0	1.105	0	318050.799	214.124
12	32920.062	20212	13740.336	0	19179.728	20213	1.132	0	1.105	0	318264.923	276.606
13	32940.274	20955	13740.336	0	19199.941	20954	1.132	0	1.105	0	318541.529	257.933
14	32961.229	19549	13740.336	12569	19220.895	6981	1.132	0	1.105	0	318799.462	266.317
15	32980.778	19824	13752.905	12632	19227.876	7191	1.132	0	1.105	0	319065.779	249.708
16	33000.602	20293	13765.537	12826	19235.067	7466	1.132	0	1.105	0	319315.487	247.226
17	33020.895	20287	13778.363	13055	19242.533	7233	1.132	0	1.105	0	319562.713	252.272
18	33041.182	19331	13791.418	12824	19249.766	6507	1.132	0	1.105	0	319814.985	246.791
19	33060.513	19251	13804.242	0	19256.273	19252	1.132	0	1.105	0	320061.776	232.437
20	33079.764	20938	13804.242	0	19275.525	20937	1.132	0	1.105	0	320294.213	272.942
21	33100.702	20444	13804.242	12864	19296.462	7580	1.132	0	1.105	0	320567.155	217.985
22	33121.146	19694	13817.106	12405	19304.042	7288	1.132	0	1.105	0	320785.14	259.385
23	33140.84	19801	13829.511	12663	19311.33	7139	1.132	0	1.105	0	321044.525	256.487
24	33160.641	20039	13842.174	12820	19318.469	7219	1.132	0	1.105	0	321301.012	239.914
25	33180.68	19429	13854.994	13116	19325.688	6313	1.132	0	1.105	0	321540.926	258.913
26	33200.109	20104	13868.11	0	19332.001	20104	1.132	0	1.105	0	321799.839	269.551
27	33220.213	20865	13868.11	0	19352.105	20865	1.132	0	1.105	0	322069.39	303.274
28	33241.078	19105	13868.11	12191	19372.97	6914	1.132	0	1.105	0	322372.664	264.77
29	33260.183	18807	13880.301	12262	19379.884	6544	1.132	0	1.105	0	322637.434	273.571
30	33278.99		13892.563		19386.428		1.132		1.105		322911.005	
31		0		0		0				0		0
1												
		576603		240870		335733		216		0.295		7222.95

Utility Consumption Cost for December 2025

	Unit price	Unit	Cost	City water used unit	7,223	Unit
Kwh On	4.1839	240870	1,007,775.99	cost	113,847.18	Bht
Kwh OFF	2.6037	335733	874,148.01	Operation cost(Bht/unit)	0.15	1,083.44 Bht
Kw peak	132.93	0	-	service charge	-	Bht
ft	(0.1572)	576603	(90,641.99)	cost	114,930.62	Bht
service charge	312.24		312.24	Vat	0.07	8,045.14 Bht
Sum			1,791,594.25	Total cost	122,975.76	Bht
VAT	0.07		125,411.60			
Grand total			1,917,005.85			

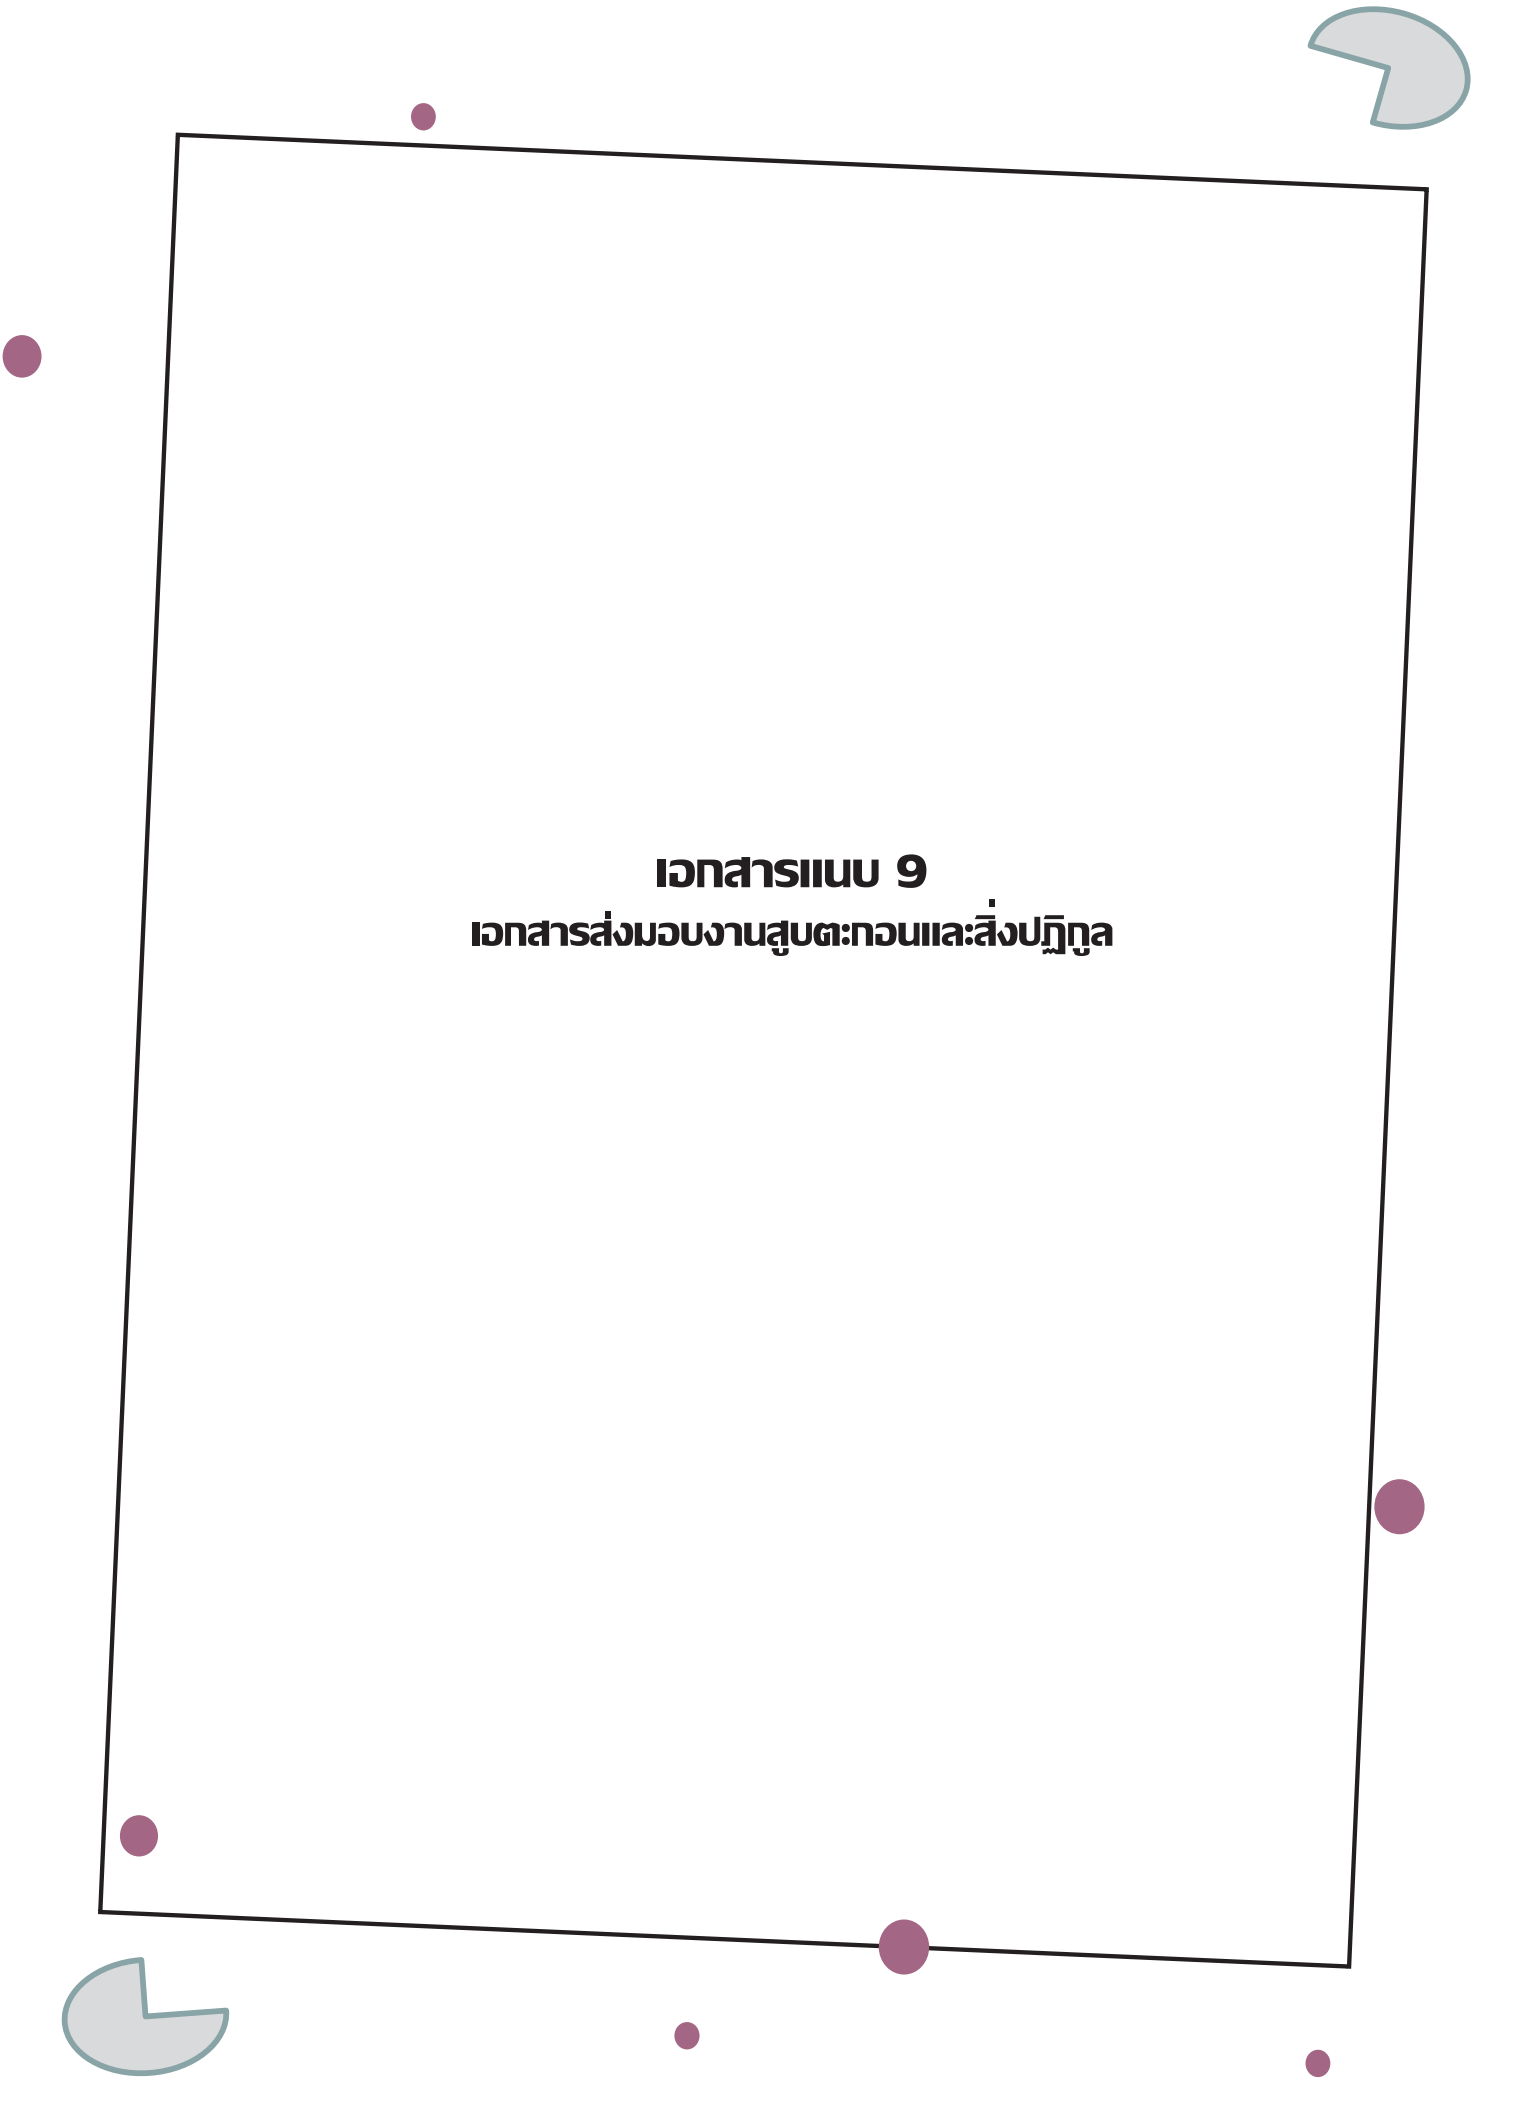

ເອກສານແບບ 9



ເອກສານສົ່ງມວນງານສູ່ບະຕະກອນແລະສິ່ງປຶກສາ

ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อไขมัน/บ่มี
(Canteen)
ก่อนการบริการ



บ่อไขมัน/บ่มี
(Canteen)
ก่อนการบริการ

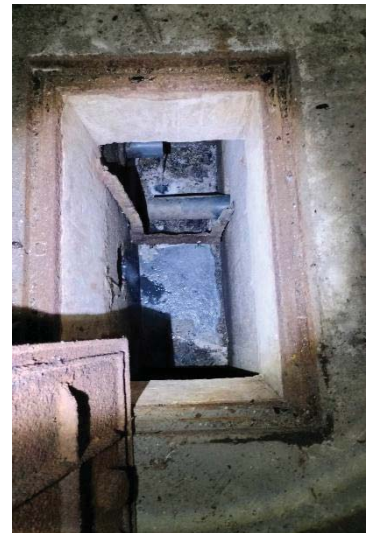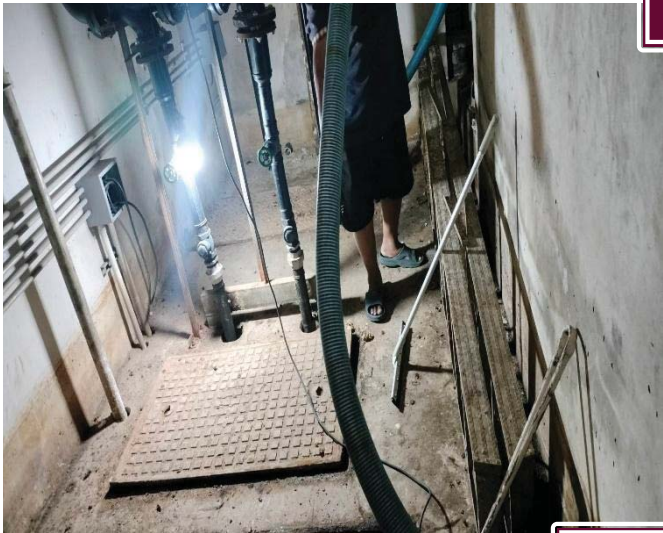


บ่อไขมัน/บ่มี
(Canteen)
ขณะบริการ




ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อไขมัน/ปัม
(Canteen)
ขณะบริการ

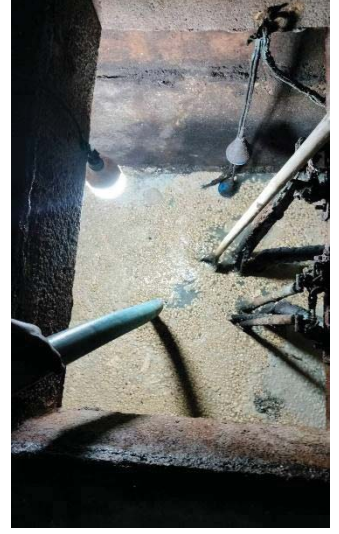

บ่อไขมัน/ปัม
(Canteen)
ขณะบริการ

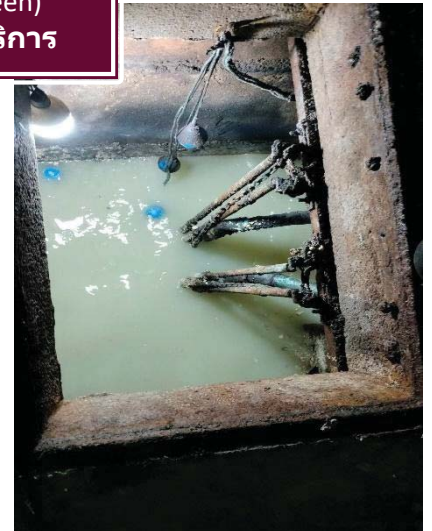

บ่อไขมัน/ปัม
(Canteen)
หลังบริการเสร็จ




ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568



บ่อ sump pump
(ชั้น B 1)
ก่อนการบริการ




บ่อ sump pump
(ชั้น B 1)
ขณะบริการ

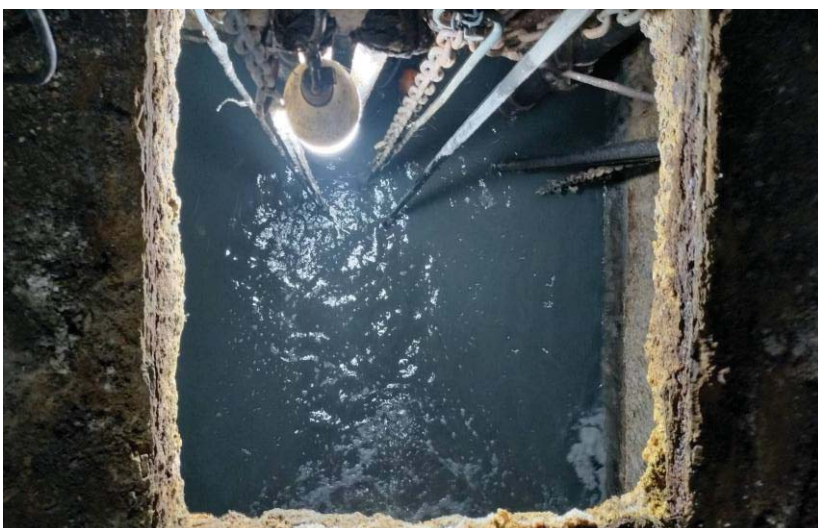


บ่อ sump pump
(ชั้น B 1)
หลังบริการเสร็จ

ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(ป้อนำบัดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568



บ่อเกรอะ
(ชั้น B2)
ก่อนการบริการ

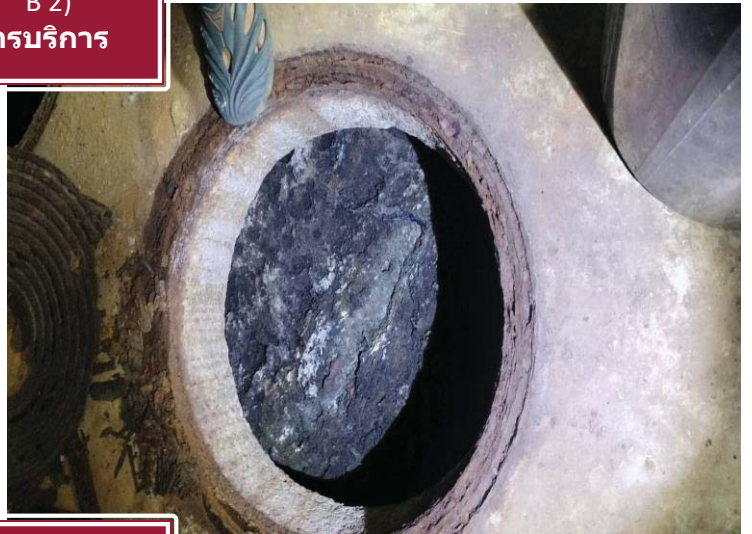

บ่อเกรอะ
(ชั้น B2)
ขณะบริการ

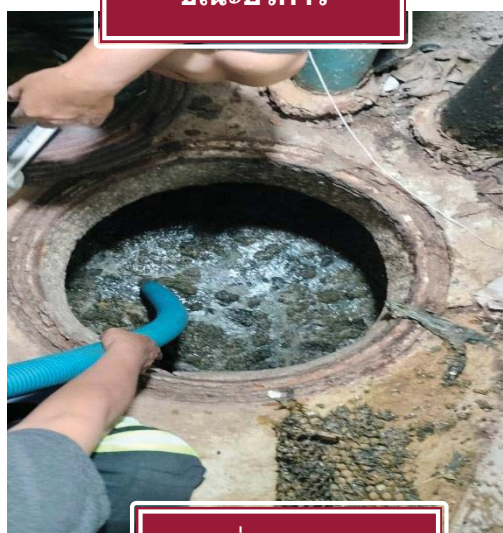

บ่อเกรอะ
(ชั้น B2)
หลังบริการ

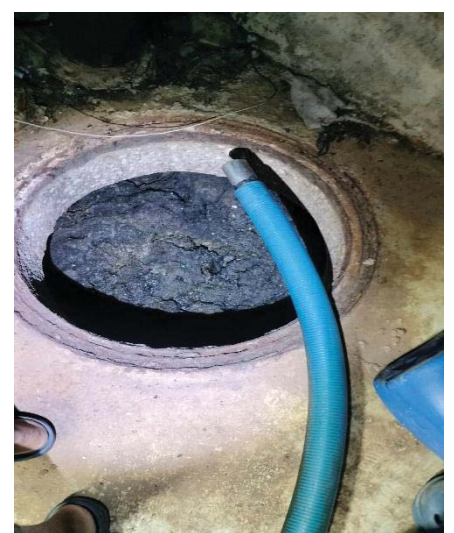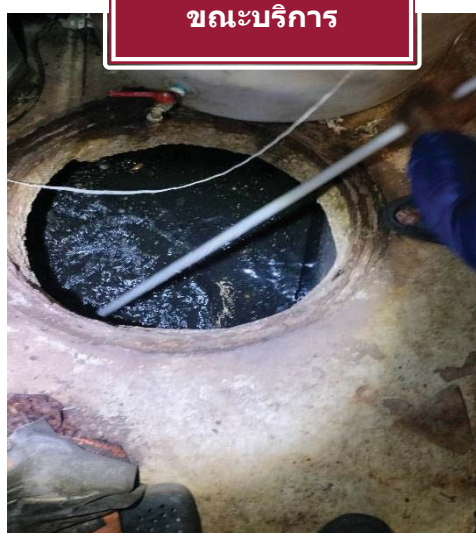

ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(ป้อนำบัดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อเกรอะ
(ชั้น B 2)
หลังบริการเสร็จ




บ่อเกรอะ
(ชั้น B 2)
หลังบริการเสร็จ




ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(บ่อน้ำบาดาลเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568



บ่อเกรอะ
(ใต้แลมปี)
ก่อนการบริการ

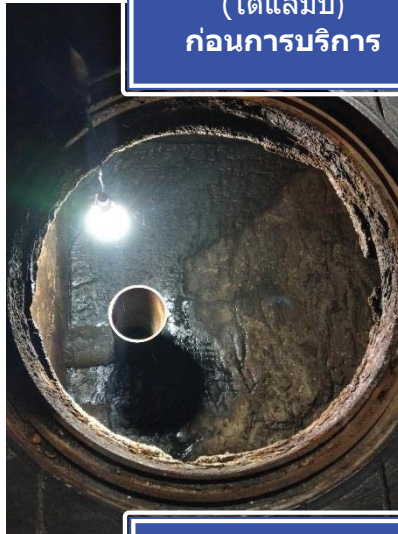

บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

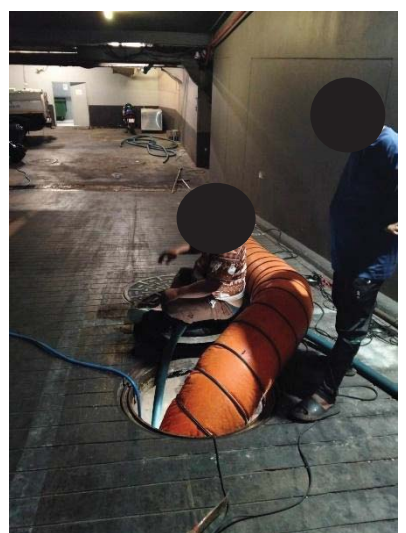


บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

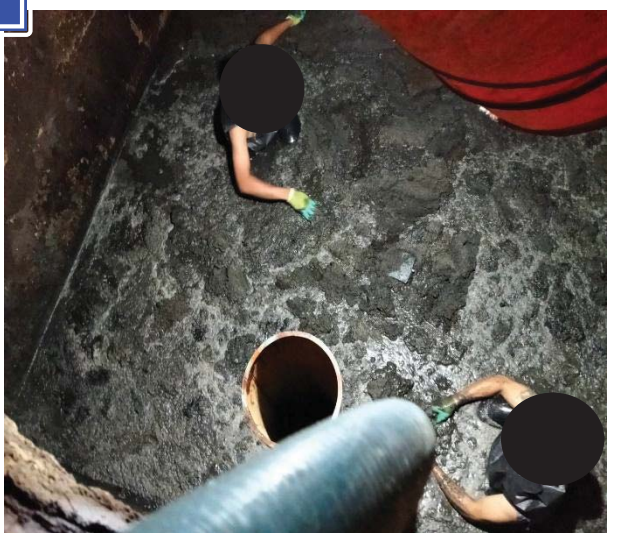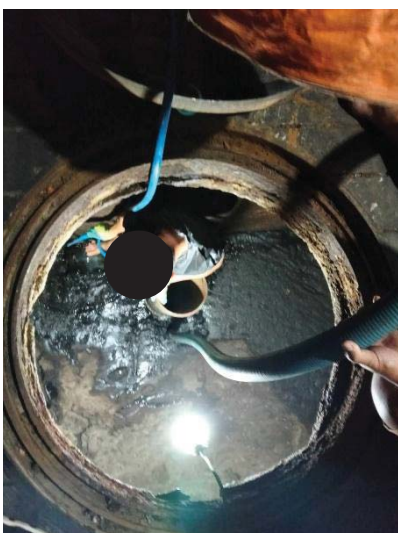


ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(ป้อนำบัดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568


บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

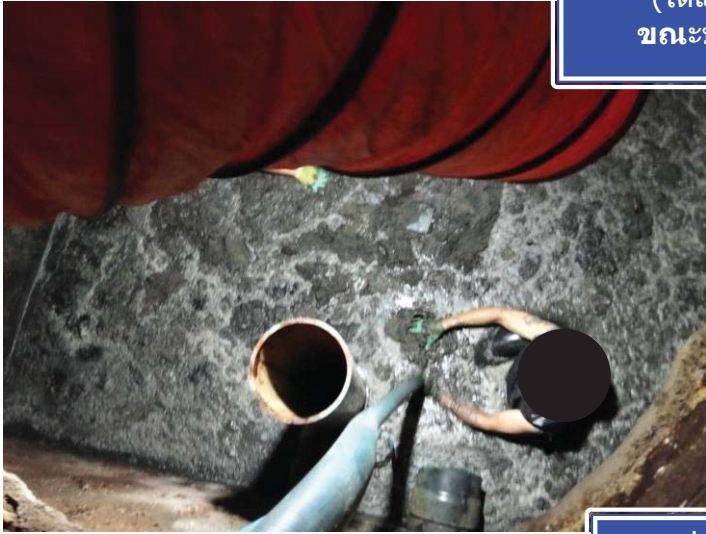

บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

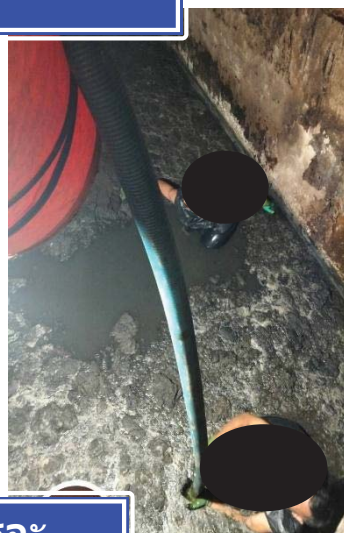


บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

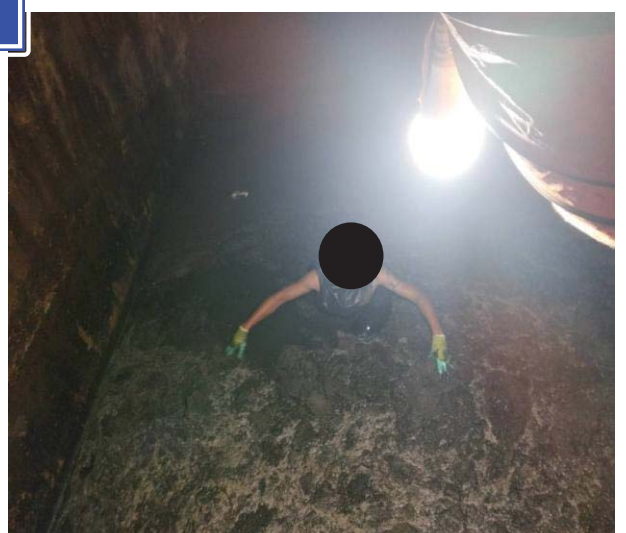

ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(บ่อน้ำบาดาลเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

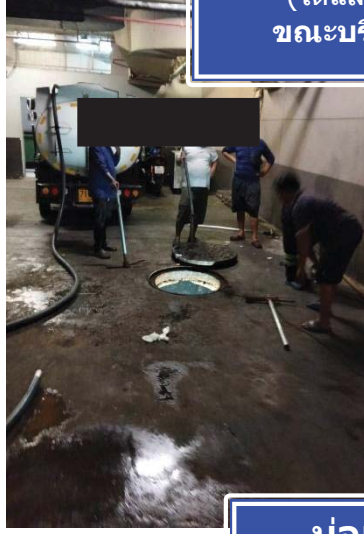

บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ



บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ




ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ



บ่อเกรอะ
(ใต้แลมปี)
ขณะบริการ

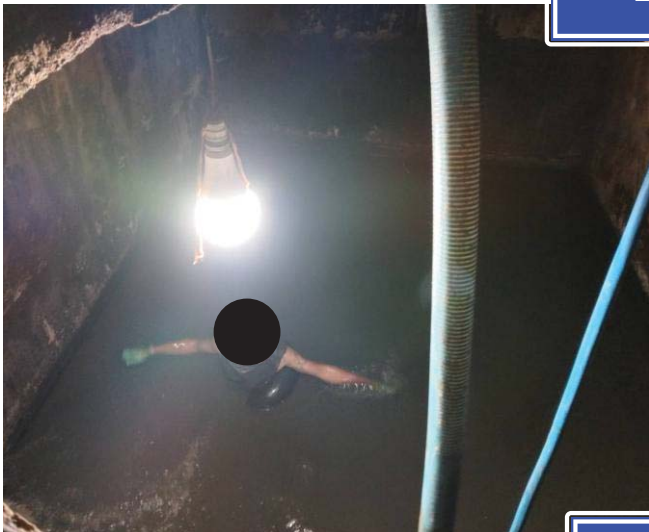

บ่อเกรอะ
(ใต้แลมปี)
หลังบริการเสร็จ



ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อเกรอะ
(ใต้แลมปี)
หลังบริการเสร็จ



บ่อเกรอะ
(ใต้แลมปี)
หลังบริการเสร็จ




ภาพประกอบการส่งมอบงาน สืบสิ่งปลูก SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568


บ่อไขมัน
(ชั้น B 1)
ก่อนการบริการ



บ่อไขมัน
(ชั้น B 1)
ขณะบริการ

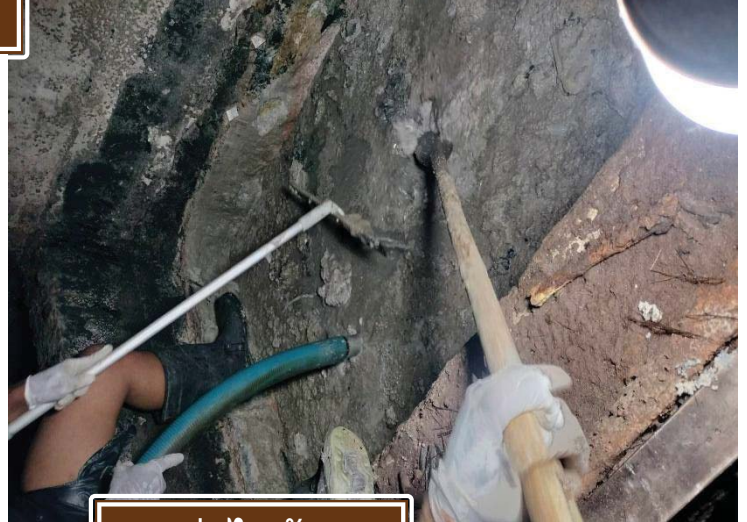

บ่อไขมัน
(ชั้น B 1)
หลังบริการเสร็จ

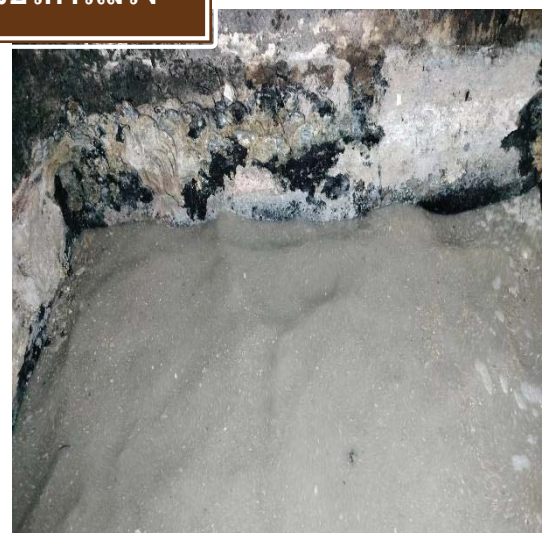

ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568

บ่อเติมอากาศ
(Aeration Tank)
ก่อนการบริการ



บ่อเติมอากาศ
(Aeration Tank)
ก่อนการบริการ



บ่อเติมอากาศ
(Aeration Tank)
ขณะบริการ



ภาพประกอบการส่งมอบงาน สืบสิ่งปฏิกูล SO/ BANGKOK
(บ่อน้ำบาดน้ำเสีย - ก่อนการบริการ ขณะบริการ และหลังบริการเสร็จ)
เข้าบริการ เมื่อวันที่ 1 ธันวาคม 2568



บ่อเติมอากาศ
(Aeration Tank)
หลังบริการเสร็จ



บ่อเติมอากาศ
(Aeration Tank)
หลังบริการเสร็จ



บ่อเติมอากาศ
(Aeration Tank)
หลังบริการเสร็จ


เอกสารแนบ 10
ตัวอย่างภาพการบุตลอกทางระบายน้ำของโครงการ ในปี 2568

SO/ BANGKOK

Gutter Drainage Cleaning 2/2025

Date: 2-December-2025

Located: G Floor

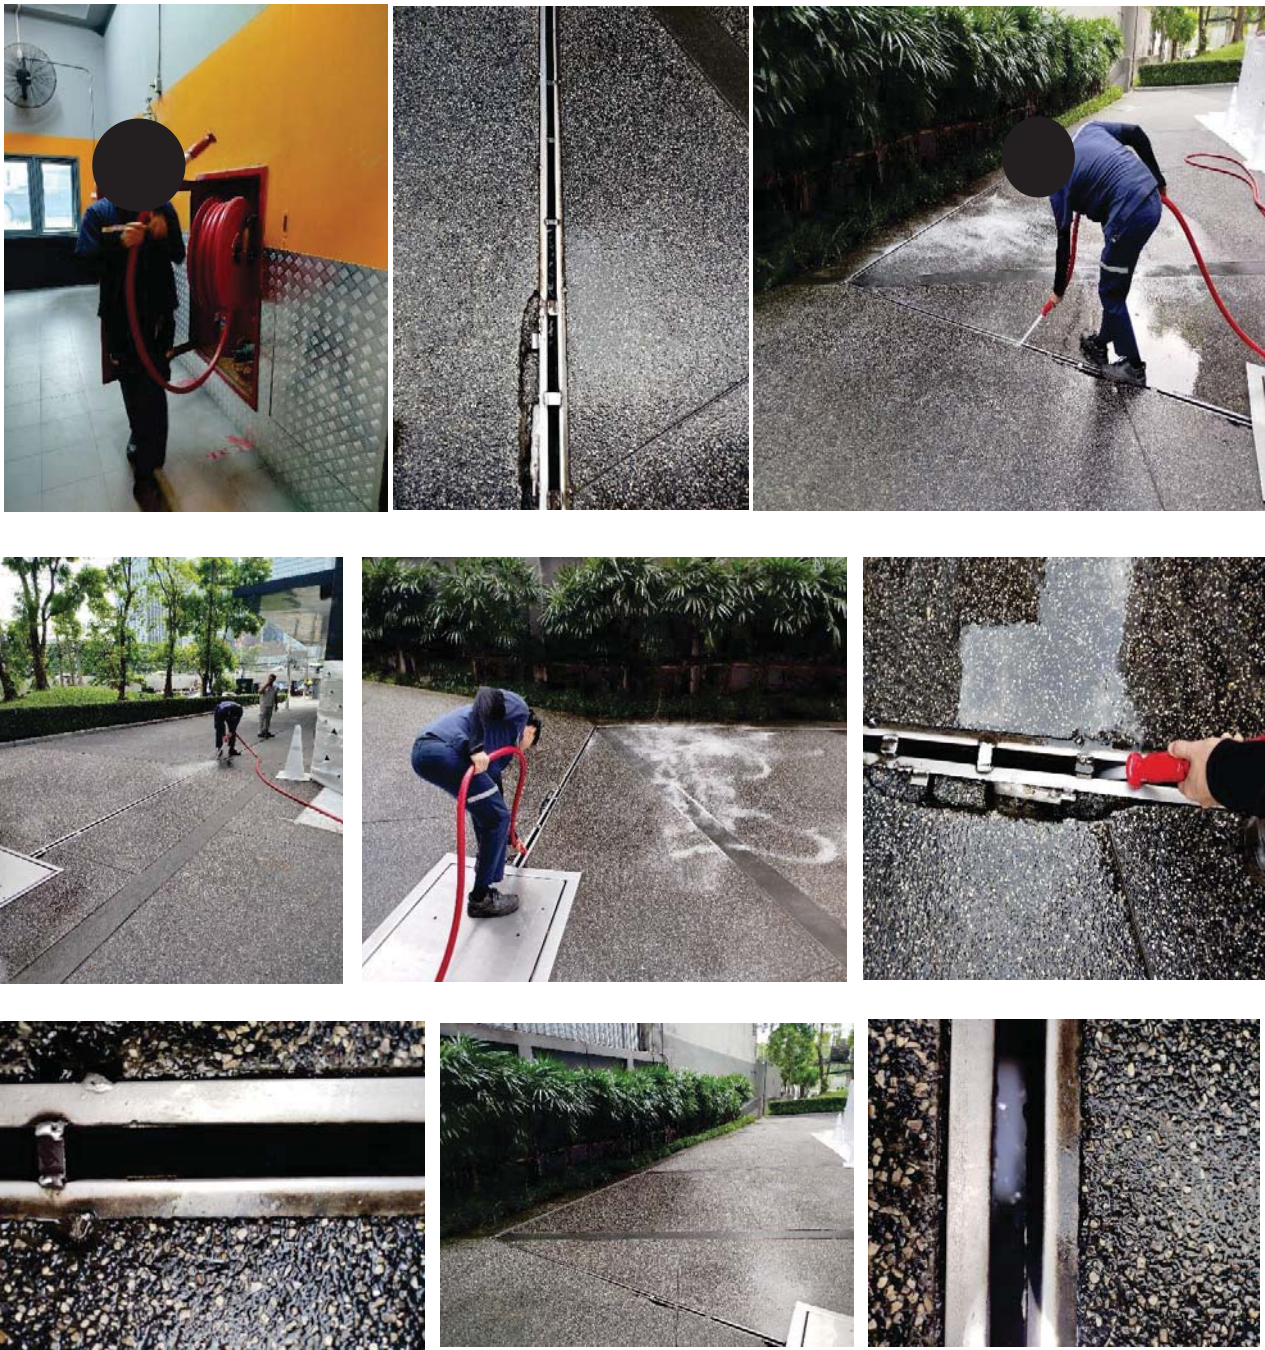

Technician: _____

Duty Engineer/Leader: _____

เอกสารแนบ 11
เอกสารการทำดัชนี:มูลพวย ในปี 2568



ใบเสร็จรับเงิน(สำเนา 1) วันที่ 6 มีนาคม 2568

สำนักงานเขต บางรัก โทร 0 2236 1395
ที่อยู่สำนักงานเขต 5 ถ.นเศศ แขวงสีพระยา เขตบางรัก กรุงเทพมหานคร 10500

ชื่อผู้ชำระค่าธรรมเนียม บริษัท โอ๊คทรี จำกัด (โรงแรมโซะเบงกอก)
ที่อยู่ เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร 10500

ปริมาณมูลฝอยทั่วไป 1,220.00 ลิตร/วัน
มีค่าธรรมเนียมจัดการมูลฝอยประจำเดือน ส.ค. 68

รายละเอียดดังนี้

ลำดับ	รายการ	จำนวนเงิน (บาท)
1	ค่าขับและขนมูลฝอย	4,000
2	ค่ากำจัดมูลฝอย	0
3		
รวมทั้งสิ้น (บาท)		4,000

จำนวนเงินทั้งสิ้น สี่พันบาทถ้วน

ช่องทางชำระเงิน (Payment) เช็ค ลงวันที่ 28 กุมภาพันธ์ 2568
เลขที่เช็ค (Cheque No.) 80032545

ธนาคาร (Bank) ธ. กสิกรไทย - สาขาถนนสาทร

วันที่เมื่อ 06 มีนาคม 2568 เวลา 13:35 น.

ใบเสร็จรับเงินนี้จะสมบูรณ์เมื่อกรุงเทพมหานครเรียกเก็บเงินได้ครบถ้วนแล้ว

กรุณาเก็บใบเสร็จไว้เพื่อเป็นหลักฐานการชำระเงินของท่าน



ใบเสร็จรับเงิน(สำเนา 1) วันที่ 6 มีนาคม 2568

สำนักงานเขต บางรัก โทร 0 2236 1395
ที่อยู่สำนักงานเขต 5 ถ.นเศศ แขวงสีพระยา เขตบางรัก กรุงเทพมหานคร 10500

ชื่อผู้ชำระค่าธรรมเนียม บริษัท โอ๊คทรี จำกัด (โรงแรมโซะเบงกอก)
ที่อยู่ เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร 10500

ปริมาณมูลฝอยทั่วไป 1,220.00 ลิตร/วัน
มีค่าธรรมเนียมจัดการมูลฝอยประจำเดือน ก.ย. 68

รายละเอียดดังนี้

ลำดับ	รายการ	จำนวนเงิน (บาท)
1	ค่าขับและขนมูลฝอย	4,000
2	ค่ากำจัดมูลฝอย	0
3		
รวมทั้งสิ้น (บาท)		4,000

จำนวนเงินทั้งสิ้น สี่พันบาทถ้วน

ช่องทางชำระเงิน (Payment) เช็ค ลงวันที่ 28 กุมภาพันธ์ 2568
เลขที่เช็ค (Cheque No.) 80032545

ธนาคาร (Bank) ธ. กสิกรไทย - สาขาถนนสาทร

วันที่เมื่อ 06 มีนาคม 2568 เวลา 13:36 น.

ใบเสร็จรับเงินนี้จะสมบูรณ์เมื่อกรุงเทพมหานครเรียกเก็บเงินได้ครบถ้วนแล้ว

กรุณาเก็บใบเสร็จไว้เพื่อเป็นหลักฐานการชำระเงินของท่าน



ใบเสร็จรับเงิน(สำเนา 1) วันที่ 6 มีนาคม 2568

สำนักงานเขต บางรัก โทร 0 2236 1395
ที่อยู่สำนักงานเขต 5 ถ.นเศศ แขวงสีพระยา เขตบางรัก กรุงเทพมหานคร 10500

ชื่อผู้ชำระค่าธรรมเนียม บริษัท โอ๊คทรี จำกัด (โรงแรมโซะเบงกอก)
ที่อยู่ เลขที่ 2 ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร 10500

ปริมาณมูลฝอยทั่วไป 1,220.00 ลิตร/วัน
มีค่าธรรมเนียมจัดการมูลฝอยประจำเดือน ก.ย. 68

รายละเอียดดังนี้

ลำดับ	รายการ	จำนวนเงิน (บาท)
1	ค่าขับและขนมูลฝอย	4,000
2	ค่ากำจัดมูลฝอย	0
3		
รวมทั้งสิ้น (บาท)		4,000

จำนวนเงินทั้งสิ้น สี่พันบาทถ้วน

ช่องทางชำระเงิน (Payment) เช็ค ลงวันที่ 28 กุมภาพันธ์ 2568
เลขที่เช็ค (Cheque No.) 80032545

ธนาคาร (Bank) ธ. กสิกรไทย - สาขาถนนสาทร

วันที่เมื่อ 06 มีนาคม 2568 เวลา 13:33 น.

ใบเสร็จรับเงินนี้จะสมบูรณ์เมื่อกรุงเทพมหานครเรียกเก็บเงินได้ครบถ้วนแล้ว

กรุณาเก็บใบเสร็จไว้เพื่อเป็นหลักฐานการชำระเงินของท่าน

เป็นจำนวนเงิน 4,000 บาท

เดือน	บาท	เดือน	บาท
ค.ย.	-	ม.ย.	-
พ.ย.	-	พ.ย.	-
ธ.ย.	-	มิ.ย.	-
ม.ย.	-	ก.ย.	4,000
ก.พ.	-	ธ.ย.	-
มี.ย.	-	ก.ย.	-

เอกสารแนบ 12
เอกสารตรวจสอบระบบระบายอากาศ ในปี 2568

Document Type	Department Name	Location	Created Date
Casual Manpower Requisition	SOB - HOUSE LAUNDRY	SO Bangkok	10/5/2025 2:02:45 PM

Document Attribute:

Attribute Name	Attribute Values
Form No	CMF05-Oct-25002191
Name of the Department	SOB - HOUSE LAUNDRY
Name of the Supplier	Chiewchan Piwkhamasing
Start Date	06-Oct-2025
End Date	12-Oct-2025
Name of the Function	Request Casual 6-12 Oct 2025
Total Cost	7000
Amount in Words	SEVEN THOUSAND

Detail Attributes :

No of Casuals Required	Per Casual Cost	Reporting In Time(24hr Format)	Reporting Out Time(24hr Format)	Reasons (Please Specify)	Amount	Shift Details	Casual Type	Meal Period
14	500	08:00	18:00	Replace K. Wichit and K. Pang Nga	7000.00	Full	Male and Female	Lunch

Document Approval History

Submitted/Approved By	Designation	Stage Name	Remarks	Submission/Approval Date
	Fashion Manager	Submitted	" Due to the resignation of two of our employees, various tasks have been delayed. Therefore' it is necessary to request daily-hire staff to support the team. "	Oct 5 2025 2:02PM
	Director of Rooms	DH Approved		Oct 7 2025 11:45AM
	Director of Talent and Culture	Director of HR Approved		Oct 7 2025 6:24PM
	ASS	DFA Approved		Oct 7 2025 6:37PM
	Associate	GM Approved		Oct 7 2025 7:20PM

Attachment Details

File Name	File Type	Description
20251005135307362.pdf	pdf	

ชื่อเครื่อง: 6A-01 Brand/ ยี่ห้อ: Kruger Model/ รุ่น: Bsbacstm ☒ Monthly ☐ Yearly
 ขนาดเครื่อง: 560 L/s CFM. ขนาดมอเตอร์: 4 KW. Serial No.: Bkmo600510 วันที่ตรวจเช็ค: 1 Jan 25
 สถานที่ติดตั้ง: Substation Room ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม	
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ		
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง						
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม						
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ						
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ						
	5	ตรวจสอบสภาพทั่วไปของพัดลม						
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริลล์จ่ายลม	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี)	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	8	ถอดล้างตะแกรงกันแมลงหรือก้นกบ (ถ้ามี)	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☒		ดำเนินการปรับตั้ง ☐ ขาดุดมาก ควรเปลี่ยนใหม่	
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง						
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N <u>220</u> V. S-N <u>220</u> V. T-N <u>220</u> V. R-S <u>380</u> V. S-T <u>380</u> V. T-R <u>380</u> V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R <u>6.2</u> A S <u>6.2</u> A T <u>6.1</u> A				Name Plate FLA = <u>6.4</u> A	
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ						
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง							
15	ตรวจสอบอุณหภูมิของเบรจและมอเตอร์เบื้องต้น (โดยการสัมผัส)							
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง						
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน (เมื่อจำเป็น)					เปลี่ยนทุกๆ 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หกลวมให้แน่น	☐		☐		ไม่ได้ดำเนินการ เนื่องจาก _____	
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง						

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไปแล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :


ชื่อเครื่อง: SA-01 Brand/ ยี่ห้อ: Kruger ☒ Monthly ☐ Yearly
 ขนาดเครื่อง: 150 CFM. ขนาดมอเตอร์: 4 KW. Model/ รุ่น: Bsb00tm
 สถานที่ติดตั้ง: Substation Room ชั้น 6 Serial No.: Bkm060090 วันที่ตรวจเช็ค: 3 feb 25

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	✓				
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	✓				
	5	ตรวจสอบสภาพทั่วไปของพัดลม	✓				
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริดจ่ายลม	✓				
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี)	✓				
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี)	✓				
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower					
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			✓		
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N 220 V. S-N 220 V. T-N 220 V.				
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R 6.2 A. S 6.1 A. T 6.2 A.				
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓				
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓					
15	ตรวจสอบอุณหภูมิของเบร็กและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓					
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง					
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุก 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และฉนวนหุ้มสายที่ความถี่สูง					
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง					

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :

อัตราน

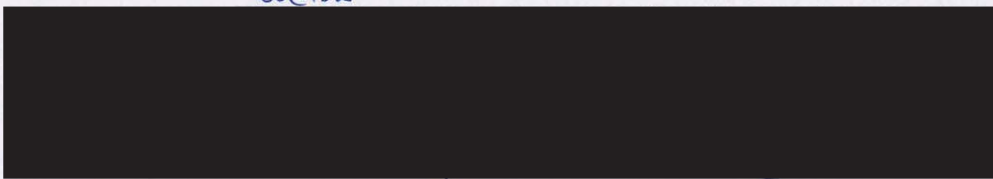

ชื่อเครื่อง 6A-01 Brand/ ยี่ห้อ: Kruger Model/ รุ่น: Asbroom ☒ Monthly ☐ Yearly
 ขนาดเครื่อง 560 L/s CFM. ขนาดมอเตอร์ 4 KW. Serial No.: Bkmb00510 วันที่ตรวจเช็ค 2 Mar 25
 สถานที่ติดตั้ง Substation Room ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม	
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ		
ประจำเดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง						
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม						
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ						
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☒	ดำเนินการ	☐	ไม่ได้ดำเนินการ เนื่องจาก		
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ						
	5	ตรวจสอบสภาพทั่วไปของพัดลม						
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริดจ่ายลม	☒	ไม่มี	☐	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก
	7	ถอดล้าง Filter ของอากาศ (ถ้ามี)	☒	ไม่มี	☐	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก
	8	ถอดล้างตะแกรงกันแมลงหรือก้นกบ (ถ้ามี)	☒	ไม่มี	☐	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☐		☒	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)					☒	ดำเนินการปรับตั้ง ☐
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง						
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N <u>220</u> V. S-N <u>220</u> V. T-N <u>220</u> V.					
			R-S <u>380</u> V. S-T <u>380</u> V. T-R <u>380</u> V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R <u>6.2</u> A. S <u>6.2</u> A. T <u>6.2</u> A.					Name Plate FLA - <u>6.4</u> A.
13	ตรวจสอบสภาพการทำงานทั่วไปและเสียงที่อาจผิดปกติ							
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง							
15	ตรวจสอบอุณหภูมิของเบรคและมอเตอร์เบื้องต้น (โดยการสัมผัส)							
ประจำปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง						
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก		
	17	ตรวจสอบสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุก 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐	ดำเนินการเรียบร้อยแล้ว	☐	ไม่ได้ดำเนินการ เนื่องจาก		
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง						

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ :

รายการอะไหล่ที่ใช้ไป :



Tec

()

()

()

ชื่อเครื่อง 6A-03

Brand/ ยี่ห้อ : Kruger

☒ Monthly☐ Yearly

ขนาดเครื่อง 5460 L/s CFM.

ขนาดมอเตอร์ 4 KW.

Model/ รุ่น : Bsb 900tn

Serial No. : Bkmo600510

วันที่ตรวจเช็ค 1 Apr 25

สถานที่ติดตั้ง Substation Room ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	☒				
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม	☒				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	☒				
	3	ทำความสะอาดและเป่าฝุ่นภายในและภายนอกตู้ควบคุม	☒		☐	ไม่ได้ดำเนินการ เนื่องจาก	
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	☒				
	5	ตรวจสอบสภาพทั่วไปของพัดลม	☒				
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริ่งจ่ายลม	☒	ไม่มี	☐	ไม่ได้ดำเนินการ เนื่องจาก	
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี)	☒	ไม่มี	☐	ไม่ได้ดำเนินการ เนื่องจาก	
	8	ถอดล้างตะแกรงกันแมลงหรือก้นก (ถ้ามี)	☒	ไม่มี	☐	ไม่ได้ดำเนินการ เนื่องจาก	
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☒		☐	ไม่ได้ดำเนินการ เนื่องจาก	
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☒	ดำเนินการปรับตั้ง	☐ ขาดมาก ควรเปลี่ยนใหม่
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N 220 V. S-N 220 V. T-N 220 V.				
			R-S 380 V. S-T 380 V. T-R 380 V.				
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R 6.1 A. S 6.2 A. T 6.2 A.				Name Plate FLA - 6.2 A.
13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ						
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง						
15	ตรวจสอบอุณหภูมิของเบร้งและมอเตอร์เบื้องต้น (โดยการสัมผัส)						
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐		☐	ไม่ได้ดำเนินการ เนื่องจาก	
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุก 10000 ชั่วโมง หรือไม่เกิน 5 ปี
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หุ้มฉนวนให้แน่น	☐		☐	ไม่ได้ดำเนินการ เนื่องจาก	
19	ตรวจเช็คความมั่นคงของ Support เครื่อง						

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขแล้วเสร็จ :



ชื่อเครื่อง 6A-04
ขนาดเครื่อง 5460 L/s CFM.

Brand/ ยี่ห้อ : Kruger
ขนาดมอเตอร์ A KW.

☒ Monthly ☐ Yearly
Model/ รุ่น : 8sb900tm

Serial No. : Bkm0600010

วันที่ตรวจเช็ค 3 May 25

สถานที่ติดตั้ง

ชั้น


ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม	
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ		
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง	☒					
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม	☒					
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟทุกตัว	☒					
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก	
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	☒					
	5	ตรวจสอบสภาพทั่วไปของพัดลม	☒					
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริ่งจ่ายลม	☒	ไม่มี	☐		ไม่ได้ดำเนินการ เนื่องจาก	
	7	ถอดล้าง Filter กรองอากาศ (ถ้ามี)	☒	ไม่มี	☐		ไม่ได้ดำเนินการ เนื่องจาก	
	8	ถอดล้างตะแกรงกันแมลงหรือกันนก (ถ้ามี)	☒	ไม่มี	☐		ไม่ได้ดำเนินการ เนื่องจาก	
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	☒		☐		ไม่ได้ดำเนินการ เนื่องจาก	
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			☐		ดำเนินการปรับตั้ง ☐ จำนวนมาก ควรเปลี่ยนใหม่	
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง						
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N <u>220</u> V. S-N <u>220</u> V. T-N <u>220</u> V. R-S <u>380</u> V. S-T <u>380</u> V. T-R <u>380</u> V.					
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R <u>6.2</u> A. S <u>6.2</u> A. T <u>6.1</u> A.					Name Plate FLA - <u>6.1</u> A.
	13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจส่งผิดปกติ	☒					
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	☒						
15	ตรวจสอบอุณหภูมิของเบร็กและมอเตอร์เบื้องต้น (โดยการสัมผัส)	☒						
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง						
	16	ทำความสะอาด Blower และตัวถังเครื่อง	☐		☐		ไม่ได้ดำเนินการ เนื่องจาก	
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน(เมื่อจำเป็น)					เปลี่ยนทุก 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หลวมให้แน่น	☐		☐		ไม่ได้ดำเนินการ เนื่องจาก	
	19	ตรวจเช็คความมั่นคงของ Support เครื่อง						


รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขแล้วเสร็จ :

ชื่อเครื่อง: EA-03 Brand/ ยี่ห้อ: Kruger Model/ รุ่น: Bsb900tm
 ขนาดเครื่อง: 540 L/s CFM. ขนาดมอเตอร์: A KW. Serial No.: Bkm000510 วันที่ตรวจเช็ค: 1 Jun 25
 สถานที่ติดตั้ง: Substation Room ชั้น 6

ความถี่	Item	รายการตรวจเช็ค / ดำเนินการ	ผลการตรวจเช็ค		ผลการแก้ไข		บันทึกเพิ่มเติม
			ปกติ	ผิดปกติ	เสร็จ	ไม่เสร็จ	
ประจำ 1 เดือน		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	1	ตรวจสอบสภาพภายนอกและภายในตู้ควบคุม	✓				
	2	ตรวจเช็คจุดต่อทางไฟฟ้า และความแน่นของขั้วไฟจุดต่างๆ	✓				
	3	ทำความสะอาดและเป่าฝุ่นทั้งภายในและภายนอกตู้ควบคุม	✓	ดำเนินการ	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	4	ตรวจเช็ค Pilot Lamp และอุปกรณ์ต่างๆ เช่น Fuse, Meter ฯลฯ	✓				
	5	ตรวจสอบสภาพทั่วไปของพัดลม	✓				
	6	ทำความสะอาดและเป่าฝุ่นหน้ากริดจ่ายลม	✓	ไม่มี	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	7	ถอดล้าง Filter ของอากาศ (ถ้ามี)	✓	ไม่มี	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	8	ถอดล้างตะแกรงกันแมลงหรือกิ้งก่า (ถ้ามี)	✓	ไม่มี	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	9	หล่อลื่นลูกปืนมอเตอร์และลูกปืน Blower	✓	ดำเนินการเรียบร้อยแล้ว	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	10	ตรวจเช็คและปรับตั้งสายพาน (เปลี่ยนทุก 3000 ชั่วโมง หรือ 1 ปี)			✓	ดำเนินการปรับตั้ง	✓
		ON CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง แล้วเดินเครื่อง					
	11	วัดแรงดันไฟฟ้าเข้าเครื่อง	R-N 220 V. S-N 220 V. T-N 220 V.				
			R-S 380 V. S-T 380 V. T-R 380 V.				
	12	วัดกระแสไฟฟ้าของมอเตอร์พัดลม	R 6.2 A. S 6.2 A. T 6.2 A.				Name Plate FLA - 6.2 A.
13	ตรวจเช็คสภาพการทำงานทั่วไปและเสียงที่อาจดังผิดปกติ	✓					
14	ตรวจความสั่นสะเทือน (Alignment) ของตัวเครื่อง	✓					
15	ตรวจสอบอุณหภูมิของเบร็กและมอเตอร์เบื้องต้น (โดยการสัมผัส)	✓					
ประจำ 1 ปี		OFF CB ที่จ่ายกระแสไฟฟ้าเข้าเครื่อง					
	16	ทำความสะอาด Blower และตัวถังเครื่อง	✓	ดำเนินการเรียบร้อยแล้ว	✓	ไม่ได้ดำเนินการ เนื่องจาก	
	17	ตรวจเช็คสภาพของลูกปืน หรือเปลี่ยน (เมื่อจำเป็น)				เปลี่ยนทุก 10000 ชั่วโมง หรือไม่เกิน 5 ปี	
	18	ตรวจเช็คขั้วไฟฟ้า และขันน็อตหัวสายที่หุ้มฉนวนในแนบ	✓	ดำเนินการเรียบร้อยแล้ว	✓	ไม่ได้ดำเนินการ เนื่องจาก	
19	ตรวจเช็คความมั่นคงของ Support เครื่อง						

รายละเอียดกรณีผิดปกติ และการแก้ไข หรือแก้ไขไม่แล้วเสร็จ:

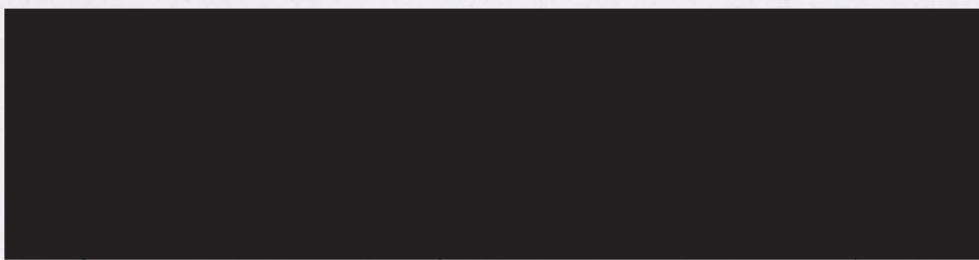

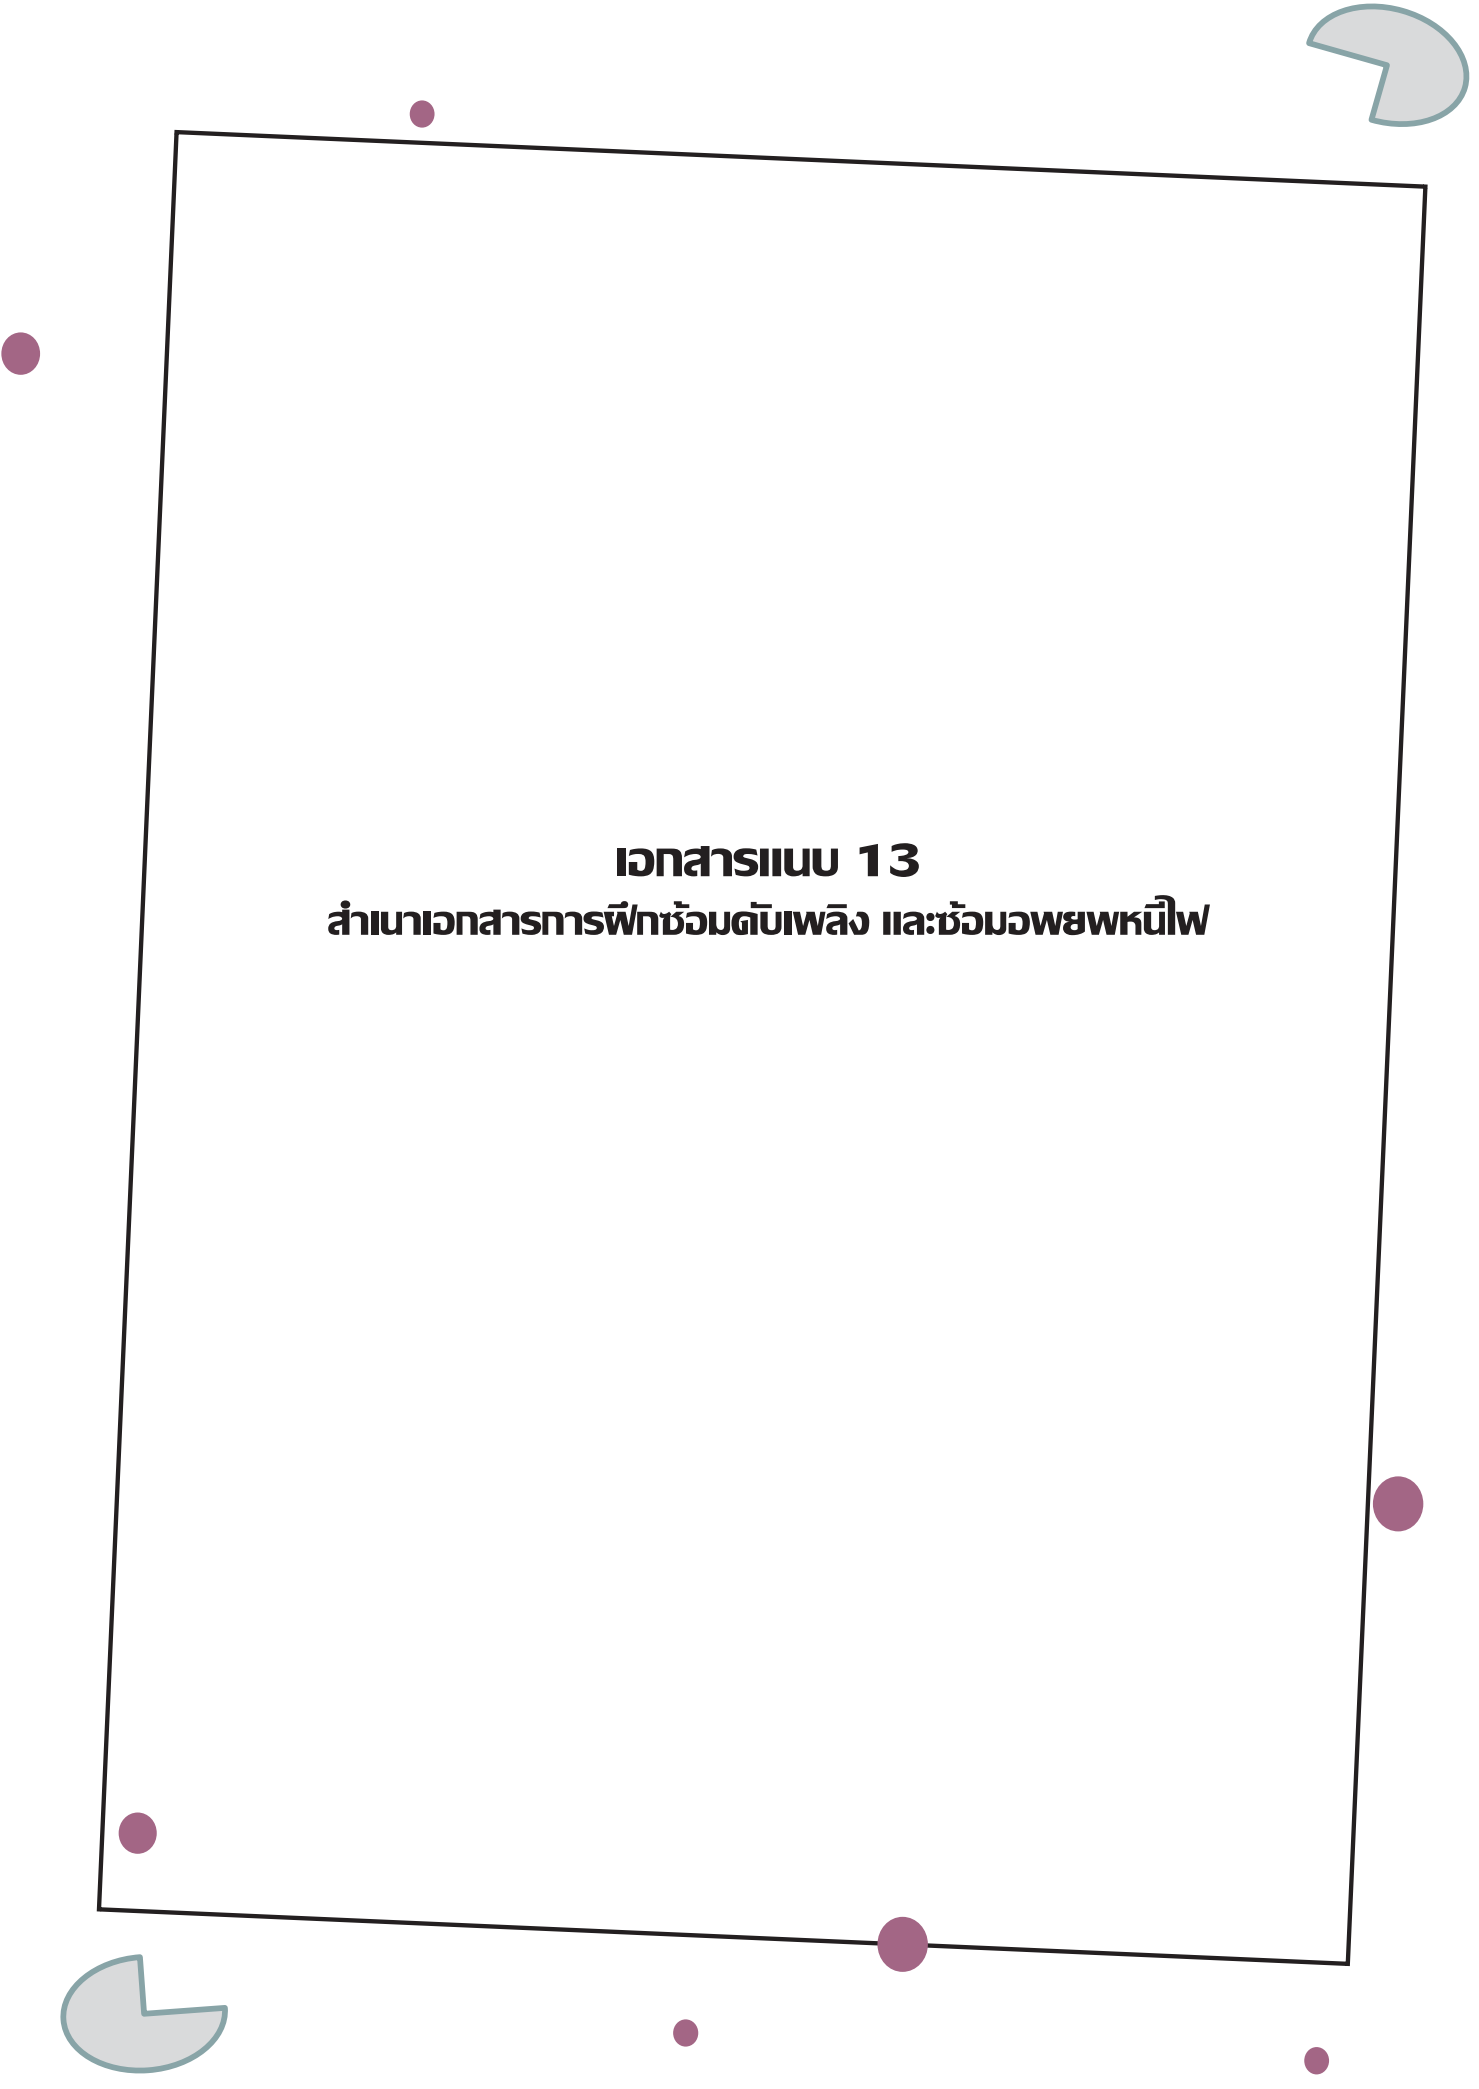

เอกสารแบบ 13

สำเนาเอกสารการไฟฟ้าช้อนดับเพลิง และซ่อมอพยพหนีไฟ



วุฒิบัตรเลขที่ สปภ.(กปภ.๒). ๑๖๑๑ /๒๕๖๔

กรุงเทพมหานคร

ได้รับใบอนุญาตจากกรมสวัสดิการและคุ้มครองแรงงาน ใบอนุญาตเลขที่ ๐๑๐๒-๐๒-๒๕๖๗-๐๑๕๑
ขอรับรองว่า

.....
โรงแรม โซ แบนคอก

ตั้งอยู่เลขที่ ๒ ถนนสาทรเหนือ แขวงสีลม เขตบางรัก กรุงเทพมหานคร ๑๐๕๐๐


ได้ดำเนินการฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ

ตามกฎหมายกระทรวงกำหนดมาตรฐานในการบริหาร จัดการ และดำเนินการด้านความปลอดภัย อาชีวอนามัย
และสภาพแวดล้อมในการทำงานเกี่ยวกับการป้องกันและระงับอัคคีภัย พ.ศ. ๒๕๕๕ ลงวันที่ ๗ ธันวาคม พ.ศ. ๒๕๕๕

มีผู้เข้ารับการฝึกอบรม จำนวน ๙๒ คน

เมื่อวันที่ ๗ ตุลาคม ๒๕๖๔

ให้ไว้ ณ วันที่ ๑๖ ต.ค. ๒๕๖๔

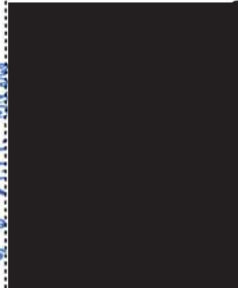

ผู้อำนวยการสำนักงานคณะกรรมการข้าราชการ
ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

เอกสารแนบ 14
สำเนาเอกสารการตรวจสอบระบบป้องกันอัคคีภัย

สำเนาเอกสารการตรวจสอบอุปกรณ์ระบบดับเพลิง



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริ่ง จำกัด
UNITED POWER ENGINEERING CO., LTD.
4 ซอยสุขุมวิท 81 (Slipdot) สุขุมวิท, กรุงเทพฯ 10260 โทร: 0-2742-5366-77 (12 Line) โทรสาร 0-2742-5378-9
Fax: 0-2742-5378-9
http://www.unitedpower.co.th / e-mail : upe@unitedpower.co.th

MAINTENANCE & RECORDS					
Customer Name and Address	Tech	Sales	Time	Date	Job No.
OAKTREE COMPANY LIMITED.	PPKSR	KP	10:00	17/11/88	110-9026/10
	Project Name				Times No.
	SO BANGKOK (VERANDA)				FP-01 (LOW ZONE)

C. Annual Service Inspection					ครั้งที่ 1/2
Item	Description	Yes	No	Remark	
Pump F/P	[Brand: AURORA , Model: 6-481-14HH , SN: 10-1937360 Capacity : 1250 gpm., TDH : 160 PSI ft. Speed : 3000 rpm.]				
36	ตรวจสอบการทำงานของเบรค	☒	☐		
37	ตรวจสอบและปรับตั้งการ Alignment ของเครื่องสูบน้ำและตัวค้ำ	☒	☐		
ENGINE	[Brand: CLARKE , Model: JUGH-UP54 , SN: RE6068785546 A-C Power Supply : V/ DC Ph/ Hz. Speed 3000 rpm., Power 216 (KW/HP), Full load - A.]				
38	เปลี่ยนน้ำมันเครื่องและไส้กรอง	☒	☐		ถ่ายทิ้งแล้ว
39	เปลี่ยนไส้กรองเชื้อเพลิง	☒	☐		16/11/88
40	เปลี่ยนไส้กรองหล่อลื่นและตรวจสอบน้ำมันหล่อลื่น	☒	☐		
41	เปลี่ยนไส้กรองอากาศ	☒	☐		
42	ตรวจสอบการตั้งค่าสวิตช์ไฮดรอลิกส์	☒	☐		
43	ตรวจสอบระบบท่ออื่นทั้งหมด	☒	☐		
44	ตรวจสอบอุปกรณ์ควบคุมในระบบไฟฟ้าทั้งหมด	☒	☐		

Pump		Driver	
Brand : AURORA	Brand : MARATHON		
Model : PVM8-110	Model :		
SN : 2545581-10	SN : E2012		

JOCKEY PUMP TEST RECORD				
A.C. Power Supply	380	V/	3	Ph/
rpm	3000	Hz		
Size	2 1/2"	Hp	306.2V	
Full load	2 1/2"	Amp	306.3V	
Type of Mounting	☒ Vertical Mount ☐ Horizontal Mount			
Starting Type	☐ D.O.L. ☒ Star-Delta			
Inboard Ball Bearing	☐ O.K. ☐ Not O.K.			
Outboard Ball Bearing	☐ O.K. ☐ Not O.K.			
Current Consumption	L1: 0.2	Amp.	L2: 5.70	Amp. L3: 5.50

The Undersigned herewith declares that the job has been completed to entire satisfaction.

Inspector/Consultant

Customer/Company Stamp



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริ่ง จำกัด
UNITED POWER ENGINEERING CO., LTD.
4 ซอยสุขุมวิท 81 (Slipdot) สุขุมวิท, กรุงเทพฯ 10260 โทร: 0-2742-5366-77 (12 Line) โทรสาร 0-2742-5378-9
Fax: 0-2742-5378-9
http://www.unitedpower.co.th / e-mail : upe@unitedpower.co.th

เล่มที่ 063

แผนกซ่อมและบริการ
SERVICE & REPAIR

เลขที่ 03143

ชื่อลูกค้า
Name of Customer.....
หน้างาน
Project.....
ชื่อช่าง
Name of Mechanic.....
วันที่ 1/11/88
Date.....
รายละเอียดงานที่ทำ
Service Performed.....
รวมเวลา
Total Hours.....

ติดตั้งกับเครื่อง
Mounted on Equipment.....
แบบ
Model.....
หมายเลข
Ser No.....
ชั่วโมงที่ใช้ไปแล้ว
Hours Operated.....
รายละเอียดงานที่ทำ
Service Performed.....
รวมเวลา
Total Hours.....

งานที่สำเร็จ
Work Completed.....
รายการอะไหล่หรือวัสดุที่เปลี่ยน
MATERIAL USE.....
1.....
2.....
3.....
4.....

ข้าพเจ้า/เรา ขอรับรองว่างานที่ติดตั้งแล้วเสร็จได้เป็นที่ยอมรับและเวลาที่ใช้นั้นถูกต้อง
I/We certify that the above job has been completed satisfactorily and that the time taken is correct.

ลายเซ็นเจ้าของเครื่องหรือผู้แทน (พร้อมตราประทับบริษัท)
Customer Signature of Owner or Representative (With Company Seal)
วันที่ 11/11/88
Date.....
Signature of Mechanic



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริง จำกัด
UNITED POWER ENGINEERING CO., LTD.
433/38 หมู่ 8 (สีชมพู, 38 หมู่ 8, สีชมพู, 38 หมู่ 8, สีชมพู, 38 หมู่ 8, สีชมพู) Bangkok 10260 Thailand Tel: (662) 7425378 Fax: (662) 7425379
4 ถนนสุขุมวิท (สีชมพู) ถนนสุขุมวิท แขวงคลองเตย เขตคลองเตย กรุงเทพฯ 10260 โทร (662) 7425378 (12 Line) โทรสาร (662) 7425379
<http://www.unitedpower.co.th> / e-mail : upec@unitedpower.co.th

LOW ZONE

MAINTENANCE SCHEDULES & RECORDS					
Customer Name and Address		Tech	Sales	Time	Job No.
OAKTREE COMPANY LIMITED.		PP, SR	KP	10:00 1-11-68	110-9026/10
		Project Name		Times No.	
		SO BANGKOK (VERANDA)		FP-01 (LOW ZONE)	

A. Normal Inspection					
Item	Description	Yes	No	Remark	ครั้งที่ 1/2
Pump F/P [Brand: AURORA, Model: 6-481-14H, SN: 10-1937360, Capacity: 1250 rpm, TDH: 160 PSI, ft. Speed: 3000 rpm]					
1	การตรวจสอบสภาพภายนอก อาทิ การรั่วซึมของน้ำมัน, ความผิดปกติของสายพาน, ความผิดปกติของสายพาน, ความผิดปกติของสายพาน	☒	☐	OK	OK
2	การตรวจสอบระดับน้ำมันและอุณหภูมิของน้ำมัน	☒	☐	OK	OK
3	การตรวจสอบการรั่วซึมของน้ำมันที่จุดต่างๆ	☒	☐	OK	OK
4	เสียงในการทำงานและการสั่นสะเทือน	☒	☐	OK	OK
5	ประสิทธิภาพของเครื่องสูบน้ำ ณ จุดทำงาน	☒	☐	OK	OK
6	ตรวจสอบ Shut-off head pressure	☒	☐	OK	OK
7	ตรวจสอบอุณหภูมิและแรงดันในระบบการไหล	☒	☐	OK	OK

ENGINE [Brand: CLARKE, Model: JUGH-UF54, SN: RE-008785546, A.C Power Supply: V/ DC Ph/ Hz, Speed 3000 rpm, Power 216 (KW/HP), Full load - A.]					
การตรวจสอบเครื่องสูบน้ำที่ขับเคลื่อนด้วยมอเตอร์ไฟฟ้า					
8	ตรวจสอบการระบายความร้อนของมอเตอร์	☒	☐	OK	OK
9	ตรวจสอบอุณหภูมิ ความดันและระดับน้ำมัน	☒	☐	OK	OK
10	ตรวจสอบการเชื่อมต่อ Coupling และการปรับระดับสายพาน	☒	☐	OK	OK
11	ตรวจสอบสายพานและสายพาน (ถ้ามีสายพาน)	☒	☐	OK	OK
12	ตรวจสอบแรงสั่นสะเทือน, รั่วซึมของน้ำมันและสายพาน	☒	☐	OK	OK
13	ตรวจสอบการเปลี่ยนแปลงของแรงดัน	☒	☐	OK	OK
14	การตรวจสอบเครื่องสูบน้ำที่ขับเคลื่อนด้วยมอเตอร์	☒	☐	OK	OK
15	ตรวจสอบการระบายความร้อนของมอเตอร์	☒	☐	OK	OK
16	ตรวจสอบอุณหภูมิ ความดันและระดับน้ำมัน	☒	☐	OK	OK
17	ตรวจสอบการเชื่อมต่อ Coupling และการปรับระดับสายพาน	☒	☐	OK	OK
18	ตรวจสอบสายพานและสายพาน (ถ้ามีสายพาน)	☒	☐	OK	OK
19	ตรวจสอบแรงสั่นสะเทือน, รั่วซึมของน้ำมันและสายพาน	☒	☐	OK	OK
20	ตรวจสอบการเปลี่ยนแปลงของแรงดัน	☒	☐	OK	OK
21	ตรวจสอบการระบายความร้อนของมอเตอร์	☒	☐	OK	OK
22	ตรวจสอบอุณหภูมิ ความดันและระดับน้ำมัน	☒	☐	OK	OK

Electric & Control [Brand: CUTLER HAMMER, Model: FDI20, SN: 16BK349D, Voltage Supply: V, Starter type, Cabinet type]					
23	ตรวจสอบการเชื่อมต่อของสายไฟ	☒	☐	OK	OK
24	ตรวจสอบการเชื่อมต่อของเทอร์มิสเตอร์	☒	☐	OK	OK
25	ตรวจสอบการตั้งค่าเวลา	☒	☐	OK	OK
26	ตรวจสอบการตั้งค่าเวลา	☒	☐	OK	OK
27	ตรวจสอบการตั้งค่าเวลา	☒	☐	OK	OK
28	ตรวจสอบการตั้งค่าเวลา	☒	☐	OK	OK

The Undersigned herewith declares that the job has been completed to entire satisfaction.

Inspector/Consultant



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริง จำกัด
UNITED POWER ENGINEERING CO., LTD.
433/38 หมู่ 8 (สีชมพู, 38 หมู่ 8, สีชมพู, 38 หมู่ 8, สีชมพู, 38 หมู่ 8, สีชมพู) Bangkok 10260 Thailand Tel: (662) 7425378 Fax: (662) 7425379
4 ถนนสุขุมวิท (สีชมพู) ถนนสุขุมวิท แขวงคลองเตย เขตคลองเตย กรุงเทพฯ 10260 โทร (662) 7425378 (12 Line) โทรสาร (662) 7425379
<http://www.unitedpower.co.th> / e-mail : upec@unitedpower.co.th

MAINTENANCE SCHEDULES & RECORDS					
Customer Name and Address		Tech	Sales	Time	Job No.
OAKTREE COMPANY LIMITED.		PP, SR	KP	10:00 1/11/68	110-9026/10
		Project Name		Times No.	
		SO BANGKOK (VERANDA)		FP-01 (LOW ZONE)	

Other					
Item	Description	Yes	No	Remark	ครั้งที่ 1/2
29	ตรวจสอบและปรับระดับของเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำแบบ Relif Valve), ส่วนประกอบ และอื่นๆ	☒	☐	OK	OK
30	ปรับระดับโปรแกรมหุ่นยนต์ (ในกรณีของเครื่องสูบน้ำแบบ Relif Valve)	☒	☐	OK	OK
31	ตรวจสอบระบบการเดินเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำแบบ Relif Valve)	☒	☐	OK	OK
32	ตรวจสอบการทำงานของระบบการเดินเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำแบบ Relif Valve)	☒	☐	OK	OK

Brkt 1 = 14.0V, 4.4A
Brkt 2 = 14.4V, 3.5A

B. Half Year Service Inspection

Item	Description	Yes	No	Remark
Driver [ENGINE]				
A.C Power Supply: V/ DC Ph/ Hz, Speed rpm, Power (KW/HP), Full load - A.]				
ในกรณีของเครื่องสูบน้ำที่ขับเคลื่อนด้วยมอเตอร์				
33	ตรวจสอบความดันของ Motor Stator	☒	☐	OK
ในกรณีของเครื่องสูบน้ำที่ขับเคลื่อนด้วยมอเตอร์				
34	ตรวจสอบระบบการเดินเครื่องสูบน้ำ	☒	☐	OK
35	ตรวจสอบการทำงานของระบบการเดินเครื่องสูบน้ำ	☒	☐	OK

The Undersigned herewith declares that the job has been completed to entire satisfaction.

Inspector/Consultant



บริษัท ยูนิเพอร์ เอ็นจิเนียริ่ง จำกัด
UNITED POWER ENGINEERING CO., LTD.
4 ซอยสุเทพวิทย์ 81 (สุเทพ) ถนนสุเทพเชียงใหม่ 50200 โทร. 0-2742-5366-77 (12 Lines) โทรสาร 0-2742-5378-9
http://www.unitedpower.co.th / e-mail : upc@unitedpower.co.th

MAINTENANCE & RECORDS					
Customer Name and Address		Tech	Sales	Time	Job No.
OAKTREE COMPANY LIMITED.		PP37.8	KP	10:00 11/11/68	110-9026/10
		Project Name		Times No.	
		SO BANGKOK (VERANDA)		FP-02 (HI ZONE)	

C. Annual Service Inspection

Item	Description	Yes	No	Remark
Pump F/P				
[Brand: AURORA , Model: 6-485-16B , S/N: 10-1937365 Capacity : 1000 gpm., TDH : 265 PSI ft. Speed : 2100 rpm.]				
36	ตรวจสอบการทำงานของปั๊ม	☒	☐	
37	ตรวจสอบและปรับตั้งการ Alignment ของเครื่องสูบน้ำและถังดูดน้ำ	☒	☐	
ENGINE				
[Brand: CLARKE , Model: JW6H-UF50 , S/N: RG6081H189406 A.C Power Supply : V/ DC PW Hz, Speed 2100 rpm., Power 340 (KW/HP), Full load - A.]				
ในการตรวจสอบเครื่องสูบน้ำให้ดูส่วนประกอบ				
38	เปลี่ยนน้ำมันเครื่องและไส้กรอง	☒	☐	ดูค่าความดัน
39	เปลี่ยนไส้กรองเชื้อเพลิง	☒	☐	16/11/68
40	เปลี่ยนไส้กรองหล่อเย็นและตรวจสอบน้ำมันหล่อเย็น	☒	☐	
41	เปลี่ยนไส้กรองอากาศ	☒	☐	
42	ตรวจสอบการตั้งค่าสำหรับโหลดสตาร์ท	☒	☐	
43	ตรวจสอบระบบท่อลมทั้งหมด	☒	☐	
44	ตรวจสอบอุปกรณ์ควบคุมในระบบไฟฟ้าทั้งหมด	☒	☐	

Pump		Driver	
Brand : AURORA	Brand :		
Model : PVM8-180	Model :		
S/N :	S/N :		

JOCKEY PUMP TEST RECORD					
A.C. Power Supply	380	V/	3	Ph/	50 Hz
RPM	2100 rpm L1-L2 = 394.5V				
Size	Hp L2-L3 = 396.6V				
Full load	Amp. L3-L4 = 396.6V				
Driver	Type of Mounting	☒ Vertical Mount	☐ Horizontal Mount		
	Starting Type	☐ D.O.L.	☒ Star-Delta		
	Inboard Ball Bearing	☒ O.K.	☐ Not O.K.		
	Outboard Ball Bearing	☒ O.K.	☐ Not O.K.		
	Current Consumption	L1	Amp. 16.11.0	Amp. 13.10.9	Amp.

The Undersigned herewith declares that the job has been completed to entire satisfaction.

Inspector/Consultant



บริษัท ยูนิเพอร์ เอ็นจิเนียริ่ง จำกัด
UNITED POWER ENGINEERING CO., LTD.
4 ซอยสุเทพวิทย์ 81 (สุเทพ) ถนนสุเทพเชียงใหม่ 50200 โทร. 0-2742-5366-77 (12 Lines) โทรสาร 0-2742-5378-9
http://www.unitedpower.co.th / e-mail : upc@unitedpower.co.th

แผนกซ่อม และบริการ SERVICE & REPAIR

เลขที่ 063

เลขที่ 03142

ชื่อลูกค้า..... ติดตั้งกับเครื่อง Mounted on Equipment.....
หน่วยงาน..... Model.....
Project..... หมายเลข Ser No.....
ชื่อช่าง..... ชั่วโมงที่ปฏิบัติงาน Hours Operated.....

Name of Customer..... เวลาเลิก Time Finished.....
วันที่ 1/11/68 เวลาเริ่ม Time Started.....
Date..... รวมเวลา Total Hours.....

รายละเอียดงานที่ทำ Service Performed.....
1. ตรวจสอบการทำงานของปั๊มสูบน้ำและถังดูดน้ำ

2. ตรวจสอบและปรับตั้งการ Alignment ของเครื่องสูบน้ำและถังดูดน้ำ

3. เปลี่ยนไส้กรองเชื้อเพลิง

4. เปลี่ยนไส้กรองหล่อเย็นและตรวจสอบน้ำมันหล่อเย็น

5. เปลี่ยนไส้กรองอากาศ

6. ตรวจสอบการตั้งค่าสำหรับโหลดสตาร์ท

7. ตรวจสอบระบบท่อลมทั้งหมด

8. ตรวจสอบอุปกรณ์ควบคุมในระบบไฟฟ้าทั้งหมด

งานที่ทำเสร็จ Work Completed.....
ไม่ ☐ ใช่ ☒ ไม่ ☐ ใช่ ☒
การรับประกัน Warranty.....
ไม่ ☐ ใช่ ☒ ไม่ ☐ ใช่ ☒

รายการอะไหล่หรือวัสดุที่ใช้เปลี่ยน MATERIAL USE.....
1.....
2.....
3.....
4.....

ข้าพเจ้า/เรา ขอรับรองว่างานที่ทำดังกล่าวแล้วข้างต้นได้เสร็จเรียบร้อยเป็นต้นไป และเวลาที่ใช้นั้นงานดังกล่าวถูกต้อง
I/We certify that the above job has been completed satisfactorily and that the time taken is correct.

ลายเซ็นเจ้าของเครื่องหรือผู้แทน (พร้อมตราประทับบริษัท)
Customer Signature of Owner or Representative (With Company Seal)

วันที่ 01/11/68
Date.....



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริง จำกัด
UNITED POWER ENGINEERING CO., LTD.
43 ซ.สุขุมวิท 81 (สุขุมวิท, สุขุมวิท 81, Bangkok, Thailand) Tel: (662) 7425378, 7425379
4 ซอยสุขุมวิท 81 (สุขุมวิท, สุขุมวิท 81, Bangkok, Thailand) Tel: (662) 7425378, 7425379
http://www.unitedpower.co.th / e-mail : upe@unitedpower.co.th

MAINTENANCE SCHEDULES & RECORDS					
Customer Name and Address		Tech	Sales	Time	Job No.
OAKTREE COMPANY LIMITED.		PPJ, SR	KP	1000 11/11/18	110-9026/10
		Project Name		Times No.	
		SO BANGKOK (VERANDA)		FP-02 (HI ZONE)	

A. Normal Inspection

Item	Description	Yes	No	Remark
Pump F/P				
[Brand: AURORA , Model: 6-485-16B , S/N: 10-1937365 Capacity: 1000 gpm., TDR: 265 PSI ft. Speed: 2100 rpm.]				
1	การตรวจสอบทางกายภาพ อาทิ การระบายอากาศในห้อง , ความผิดปกติของเครื่องสูบน้ำ	☒	☐	OK
2	การตรวจสอบระดับน้ำและระดับของเครื่องสูบน้ำ	☒	☐	OK
3	ตรวจสอบการรั่วซึมของเครื่องสูบน้ำ หรือท่อส่งน้ำ	☒	☐	OK
4	เงื่อนไขการสูบน้ำและการระบายน้ำทั้งหมด	☒	☐	OK
5	ประสิทธิภาพของเครื่องสูบน้ำ ณ จุดทำงาน	☒	☐	OK
6	ตรวจสอบ Shut-off head pressure	☒	☐	OK
7	ตรวจสอบการสั่นสะเทือนและระดับการสั่น	☒	☐	OK
ENGINE				
[Brand: CLARKE , Model: JWG6-UF50 , S/N: RG6081H189406 A.C Power Supply : V/ DC PW Hz, Speed 2100 rpm., Power 340 (KW/HP), Full load - A.]				

8	ตรวจสอบการระบายอากาศของมอเตอร์	☒	☐	
9	ตรวจสอบระดับน้ำ, ความชื้นและอุณหภูมิของเครื่องสูบน้ำ	☒	☐	
10	ตรวจสอบระดับน้ำ Coupling และการปนเปื้อนของน้ำมัน	☒	☐	
11	ตรวจสอบสภาพความดันและระดับน้ำ (ถ้ามีระบบความดัน)	☒	☐	
12	ตรวจสอบระดับน้ำ, รั่วซึมที่ท่อส่งน้ำหรือท่อรับน้ำ	☒	☐	
13	ตรวจสอบระดับน้ำของเครื่องสูบน้ำ	☒	☐	
14	ตรวจสอบการสั่นสะเทือนและระดับการสั่น	☒	☐	
15	ตรวจสอบการระบายความร้อนของเครื่องสูบน้ำ	☒	☐	
16	ตรวจสอบระดับน้ำของเครื่องสูบน้ำ	☒	☐	
17	ตรวจสอบระดับน้ำของเครื่องสูบน้ำ	☒	☐	
18	ตรวจสอบสภาพความดันและระดับน้ำ (ถ้ามีระบบความดัน)	☒	☐	
19	ตรวจสอบการรั่วซึมของเครื่องสูบน้ำ	☒	☐	
20	ตรวจสอบการสั่นสะเทือนและระดับการสั่น	☒	☐	
21	ตรวจสอบการสั่นสะเทือนและระดับการสั่น	☒	☐	
22	ตรวจสอบการสั่นสะเทือนและระดับการสั่น	☒	☐	

Electric & Control				
[Brand: CUTLER HAMMER , Model: FDI20 , S/N: 16BK358D Voltage Supply : V, Starter type , Cabinet type]				
23	ตรวจสอบระดับน้ำของไฟฟ้าแรงดันสูง	☒	☐	
24	ตรวจสอบการเชื่อมต่อของมอเตอร์	☒	☐	
25	ตรวจสอบการเชื่อมต่อของมอเตอร์	☒	☐	
26	ตรวจสอบการเชื่อมต่อของมอเตอร์	☒	☐	
27	ตรวจสอบการเชื่อมต่อของมอเตอร์	☒	☐	
28	ตรวจสอบการเชื่อมต่อของมอเตอร์	☒	☐	

The Undersigned herewith declares that the job has been completed to entire satisfaction.

Inspector/Consultant

Customer/Company Stamp

Technician

Customer/Company Stamp

Technician

Inspector/Consultant



บริษัท ยูไนเต็ด เพาเวอร์ เอ็นจิเนียริง จำกัด
UNITED POWER ENGINEERING CO., LTD.
43 ซ.สุขุมวิท 81 (สุขุมวิท, สุขุมวิท 81, Bangkok, Thailand) Tel: (662) 7425378, 7425379
4 ซอยสุขุมวิท 81 (สุขุมวิท, สุขุมวิท 81, Bangkok, Thailand) Tel: (662) 7425378, 7425379
http://www.unitedpower.co.th / e-mail : upe@unitedpower.co.th

MAINTENANCE SCHEDULES & RECORDS

Customer Name and Address		Tech	Sales	Time	Job No.
OAKTREE COMPANY LIMITED.		PPJ, SR	KP	10:00 11/11/18	110-9026/10
		Project Name		Times No.	
		SO BANGKOK (VERANDA)		FP-02 (HI ZONE)	

Other	ครั้งที่ 1/2				
29	ตรวจสอบและปรับระดับของเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำอัตโนมัติ) อาทิ รีลิววาล์ว (Relief Valve) , ตัวพัดใบพัด และอื่นๆ	☒	☐		Auto
30	ปรับระดับใบพัดของเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำอัตโนมัติ)	☒	☐		= 230 PSI
31	ตรวจสอบการรั่วซึมของเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำอัตโนมัติ)	☒	☐		
32	ตรวจสอบการรั่วซึมของเครื่องสูบน้ำ (ในกรณีของเครื่องสูบน้ำอัตโนมัติ)	☒	☐		PSI = 41.5 V

B. Half Year Service Inspection

Item	Description	Yes	No	Remark
Driver				
[Brand: , Model: , S/N: , A.C Power Supply : V/ DC PW Hz, Speed rpm., Power (KW/HP), Full load - A.]				
ในกรณีของเครื่องสูบน้ำที่ขับเคลื่อนด้วยมอเตอร์				
33	ตรวจสอบความดันของ Motor Stator	☒	☐	
ในกรณีของเครื่องสูบน้ำที่ขับเคลื่อนด้วยเครื่องยนต์				
34	ตรวจสอบความดันของเครื่องยนต์	☒	☐	
35	ตรวจสอบการรั่วซึมของเครื่องยนต์	☒	☐	

The Undersigned herewith declares that the job has been completed to entire satisfaction.

F22-03	Electric room			1		✓	
Floor 21st							
F21-01	Inside fire hose cabinet FHC 21-01	1				✓	
F21-02	Inside fire hose cabinet FHC 21-02	1				✓	
F21-03	Electric room			1		✓	
Floor 20th							
F20-01	Inside fire hose cabinet FHC 20-01			1		✓	
F20-02	Inside fire hose cabinet FHC 20-02	1				✓	
F20-03	Electric room			1		✓	
Floor 19th							
F19-01	Inside fire hose cabinet FHC 19-01	1				✓	
F19-02	Inside fire hose cabinet FHC 19-02	1				✓	
F19-03	Electric room			1		✓	
Floor 18th							
F18-01	Inside fire hose cabinet FHC 18-01	1				✓	
F18-02	Inside fire hose cabinet FHC 18-02	1				✓	
F18-03	Electric room			1		✓	
Floor 17th							
F17-01	Inside fire hose cabinet FHC 17-01	1				✓	
F17-02	Inside fire hose cabinet FHC 17-02	1				✓	
F17-03	Electric room			1		✓	
Floor 16th							
F16-01	Inside fire hose cabinet FHC 16-01	1				✓	
F16-02	Inside fire hose cabinet FHC 16-02	1				✓	
F16-03	Electric room			1		✓	
Floor 15th							
F15-01	Inside fire hose cabinet FHC 15-01	1				✓	
F15-02	Inside fire hose cabinet FHC 15-02	1				✓	
F15-03	Electric room			1		✓	
Floor 14th							
F14-01	Inside fire hose cabinet FHC 14-01	1				✓	
F14-02	Inside fire hose cabinet FHC 14-02	1				✓	
F14-03	Electric room			1		✓	
Floor 11st (Sps)							
F11-01	Inside fire hose cabinet FHC11 M	1				✓	
F11-02	Inside fire hose cabinet FHC 11-01			1		✓	
F11-03	Inside fire hose cabinet FHC 11-02			1		✓	
F11-04	In Front of Gann Muntha room			1		✓	
Floor 10th (So FT)							
F10-01	Inside fire hose cabinet FHC 10-01			1		✓	
F10-02	Inside fire hose cabinet FHC 10-02			1		✓	
F10-03	In Lift Control room Low zone			1		✓	
F10-04	Electric room			1		✓	
F10-05	In Front of Gann Pump room(Pool)			1		✓	
F10-06	Water Club			1		✓	
Floor 09th							
F09-01	Inside fire hose cabinet FHC 09-01			1		✓	
F09-02	Inside fire hose cabinet FHC 09-02			1		✓	
F09-03	In Front of behind the counter			1		✓	

Code	Location	Type of Fire Extinguisher				Status		Remarks
		Dry Chemical	Halotron	Co2	Wet Chemical	Fire Blanket		
Roof Top Floor								
F30-01	In Lift Control room L9 L10			1			✓	
F30-02	Inside fire hose cabinet FHC 30-01			1			✓	
F30-03	Inside fire hose cabinet FHC 30-02			1			✓	
F30-04	Roof Top Floor (The Cassette bar)			1			✓	
F30-05	In Lift Control room high zone			2			✓	
Floor 29th								
F29-01	Inside fire hose cabinet FHC 29-01			1			✓	
F29-02	Inside fire hose cabinet FHC 29-02			1			✓	
F29-03	Inside water pump room	1					✓	
Floor 28th								
F28-01	Inside fire hose cabinet FHC 28-01	1					✓	
F28-02	Inside fire hose cabinet FHC 28-02	1					✓	
F28-03	Electric room			1			✓	
Floor 27th								
F27-01	Inside fire hose cabinet FHC 27-01	1					✓	
F27-02	Inside fire hose cabinet FHC 27-02	1					✓	
F27-03	Electric room			1			✓	
Floor 26th								
F26-01	Inside fire hose cabinet FHC 26-01	1					✓	
F26-02	Inside fire hose cabinet FHC 26-02	1					✓	
F26-03	Electric room			1			✓	
Floor 25th(Club Signature)								
F25-01	Inside fire hose cabinet FHC 25-01	1					✓	
F25-02	Inside fire hose cabinet FHC 25-02	1					✓	
F25-03	Electric room			1			✓	
F25-04	Club Signature Kitchen			1			✓	
Floor 24th								
F24-01	Inside fire hose cabinet FHC 24-01	1					✓	
F24-02	Inside fire hose cabinet FHC 24-02	1					✓	
F24-03	Electric room			1			✓	
Floor 23rd								
F23-01	Inside fire hose cabinet FHC 23-01	1					✓	
F23-02	Inside fire hose cabinet FHC 23-02	1					✓	
F23-03	Electric room			1			✓	
Floor 22nd								
F22-01	Inside fire hose cabinet FHC 22-01	1					✓	
F22-02	Inside fire hose cabinet FHC 22-02	1					✓	

B01-02	Inside fire hose cabinet FHC B1-Q2	1					✓		
B01-03	Inside fire hose cabinet FHC B1-Q3	1					✓		
B01-04	Inside fire hose cabinet FHC B1-Q4	1					✓		
B01-05	In Front of SO Safe room		3				✓		
B01-06	Canteen Kitchen			1			✓		
	Basement 02								
B02-01	Inside fire hose cabinet FHC B2-Q1	1					✓		
	Total	73	0	74	4	6	Grand Total	157	

Dry Chemical	Total = 73 60
Halotron	Total = 0 60
CO2	Total = 74 60
Wet Chemical	Total = 4 60
Fire Blanket	Total = 6 60
Damage	0

Checked By: .SO.....

Security Officer / Supervisor

Acknowledged By:

Security Manager/Asst. Security Manager

Floor 08th (Ballroom)									
F08-01	Inside fire hose cabinet FHC 08-01			1					✓
F08-02	Inside fire hose cabinet FHC 08-02				1				✓
F08-03	Inside fire hose cabinet FHC 08-03					1			✓
F08-04	In the Ballroom					2			✓
F08-05	In the Kitchen Bakery.						1	1	✓
F08-06	BQ Kitchen								✓
Floor 07th (Redoven/SOSH)									
F07-01	Inside fire hose cabinet FHC 07-01				1				✓
F07-02	Inside fire hose cabinet FHC 07-02			1					✓
F07-03	Inside fire hose cabinet FHC 07-03					1			✓
F07-04	Redoven Reception					1			✓
F07-05	Main Kitchen						1	1	✓
F07-06	Front of Social Room2						1		✓
F07-07	Japanese Kitchen						1	1	✓
F07-08	Redoven Turnless			1					✓
Floor 06th									
F06-01	Inside fire hose cabinet FHC 06-01			1					✓
F06-02	Inside fire hose cabinet FHC 06-02				1				✓
F06-03	Inside fire hose cabinet FHC 06-03					1			✓
F06-04	Laundry Room						1		✓
F06-05	In Front of Server room						1		✓
F06-06	Generator room						1		✓
F06-07	MOD room						1		✓
F06-08	Chiller room						1		✓
F06-09	Transformer room							1	✓
Floor 05th (Car park)									
F05-01	Inside fire hose cabinet FHC 05-01			1					✓
F05-02	Inside fire hose cabinet FHC 05-02				1				✓
F05-03	Inside fire hose cabinet FHC 05-03					1			✓
F05-04	Additional extinguishers			3					✓
Floor 04th (Car park)									
F04-01	Inside fire hose cabinet FHC 04-01				1				✓
F04-02	Inside fire hose cabinet FHC 04-02					1			✓
F04-03	Inside fire hose cabinet FHC 04-03						1		✓
F04-04	Additional extinguishers					3			✓
Floor 03rd (Car park)									
F03-01	Inside fire hose cabinet FHC 03-01				1				✓
F03-02	Inside fire hose cabinet FHC 03-02					1			✓
F03-03	Inside fire hose cabinet FHC 03-03						1		✓
F03-04	Additional extinguishers					3			✓
Floor 02nd (Car park)									
F02-01	Inside fire hose cabinet FHC 02-01				1				✓
F02-02	Inside fire hose cabinet FHC 02-02					1			✓
F02-03	Inside fire hose cabinet FHC 02-03						1		✓
F02-04	Additional extinguishers						2		✓
Floor G									
G01-01	Inside fire hose cabinet FHC G-01				1				✓
G01-02	Inside fire hose cabinet FHC G-02					1			✓
G01-03	In Front of KOF						1		✓
G01-04	Beside Concierge							1	✓
G01-05	In Front of Store PA						1		✓
G01-06	GAS Room								✓
G01-07	In Fire cart							5	✓
	Basement 01								
B01-01	Inside fire hose cabinet FHC B1-Q1				1				✓

Code	Location	Type of Fire Extinguisher					Status		Remarks
		Dry Chemical	Halotron	CO ₂	Wet Chemical	Fire Blanket	Good	Poor	
Floor Top floor									
F30-01	In Lift Control room U9 L10			1			✓		
F30-02	Inside fire hose cabinet FHC10-01			1			✓		
F30-03	Inside fire hose cabinet FHC13-02			1			✓		
F30-04	Rooftop Floor (The Cassette bar)			1			✓		
F30-05	In Lift Control room high zone			2			✓		
Floor 28th									
F28-01	Inside fire hose cabinet FHC29-01			1			✓		
F28-02	Inside fire hose cabinet FHC29-02			1			✓		
F28-03	Inside water pump room	1					✓		
Floor 28th									
F28-01	Inside fire hose cabinet FHC28-01	1					✓		
F28-02	Inside fire hose cabinet FHC28-02	1					✓		
F28-03	Electric room			1			✓		
Floor 27th									
F27-01	Inside fire hose cabinet FHC27-01	1					✓		
F27-02	Inside fire hose cabinet FHC27-02	1					✓		
F27-03	Electric room			1			✓		
Floor 26th									
F26-01	Inside fire hose cabinet FHC26-01	1					✓		
F26-02	Inside fire hose cabinet FHC26-02	1					✓		
F26-03	Electric room			1			✓		
Floor 25th(Club Signature)									
F25-01	Inside fire hose cabinet FHC25-01	1					✓		
F25-02	Inside fire hose cabinet FHC25-02	1					✓		
F25-03	Electric room			1			✓		
F25-04	Club Signature Kitchen			1			✓		
Floor 24th									
F24-01	Inside fire hose cabinet FHC24-01	1					✓		
F24-02	Inside fire hose cabinet FHC24-02	1					✓		
F24-03	Electric room			1			✓		
Floor 23rd									
F23-01	Inside fire hose cabinet FHC23-01	1					✓		
F23-02	Inside fire hose cabinet FHC23-02	1					✓		
F23-03	Electric room			1			✓		
Floor 22nd									
F22-01	Inside fire hose cabinet FHC22-01	1					✓		
F22-02	Inside fire hose cabinet FHC22-02	1					✓		
F22-03	Electric room			1			✓		
Floor 21st									
F21-01	Inside fire hose cabinet FHC21-01	1					✓		
F21-02	Inside fire hose cabinet FHC21-02	1					✓		
F21-03	Electric room			1			✓		
Floor 20th									
F20-01	Inside fire hose cabinet FHC20-01			1			✓		
F20-02	Inside fire hose cabinet FHC20-02	1					✓		
F20-03	Electric room			1			✓		
Floor 19th									
F19-01	Inside fire hose cabinet FHC19-01	1					✓		
F19-02	Inside fire hose cabinet FHC19-02	1					✓		
F19-03	Electric room			1			✓		
Floor 18th									

Month September 2025 : FHC & Fire Extinguisher Inspection Report

Code	Location	Type of Fire Extinguisher					Status		Remarks
		Dry Chemical	Helidon	Co2	Wet Chemical	Fire Blanket	Good	Poor	
Roof Top Floor									
F30-01	In Lift Control room 19 L10			1			✓		
F30-02	Inside fire hose cabinet FHC 30-01			1			✓		
F30-03	Inside fire hose cabinet FHC 30-02			1			✓		
F30-04	Roof Top Floor (The Cassette bar)			1			✓		
F30-05	In Lift Control room high zone			2			✓		
Floor 28th									
F29-01	Inside fire hose cabinet FHC 29-01			1			✓		
F29-02	Inside fire hose cabinet FHC 29-02			1			✓		
F29-03	Inside water pump room	1					✓		
Floor 28th									
F28-01	Inside fire hose cabinet FHC 28-01	1					✓		
F28-02	Inside fire hose cabinet FHC 28-02	1					✓		
F28-03	Electric room			1			✓		
Floor 27th									
F27-01	Inside fire hose cabinet FHC 27-01	1					✓		
F27-02	Inside fire hose cabinet FHC 27-02	1					✓		
F27-03	Electric room			1			✓		
Floor 26th									
F26-01	Inside fire hose cabinet FHC 26-01	1					✓		
F26-02	Inside fire hose cabinet FHC 26-02	1					✓		
F26-03	Electric room			1			✓		
Floor 25th(Club Signature)									
F25-01	Inside fire hose cabinet FHC 25-01	1					✓		
F25-02	Inside fire hose cabinet FHC 25-02	1					✓		
F25-03	Electric room			1			✓		
F25-04	Club Signature Kitchen			1			✓		
Floor 24th									
F24-01	Inside fire hose cabinet FHC 24-01	1					✓		
F24-02	Inside fire hose cabinet FHC 24-02	1					✓		
F24-03	Electric room			1			✓		
Floor 23rd									
F23-01	Inside fire hose cabinet FHC 23-01	1					✓		
F23-02	Inside fire hose cabinet FHC 23-02	1					✓		
F23-03	Electric room			1			✓		
Floor 22nd									
F22-01	Inside fire hose cabinet FHC 22-01	1					✓		
F22-02	Inside fire hose cabinet FHC 22-02	1					✓		
F22-03	Electric room			1			✓		
Floor 21st									
F21-01	Inside fire hose cabinet FHC 21-01	1					✓		
F21-02	Inside fire hose cabinet FHC 21-02	1					✓		
F21-03	Electric room			1			✓		
Floor 20th									
F20-01	Inside fire hose cabinet FHC 20-01			1			✓		
F20-02	Inside fire hose cabinet FHC 20-02	1					✓		
F20-03	Electric room			1			✓		
Floor 19th									
F19-01	Inside fire hose cabinet FHC 19-01	1					✓		
F19-02	Inside fire hose cabinet FHC 19-02	1					✓		
F19-03	Electric room			1			✓		
Floor 18th									

F04-01	Inside fire hose cabinet FHC 04-01	1					✓
F04-02	Inside fire hose cabinet FHC 04-02	1					✓
F04-03	Inside fire hose cabinet FHC 04-03	1					✓
F04-04	Additional extinguishers	3					✓
Floor 03rd (Car park)							
F03-01	Inside fire hose cabinet FHC 03-01	1					✓
F03-02	Inside fire hose cabinet FHC 03-02	1					✓
F03-03	Inside fire hose cabinet FHC 03-03	1					✓
F03-04	Additional extinguishers	3					✓
Floor 02nd (Car park)							
F02-01	Inside fire hose cabinet FHC 02-01	1					✓
F02-02	Inside fire hose cabinet FHC 02-02	1					✓
F02-03	Inside fire hose cabinet FHC 02-03	1					✓
F02-04	Additional extinguishers	2					✓
Floor 01							
G01-01	Inside fire hose cabinet FHC G-01	1					✓
G01-02	Inside fire hose cabinet FHC G-02	1					✓
G01-03	In front of KOP		1				✓
G01-04	Beside Congeorge		1				✓
G01-05	In front of store PA	1					✓
G01-06	G&E Room						✓
G01-07	In fire cart	5	1		4		✓
Basement 01							
B01-01	Inside fire hose cabinet FHC B1-01	1					✓
B01-02	Inside fire hose cabinet FHC B1-02	1					✓
B01-03	Inside fire hose cabinet FHC B1-03	1					✓
B01-04	Inside fire hose cabinet FHC B1-04	1					✓
B01-05	In front of SO safe room		3		1		✓
B01-06	Canteen Kitchen						✓
Basement 02							
B02-01	Inside fire hose cabinet FHC B2-01	1					✓
Total		73	0	74	4	6	Grand Total 157
Total = 71260							
Total = 6460							
Total = 72460							
Total = 4460							
Total = 6 du							
0							

Checked By:
Security Officer / Supervisor

Acknowledged By:
Security Manager/Ast. Security Manager

Dry Chemical	Halotron	Total = 72.6
		Total = 0 f6
	Co2	Total = 74.6 f6
	Wet Chemical	Total = 4 f6
	Fire Blanket	Total = 6 du
	Damage	0

Security Manager/Asst. Security Manager

Code	Location	Type of Fire Extinguisher				Status	Remarks
		Dry Chemical	Halon	Co2	Wet Chemical		
						Good	Poor
	Floor Top Floor						
F30-01	In Lift Control room L9 L10			1		✓	
F30-02	Inside fire hose cabinet FHC30-01			1		✓	
F30-03	Inside fire hose cabinet FHC30-02			1		✓	
F30-04	Floor Top Floor (The Cassette bar)			1		✓	
F30-05	In Lift Control room high zone			2		✓	
	Floor 25th						
F29-01	Inside fire hose cabinet FHC29-01			1		✓	
F29-02	Inside fire hose cabinet FHC29-02			1		✓	
F29-03	Inside water pump room	1				✓	
	Floor 28th						
F28-01	Inside fire hose cabinet FHC28-01	1				✓	
F28-02	Inside fire hose cabinet FHC28-02	1				✓	
F28-03	Electric room			1		✓	
	Floor 27th						
F27-01	Inside fire hose cabinet FHC27-01	1				✓	
F27-02	Inside fire hose cabinet FHC27-02	1				✓	
F27-03	Electric room			1		✓	
	Floor 26th						
F26-01	Inside fire hose cabinet FHC26-01	1				✓	
F26-02	Inside fire hose cabinet FHC26-02	1				✓	
F26-03	Electric room			1		✓	
	Floor 25th (Club Signature)						
F25-01	Inside fire hose cabinet FHC25-01	1				✓	
F25-02	Inside fire hose cabinet FHC25-02	1				✓	
F25-03	Electric room			1		✓	
F25-04	Club Signature Kitchen			1		✓	
	Floor 24th						
F24-01	Inside fire hose cabinet FHC24-01	1				✓	
F24-02	Inside fire hose cabinet FHC24-02	1				✓	
F24-03	Electric room			1		✓	
	Floor 23rd						
F23-01	Inside fire hose cabinet FHC23-01	1				✓	
F23-02	Inside fire hose cabinet FHC23-02	1				✓	
F23-03	Electric room			1		✓	
	Floor 22nd						
F22-01	Inside fire hose cabinet FHC22-01	1				✓	
F22-02	Inside fire hose cabinet FHC22-02	1				✓	
F22-03	Electric room			1		✓	
	Floor 21st						
F21-01	Inside fire hose cabinet FHC21-01	1				✓	
F21-02	Inside fire hose cabinet FHC21-02	1				✓	
F21-03	Electric room			1		✓	
	Floor 20th						
F20-01	Inside fire hose cabinet FHC20-01			1		✓	
F20-02	Inside fire hose cabinet FHC20-02	1				✓	
F20-03	Electric room			1		✓	
	Floor 19th						
F19-01	Inside fire hose cabinet FHC19-01	1				✓	
F19-02	Inside fire hose cabinet FHC19-02	1				✓	
F19-03	Electric room			1		✓	
	Floor 18th						

Month November 2025 : FHC & Fire Extinguisher Inspection Report

Code	Location	Type of Fire Extinguisher				Status		Remarks
		Dry Chemical	Helidran	Co2	Wet Chemical	Fire Blanket	Good	
Roof Top Floor								
F30-01	In Lift Control room 19 L10			1			✓	
F30-02	Inside fire hose cabinet FHC30-01			1			✓	
F30-03	Inside fire hose cabinet FHC30-02			1			✓	
F30-04	Roof Top Floor			1			✓	
F30-05	In Lift Control room high zone			2			✓	
Floor 29th								
F29-01	Inside fire hose cabinet FHC29-01			1			✓	
F29-02	Inside fire hose cabinet FHC29-02			1			✓	
F29-03	Inside water pump room	1					✓	
Floor 28th								
F28-01	Inside fire hose cabinet FHC28-01			1			✓	
F28-02	Inside fire hose cabinet FHC28-02			1			✓	
F28-03	Electric room			1			✓	
Floor 27th								
F27-01	Inside fire hose cabinet FHC27-01			1			✓	
F27-02	Inside fire hose cabinet FHC27-02			1			✓	
F27-03	Electric room			1			✓	
Floor 26th								
F26-01	Inside fire hose cabinet FHC26-01			1			✓	
F26-02	Inside fire hose cabinet FHC26-02			1			✓	
F26-03	Electric room			1			✓	
Floor 25th(Club Signature)								
F25-01	Inside fire hose cabinet FHC25-01			1			✓	
F25-02	Inside fire hose cabinet FHC25-02			1			✓	
F25-03	Electric room			1			✓	
F25-04	Club Signature Kitchen			1			✓	
Floor 24th								
F24-01	Inside fire hose cabinet FHC24-01			1			✓	
F24-02	Inside fire hose cabinet FHC24-02			1			✓	
F24-03	Electric room			1			✓	
Floor 23rd								
F23-01	Inside fire hose cabinet FHC23-01			1			✓	
F23-02	Inside fire hose cabinet FHC23-02			1			✓	
F23-03	Electric room			1			✓	
Floor 22nd								
F22-01	Inside fire hose cabinet FHC22-01			1			✓	
F22-02	Inside fire hose cabinet FHC22-02			1			✓	
F22-03	Electric room			1			✓	
Floor 21st								
F21-01	Inside fire hose cabinet FHC21-01			1			✓	
F21-02	Inside fire hose cabinet FHC21-02			1			✓	
F21-03	Electric room			1			✓	
Floor 20th								
F20-01	Inside fire hose cabinet FHC20-01			1			✓	
F20-02	Inside fire hose cabinet FHC20-02			1			✓	
F20-03	Electric room			1			✓	
Floor 19th								
F19-01	Inside fire hose cabinet FHC19-01			1			✓	
F19-02	Inside fire hose cabinet FHC19-02			1			✓	
F19-03	Electric room			1			✓	
Floor 18th								

F04-01	Inside fire hose cabinet FHC 04-01	1					✓
F04-02	Inside fire hose cabinet FHC 04-02	1					✓
F04-03	Inside fire hose cabinet FHC 04-03	1					✓
F04-04	Additional extinguishers	3					✓
Floor 03rd (Car park)							
F03-01	Inside fire hose cabinet FHC 03-01	1					✓
F03-02	Inside fire hose cabinet FHC 03-02	1					✓
F03-03	Inside fire hose cabinet FHC 03-03	1					✓
F03-04	Additional extinguishers	3					✓
Floor 02nd (Car park)							
F02-01	Inside fire hose cabinet FHC 02-01	1					✓
F02-02	Inside fire hose cabinet FHC 02-02	1					✓
F02-03	Inside fire hose cabinet FHC 02-03	1					✓
F02-04	Additional extinguishers	2					✓
Floor 01							
G01-01	Inside fire hose cabinet FHC G-01	1					✓
G01-02	Inside fire hose cabinet FHC G-02	1					✓
G01-03	In front of KOP	1					✓
G01-04	Beside Congeorge	1					✓
G01-05	In front of SO safe room	1					✓
G01-06	G&E Room						✓
G01-07	In fire cart	5	1		4		✓
Basement 01							
B01-01	Inside fire hose cabinet FHC B1-01	1					✓
B01-02	Inside fire hose cabinet FHC B1-02	1					✓
B01-03	Inside fire hose cabinet FHC B1-03	1					✓
B01-04	Inside fire hose cabinet FHC B1-04	1					✓
B01-05	In front of SO safe room	1					✓
B01-06	Canteen Kitchen			3	1		✓
Basement 02							
B02-01	Inside fire hose cabinet FHC B2-01	1					✓
Total		73	0	74	4	6	Grand Total
							157

Dry Chemical	Total = 71160
Helidon	Total = 6145
Co2	Total = 27460
Wet Chemical	Total = 4168
Fire Blanket	Total = 6 du
Damage	0

Checked By:
Security Officer / Supervisor

Acknowledged By:
Security Manager/Ast. Security Manager

F04-01	Inside fire hose cabinet FHC14-01	1							✓
F04-02	Inside fire hose cabinet FHC14-02	1							✓
F04-03	Inside fire hose cabinet FHC14-03	1							✓
F04-04	Additional extinguishers	3							✓
Floor 04th (Car park)									
F03-01	Inside fire hose cabinet FHC13-01	1							✓
F03-02	Inside fire hose cabinet FHC13-02	1							✓
F03-03	Inside fire hose cabinet FHC13-03	1							✓
F03-04	Additional extinguishers	3							✓
Floor 03rd (Car park)									
F02-01	Inside fire hose cabinet FHC12-01	1							✓
F02-02	Inside fire hose cabinet FHC12-02	1							✓
F02-03	Inside fire hose cabinet FHC12-03	1							✓
F02-04	Additional extinguishers	2							✓
Floor 02									
G01-01	Inside fire hose cabinet FHC11-01	1							✓
G01-02	Inside fire hose cabinet FHC11-02	1							✓
G01-03	In front of KDF			1					✓
G01-04	Beside Garage			1					✓
G01-05	In front of Store PA	1							✓
G01-06	Gas Room	1							✓
G01-07	In Fire cart	5		1		4			✓
Basement 01									
B01-01	Inside fire hose cabinet FHC11-01	1							✓
B01-02	Inside fire hose cabinet FHC11-02	1							✓
B01-03	Inside fire hose cabinet FHC11-03	1							✓
B01-04	Inside fire hose cabinet FHC11-04	1							✓
B01-05	In front of SD Safe room			1					✓
B01-06	Car item Kitchen					1			✓
Basement 02									
B02-01	Inside fire hose cabinet FHC12-01	1							✓
Total		43	0	104	4	6		Grand Total	157

	Dry Chemical	Total = 43
	Water	Total = 43
	CO2	Total = 104
	Wet Chemical	Total = 4
	Fire Blanket	Total = 4
	Damage	Total = 6
		0

Checked By:
Security Officer / Supervisor

Acknowledged By:
Security Manager/Asst. Security Manager

F18-01	Inside fire hose cabinet FHC18-01								✓
F18-02	Inside fire hose cabinet FHC18-02								✓
F18-03	Electric room								✓
Floor 17th									
F17-01	Inside fire hose cabinet FHC17-01								✓
F17-02	Inside fire hose cabinet FHC17-02								✓
F17-03	Electric room								✓
Floor 16th									
F16-01	Inside fire hose cabinet FHC16-01								✓
F16-02	Inside fire hose cabinet FHC16-02								✓
F16-03	Electric room								✓
Floor 15th									
F15-01	Inside fire hose cabinet FHC15-01								✓
F15-02	Inside fire hose cabinet FHC15-02								✓
F15-03	Electric room								✓
Floor 14th									
F14-01	Inside fire hose cabinet FHC14-01								✓
F14-02	Inside fire hose cabinet FHC14-02								✓
F14-03	Electric room								✓
Floor 13th (Spa)									
F13-01	Inside fire hose cabinet FHC13-01								✓
F13-02	Inside fire hose cabinet FHC13-02								✓
F13-03	Electric room								✓
Floor 12th (Spa)									
F12-01	Inside fire hose cabinet FHC12-01								✓
F12-02	Inside fire hose cabinet FHC12-02								✓
F12-03	Electric room								✓
F12-04	In front of Gym Murtha room								✓
Floor 10th (50 FT)									
F10-01	Inside fire hose cabinet FHC10-01								✓
F10-02	Inside fire hose cabinet FHC10-02								✓
F10-03	In lift Control of room Low zone								✓
F10-04	Electric room								✓
F10-05	In front of Gym Pump room (pool)								✓
F10-06	Water Club								✓
Floor 08th									
F08-01	Inside fire hose cabinet FHC08-01								✓
F08-02	Inside fire hose cabinet FHC08-02								✓
F08-03	In front of behind the counter								✓
Floor 08th (Ballroom)									
F08-01	Inside fire hose cabinet FHC08-01								✓
F08-02	Inside fire hose cabinet FHC08-02								✓
F08-03	Inside fire hose cabinet FHC08-03								✓
F08-04	In the Ballroom								✓
F08-05	In the kitchen Bakery								✓
F08-06	BD Kitchen								✓
Floor 07th (Redoven/508th)									
F07-01	Inside fire hose cabinet FHC07-01								✓
F07-02	Inside fire hose cabinet FHC07-02								✓
F07-03	Inside fire hose cabinet FHC07-03								✓
F07-04	Redoven Reception								✓
F07-05	Main Kitchen								✓
F07-06	Front of Social Room2								✓
F07-07	Japanese Kitchen								✓
F07-08	Redoven terrace								✓
Floor 06th									
F06-01	Inside fire hose cabinet FHC06-01								✓
F06-02	Inside fire hose cabinet FHC06-02								✓
F06-03	Inside fire hose cabinet FHC06-03								✓
F06-04	Laundry Room								✓
F06-05	In front of Server room								✓
F06-06	Generator room								✓
F06-07	MOD room								✓
F06-08	Chiller room								✓
F06-09	Transformer room								✓
Floor 05th (Car park)									
F05-01	Inside fire hose cabinet FHC05-01								✓
F05-02	Inside fire hose cabinet FHC05-02								✓
F05-03	Inside fire hose cabinet FHC05-03								✓
F05-04	Additional extinguishers								✓
Floor 04th (Car park)									

BANGKOK

Code	Location	Type of Fire Extinguisher				Status	Remarks
		Dry Chemical	Halon	CO2	Wet Chemical		
							
Roof Top Floor							
F30-01	In Lift Control room U9 L10			1			✓
F30-02	Inside fire hose cabinet FHC10-01				1		✓
F30-03	Inside fire hose cabinet FHC10-02			1			✓
F30-04	Jan Terrace				1		✓
F30-05	In Lift Control room high zone			2			✓
Floor 28th							
F29-01	Inside fire hose cabinet FHC29-01			1			✓
F29-02	Inside fire hose cabinet FHC29-02			1			✓
F29-03	Inside #15			1		1	✓
F29-04	Inside fire kitchen						
F29-03	Inside water pump room	1					✓
Floor 28th							
F28-01	Inside fire hose cabinet FHC28-01			1			✓
F28-02	Inside fire hose cabinet FHC28-02			1			✓
F28-03	Electric room			1			✓
Floor 27th							
F27-01	Inside fire hose cabinet FHC27-01			1			✓
F27-02	Inside fire hose cabinet FHC27-02			1			✓
F27-03	Electric room			1			✓
Floor 26th							
F26-01	Inside fire hose cabinet FHC26-01			1			✓
F26-02	Inside fire hose cabinet FHC26-02			1			✓
F26-03	Electric room			1			✓
Floor 25th(Club Signature)							
F25-01	Inside fire hose cabinet FHC25-01			1			✓
F25-02	Inside fire hose cabinet FHC25-02			1			✓
F25-03	Electric room			1			✓
F25-04	Club Signature Kitchen			1			✓
Floor 24th							
F24-01	Inside fire hose cabinet FHC24-01			1			✓
F24-02	Inside fire hose cabinet FHC24-02			1			✓
F24-03	Electric room			1			✓
Floor 23rd							
F23-01	Inside fire hose cabinet FHC23-01			1			✓
F23-02	Inside fire hose cabinet FHC23-02			1			✓
F23-03	Electric room			1			✓
Floor 22nd							
F22-01	Inside fire hose cabinet FHC22-01			1			✓
F22-02	Inside fire hose cabinet FHC22-02			1			✓
F22-03	Electric room			1			✓
Floor 21st							
F21-01	Inside fire hose cabinet FHC21-01			1			✓
F21-02	Inside fire hose cabinet FHC21-02			1			✓
F21-03	Electric room			1			✓
Floor 20th							
F20-01	Inside fire hose cabinet FHC20-01			1			✓
F20-02	Inside fire hose cabinet FHC20-02			1			✓
F20-03	Electric room			1			✓
Floor 19th							
F19-01	Inside fire hose cabinet FHC19-01			1			✓
F19-02	Inside fire hose cabinet FHC19-02			1			✓

F05-04	Additional extinguishers	3							✓	
Floor 04th (Car park)										
F04-01	Inside fire hose cabinet FHC 04-01	1							✓	
F04-02	Inside fire hose cabinet FHC 04-02	1							✓	
F04-03	Inside fire hose cabinet FHC 04-03	1							✓	
F04-04	Additional extinguishers	3							✓	
Floor 03rd (Car park)										
F03-01	Inside fire hose cabinet FHC 03-01	1							✓	
F03-02	Inside fire hose cabinet FHC 03-02	1							✓	
F03-03	Inside fire hose cabinet FHC 03-03	1							✓	
F03-04	Additional extinguishers	3							✓	
Floor 02nd (Car park)										
F02-01	Inside fire hose cabinet FHC 02-01	1							✓	
F02-02	Inside fire hose cabinet FHC 02-02	1							✓	
F02-03	Inside fire hose cabinet FHC 02-03	1							✓	
F02-04	Additional extinguishers	2							✓	
Floor 01										
G01-01	Inside fire hose cabinet FHC G-01	1							✓	
G01-02	Inside fire hose cabinet FHC G-02	1							✓	
G01-03	In Front of MOF	1				1			✓	
G01-04	Beside Congratge	1				1			✓	
G01-05	In Front of store PA	1							✓	
G01-06	GAZ Room	1				1			✓	
G01-07	In Fire cart	5				1		3	✓	
Basement 01										
B01-01	Inside fire hose cabinet FHC B-01	1							✓	
B01-02	Inside fire hose cabinet FHC B-02	1							✓	
B01-03	Inside fire hose cabinet FHC B-03	1							✓	
B01-04	Inside fire hose cabinet FHC B-04	1							✓	
B01-05	In Front of ISO Safe room	1				1			✓	
B01-06	Car Wash Kitchen								✓	
Basement 02										
B02-01	Inside fire hose cabinet FHC B-01	1							✓	
Total		43	0	105	5	6	Grand Total		159	

Total = 43 rds
Total = 0 rds
Total = 304 rds
Total = 0 rds
Total = 6 rds

Checked By:

Security Officer / Supervisor

Acknowledged By:

Security Manager/Ast. Security Manager

สำเนาเอกสารการตรวจสอบระบบป้องกันอัคคีภัย


MR-05



FL 27 ROOM 2713 TEST SMOKE DETECTOR 2 SET AND HEAT 4 SET..NORMAL




FL 27 ROOM 2712 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL

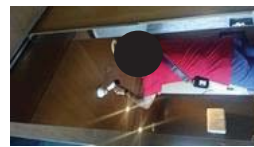

FL 27 ROOM 2714 TEST SMOKE DETECTOR 1 SET AND HEAT 2 SET..NORMAL



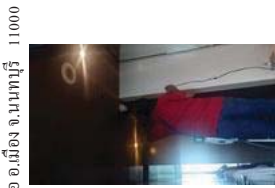

FL 28 ROOM 2712 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL



FL 28 ROOM 2810 TEST SMOKE DETECTOR 4 SET ...NOWORK 1 SET
AND HEAT 3 SET..NOWORK 1 SET



11000

11000

11000

11000



FL 28 ROOM 2815 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL



FL 26 ROOM 2606 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL



FL 26 ROOM 2603 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL

FL 26 ROOM 2613 TEST SMOKE DETECTOR 3 SET AND HEAT 3 SET..NORMAL




CLEAN AND CHECK THE CABINET OF CONTROL



FL 26 ROOM 2601 TEST SMOKE DETECTOR 2 SET AND HEAT 2 SET..NORMAL




FL 28 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

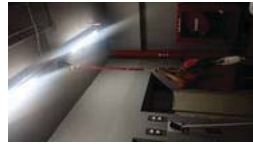

FL 27 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 28 CORRIDOR TEST SMOKE DETECTOR 10 SET..NORMAL

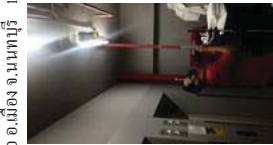

11000




FL 26 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



11000





FL 27 CORRIDOR TEST SMOKE DETECTOR 8 SET..NORMAL

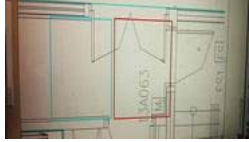


FL 27 TEST MANUAL DETECTOR 2 SET..NORMAL



FL 26 TEST MANUAL DETECTOR 1 SET..NORMAL

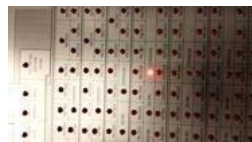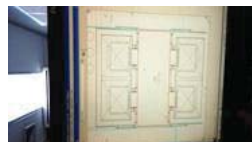


FL 26 CORRIDOR TEST SMOKE DETECTOR 10 SET. NORMAL

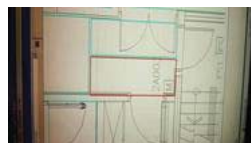

FL 25 TEST MANUAL DETECTOR 2 SET.,NORMAL





FL 25 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

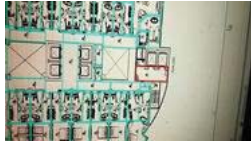

FL 24 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL




FL 24 TEST MANUAL DETECTOR 2 SET..NORMAL

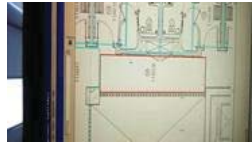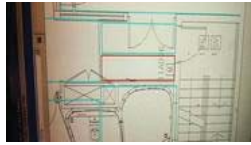



FL 25 CORRIDOR TEST SMOKE DETECTOR 8 SET..NORMAL



FL 24 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

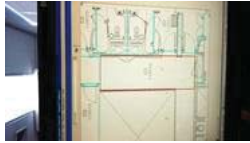


FL 23 TEST MANUAL DETECTOR 2 SET..NORMAL

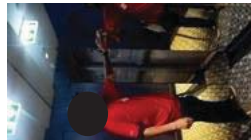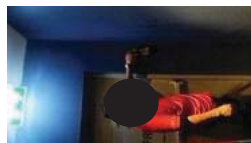

FL 23 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 23 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

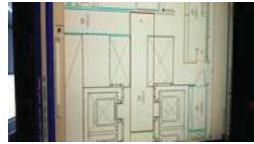


FL 23 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL




FL 22 TEST MANUAL DETECTOR 2 SET..NORMAL



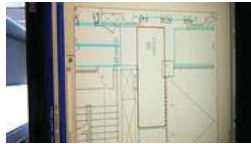

FL 21 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

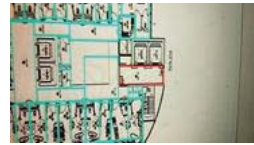

FL 21 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 22 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 21 TEST MANUAL DETECTOR 2 SET..NORMAL




MR-05




FL 20 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL




FL 20 TEST MANUAL DETECTOR 2 SET..NORMAL

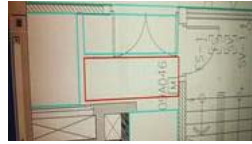

FL 20 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

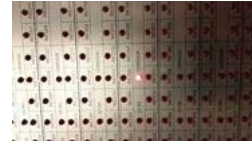


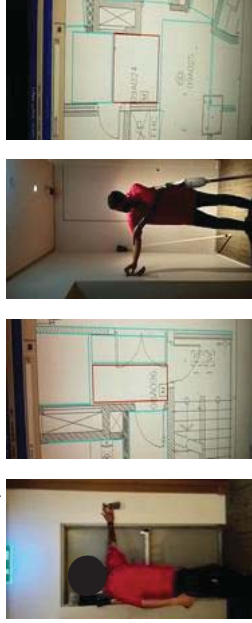

FL 19 TEST MANUAL DETECTOR 2 SET..NORMAL



FL 19 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

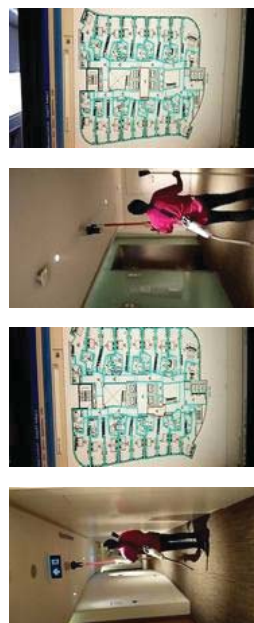

FL 19 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

11000





FL 18 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



11000



FL 18 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

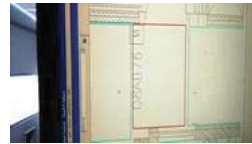
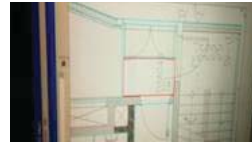


FL 18 TEST MANUAL DETECTOR 2 SET..NORMAL

MR-05



FL 17 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

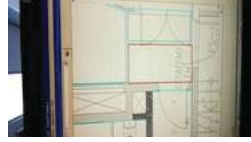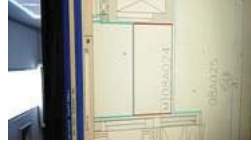

FL 17 TEST MANUAL DETECTOR 2 SET..NORMAL



FL 17 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 15 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL





FL 15 TEST MANUAL DETECTOR 1 SET..NORMAL



FL 16 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL





FL 16 TEST MANUAL DETECTOR 2 SET..NORMAL

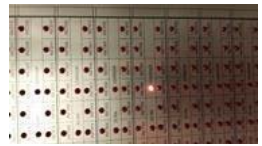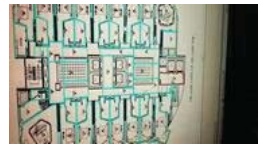

FL 16 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



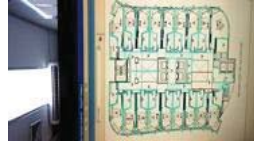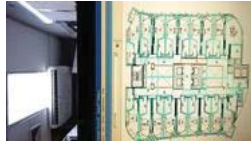

FL 15 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL




FL 14 TEST MANUAL DETECTOR 2 SET..NORMAL



FL 14 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL




FL 15 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

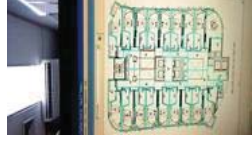



FL 14 CORRIDOR TEST SMOKE DETECTOR 9 SET..NORMAL

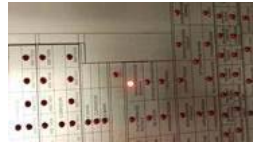

FL 11 GAM MUNTHA TEST SMOKE DETECTOR 1 SET..NORMAL





FL 11 ANODARTH TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 ANODARTH TEST SMOKE DETECTOR 2 SET..NORMAL



FL 11 RODKARA TEST SMOKE DETECTOR 1 SET..NORMAL

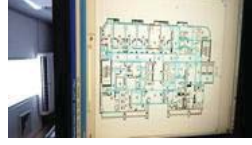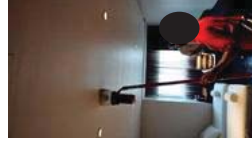

FL 11 THIYAKKHALA TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 SRIHAPAPATA TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 SO SPA TEST SMOKE DETECTOR 2 SET..NORMAL



FL 11 CHATTAN TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 MANTHAKINEE TEST SMOKE DETECTOR 1 SET..NORMAL






FL 11 KUNATA TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 OFFICE TEST SMOKE DETECTOR 1 SET..NORMAL



FL 11 SO WELL OFFICE TEST SMOKE DETECTOR 1 SET..NORMAL

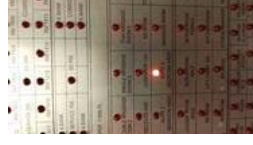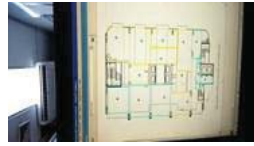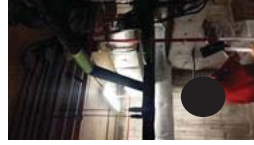


FL 11 CORRIDOR TEST SMOKE DETECTOR 2 SET..NORMAL



FL 11M AHU ROOM TEST SMOKE DETECTOR 10 SET..NORMAL 5 SET NOWORK 5 SET




FL 11 TEST MANUAL DETECTOR 1 SET..NORMAL

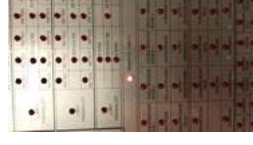



FL 11 CORRIDOR TEST SMOKE DETECTOR 1 SET..NORMAL




FL 11M EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL

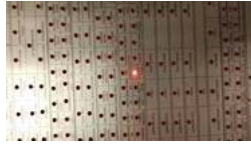

FL 4 CARPARK TEST HEAT DETECTOR 1 SET..NORMAL

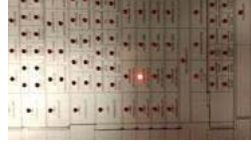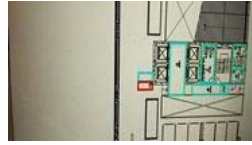

FL 4 CARPARK TEST MANUAL DETECTOR 3 SET..NORMAL

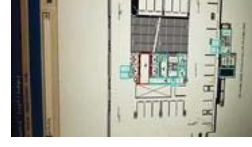

FL 3 CARPARK TEST HEAT DETECTOR 1 SET..NORMAL



FL 11 M TEST MANUAL 1 SET..NORMAL



FL 11 EMPLOYEE LIFT FRONT TEST SMOKE DETECTOR 1 SET..NORMAL



FL 5 CARPARK TEST HEAT DETECTOR 2 SET..NORMAL







FL 5 CARPARK TEST MANUAL DETECTOR 2 SET..NORMAL




FL 2 CARPARK TEST MANUAL DETECTOR 4 SET..NORMAL 3 SET **NOWORK 1 SET**



FL 2 CARPARK TEST HEAT DETECTOR 1 SET..NORMAL



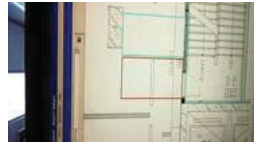
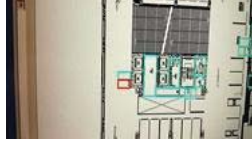
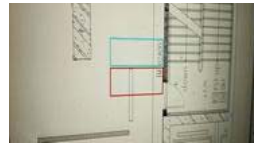
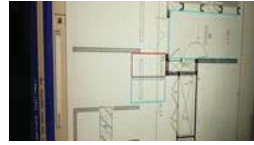


FL 3 CARPARK TEST MANUAL DETECTOR 3 SET..NORMAL

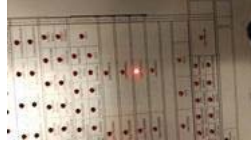

FL 2 CARPARK TEST HEAT DETECTOR 2 SET..NORMAL



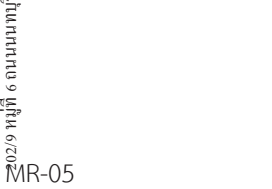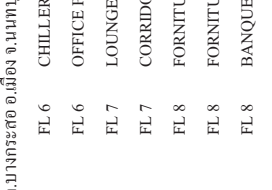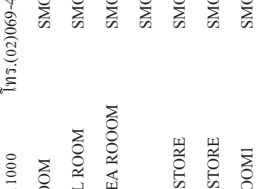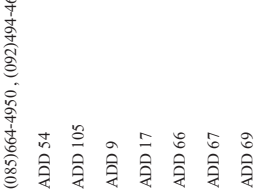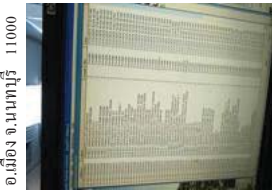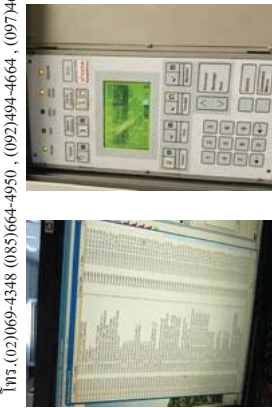

TROUBLE SMOKE DETECTOR

GROUND FAULT		
FL B2	PUMP ROOM	SMOKE ADD 6
FL B2	PUMP ROOM	SMOKE ADD 10
FL B2	PUMP ROOM	SMOKE ADD 11
FL B2	PUMP ROOM	SMOKE ADD 12
FL B2	ST2	SMOKE ADD 9
FL B2	ST2	SMOKE ADD 7
FL B1	PUMP ROOM	SMOKE ADD 20
FL B1	CONTROL ROOM	SMOKE ADD 12
FL B1	CORRIDOR	SMOKE ADD 38
FL B1	CORRIDOR	SMOKE ADD 49
FL B1	CORRIDOR	SMOKE ADD 63
FL B1	CORRIDOR	SMOKE ADD 64
FL B1	CORRIDOR	SMOKE ADD 78
FL B1	LOCKER MALE ROOM	SMOKE ADD 51
FL B1	LOCKER MALE ROOM	SMOKE ADD 53
FL B1	SUMP PUMP	SMOKE ADD 47
FL B1	BEVERAGE STORGE	SMOKE ADD 65
FL B1	FLOWER ROOM 1	SMOKE ADD 69
FL G	ST 3	SMOKE ADD 84
FL G	FAN ROOM	SMOKE ADD 86
FL G	FAN ROOM	SMOKE ADD 94
FL MEZ	HALL FIRE MAN LIFT	SMOKE ADD 106
FL MEZ	HALL FIRE MAN LIFT	SMOKE ADD 108
FL 1	SORA OMAKASE ROOM	SMOKE ADD 88/3
FL 3	CORRIDOR ST2	SMOKE ADD 16/2
FL 5	LOBBY FIRE MAN LIFT	SMOKE ADD 30
FL 6	CORRIDOR	SMOKE ADD 44
FL 6	MEETING ROOM	SMOKE ADD 96

TROUBLE HEAT DETECTOR

FL B1	CARPARK	HEAT ADD 14
FL B1	CARPARK	HEAT ADD 15
FL B1	CARPARK	HEAT ADD 27
FL B1	KITCHEN ROOM	HEAT ADD 46
FL B1	LOCKER FEMALE ROOM	HEAT ADD 57
FL MEZ	FIREMAN LIFT	HEAT ADD 107
FL 2	TOILETMAN	HEAT ADD 7
FL 2	TOILET	HEAT ADD 4
FL 9	JANNITOR	HEAT ADD 40
FL 10	CHANGING FEMALE ROOM	HEAT ADD 75

DISABLE

FL MEZ HALL SMOKE ADD 109

FL 1 SORA OMAKASE ROOM SMOKE ADD 088/2

EDWARDS Model.EDC-M9102 Conventional	56	SET
Edwards EST (SIGA-HRS) Intelligent Fixed Temp Heat Detector	11	SET
Dual Input Module รุ่น SIGA-CT2	14	SET
Single Input Signal Module รุ่น SIGA-CCI	9	SET
สัญญาณเตือนภัยชนิดมือ รุ่น SIGA-270P	8	SET

FL 27 ROOM 2711	HEAT	ADD 23
TOTAL HEAT DETECTOR	11	SET


FL B2 SUPERVISORY	5
FL B2 SUPERVISORY	6
FL B2 SUPERVISORY	9
FL B2 SUPERVISORY	10
FL B2 SUPERVISORY	13
FL B2 SUPERVISORY	14
FL 2 SUPERVISORY	1
FL 2 SUPERVISORY	2
FL 2 WATER FLOW	1
FL 2 WATER FLOW	2
FL 3 SUPERVISORY	1
FL 3 SUPERVISORY	2
FL 3 WATER FLOW	1
FL 3 WATER FLOW	2
TOTAL MODULE SIGA CT2	14 SET

FL B2 MANUAL PUMP ROOM	ADD 4
FL B2 MANUAL PUMP ROOM	ADD 8
FL B2 MANUAL CORRIDOR	ADD 48
FL 2 MANUAL CARPARK 2	ADD 10
FL 3 MANUAL CORRIDOR ST2	
FL B2 KEYSWITCH 4 PUMP ROOM	
FL B2 KEYSWITCH 8 PUMP ROOM	
FL 3 KEYSWITCH ST 2	
TOTAL MODULE SIGA 270P	8 SET

FL 1 SPEKER 1	
FL MEZ STORBE 1	
FL MEZ SPEKER 1	
FL 2 SPEKER 2	
FL 4 SPEKER 2	
FL 7 STORBE 1	
FL 11 SPEKER 2	
FL 26 SPEKER 2	
FL 28 STORBE 1	
TOTAL MODULE SIGA CC1	9 SET

เอกสารแบบ 15
ใบรับรองการตรวจสอบอาคาร

เลขที่ ๒๗๙๔/๒๕๖๗

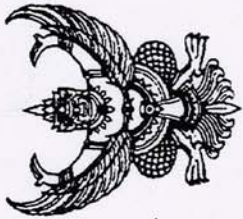

แบบ ร.๑

รายงานผลการตรวจสอบประจำปี ครั้งที่ ๑

ตามใบรับรองการตรวจสอบใหญ่เลขที่ ๒๒๔๐/๒๕๖๗
ลงวันที่ ๑๑ มิถุนายน ๒๕๖๗

ใบรับรองการตรวจสอบอาคาร

ใบรับรองฉบับนี้ออกให้เพื่อแสดงว่า

อาคาร...โรงแรม...โซ...แบบคอก...โดย...บริษัท...โอเคพี...จำกัด.....

ตั้งอยู่เลขที่...๒...ตรอก/ซอย...ถนน...สาทรเหนือ...หมู่ที่...ตำบล/แขวง...สีลม...อำเภอ/เขต...บางรัก...จังหวัด...กรุงเทพมหานคร.....

ได้ผ่านการตรวจสอบอาคาร ตามพระราชบัญญัติควบคุมอาคาร พ.ศ. ๒๕๖๒ แล้ว

เจ้าพนักงานท้องถิ่นได้พิจารณาผลการตรวจสอบอาคาร ซึ่งทำการตรวจสอบโดยผู้ตรวจสอบชื่อ...พันตำรวจโท...ก้องกาญจน์...ฉันทบุรีวัฒ.....

เลขทะเบียน...น.๑๐๔๐/๒๕๕๐...ออกให้...ณ...วันที่...๑๒...ธันวาคม...๒๕๖๖...แล้วเห็นว่า อาคารนี้มีสภาพปลอดภัยในการใช้งาน

ออกให้ ณ วันที่...เดือน...๒๕๖๘...พ.ศ.....

คำเตือน

๑. ใบรับรองฉบับนี้เป็นการรับรองเฉพาะผลการตรวจสอบอาคาร

มิได้เป็นการรับรองความถูกต้องของการก่อสร้างอาคาร
ดัดแปลงอาคาร หรือเคลื่อนย้ายอาคารแต่อย่างใด

๒. ให้จัดส่งรายงานผลการตรวจสอบอาคารภายใน ๓๐ วัน

ก่อนใบรับรองการตรวจสอบอาคาร (แบบ ร.๑) จะมี

ระยะเวลาครบ ๑ ปี

BID 996AA814F1D0

ใบรับรองฉบับนี้ให้ใช้ได้จนถึงวันที่...๒๑...เดือน...พ.ศ.....๒๕๖๘



ตำแหน่ง...ผู้อำนวยการส่วนบริหารโยธา.....

ปฏิบัติราชการแทนผู้ว่าราชการกรุงเทพมหานคร

เจ้าพนักงานท้องถิ่น



เอกสารแบบ 16
เอกสารรับรองผลการตรวจวิเคราะห์คุณภาพน้ำทิ้ง



Analysis / Test Report

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : ศุภกิจ

Project Name :

Project Location :

TESTING
No.0009
Lot ID: 2563954

Date Received : Jul 07, 2025

Date Reported : Jul 18, 2025

Report Number : 3362728-1

Page 1 of 2

Sample Number		2563954-2					
Sampled Date		Jul 07, 2025 12:10 PM					
Sample Description		Wastewater					
Location		Storage Tank					
Date Analysis Commenced		Jul 08, 2025					
Condition of Sample		Contained in one amber glass bottle and four plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)					
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C)	mg/L	-	2.0	317	≤20	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5210 B, part 4500 - O G	Bangkok
Oil & Grease	mg/L	-	3	13	≤20	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5520 B	Bangkok
pH at 25 degree C		-	-	7.7	5.5-9.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	10.0	No Standard	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 F	Bangkok
Sulfide *	mg/L	-	0.5	6.0	≤1	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500-52 (C, F)	Bangkok
Total Dissolved solids Dried at 180 degree C	mg/L	-	5	396	≤1000	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	97.4	≤35	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500-Norg (C)	Bangkok
Total Suspended Solids Dried at 103-105 degree C	mg/L	-	5	266	≤30	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 D	Bangkok

Guideline : Notification of Ministry of Natural Resources and Environment B.E. 2567 on Effluent Control Standard from Types and Sized of Buildings, Type A.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

SCIENTIST (C)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7641-101/ EMAIL

S: Reports_AL_Grup (13799)



Analysis / Test Report

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : ศุภกิจ

Project Name :

Project Location :

TESTING
No.0009
Lot ID: 2563954

Date Received : Jul 07, 2025

Date Reported : Jul 18, 2025

Report Number : 3362727-1

Page 1 of 1

Sample Number		2563954-1						
Sampled Date		Jul 07, 2025 11:50 AM						
Sample Description		Consumption Water						
Location		Swimming Pool						
Date Analysis Commenced		Jul 08, 2025						
Condition of Sample		Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)						
Analyte		Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing								
<i>Escherichia coli</i>								
		in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok
Total Coliform		MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B	Bangkok
Water Testing								
pH at 25 degree C *		-	-	-	7.2	7.2-8.4	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Residual Free Chlorine *		mg/L	-	0.1	0.7	0.6-1.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500-Cl (F)	Bangkok

Guideline : ค่ามาตรฐานของกรมการสาธารณสุข ฉบับที่ 1/2550 ซึ่งกำหนดเกณฑ์การตรวจ/การวิเคราะห์น้ำ เพื่อการดื่ม น้ำดื่มในครัวเรือน

Sampling By : Pichai Boonyong

Remark :
- LOD : Limit of Detection
- <C : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7641-101/ EMAIL

S: Reports_AL_Grup (13799)



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : ศุภฤกษ์
Project Name :
Project Location :

Sample Number 2570965-1
Sampled Date Aug 04, 2025 11:10 AM
Sample Description Consumption Water
Location Swimming Pool
Date Analysis Commenced Aug 05, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Page 1 of 1

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B, F	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B	Bangkok
Water Testing							
pH at 25 degree C *	-	-	-	7.4	7.2-8.4	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Residual Free Chlorine *	mg/L	-	0.1	0.6	0.6-1.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - Cl (F)	Bangkok

Guideline : ค่ามาตรฐานของกรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการปนเปื้อนและการตรวจวัดค่าคุณภาพน้ำในแหล่งน้ำดื่ม
Sampling By : Theeraphol Sangthong

- Remark :
- LOD : Limit of Detection
 - < : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

SCIENTIST (S)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : ศุภฤกษ์
Project Name :
Project Location :

Sample Number 2570965-1
Sampled Date Aug 04, 2025 11:10 AM
Sample Description Consumption Water
Location Swimming Pool
Date Analysis Commenced Aug 05, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Page 2 of 2

Microbiological Testing							
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B, F	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<10	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B	Bangkok
Water Testing							
pH at 25 degree C *	-	-	-	7.4	7.2-8.4	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Residual Free Chlorine *	mg/L	-	0.1	0.6	0.6-1.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - Cl (F)	Bangkok

Guideline : ค่ามาตรฐานของกรมการสาธารณสุข ฉบับที่ 1/2550 เรื่อง การควบคุมการปนเปื้อนและการตรวจวัดค่าคุณภาพน้ำในแหล่งน้ำดื่ม
Sampling By : Theeraphol Sangthong

- Remark :
- LOD : Limit of Detection
 - < : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

SCIENTIST (S)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location:

TESTING
No.0009
Lot ID: 2570965
Date Received : Aug 04, 2025
Date Reported : Aug 15, 2025
Report Number : 3383568-1

Page 2 of 2

Sampling by : Theeraphol Sangthong

- Remark :
- LOD : Limit of Detection
 - " < " : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location:

TESTING
No.0009
Lot ID: 2570965
Date Received : Aug 04, 2025
Date Reported : Aug 15, 2025
Report Number : 3383568-1

Page 1 of 2

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C)	mg/L	-	2.0	162	≤20	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5210 B, part 4500 - O G	Bangkok
Oil & Grease	mg/L	-	3	15	≤20	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5520 B	Bangkok
pH at 25 degree C	-	-	-	7.8	5.5-9.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Settleable Solid *	mL/L/hr	-	0.1	3.5	No Standard	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 F	Bangkok
Sulfide *	mg/L	-	0.5	4.8	≤1	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500-S2 (C, F)	Bangkok
Total Dissolved solids Dried at 180 degree C	mg/L	-	5	384	≤1000	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	126	≤35	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500-Norg (C)	Bangkok
Total Suspended Solids Dried at 103-105 degree C	mg/L	-	5	182	≤30	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 D	Bangkok

Guideline : Notification of Ministry of Natural Resources and Environment B.E. 2567 on Effluent Control Standard from Types and Size of Buildings, Type A.

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวจิราพร
Project Name :
Project Location :

TESTING
No.0009
Lot ID: 2579995
uate Re-lidat : Sep 01, 2025
uate Reported : Sep 1c, 2025
Report Nmber : v308680-1

Page 1 of 2

Sample Number		256885-2					
Sample Date		Sep 01, 2025 10:28 A9					
Sample Description		MasteWater					
Location		Storage Tank					
Date Analysis Commenced		Sep 02, 2025					
Condition of Sample		Contained in 2br plasti4 Pottles and one amPer glass Pottle, sample 4ontainers 4omply to pretreatment - preserDation standards wAF (A, HSLF AE					
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOu v6 days at 20 degree CE	mg/L	-	2.0	1v5	G20	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 5210 B, part 3500 - O F	Bangkok
Oil . Frease	mg/L	-	v	12	G20	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 5520 B	Bangkok
p(at 25 degree C	-	-	-	6w	56-8.0	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 3500 - (WE	Bangkok
SettlePle Solid ≤	mL/L/hr	-	0.4	0.8	No Standard	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 2530 &	Bangkok
Sbl7de ≤	mg/L	-	0.6	0c	G1	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 3500-52 vC, &	Bangkok
Total uissolDed solids uried at 1c0 degree C	mg/L	-	5	25*	G1000	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 2530 C	Bangkok
Total Kjeldahl Nitrogen as N ≤	mg/L	0.45	1.0	vv*	Gv5	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 3500-Norg vE	Bangkok
Total Stopped Solids uried at 10v-15 degree C	mg/L	-	5	c8	Gv0	Standard 9 ethods 2or the Uamination o7Mater and MasteWaterAF (A, AMMA . ML&, 23th edx 202v, part 2530 u	Bangkok

Guideline : Not74ation o79 mistry o7 Natbrl Resob4es and Undroment Bux25*6 on U7lbent Control Standard 7om Types and Sized o7Bldings, Type Ax

Ree-its apply to the samplee as e-bertied, unless the sampling Was food-ried by ALS. The report shall not be resonded to if it is not the Written approval of the Laboratory.

Approved by

Scientist WE

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

RIGHT SOLUTIONS RIGHT PARTNER

6*31-101/UPAL

S:Reports/LAL_Fcspv2/v279 E



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวจิราพร
Project Name :
Project Location :

TESTING
No.0009
Lot ID: 2579995
uate Re-lidat : Sep 01, 2025
uate Reported : Sep 1c, 2025
Report N- mber : v3086871

Page 1 of 1

Sample Number	25688571						
Sample Date	Sep 01, 2025 8:v8 A9						
Sample Description	Cons- nption Water						
Location	Swimming Pool						
Date Analysis Commenced	Sep 02, 2025						
Condition of Sample	Contained in tWo plasti4 bottles, sample 4ontainers 4omply to pretreatment 7 preserDation standards wF (A, HSUPAE						
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
U6-phen-Pha 4opi							
	in 100 mL	7	7	Not uetected	Not uetected	Standard 9 ethods for the Uamination of Mater and MasteWaterAP (A, AMMA . ML&, 23th edx 202v, part 8221 B, &	Bangkok
Total Coliform	9 PN/100mL	7	7	F 14	F 10	Standard 9 ethods for the Uamination of Mater and MasteWaterAP (A, AMMA . ML&, 23th edx 202v, part 8221 B	Bangkok
Water Testing							
p(at 25 degree C <		7	7	6.2	6.2<:3	Standard 9 ethods for the Uamination of Mater and MasteWaterAP (A, AMMA . ML&, 23th edx 202v, part 3500 7(WE	Bangkok
Resid- al &ree Chlorine <	mg/L	7	0.4	0c	0<:71.0	Standard 9 ethods for the Uamination of Mater and MasteWaterAP (A, AMMA . ML&, 23th edx 202v, part 3500 7(WE	Bangkok

Guideline : ค่าเบี่ยงเบนมาตรฐานการทดสอบ อยู่ภายใต้ 1/2550 ซึ่งมาตรฐานการทดสอบ/ผลการทดสอบนี้ ใช้สำหรับการวัดค่าในหน่วยเดียวกัน

Sampling By : Ch-ladet Martin

- Remark :
- LOU : Limit of uetelion
 - F : Lower than LOQ Limit of Q- antitationE / LOR limit of ReportingE
 - AnalyseeMarked < 5 are not inH- ded in slope of 44Hreditation ISO/TC 16025x
 - Sampling is not in4- ded in slope of 44Hreditation ISO/TC 16025

Ree-its apply to the samplee as e-bertied, unless the sampling Was food-ried by ALS. The report shall not be resonded to if it is not the Written approval of the Laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

RIGHT SOLUTIONS RIGHT PARTNER

6*31701/UPAL

S:Reports/LAL_GLsp vvdppE



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangkok, Bangkok Thailand 10500

P/O : สิบญดาจิ

Project Name :

Project Location :

Page 2 of 2

Sampling vy : Chliladet Mairin

Remark :

- LOU : Limit of detection
- "e" : Lower than LOQ limit of Quantitation / LOR limit of Reporting
- Analytes Marked as Is are not included in slope of AA44 calibration ISO/PLC 16025x

Sampling is not included in slope of AA44 calibration ISO/PLC 16025

Results apply to the sample as submitted, unless the sampling was conducted by ALX. The report shall not be reproduced in any form without the written approval of the laboratory.

ApproBed

ADDRESS 1 04 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

6*31-101/ U9 AIL

S:\Reports\ All FLXpt v2:v2f9 E



MR-05

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : บริษัท ออคิดทรี จำกัด
Project Name :
Project Location :

Lot ID: 2579995
Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409793-1

Page 1 of 1

Sample Number 2579995-5
Sample Date Sep 01, 2025 10:19 AM
Sample Description Consumption Water
Location Cooling Tower Water Sample
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.
Sampling By : Chuladet Warin

Remark :
- LOD : Limit of Detection
- "L" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : บริษัท ออคิดทรี จำกัด
Project Name :
Project Location :

Lot ID: 2579995
Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409792-1

Page 1 of 1

Sample Number 2579995-4
Sample Date Sep 01, 2025 9:57 AM
Sample Description Consumption Water
Location Spa Water Sample สบู่เท้า
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.
Sampling By : Chuladet Warin

Remark :
- LOD : Limit of Detection
- "L" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

u.16/6



MR-05

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location :

Lot ID: 2579995
Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409795-1

Page 1 of 1

Sample Number 2579995-7
Sampled Date Sep 01, 2025 10:15AM
Sample Description Consumption water
Location Roof Tank
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in 1 of plastic bottles, sample containers comply to pretreatment - preservation standards HAPUA, (S) PA.

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp</i>	C*/E/L	-	-	Not Detected	Not Detected	ISO 11731 H017.	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower (or BD) 12544
Note : QQ Not Detected mean Bacteria not found in agar plate
Sampling By : Chuladet warin

Remark :
- LOD : Limit of Detection
- < < : Lot (or than LOD) Limit of Reporting.

Results apply to the sample, as submitted, unless the sampling has been conducted by ALS. The report shall not be reproduced or used for any other purpose without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location :

Lot ID: 2579995
Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409794-1

Page 1 of 1

Sample Number 2579995-M
Sampled Date Sep 01, 2025 10:34 AM
Sample Description Consumption water
Location (nderground Tank
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in 1 plastic bottles, sample containers comply to pretreatment - preservation standards APEA, (S) PA.

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp</i>	C*/E/L	-	-	Not Detected	Not Detected	ISO 11731 U017.	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower (or BD) 12544
Note : QQ Not Detected mean Bacteria not found in agar plate
Sampling By : Chuladet warin

Remark :
- LOD : Limit of Detection
- < < : Lot (or than LOD) Limit of Reporting.

Results apply to the sample, as submitted, unless the sampling has been conducted by ALS. The report shall not be reproduced or used for any other purpose without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

u.16/7



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวกัญญา
Project Name :
Project Location :

Lot ID: 2579995
Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409797-1

Page 1 of 1

Sample Number 2579995-9
Sampled Date Sep 01, 2025 10:19 AM
Sample Description Consumption Water
Location Cooling Tower Water Sample
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing <i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Chuladet Warin
Remark :
- LOD : Limit of Detection
- "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Lot ID: 2579995

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวกัญญา
Project Name :
Project Location :

Date Received : Sep 01, 2025
Date Reported : Sep 18, 2025
Report Number : 3409796-1

Page 1 of 1

Sample Number 2579995-8
Sampled Date Sep 01, 2025 10:07 AM
Sample Description Consumption Water
Location Kitchen ตู้ 7
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Chuladet Warin
Remark :
- LOD : Limit of Detection
- "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : บริษัทฯ

Project Name :

Project Location :

Lot ID: 2579995

Date Received :Sep 01, 2025

Date Reported :Sep 18, 2025

Report Number :3409799-1

Page 1 of 1

Sample Number 2579995-11
Sample Date Sep 01, 2025 9:57 AM
Sample Description Consumption Water
Location Spa Water Sample
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards WPC A, HSLPAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Chuladet Warin

- Remark :
- LOD : Limit of Detection
 - "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

7641-101 / EMAIL

S:\Report\AL_NSG_Lpr_v6.52PHE



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : บริษัทฯ

Project Name :

Project Location :

Lot ID: 2579995

Date Received :Sep 01, 2025

Date Reported :Sep 18, 2025

Report Number :3409798-1

Page 1 of 1

Sample Number 2579995-10
Sample Date Sep 01, 2025 10:01 AM
Sample Description Consumption Water
Location Shower Water Sample
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Chuladet Warin

- Remark :
- LOD : Limit of Detection
 - "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

www.alsglobal.com
RIGHT SOLUTIONS RIGHT PARTNER

7641-101 / EMAIL

S:\Report\AL_NSG_Lpr (5.51PM)



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : บริษัท ออคิดรี จำกัด
Project Name :
Project Location :
Lot ID: 2579995
Date Received :Sep 01, 2025
Date Reported :Sep 18, 2025
Report Number :3409801-1

Page 1 of 1

Sample Number 2579995-13
Sample Date Sep 01, 2025 10:07 AM
Sample Description Consumption Water
Location Kitchen ชั้น 7
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Chuladet Warin
Remark :
- LOD : Limit of Detection
- "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used for any other purpose without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : บริษัท ออคิดรี จำกัด
Project Name :
Project Location :
Lot ID: 2579995
Date Received :Sep 01, 2025
Date Reported :Sep 18, 2025
Report Number :340980021

Page 1 of 1

Sample Number 2579995712
Sample Date Sep 01, 2025 9:39 AM
Sample Description Consumption Water
Location Pool
Date Analysis Commenced Sep 02, 2025
Condition of Sample Contained in one plastic bottle, sample containers comply to pretreatment - preservation standards (WHO, HSLDAE)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	7	7	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B, F	Bangkok

Sampling By : Chuladet Warin
Remark :
- LOD : Limit of Detection
- "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used for any other purpose without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



MR-05

Analysis / Test Report

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : ศุภณัฐ

Project Name :

Project Location :

TESTING
No.0009
Lot ID: 2592538

Date Reissued : Oct 04, 2025

Date Reported : Oct 14, 2025

Report NbmPer : 3826503-1

Page 1 of 2

Sample Number	2562539-2						
Sample Date	Oct 04, 2025 10:20 AM						
Sample Description	Wastewater						
Location	Storage Tank						
Date Analysis Commenced	Oct 0v, 2025						
Condition of Sample	Contained in one amPer glass Pottle and 7bir plasti Pottles, sample untainers comply to pretreatment - presercation standards (AFHA, USEFA)						
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOD (5 days at 20 degree C)	mg/L	-	2.0	182	≤20	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 5210 B, part 8500 - O G	Bangkok
Oil & Grease	mg/L	-	3	1v	≤20	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 5520 B	Bangkok
pH at 25 degree C		-	-	v.8	5.5-6.0	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 8500 - H (B)	Bangkok
SettleaPle Solid *	mL/L/hr	-	0.1	0.1	No Standard	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 2580 F	Bangkok
Sbl 7de *	mg/L	-	0.5	1.4	≤1	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 8500-52 (C, F)	Bangkok
Total Dissolced solids Dried at 190 degree C	mg/L	-	5	288	≤1000	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 2580 C	Bangkok
Total Kjeldahl Nitrogen as N *	mg/L	0.15	1.0	35.0	≤35	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 8500-Norg (C)	Bangkok
Total Sispended Solids Dried at 103-105 degree C	mg/L	-	5	wv	≤30	Standard Methods 7ar the Examination o7 Water and Wastewater. Af HA, AWWA & WEF, 28th ed., 2023, part 2580 D	Bangkok

Guideline : Not/uation of Ministry of Natbral Resobrues and Encrionment B.E. 254v on E7lbent Control Standard 7om Types and Sized o7Bbldings, Type A.

Ree-its apply to the sample(s) as e-bertied, -nece the sampling was und-eed by ALS. The report shall not be resped or used for any other p-ose without the written approval of the Laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

v481101/ EMAIL

S:\Reports\AL_GL_rpt (2 of 4)

Analysis / Test Report

Client : Oaktree Company Limited

2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

P/O : ศุภณัฐ

Project Name :

Project Location :

TESTING
No.0009
Lot ID: 2592538

Date Reissued : Oct 04, 2025

Date Reported : Oct 14, 2025

Report N-miber : 3826502/1

Page 1 of 1

Sample Number		2562539/1					
Sample Date		Oct 04, 2025 10:00 AM					
Sample Description		Cons- nption Water					
Location		Swimming Pool					
Date Analysis Commenced		Oct 0v, 2025					
Condition of Sample		Contained in two plasti bottles, sample untainers comply to pretreatment 7presercation standards (APHA, USEPA)					
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Escherichia coli</i>	in 100 mL	7	7	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 28th ed., 2023, part 6221 B, F	Bangkok
	MPN/100mL	7	7	<1.1	<10	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 28th ed., 2023, part 6221 B	Bangkok
Water Testing							
pH at 25 degree C *		7	7	v.5	v.279.8	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 28th ed., 2023, part 8500 7H (B)	Bangkok
Resid- al Free Chlorine *	mg/L	7	0.1	0.6	0.471.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 28th ed., 2023, part 8500ZC (F)	Bangkok

Guideline : ค่าเบี่ยงเบนมาตรฐานการตรวจวัดตาม อย.บพ. 1/2550 ซึ่ง มาจากอนุกรมการตรวจวัด/การตรวจวัดค่า ทดสอบการวัดค่า ในงานบ่อสาธารณะ

Sampling By : Pichai Boonyong

- Remark :
- LOD : Limit of Detection
 - LOQ : Lower than LOQ (Limit of Q-antitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not ind- ded in slope of Aureditation ISO/IEC 1v025.
 - Sampling is not ind- ded in slope of aureditation ISO/IEC 1v025

Ree-its apply to the sample(s) as e-bertied, -nece the sampling was und-eed by ALS. The report shall not be resped or used for any other p-ose without the written approval of the Laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

v481701/ EMAIL

S:\Reports\AL_GL_rpt (4 of 4)

u.16/11



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาว
Project Name :
Project Location :

Lot ID: 2592538
Date Received : Oct 06, 2025
Date Reported : Oct 17, 2025
Report Number : 3429504-1

Page 1 of 5

Sample Number 2592538-3
Sampled Date Oct 06, 2025 10:10 AM
Sample Description Drinking Water
Location Domestic Water
Date Analysis Commenced Oct 07, 2025
Condition of Sample Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Metals Testing							
Aluminum	mg/L	0.003	0.005	0.04	≤0.2	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Arsenic	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Barium	mg/L	0.0003	0.0005	0.07	≤1.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Cadmium	mg/L	0.0003	0.0005	Not Detected	≤0.005	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Calcium	mg/L	0.01	0.10	22.8	No Standard	In-house method : STM 05-014 based on United States Environmental Protection Agency, 1994, EPA Method 200.7	Bangkok
Chromium	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Copper	mg/L	0.0003	0.0005	0.002	≤1.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Iron	mg/L	0.003	0.005	<0.005	≤0.3	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

LIFE SCIENCES
RIGHT SOLUTIONS RIGHT PARTNER

7541-101 / EMAIL

S:\Reports\AL_GLP\ (6.38PM)



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาว
Project Name :
Project Location :

Lot ID: 2592538
Date Received : Oct 04, 2025
Date Reported : Oct 14, 2025
Report Number : 3826503-1

Page 2 of 2

Sampling by : f i l i a l Boonyong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * & are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of Accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

LIFE SCIENCES
RIGHT SOLUTIONS RIGHT PARTNER

7481-101 / EMAIL

S:\Reports\AL_GLP\ (2:04PM)



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวจิราพร
Project Name :
Project Location:

Lot ID: 2592538
Date Received : Oct 06, 2025
Date Reported : Oct 17, 2025
Report Number : 3429504-1

Page 3 of 5

Sample Number	2592538-3
Sampled Date	Oct 06, 2025 10:10 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Oct 07, 2025
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Clostridium perfringens</i>	in 100 mL	-	-	Not Detected	No Standard	In-house method STM No. 01-012 In connection with: - Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9274 B - FDA BAM online, 2001 (Chapter 16)	Bangkok
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Not Detected	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok
<i>Salmonella</i> spp.	in 100 mL	-	-	Not Detected	Not Detected	ISO 19250 (2010)	Bangkok
Standard Plate Count	CFU/mL	-	-	320	No Standard	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9215 B	Bangkok
<i>Staphylococcus aureus</i>	CFU/100mL	-	-	<1	≤100	In-house method STM No. 01-054 In connection with: - Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9213 B - FDA BAM online, 2016 (Chapter 12)	Bangkok
Total Coliform	MPN/100mL	-	-	<1.1	<2.2	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 9221 B	Bangkok
Water Testing							
Alky/benzene Sulfonate as MBAS	mg/L	0.05	0.1	Not Detected	≤0.2	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5540 C	Bangkok
Chloride as Cl	mg/L	0.06	0.2	17.3	≤250.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4110 B	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7941-101/ EMAIL

S:\Reports\AL_GL\pt (6.38PM)



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : นางสาวจิราพร
Project Name :
Project Location:

Lot ID: 2592538
Date Received : Oct 06, 2025
Date Reported : Oct 17, 2025
Report Number : 3429504-1

Page 2 of 5

Sample Number	2592538-3
Sampled Date	Oct 06, 2025 10:10 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Oct 07, 2025
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Metals Testing							
Lead	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Manganese	mg/L	0.0003	0.0005	0.002	≤0.05	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Mercury	mg/L	0.0001	0.0005	Not Detected	≤0.002	In-house method : STM 05-007 based on United States Environmental Protection Agency, 2002, EPA Method 1631, Revision E	Bangkok
Selenium	mg/L	0.0003	0.0005	Not Detected	≤0.01	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Silver	mg/L	0.0003	0.0005	Not Detected	≤0.05	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok
Sodium	mg/L	0.01	0.10	12.4	No Standard	In-house method : STM 05-014 based on United States Environmental Protection Agency, 1994, EPA Method 200.7	Bangkok
Zinc	mg/L	0.003	0.005	0.76	≤5.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 3125 B.3030 F	Bangkok

Microbiological Testing

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7941-101/ EMAIL

S:\Reports\AL_GL\pt (6.38PM)



Analysis / Test Report

ISO/IEC 17025

Accreditation No. 10311/47

Lot ID: 2592538

Date Received : Oct 06, 2025

Date Reported : Oct 17, 2025

Report Number : 3429504-1

Client : Oaktree Company Limited

P/O : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Project Name : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Project Location : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Page 5 of 5

Sample Number	2592538-3
Sampled Date	Oct 06, 2025 10:10 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Oct 07, 2025
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
B ater Testing							
Total Hardness as CaCO3	mg/L	0.5	1	75	≤100	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2340 C	Bangkok
Total Solids Dried at 103-105 degree C	mg/L	-	5	130	≤500	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 B	Bangkok
Turbidity	NTU	-	0.1	0.30	≤5	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2150 B	Bangkok

Guideline : Notification of the Ministry of Public Health No. 61 B.E. 2524 & 135 B.E. 2534 on bottled drinking water (No.2) & 316 B.E. 2553 & Pathogenic 416

B.E. 2563

Sampling vy : Pichai Boonyong

- Remark :
- LOD : Limit of Detection
 - "≤" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197

ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7641-101/ EMAIL

S:\Reports\AL_GL.rpt (6.38PM)



Analysis / Test Report

ISO/IEC 17025

Accreditation No. 10311/47

Lot ID: 2592538

Date Received : Oct 06, 2025

Date Reported : Oct 17, 2025

Report Number : 3429504-1

Client : Oaktree Company Limited

P/O : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Project Name : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Project Location : 2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500

Page 4 of 5

Sample Number	2592538-3
Sampled Date	Oct 06, 2025 10:10 AM
Sample Description	Drinking Water
Location	Domestic Water
Date Analysis Commenced	Oct 07, 2025
Condition of Sample	Contained in two glass vials and seven plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
B ater Testing							
Color	Color unit	-	5	<5	≤20	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2120 B	Bangkok
Cyanide as CN	mg/L	0.002	0.005	Not Detected	≤0.1	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - CN (C, E)	Bangkok
Fluoride as F	mg/L	0.05	0.1	0.2	≤1.5	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4110 B	Bangkok
Nitrate as N	mg/L	0.06	0.2	0.3	≤4	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4110 B	Bangkok
Odour	-	-	-	Odourless	Odourless	In-house method : STM 04-025 based on Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2150 B	Bangkok
pH at 25 degree C	-	-	-	7.5	6.5-8.5	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4500 - H (B)	Bangkok
Phenol	mg/L	0.0005	0.001	Not Detected	≤0.001	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 5530 D	Bangkok
Sulfate	mg/L	0.15	0.5	8.0	≤250.0	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 4110 B	Bangkok
Total Dissolved solids Dried at 180 degree C	mg/L	-	5	126	No Standard	Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023, part 2540 C	Bangkok

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197

ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7641-101/ EMAIL

S:\Reports\AL_GL.rpt (6.38PM)

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom
P/O : สัญญาจ้าง
Project Name :
Project Location:

TESTING
No. 0009
Lot ID: 2599119

Date Received : Nou 04, 2025
Date Reported : Nou 14, 2025
Report N6m-er : 4v5003381

baqe 2 op2

Sampling By : Theeraphol Sanathong

Remark :

- LOD : Limit of Detection
- <L : Lo9er than LO" Limit of" Quantitation/ LO" Limit of Reporting
- Sample#Hmarked G is/are not included in scope of Accreditation
- Sampling is not included in scope of Accreditation

baqe 1 op2

Sample Number		253311302					
Sample Date		Nov 04, 2025 10:20 Af					
Sample Description		7 aste9 ater					
Location		Storage Tank					
Date Analysis Commenced		Nov 0v, 2025					
Condition of Sample		Contained in one am-er glass -ottle and R6r plastic -ottles, sample containers comply to pretreatment 8 preservation standards MbAbv, v56 BAH					
Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing	mg/L	8	210	1v1	8.20	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part 5210 B, part v500 8 O .	Bangkok
Oil) . rease	mg/L	8	4	1v	8.20	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part 5520 B	Bangkok
pWat 25 degree C		8	8	F6	555810	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part v500 8 W10H	Bangkok
Settle- le Solid G	mL/L/hr	8	01	≤01	No Standard	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part 25v0 x	Bangkok
SEIRde G	mg/L	8	015	≤015	&1	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part v50082 N,	Bangkok
Total Dissolved solids Dried at 1*0 degree C	mg/L	8	5	25K	8.1000	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part 25v0 C	Bangkok
Total j aldaH Nitrogen as N G	mg/L	015	110	4*1F	8.45	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part v5008Norg	Bangkok
Total S6pendent Solids Dried at 1048.05 degree C	mg/L	8	5	5F	8.40	Standard f ethods for the (Lamination oP7 ater and 7 aste9 aterEAbvA, A7 7 A) 7 (x, 2vth eEf, 2024, part 25v0 D	Bangkok

Guideline : Notification of Primary Resources and (Environment) Standard Prom Types and Silled PB61dings, Type AE

Approved by

Results apply to the sample unless the sampling is conducted by a different method. The report shall not be reproduced without the written approval of the laboratory.

Approved by

Results apply to the sample unless the sampling is conducted - y
ALSE The report shall not be reproduced except in full or litho the 9 ritten approval
of the laboratory

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

www.alsglobal.com

 Kv18101/ (f AQ

FKv18101/ (f AQ.

S: Reports J All. Left M5:12bf H



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : ศุภกิจจาง
Project Name :
Project Location :
Sample Number : 2510w0PBL
Sample Date : ue401, 2025 12:15 - f
Sample Description : Consumption 9 ater
Location : SMimming -ool
Date Analysis Commenced : ue401, 2025
Condition of Sample : Contained in b6r plasti4 7ottles, sample 4ontainers 4omply to pretreatment 8preserBation standards VA-wA, (SH-AU

- age 1 ob1

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Escherichia coli</i>	in 100 mL	8	8	Not u ete4ted	Not u ete4ted	Standard f ethods for the H4mination ob9 ater and 9 ase4water) A-wA, A9 9 A x 9 H., 2vth ed), 202c, part 8221 .	Bangkok
<i>Legionella spp</i>) F	C. (/L	8	8	*1	No Standard	<50 113c1 W013U	Bangkok
Total Colliform	f -N/100mL	8	8	*1J1	* 10	Standard f ethods for the H4mination ob9 ater and 9 ase4water) A-wA, A9 9 A x 9 H., 2vth ed), 202c, part 8221 B	Bangkok
Water Testing							
pw at 25 degree C F		8	8	3J0	3J28y	Standard f ethods for the H4mination ob9 ater and 9 ase4water) A-wA, A9 9 A x 9 H., 2vth ed), 202c, part v500 8w WU	Bangkok
Residual . ree Chlorine F	mg/L	8	0J1	0J8	0J8J0	Standard f ethods for the H4mination ob9 ater and 9 ase4water) A-wA, A9 9 A x 9 H., 2vth ed), 202c, part v5008J WU	Bangkok

Guideline : f 407ologHal Testing Result *1 mean Bacteria not bound in agar plate)
Note : f 407ologHal Testing Result *1 mean Bacteria not bound in agar plate)
Sampling By : -angpong womeMong
Remark :
- LOU : Limit ob4et4ction
- I*1 : Lower than LO" Limit ob" GanitationU/LOR Limit obReportingU
- AnalyteUmarked F is/are not included in slope ob4Hediation <50/4C 13025)
- Sampling is not included in slope ob4Hediation <50/4C 13025

Rec7ite apply to the sampleUas 47-mitted, Unless the sampling Has 4one77ed - y ALS) The report shall not e reported unless it is approved by Hetro7the Written approval (Date 13/08/2025)

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : ศุภกิจจาง
Project Name :
Project Location :
Sample Number : 2510c886J
Sample Date : Nou 12, 2025 10:v8 Af
Sample Description : Cons7nption 9 ater
Location : SMimming pool
Date Analysis Commenced : Nou 1c, 2025
Condition of Sample : Contained in one plastiD-ottle, sample Dintainers Dmply to pretreatment 6presenation standards WbwA, (SH-AU

page 1 of 1

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing							
<i>Escherichia coli</i>	in 100 mL	6	6	Not 4ete4ted	Not 4ete4ted	Standard f ethods for the H4mination ob9 ater and 9 ase4water) AbwA, A9 9 A x 9 H., 2vth ed), 202c, part 3221 B, .	Bangkok
Total Colliform	f bN/100mL	6	6	8J1J1	8J10	Standard f ethods for the H4mination ob9 ater and 9 ase4water) AbwA, A9 9 A x 9 H., 2vth ed), 202c, part 3221 B	Bangkok
Water Testing							
pw at 25 degree C F		6	6	8J2	8J26y	Standard f ethods for the H4mination ob9 ater and 9 ase4water) AbwA, A9 9 A x 9 H., 2vth ed), 202c, part v500 6w WU	Bangkok
Resid7al . ree Chlorine F	mg/L	6	0J1	0J8	0Jv8J0	Standard f ethods for the H4mination ob9 ater and 9 ase4water) AbwA, A9 9 A x 9 H., 2vth ed), 202c, part v5008J WU	Bangkok

Guideline : 4านูเนชันของผลตรวจการตรวจผล อดับที่ 1/2550 4้าน การควบคุมการปนเปื้อน/การตรวจวัดค่า ทดสอบการวัดค่า
Sampling By : Ch7iladet 9 arin
Remark :
- LO4 : Limit ob4et4ction
- I*8 : Lower than LOQ Limit obQ7anitationU/LOR Limit obReportingU
- AnalyteUmarked F is/are not included in slope ob4Hediation ISO/HC 18025)
- Sampling is not included in slope ob4Hediation ISO/HC 18025

Rec7ite apply to the sampleUas 47-mitted, Unless the sampling Has 4one77ed - y ALS) The report shall not e reported unless it is approved by Hetro7the Written approval (Date 13/08/2025)

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location :

TESTING
No.0009
Lot ID: 25104406
Date Reported : ue4 01, 2025
Date Reported : ue4 1c, 2025
Report NumPer : v385816-1

Remark :
- LOU : Limit of detection
- <<< : Lower than LOU
- Analytical marked S's are not included in slope of Accreditation QO/QC 18025x
- Sampling is not included in slope of Accreditation QO/QC 18025

Page 2 of 2



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : กรุงเทพมหานคร
Project Name :
Project Location :

TESTING
No.0009
Lot ID: 25104406
Date Reported : ue4 01, 2025
Date Reported : ue4 1c, 2025
Report NumPer : v385816-1

Page 1 of 2

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Water Testing							
BOU 46 days at 20 degree C	mg/L	-	2.0	166	G20	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 5210 B, part 3500 - OF	Bangkok
Oil - Frease	mg/L	-	V	16	G20	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 5520 B	Bangkok
pH at 25 degree C	-	-	-	8w	5.5-c40	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 3500 - (46E	Bangkok
Settleable Solid ≤	mL/L/hr	-	0.4	*0.4	No Standard	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 2530 C	Bangkok
Soluble ≤	mg/L	-	0.5	12	G1	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 3500-S2, 4C, 8E	Bangkok
Total dissolved solids at 180 degree C	mg/L	-	5	286	G1000	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 2530 C	Bangkok
Total dissolved Nitrogen as N ≤	mg/L	0.45	1.0	32c	Gv5	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 3500-Norg	Bangkok
Total Suspended Solids at 10v-105 degree C	mg/L	-	5	55	Gv0	Standard 9 methods for the Uamination of Water and MasterWaterAF (A, AMMA, MUG, 23th edx 202v, part 2530 u	Bangkok

Guideline : Notation of Ministry of Natural Resources and Environment BUK 2568 on U/ient Control Standard 7om Types and S/ed of Buildings, Type Ax
Sampling By : f anipong (onelVong

Results apply to the sample as submitted, unless the sampling was conducted by ALS. The report shall not be responsible for any error without the written approval of the laboratory.

Approved by

Approved by

Signature

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



MR-05

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 809434
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 347571- ul

Page 1 of 1

Sample Number 25104406M4
Sample Date Dec 01, 2025 12:20 F W
Sample Description Consumption water
Location Spa water Sample Room Srihapapata
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in 160 plastic bottles, sample containers comply to pretreatment upreservation standards 84Y (A, HSLF AE

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	u	u	Not Detected	Not Detected	.SO 11731.82017E	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower BUN 2544
Note : FF Not Detected mean Bacteria not found in agar plate

Sampling By : Panpong Homewong

Remark :
- LOD : Limit of Detection
- Q/Q : Lower than LOD
- Q/Q : Lower than LOD

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used for any purpose without the written approval of the laboratory.

Approved by

Signature (e3d)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

7941-001/ UML

S:\Reports\AN_L\7941-001 ME



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 809434
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 3475717-1

Page 1 of 1

Sample Number 25104406-3
Sample Date Dec 01, 2025 12:41 PM
Sample Description Consumption Water
Location Shower Water Sample : Guest room 2218
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Panpong Homewong

Remark :
- LOD : Limit of Detection
- "x" : Lower than LOD (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used for any purpose without the written approval of the laboratory.

Approved by

Signature (e3d)

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

7941-001/ EMAIL

S:\Reports\AN_GL\7941-001

u.16/18



MR-05

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 8099430
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 3475720-1

Page 1 of 1

Sample Number 25104406-6
Sampled Date Dec 01, 2025 12:55 PM
Sample Description Consumption Water
Location Underground Tank
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "L" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 8099430
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 3475719-1

Page 1 of 1

Sample Number 25104406-5
Sampled Date Dec 01, 2025 12:36 PM
Sample Description Consumption Water
Location Cooling Tower Water Sample
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "L" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



MR-05

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 8099434
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 3475722-1

Page 1 of 1

Sample Number 25104406-8
Sampled Date Dec 01, 2025 12:50 PM
Sample Description Consumption Water
Location Kitchen
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 (2017)	Bangkok

Guideline : Notification of Department of Health about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Panupong Homewong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : 8099434
Project Name :
Project Location :

Lot ID: 25104406
Date Received : Dec 01, 2025
Date Reported : Dec 20, 2025
Report Number : 3475721-1

Page 1 of 1

Sample Number 25104406-7
Sampled Date Dec 01, 2025 12:30 PM
Sample Description Consumption Water
Location Roof Tank
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards WPT (A, HSEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Guideline / Specification	Method	Testing Location
Microbiological Testing <i>Legionella spp.</i>	CFU/L	-	-	Not Detected**	Not Detected	ISO 11731 W017)	Bangkok

Guideline : Notification of Department of (ealth about Legionella Control in Cooling Tower B.E. 2544
Note : ** Not Detected mean Bacteria not found in agar plate.

Sampling By : Panupong (onelong

Remark :
- LOD : Limit of Detection
- "<" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in full without the written approval of the laboratory.

Approved by



ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



ISO/IEC 17025
Accreditation No. 10311/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : : ๔๐๑๖-๔๖
Project Name :
Project Location :

Lot ID: 25104406
Date Received :Dec 01, 2025
Date Reported :Dec 20, 2025
Report Number :834542391

Page 1 of 1

Sample Number 2510330P910
Sample Date Dec 01, 2025 12:31 uf
Sample Description Cons7mpton Mater
Location Shower Water Sample Room 221w
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment 9 preservation standards (AuHA, USEUA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	9	9	Not Detected	Standard f. ehtods for the Examination ob Mater and WasteWater. AuHA, AMMA & MEF, 23th ed., 2028, part Q21 F	Bangkok

Sampling By : uan7pong HomeMong

Remark :
- LOD :Limit obDetection
- "<" :LoWer than "LO" (Unit ob "7anitation) / LOR (Limit obReporting)
- Analyte(s) marked 1 is/are not inst7aded in scope obAccreditation ISO/IEC 14025.
- Sampling is not ind7aded in scope obaccreditation ISO/IEC 14025

Results apply to the sample(s) as 77-mitted, 77unless the sampling Was cond7cted -y ALS. The report shall not -e respo7sible without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



ISO/IEC 17025
Accreditation No. 10311/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : : ๔๐๑๖-๔๖
Project Name :
Project Location :

Lot ID: 25104406
Date Received :Dec 01, 2025
Date Reported :Dec 20, 2025
Report Number :3475723-1

Page 1 of 1

Sample Number 25104406-9
Sample Date Dec 01, 2025 12:36 PM
Sample Description Consumption Water
Location Cooling Tower Water Sample
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater. APHA, AMWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Panupong Homewong

Remark :
- LOD :Limit of Detection
- "<" :Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
- Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
- Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be responsible without the written approval of the laboratory.

Approved

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : รุ่งอรุณ
Project Name :
Project Location :

Lot ID: 25104406
Date Received :Dec 01, 2025
Date Reported :Dec 20, 2025
Report Number :347572- u

Page 1 of 1

Sample Number 2510440-u2
Sampled Date Dec 01, 2025 12:15 f 9
Sample Description Consumption Mater
Location f ool
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment upreservation standards w/ (A, HSLIF AE

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	u	u	Not Detected	Standard 9 ethods for the U/amination of Mater and MasteWatersAF (A, AMMA . MUX, 24th edx, 2023, part F221 &	Bangkok

Sampling By : f anbporg (onelMong
Remark :
- LOD :Limit ofDetection
- "u" : Lower than LOQ w/limit ofQuantitationE/ LOR w/limit ofReportingE
- AnalyteEmarked * is/are not included in scope ofAccreditation ISO/ILC 17025x
- Sampling is not included in scope of accreditation ISO/ILC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in any way without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



Analysis / Test Report

ISO/IEC 17025
Accreditation No. 10311/47

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : รุ่งอรุณ
Project Name :
Project Location :

Lot ID: 25104406
Date Received :Dec 01, 2025
Date Reported :Dec 20, 2025
Report Number :3475725-1

Page 1 of 1

Sample Number 25104406-11
Sampled Date Dec 01, 2025 12:20 P9
Sample Description Consumption Mater
Location Spa Mater Sample Room Srihapapata
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards w/ (A, HSLPAE

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard 9 ethods for the U/amination of Mater and MasteWatersAF (A, AMMA . MUX, 24th edx, 2023, part F221 &	Bangkok

Sampling By : Panupong (onelMong
Remark :
- LOD :Limit ofDetection
- "u" : Lower than LOQ w/limit ofQuantitationE/ LOR w/limit ofReportingE
- AnalyteEmarked * is/are not included in scope ofAccreditation ISO/ILC 17025x
- Sampling is not included in scope of accreditation ISO/ILC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or used in any way without the written approval of the laboratory.

Approved by

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company



ISO/IEC 17025
Accreditation No. 1031/47

Analysis / Test Report

Client : Oaktree Company Limited
2, North Sathorn Road, Silom, Bangrak, Bangkok Thailand 10500
P/O : ศุภฤกษ์
Project Name :
Project Location :

Lot ID: 25104406
Date Received :Dec 01, 2025
Date Reported :Dec 20, 2025
Report Number :3475727-1

Page 1 of 1

Sample Number 25104406-13
Sampled Date Dec 01, 2025 12:50 PM
Sample Description Consumption Water
Location Kitchen
Date Analysis Commenced Dec 02, 2025
Condition of Sample Contained in two plastic bottles, sample containers comply to pretreatment - preservation standards (APHA, USEPA)

Analyte	Unit	LOD	LOQ (LOR)	Result	Method	Testing Location
Microbiological Testing						
<i>Escherichia coli</i>	in 100 mL	-	-	Not Detected	Standard Methods for the Examination of Water and Wastewater: APHA, AWWA & WEF, 24th ed., 2023, part 9221 F	Bangkok

Sampling By : Panupong Homewong

- Remark :
- LOD : Limit of Detection
 - " <" : Lower than LOQ (Limit of Quantitation) / LOR (Limit of Reporting)
 - Analyte(s) marked * is/are not included in scope of Accreditation ISO/IEC 17025.
 - Sampling is not included in scope of accreditation ISO/IEC 17025

Results apply to the sample(s) as submitted, unless the sampling was conducted by ALS. The report shall not be reproduced or copied in any form without the written approval of the laboratory.

Approved by

Section Head

ADDRESS 104 Phatthanakan 40, Phatthanakan Rd., Khwaeng Phatthanakan, Khet Suan Luang, Bangkok 10250 Thailand | PHONE +66 0 2760 3000 | FAX +66 0 2760 3197
ALS LABORATORY GROUP (THAILAND) CO., LTD. An ALS Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

7641-101/ EMAIL

S:\Reports\AL_NSG\prf (136PW)