ภาคผนวกที่ 2

ผลการติดตามตรวจสอบคุณภาพสิ่งแวดล้อม

ภาคผนวกที่ 2.1

ผลการตรวจวิเคราะห์คุณภาพน้ำผ่านการบำบัด (EFFLUENT)

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6801-243

Report No.W 6801-231

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 22/01/2025	SAMPLE NO.	: 6801-947
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.58 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
		(MS. JUTAPORN JUTAMAST ว-176-จ-0006)	
TESTED DATE	: 22/01/2025-03/02/2025	RECEIVED DATE	: 22/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	180
Total Suspended Solids	mg/l	Dried at 103-105 °C	102

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7868-9 Fax : 0-7661-7870

Request No. 6801-243

Report No.W 6801-231

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 22/01/2025	SAMPLE NO.	: 6801-948
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 08.00 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
		(MS. JUTAPORN JUTAMAST ว-176-จ-0006)	
TESTED DATE	: 22/01/2025-03/02/2025	RECEIVED DATE	: 22/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric	7.05	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	29.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 ^{o}C	95.0	≤ 40
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	38.29	≤ 35
Total Dissolved Solids	mg/l	Dried at 180 ^{o}C	556	≤ 1,000
Sulfide	mg/l as S^{2-}	Iodometric	1.20	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภทและขนาด (ประเภท ข)

Ex

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6801-243

Report No.W 6801-251

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 22/01/2025	SAMPLE NO.	: 6801-948
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 08.00 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 22/01/2025-03/02/2025	RECEIVED DATE	: 22/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Grease & Oil	mg/l	Partition-Gravimetric	1.0	≤ 20
Settleable Solids	ml/l	Volumetric	1.3	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	350,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6802-246

Report No.W 6802-273

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-883
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 11.16 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ว-176-จ-0006)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	212
Total Suspended Solids	mg/l	Dried at 103-105 °C	423

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7666-8 Fax : 0-7661-7670

Request No. 6802-246

Report No.W 6802 273

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-884
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 11.14 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ว-176-จ-0006)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric	7.13	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	74.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 $^{\circ}$C	216	≤ 40
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	39.90	≤ 35
Total Dissolved Solids	mg/l	Dried at 180 $^{\circ}$C	400	≤ 1,000
Grease & Oil	mg/l	Partition-Gravimetric	37.0	≤ 20
Sulfide	mg/l as S^{2-}	Iodometric	2.47	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภทและขนาด (ประเภท ข)

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax . 0-7661-7670

Request No. 6802-236

Report No.W 6-02-253

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-884
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 11.14 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	ml/l	Volumetric	1.5	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	16,000,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6803-205

Report No.W 6803-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-755
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.21 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST จ-176-จ-0006)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	93.0
Total Suspended Solids	mg/l	Dried at 103-105 °C	134

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

Ex [redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6803-205

Report No.W 6803-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-756
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.23 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ๑-๑๗๖-๑-๐๐๐๖)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric	7.27	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	50.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 $^{\circ}$C	180	≤ 40
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	38.71	≤ 35
Total Dissolved Solids	mg/l	Dried at 180 $^{\circ}$C	520	≤ 1,000
Grease & Oil	mg/l	Partition-Gravimetric	4.0	≤ 20
Sulfide	mg/l as S^{2-}	Iodometric	1.67	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 botties), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6805-305

Report No.W 6805-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-756
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.23 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	ml/l	Volumetric	0.9	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	5,400,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6804-142

Report No.W 6804-207

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-588
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 00.16 M
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST 3-176-3-0006)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	220
Total Suspended Solids	mg/l	Dried at 103-105 °C	96.0

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation. Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6804-142

Report No.W 6804-207

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-589
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 00.18 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ว-176-จ-0006)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric	7.02	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	63.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 $^{\circ}$C	147	≤ 40
Total Dissolved Solids	mg/l	Dried at 180 $^{\circ}$C	306	≤ 1,000
Sulfide	mg/l as S^{2-}	Iodometric	1.80	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7586-9 Fax . 0-7661-7670

Request No. 68-04-[illegible]

Report No. [illegible]-2025

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-589
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 00.18 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	3.29	≤ 35
Grease & Oil	mg/l	Partition-Gravimetric	ND	≤ 20
Settleable Solids	ml/l	Volumetric	0.9	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	2,200,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6805-176

Report No.W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-704
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 09.31 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST จ-176-จ-0006)
TESTED DATE	: 16-26/05/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 27/05/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	420
Total Suspended Solids	mg/l	Dried at 103-105 °C	133

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6805-176

Report No.W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-705
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 09.30 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ว-176-จ-0006)
TESTED DATE	: 16-26/05/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 27/05/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25^{0}C	-	Electrometric	7.09	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test. Azide modification Method	23.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 $^{\circ}$C	34.0	≤ 40
Total Dissolved Solids	mg/l	Dried at 180 $^{\circ}$C	520	≤ 1,000
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	35.00	≤ 35

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6805-176

Report No.W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-705
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 09.30 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 16-26/05/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 27/05/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Grease & Oil	mg/l	Partition-Gravimetric	1.0	≤ 20
Sulfide	mg/l as S^{2-}	Iodometric	0.40	≤ 1
Settleable Solids	ml/l	Volumetric	0.1	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	540,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6806-146

Report No.W 6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-545
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.37 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
		(MS. JUTAPORN JUTAMAST ว-176-จ-0006)	
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	308
Total Suspended Solids	mg/l	Dried at 103-105 °C	113

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7662-9 Fax : 0-7661-7670

Request No. 6806-146

Report No.W 6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-546
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.38 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST ว-176-ง-0006)
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25^{0}C	-	Electrometric	7.11	5.5 - 9.0
BOD_5	mg/l	5-Day BOD Test, Azide modification Method	54.0	≤ 30
Total Suspended Solids	mg/l	Dried at 103-105 $^\circ$C	64.0	≤ 40
Total Dissolved Solids	mg/l	Dried at 180 $^\circ$C	414	≤ 1,000
Total Kjeldahl Nitrogen	mg/l	Macro-Kjeldahl	28.21	≤ 35
Grease & Oil	mg/l	Partition-Gravimetric	4.0	≤ 20
Sulfide	mg/l as S^{2-}	Iodometric	0.67	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Report No.W6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-546
SAMPLING CONDITION	: Wastwater Treatment	SAMPLING TIME	: 10.38 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	ml/l	Volumetric	ND	-
Total Coliform Bacteria	MPN/100 ml	MPN Test	5,400,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 boules), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบ ตามวิธีของห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No.W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-718
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.20 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
		(MS. JUTAPORN JUTAMAST จ-176-จ-0006)	
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	390
Total Suspended Solids	mg/L	Dried at 103-105 °C	130

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล มีกลิ่นเหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้นทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Sriscontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No.W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-562
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST จ-176-จ-0006)
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25^{0}C	-	Electrometric Method	7.16	5.5 - 9.0
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	52.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 $^{\circ}$C	122	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 $^{\circ}$C	638	≤ 1,000
Total Kjeldahl Nitrogen	mg/L	Macro-Kjeldahl, Titrimetric Method	29.40	≤ 35
Grease & Oil	mg/L	Liquid-Liquid, Partition-Gravimetric Method	8.0	≤ 20
Sulfide	mg/L as S^{2-}	Iodometric Method	1.67	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No.W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-562
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	mL/L	Volumetric Method	0.2	-
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	9,200,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6808-0124

Report No.W 6808-0200

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0479
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 10.33 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST 3-176-9-0006)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	370
Total Suspended Solids	mg/L	Dried at 103-105 ^{O}C (Part 2540D)	196

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7601-7668-9 Fax 0-7601-7670

Report No.W-0806-0480

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0480
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 10.35 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST 3-176-9-0006)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric Method	7.10	5.5 - 9.0
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	62.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 ^{o}C (Part 2540D)	170	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 ^{o}C (Part 2540C)	654	≤ 1,000
Total Kjeldahl Nitrogen	mg/L	Macro-Kjeldahl, Titrimetric Method	33.32	≤ 35
Grease & Oil	mg/L	Liquid-Liquid, Partition-Gravimetric Method	22.0	≤ 20
Sulfide	mg/L as S^{2-}	Iodometric Method	1.93	≤ 1

PHYSICAL APPEARANCE : 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. [illegible]

Report No.W 6808-0030

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0480
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 10.35 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	mL/L	Volumetric Method	25.0	-
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	2,400,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น 2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6809-0218

Report No.W 6809-0323

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0808
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.20 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-16/09/2025		(MS. JUTAPORN JUTAMAST ว-176-ง-0006)
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	370
Total Suspended Solids	mg/L	Dried at 103-105 ^{O}C (Part 2540D)	196

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax. 0-7661-7670

Report No.: 6[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เลสซิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0809
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-16/09/2025		(MS. JUTAPORN JUTAMAST 1-176-1-0006)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25^{0}C	-	Electrometric Method	6.75	5.5 - 9.0
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	68.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 ^{O}C (Part 2540D)	244	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 ^{o}C (Part 2540C)	627	≤ 1,000
Grease & Oil	mg/L	Liquid-Liquid, Partition-Gravimetric Method	5.0	≤ 20
Sulfide	mg/L as S^{2-}	Iodometric Method	1.60	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

[redacted]

REPORTED ANALYSIS REFER TO SUBMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6809-0218

Report No.W 6809-0323

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0809
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-16/09/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Total Kjeldahl Nitrogen	mg/L	Macro-Kjeldahl, Titrimetric Method	0.42	≤ 35
Settleable Solids	mL/L	Volumetric Method	1.0	-
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	9,200,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

END OF REPORT

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6810-0105

Report No.W 6810-0167

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 08/10/2025	SAMPLE NO.	: 6810-0422
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.00 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: CUSTOMER
TESTED DATE	: 08-20/10/2025	RECEIVED DATE	: 08/10/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	236
Total Suspended Solids	mg/L	Dried at 103-105 °C (Part 2540D)	278

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7679

Request No. 6810-0167

Report No.W 6810-0167

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 08/10/2025	SAMPLE NO.	: 6810-0423
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.10 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: CUSTOMER
TESTED DATE	: 08-20/10/2025	RECEIVED DATE	: 08/10/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C	-	Electrometric Method	6.83	5.5 - 9.0
BOD_5	mg/L	5-Day BOD Test, Azide modification Method	94.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 $^{\circ}$C (Part 2540D)	131	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 $^{\circ}$C (Part 2540C)	248	≤ 1,000
Total Kjeldahl Nitrogen	mg/L	Macro-Kjeldahl, Titrimetric Method	33.18	≤ 35
Grease & Oil	mg/L	Liquid-Liquid, Partition-Gravimetric Method	17.0	≤ 20
Sulfide	mg/L as S^{2-}	Iodometric Method	2.47	≤ 1

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

R [redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Sriscontorn, Talang, Phuket 83110 Tel. 0-7661-7660-9 Fax : 0-7661-7670

Report No. [illegible]

Report No. W [illegible]-0167

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 08/10/2025	SAMPLE NO.	: 6810-0423
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME	: 11.10 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: CUSTOMER
TESTED DATE	: 08-20/10/2025	RECEIVED DATE	: 08/10/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids	mL/L	Volumetric Method	1.5	-
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	35,000,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles), G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

REMARK 1) Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF. 24th ed., 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6811-0148

Report No.W 6811-0175

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[/3]	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[/3]	: 12/11/2025	SAMPLE NO.	: 6811-0383
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[/3]	: 01.52 PM
SAMPLING METHOD[/3]	: GRAB	SAMPLING BY[/3]	: CUSTOMER
TESTED DATE	: 12-22/11/2025	RECEIVED DATE	: 12/11/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/11/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5[/1]	mg/L	5-Day BOD Test, Azide modification Method	380
Total Suspended Solids	mg/L	Dried at 103-105 °C (Part 2540D)	135

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK

1. [/1] : Out of accredited scope by TISI (ISO/IEC 17025:2017)
2. [/2] : Out of accredited scope of private analysis laboratories 2.-176
3. [/3] : Information received from customer

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Sriscontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6811-0175

Report No.W 6811-0175

TEST REPORT

CUSTOMER	: บริษัท เดอะซิวิว เดสทินชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[3]	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[3]	: 12/11/2025	SAMPLE NO.	: 6811-0568
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[3]	: 10.00 AM
SAMPLING METHOD[3]	: GRAB	SAMPLING BY[3]	: CUSTOMER
TESTED DATE	: 12-22/11/2025	RECEIVED DATE	: 12/11/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/11/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 °C[1]	-	Electrometric Method	6.91	5.5 - 9.0
BOD_5[1]	mg/L	5-Day BOD Test, Azide modification Method	92.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 °C (Part 2540D)	126	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 °C (Part 2540C)	165	≤ 1,000
Total Kjeldahl Nitrogen[1]	mg/L	Macro-Kjeldahl, Titrimetric Method	20	≤ 35
Sulfide[1]	mg/L as S^{2-}	Iodometric Method	1.87	≤ 1
Grease & Oil[1]	mg/L	Liquid-Liquid, Partition-Gravimetric Method	11.0	≤ 20

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น 2. Container : normal [PE 2.0 L , G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6[illegible]

Report No.W. 6811-0175

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[3]	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[3]	: 12/11/2025	SAMPLE NO.	: 6811-0568
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[3]	: 10.00 AM
SAMPLING METHOD[3]	: GRAB	SAMPLING BY[3]	: CUSTOMER
TESTED DATE	: 12-22/11/2025	RECEIVED DATE	: 12/11/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/11/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids[1,2]	mL/L	Volumetric Method	0.4	≤ 20
Total Coliform Bacteria[1,2]	MPN/100 mL	MPN Test Method	5,400,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L , G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK
1. [1] : Out of accredited scope by TISI (ISO/IEC 17025:2017)
2. [2] : Out of accredited scope of private analysis laboratories ว.-176

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6812-0235

Report No.W 6812-032

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[/3]	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[/3]	: 18/12/2025	SAMPLE NO.	: 6812-1020
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[/3]	: 10.00 AM
SAMPLING METHOD[/3]	: GRAB	SAMPLING BY[/3]	: CUSTOMER
TESTED DATE	: 18-24/12/2025	RECEIVED DATE	: 18/12/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	น้ำก่อนเข้าระบบบำบัด (Influent)
BOD_5[/1]	mg/L	5-Day BOD Test, Azide modification Method	150
Total Suspended Solids	mg/L	Dried at 103-105 °C (Part 2540D)	192

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล เหม็น

2. Container : normal [PE 2.0 L (2 bottles)]

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK

1. [/1] : Out of accredited scope by TISI (ISO/IEC 17025:2017)
2. [/2] : Out of accredited scope of private analysis laboratories 1.-176
3. [/3] : Information received from customer

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6812-0285

Report No.W 6812-052

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[3]	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[3]	: 18/12/2025	SAMPLE NO.	: 6812-1021
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[3]	: 10.10 AM
SAMPLING METHOD[3]	: GRAB	SAMPLING BY[3]	: CUSTOMER
TESTED DATE	: 18-24/12/2025	RECEIVED DATE	: 18/12/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
pH at 25 ^{0}C[1]	-	Electrometric Method	7.63	5.5 - 9.0
BOD_5[1]	mg/L	5-Day BOD Test, Azide modification Method	15.0	≤ 30
Total Suspended Solids	mg/L	Dried at 103-105 $^{\circ}$C (Part 2540D)	12	≤ 40
Total Dissolved Solids	mg/L	Dried at 180 $^{\circ}$C (Part 2540C)	242	≤ 1,000
Total Kjeldahl Nitrogen[1]	mg/L	Macro-Kjeldahl, Titrimetric Method	35.00	≤ 35
Sulfide[1]	mg/L as S^{2-}	Iodometric Method	0.27	≤ 1
Grease & Oil[1]	mg/L	Liquid-Liquid, Partition-Gravimetric Method	1.0	≤ 20

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล 2. Container : normal [PE 2.0 L , G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567
เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

[1] ... TIS) (ISO/IEC 17025:2017)

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks,
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6-12-0035

Report No. W 6812-022

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE[3]	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE[3]	: 18/12/2025	SAMPLE NO.	: 6812-1021
SAMPLING CONDITION	: Wastewater Treatment	SAMPLING TIME[3]	: 10.10 AM
SAMPLING METHOD[3]	: GRAB	SAMPLING BY[3]	: CUSTOMER
TESTED DATE	: 18-24/12/2025	RECEIVED DATE	: 18/12/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการบำบัด (Effluent)	STANDARD
Settleable Solids[1,2]	mL/L	Volumetric Method	ND	≤ 20
Total Coliform Bacteria[1,2]	MPN/100 mL	MPN Test Method	92,000	-

PHYSICAL APPEARANCE 1. Sample : ขุ่นมีตะกอนแขวนลอยสีน้ำตาล

2. Container : normal [PE 2.0 L , G 0.5 L]

STANDARD : ประกาศกระทรวงทรัพยากรธรรมชาติ และสิ่งแวดล้อม พ.ศ. 2567

เรื่อง กำหนดมาตรฐานควบคุมการระบายน้ำทิ้งจากอาคาร บางประเภท และบางขนาด (ประเภท ข)

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK

1. [1] : Out of accredited scope by TISI (ISO/IEC 17025:2017)
2. [2] : Out of accredited scope of private analysis laboratories 3.-176
3. [3] : Information received from customer

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

ภาคผนวกที่ 2.2

ผลการตรวจวิเคราะห์คุณภาพน้ำสระว่ายน้ำ (SWIMMING POOL)

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6801-183

Report No. W 6801-174

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 17/01/2025	SAMPLE NO.	: 6801-761
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 11.10 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 17-31/01/2025	RECEIVED DATE	: 17/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6802-246

Report No. W 6802-273

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-886
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.52 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 68/03-205

Report No. W 68/03-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-759
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 09.51 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7651-7368-9 Fax. 0-7651-7370

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-591
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 00.05 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6805-176

Report No. W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เลสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-707
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 09.11 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 16-26/05/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เลสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 27/05/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6806-146

Report No. W 6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-548
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.18 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No. W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-564
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.52 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 ml	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 ml	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6808-012-I

Report No. W 6808-0200

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0482
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.16 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

3) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7677

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0811
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.47 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-26/09/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

3) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY
THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks,
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7651-7668-9 Fax : 0-7651-7670

Request No. [illegible]

Report No. [illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 07/10/2025	SAMPLE NO.	: 6810-0339
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 10.08 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 07-20/10/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 07/10/2025
		REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

2) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

3) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7688-9 Fax : 0-7661-7870

Request No. [illegible]

Report No. W68-[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 10/11/2025	SAMPLE NO.	: 6811-0385
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 01.35 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 10-21/11/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 10/11/2025
		REPORTED DATE	: 21/11/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK 1) Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2) Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6812-0237
Report No. W 6812-0300

TEST REPORT

CUSTOMER	: บริษัท เดอะซิกิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/12/2025	SAMPLE NO.	: 6812-0886
SAMPLING CONDITION	: Swimming Pool	SAMPLING TIME	: 02.02 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 15-22/12/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 15/12/2025
		REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	Swimming Pool "Main Pool"	STANDARD
Total Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	≤ 10
Fecal Coliform Bacteria	MPN/100 mL	MPN Test Method	< 1.8	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD คณะกรรมการสาธารณสุข ฉบับที่ 1/2550 เรื่องการควบคุมการประกอบกิจการสระว่ายน้ำ

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA. WEF, 24th edition, 2023

REMARK 1. Total Coliform bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

2. Fecal Coliform Bacteria < 1.8 mean Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

FM-LAB-034 / Rev.1 / 12-11-68

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

ภาคผนวกที่ 2.3

ผลการตรวจวิเคราะห์คุณภาพน้ำใช้ (WATER SUPPLY)

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7691-7668-9 Fax : 0 7691-7672

Report No. 6801-183

Report No. W 6801-183

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 17/01/2025	SAMPLE NO.	: 6801-760
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.38 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 17-31/01/2025	RECEIVED DATE	: 17/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 605"	STANDARD
pH at 25^{0}C	-	Electrometric	7.34	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	0.07	≤ 0.08
Chloride	mg/l as Cl^-	Argentometric Method	142.18	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	52.0	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.01	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoonlorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax . 0-7661-7670

Request No. 6801-183

Report No. W 6801-174

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 17/01/2025	SAMPLE NO.	: 6801-760
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.38 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 17-31/01/2025	RECEIVED DATE	: 17/01/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 04/02/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 605"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	ND	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks,
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Sriscontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6802-246

Report No. W 6802-273

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-885
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.47 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Canteen"	STANDARD
pH at 25^{0}C	-	Electrometric	7.81	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/l as Cl^{-}	Argentometric Method	42.89	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	0.04	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	120	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.96	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6802-216

Report No. W 6802-273

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 19/02/2025	SAMPLE NO.	: 6802-885
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.47 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 19-28/02/2025	RECEIVED DATE	: 19/02/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 03/03/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Canteen"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	4.5	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7679

Request No. 6803-205

Report No. W 6803-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-757
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.13 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 211"	STANDARD
pH at 25^{0}C	-	Electrometric	7.29	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/l as Cl^-	Argentometric Method	70.19	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	0.03	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	104	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.05	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7579

Request No. 6803-209

Report No. W 6803-227

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/03/2025	SAMPLE NO.	: 6803-757
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.13 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 15-28/03/2025	RECEIVED DATE	: 15/03/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 02/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 211"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	7.8	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6804-[illegible]

Report No. W 6804-20[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-590
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 00.08 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 503"	STANDARD
pH at 25^0C	-	Electrometric	6.86	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	0.02	≤ 0.08
Chloride	mg/l as Cl^-	Argentometric Method	33.09	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	0.05	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	48.0	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.22	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

FM-LAB-034/Rev.0/01-02-66

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6804-142

Report No. W 6804-207

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/04/2025	SAMPLE NO.	: 6804-590
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 00.08 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-24/04/2025	RECEIVED DATE	: 11/04/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/04/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง 503"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	ND	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7651-7668-9 Fax : 0-7651-7670

Request No. 6805-176

Report No. W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-706
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 09.11 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 16/05/2025-05/06/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 06/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Manaw Pool Bar"	STANDARD
pH at 25^{0}C	-	Electrometric	6.89	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/l as Cl^-	Argentometric Method	43.52	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	116	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.11	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

FM-LAB-034/Rev.0/01-02-66

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้นทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7691-7666-9 Fax : 0-7691-7670

Request No. 6805-176

Report No. W 6805-248

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 16/05/2025	SAMPLE NO.	: 6805-706
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 09.11 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 16/05/2025-05/06/2025	RECEIVED DATE	: 16/05/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 06/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Manaw Pool Bar"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	ND	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6806-146

Report No. W 6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-547
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC (MS. JUTAPORN JUTAMAST)
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 213"	STANDARD
pH at 25^{0}C	-	Electrometric	7.59	6.5-8.5
Manganese	mg/l as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/l as Cl^-	Argentometric Method	225.83	≤ 250
Iron	mg/l as Fe	Phenanthroline Method	0.27	≤ 0.3
Hardness	mg/l	EDTA Titrimetric Method	184	≤ 300
Chlorine (Residual)	mg/l as Cl_2	DPD Colorimetric	0.13	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6806-146

Report No. W 6806-219

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 13/06/2025	SAMPLE NO.	: 6806-547
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.19 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 13-24/06/2025	RECEIVED DATE	: 13/06/2025
FILE NAME	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)	REPORTED DATE	: 25/06/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 213"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test	ND	ND
Escherichia Coli	ใน 100 ml	MPN Test	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No. W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-563
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.07 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 204"	STANDARD
pH at 25^{0}C	-	Electrometric Method	6.83	6.5-8.5
Manganese	mg/L as Mn	Persulfate Method	0.02	≤ 0.08
Chloride	mg/L as Cl^-	Argentometric Method	134.51	≤ 250
Iron	mg/L as Fe	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	188	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric	0.01	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6807-147

Report No. W 6807-211

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/07/2025	SAMPLE NO.	: 6807-563
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.07 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-22/07/2025	RECEIVED DATE	: 11/07/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 23/07/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 204"	STANDARD
Total coliform bacteria	ใน 100 ml	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 ml	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6808-0124

Report No. W 6808-0200

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0481
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.27 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 209"	STANDARD
pH at 25^0C	-	Electrometric Method	7.02	6.5-8.5
Manganese	mg/L as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/L as Cl^-	Argentometric Method	65.33	≤ 250
Iron	mg/L as Fe	Phenanthroline Method	0.30	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	70.0	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric Method	0.10	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. [illegible]

Report No. W-[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 11/08/2025	SAMPLE NO.	: 6808-0481
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.27 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
			(MS. JUTAPORN JUTAMAST)
TESTED DATE	: 11-25/08/2025	RECEIVED DATE	: 11/08/2025
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	REPORTED DATE	: 27/08/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 209"	STANDARD
Total coliform bacteria	ใน 100 mL	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 mL	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

2) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax. 0-7661-7670

Request No. [illegible]

Report No. W[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0810
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.05 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-26/9/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 415"	STANDARD
pH at 25^{0}C	-	Electrometric Method	6.94	6.5-8.5
Manganese	mg/L as Mn	Persulfate Method	0.59	≤ 0.08
Chloride	mg/L as Cl^-	Argentometric Method	19.50	≤ 250
Iron	mg/L as Fe	Phenanthroline Method	0.03	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	24.0	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric Method	0.90	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6809-0[illegible]

Report No. W 6809-0333

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 18/09/2025	SAMPLE NO.	: 6809-0810
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 11.05 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 18-26/9/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 18/09/2025
		REPORTED DATE	: 27/09/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "หมายเลขห้อง A 415"	STANDARD
Total coliform bacteria	ใน 100 mL	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 mL	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

2) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks,
Design Construction & Installation of Wastewater Treatment and Recycle System etc

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 68/0809/

Report No. W 6810-0158

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 07/10/2025	SAMPLE NO.	: 6810-0338
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.13 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 07-20/10/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 07/10/2025
		REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Store"	STANDARD
pH at 25^{0}C	-	Electrometric Method	7.10	6.5-8.5
Manganese	mg/L as Mn	Persulfate Method	ND	≤ 0.08
Chloride	mg/L as Cl^{-}	Argentometric Method	42.74	≤ 250
Iron	mg/L as Fe	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	34.0	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric Method	0.16	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) Standard Methods for the Examination of Water and Wastewater, APHA, AWWA & WEF, 24th ed., 2023

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation. Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้นเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 68-10-0338

Report No. W 6810-0338

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 07/10/2025	SAMPLE NO.	: 6810-0338
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 10.13 AM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 07-20/10/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 07/10/2025
		REPORTED DATE	: 21/10/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Store"	STANDARD
Total coliform bacteria	ใน 100 mL	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 mL	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

REMARK 1) Standard Methods for the Examination of Water and Wastewater. APHA, AWWA & WEF, 24th ed., 2023

2) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7868-9 Fax : 0-7661-7870

Request No. 68[illegible]

Report No. W 68[illegible]

TEST REPORT

CUSTOMER	: บริษัท เดอะซิวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 10/11/2025	SAMPLE NO.	: 6811-0384
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 01.33 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 10-21/11/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 10/11/2025
		REPORTED DATE	: 22/11/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "JaakDin Kitchen"	STANDARD
pH at 25°C	-	Electrometric Method	6.01	6.5-8.5
Manganese	mg/L	Persulfate Method	ND	≤ 0.08
Chloride	mg/L as Cl^-	Argentometric Method	15.43	≤ 250
Iron	mg/L	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	36.0	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric Method	0.32	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring, EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Report No. 6811-0384

Report Date 22/11/2025

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 10/11/2025	SAMPLE NO.	: 6811-0384
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 01.33 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 10-21/11/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีนโฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 10/11/2025
		REPORTED DATE	: 22/11/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "JaakDin Kitchen"	STANDARD
Total coliform bacteria	ใน 100 mL	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 mL	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK 1) ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. W68[illegible]237

Report No. W 68[illegible]0885

TEST REPORT

CUSTOMER	: บริษัท เดอะซีวิว เดสทินเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/12/2025	SAMPLE NO.	: 6812-0885
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 01.58 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 15-22/12/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 15/12/2025
		REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Building A"	STANDARD
pH at 25°C	-	Electrometric Method	7.14	6.5-8.5
Manganese	mg/L	Persulfate Method	ND	≤ 0.08
Chloride	mg/L as Cl^-	Argentometric Method	49.96	≤ 250
Iron	mg/L	Phenanthroline Method	ND	≤ 0.3
Hardness	mg/L as $CaCO_3$	EDTA Titrimetric Method	24.0	≤ 300
Chlorine (Residual)	mg/L as Cl_2	DPD Colorimetric Method	0.23	> 0.2

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [PE 1.0 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK 1. ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

FM-LAB-034/Rev.1/12-11-68

Environmental Management Consultation, Water Quality,
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

บริษัท เซ้าเทิร์นไทยคอนซัลติ้ง จำกัด
SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 Srisoontorn, Talang, Phuket 83110 Tel. 0-7661-7668-9 Fax : 0-7661-7670

Request No. 6812-0237

Report No. W 6812-0300

TEST REPORT

CUSTOMER	: บริษัท เคอะซีวิว เดสทิเนชั่น จำกัด (สำนักงานใหญ่)		
ADDRESS	: 149 หมู่ 6 ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต 83110		
SAMPLING SOURCE	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์ (La Green Hotel and Residence)		
SAMPLING DATE	: 15/12/2025	SAMPLE NO.	: 6812-0885
SAMPLING CONDITION	: WATER	SAMPLING TIME	: 01.58 PM
SAMPLING METHOD	: GRAB	SAMPLING BY	: STC
TESTED DATE	: 15-22/12/2025		(MS. JUTAPORN JUTAMAST)
FILE NAME	: ลา กรีน โฮเทล แอนด์ เรสซิเดนซ์	RECEIVED DATE	: 15/12/2025
		REPORTED DATE	: 24/12/2025

PARAMETER	UNIT	METHOD	น้ำผ่านการกรอง "Building A"	STANDARD
Total coliform bacteria	ใน 100 mL	MPN Test Method	ND	ND
Escherichia Coli	ใน 100 mL	MPN Test Method	ND	ND

PHYSICAL APPEARANCE 1. Sample : clear

2. Container : normal [G 0.25 L]

STANDARD มาตรฐานคุณภาพน้ำประปาของการประปาส่วนภูมิภาค พ.ศ. 2567

ANALYSIS METHOD Standard Methods for the Examination of Water and Wastewater, APHA, AWWA, WEF, 24th edition, 2023

REMARK 1. ND = Not Detected (ตรวจวัดไม่พบโดยวิธีทางห้องปฏิบัติการ)

[redacted]

REPORTED ANALYSIS REFER TO SUMITTED SAMPLES ONLY

THIS REPORT SHALL NOT REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL LABORATORY

Environmental Management Consultation, Water Quality.
Air Quality Analysis and Environmental Monitoring. EIA Report Design Construction & Installation Soft Water and Waterworks.
Design Construction & Installation of Wastewater Treatment and Recycle System etc.

ภาคผนวกที่ 3

เอกสารขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน



ที่ อก ๐๓๒๒/๑๗๕๖๕

กรมโรงงานอุตสาหกรรม
ถนนพระรามที่ ๖ แขวงทุ่งพญาไท
เขตราชเทวี กรุงเทพฯ ๑๐๔๐๐

๒๘ ธ.ค. ๒๕๖๖

เรื่อง ต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน

เรียน กรรมการผู้จัดการ บริษัท เช้าเทิร์นไทยคอนซัลติ้ง จำกัด

อ้างถึง คำขอต่ออายุของห้องปฏิบัติการวิเคราะห์เอกชน ลงวันที่ ๑๐ พฤศจิกายน ๒๕๖๖

สิ่งที่ส่งมาด้วย เอกสารแนบท้ายหนังสือรับต่ออายุขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน
บริษัท เช้าเทิร์นไทยคอนซัลติ้ง จำกัด จำนวน ๑ แผ่น

ตามหนังสือที่อ้างถึง บริษัท เช้าเทิร์นไทยคอนซัลติ้ง จำกัด ขอต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน เลขทะเบียน ว-๑๗๖ สถานที่ตั้ง เลขที่ ๕๙/๔๕ หมู่ที่ ๕ ตำบลศรีสุนทร อำเภอถลาง จังหวัดภูเก็ต ต่อกรมโรงงานอุตสาหกรรม นั้น

กรมโรงงานอุตสาหกรรมพิจารณาแล้ว ให้บริษัท เช้าเทิร์นไทยคอนซัลติ้ง จำกัด ต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน โดยมีองค์ประกอบดังนี้

ก. ผู้ควบคุมดูแลห้องปฏิบัติการวิเคราะห์

๑) นายพิมุข สอนมี	ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๑
๒) นายศิริพงศ์ พะสริ	ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๒
๓) นางเพ็ญนภา จันทร์เพ็ญ	ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๓
๔) นางสาวพรรวิษา จินรัตน์	ทะเบียนเลขที่ ว-๑๗๖-ค-๐๐๐๔

ข. เจ้าหน้าที่ประจำห้องปฏิบัติการวิเคราะห์

๑) นางสาวกรรณิกา แก้วสามเขียว	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๑
๒) นางสาวศิริรัตน์ นิเทศนพกุล	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๒
๓) นางสาวจุฑาทิพย์ ชูถึง	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๓
๔) นางสาวปรีชญา หมุกแก้ว	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๔
๕) นางสาวบุษยา ประกอบแสง	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๕
๖) นางสาวจุฑาภรณ์ จุฑามาตย์	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๖
๗) นางสาวกรรณนิการ์ ประทุมเพชร	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๗
๘) นางสาวสุธาสินี ละเมาะ	ทะเบียนเลขที่ ว-๑๗๖-จ-๐๐๐๘

ค. ขอบข่ายสารมลพิษที่ได้รับขึ้นทะเบียนให้วิเคราะห์ในน้ำเสีย ตามสิ่งที่ส่งมาด้วย

[redacted]

หนังสือฉบับนี้จะหมดอายุในวันที่ ๑ ธันวาคม ๒๕๖๙ หากประสงค์จะต่ออายุหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน ให้ยื่นคำขอต่ออายุพร้อมเอกสารประกอบคำขอต่อกรมโรงงานอุตสาหกรรม ภายใน ๓๐ วัน ก่อนวันสิ้นอายุของหนังสือรับขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน ทั้งนี้ สามารถยื่นคำขอผ่านระบบอิเล็กทรอนิกส์ได้ที่หน้าเว็บไซต์กรมโรงงานอุตสาหกรรม

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

(นายนเรศวร์ ตรียงค์)
ผู้อำนวยการศูนย์วิจัยและเตือนภัยมลพิษโรงงานภาคใต้
ปฏิบัติราชการแทนอธิบดีกรมโรงงานอุตสาหกรรม

[redacted]

ศูนย์วิจัยและเตือนภัยมลพิษโรงงานภาคใต้
โทร. ๐ ๗๔๓๒ ๕๐๒๙, ๐ ๗๔๘๙ ๐๖๓๔ ต่อ ๕๒๐๑
ไปรษณีย์อิเล็กทรอนิกส์ sirw@diw.mail.go.th

เอกสารแนบท้ายหนังสือรับต่ออายุขึ้นทะเบียนห้องปฏิบัติการวิเคราะห์เอกชน
บริษัท เช้าเทิร์นไทยคอนซัลติ้ง จำกัด เลขทะเบียน ว-๑๗๖
ที่ อก ๐๓๒๒/ ลงวันที่

ขอบข่ายสารมลพิษที่ได้รับการขึ้นทะเบียนจากกรมโรงงานอุตสาหกรรม จำนวน ๙ รายการ

น้ำเสีย จำนวน 9 รายการ

ลำดับที่	สารมลพิษ	วิธีวิเคราะห์
1	Biochemical Oxygen Demand	5-Day BOD Test, Azide Modification Method
2	Chemical Oxygen Demand	Closed Reflux, Titrimetric Method
3	Oil & Grease	Liquid-Liquid, Partition-Gravimetric Method
4	pH	Electrometric Method
5	Sulfide	Iodometric Method
6	Temperature	Laboratory and Field Method
7	Total Dissolved Solids	Dried at 180 °C
8	Total Kjeldahl Nitrogen	Macro-Kjeldahl, Titrimetric Method
9	Total Suspended Solids	Dried at 103-105 °C

เอกสารอ้างอิง

APHA, AWWA, WEF. Standard Methods for the Examination of Water and Wastewater. 24th ed. Washington, DC: APHA, 2023.

[redacted]

(นางสาว[redacted]
นักวิทยาศา[redacted]

ภาคผนวกที่ 4

เอกสารสอบเทียบอุปกรณ์เครื่องมือห้องปฏิบัติการ

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : V25-0477
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	pH Meter
Manufacturer	:	SI Analytics
Model	:	lab 845
Serial No.	:	21021943
ID. No.	:	-
Resolution	:	0.01 pH
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(25 ± 3)°C
Relative Humidity	:	(55 ± 15) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

Calibrated By : Mr. Alongkorn Chewaisarakul
(Calibration Technician)

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	pH Meter
Manufacturer	:	SI Analytics
Model	:	lab 845
Serial No.	:	21021943
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Nominal Value/Model	Serial No.	Cert. No.		Traceability
pH Calibration Standard	4.00	1027602	1027602	15-09-2025	CPA Chem
pH Calibration Standard	6.98	1027603	1027603	15-09-2025	CPA Chem
pH Calibration Standard	10.01	1027604	1027604	15-09-2025	CPA Chem
Temperature/Electrical Calibrator	MC2-TE	10548	CAL0252-25P0013	26-01-2026	RKT

CALIBRATION METHOD :

In-house method : CA.WI.11.117 based on direct measurement by using standard voltage calibrator

In-house method : CA.WI.11.117 based on direct measurement by using certified reference material (CRM)

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

CPA Chem : CPA chem Ltd. (ANAB Cert No. AR-1835)

RKT : Rockertek (Thailand) Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0069)

CALIBRATION RESULTS :

Function : Electrical Measurement

Applied Voltage (mV)	pH meter Reading (mV)	Correction (mV)	Uncertainty (± mV)	Coverage Factor (k)
177.48	178	-0.52	0.60	2.00
0.00	1	-1.00	0.59	2.00
-177.48	-177	-0.48	0.60	2.00

COPY

Function : Chemical Measurement

Standard Buffer Solutions (pH)	pH meter Reading (pH)	Correction (pH)	Uncertainty (± pH)	Coverage Factor (k)
4.007	4.01	-0.003	0.013	2.09
6.976	6.98	-0.004	0.019	2.02
10.010	9.96	0.050	0.058	2.25

Calibration curve - % off set - mV

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

[redacted]

Equipment	:	pH Meter
Manufacturer	:	SI Analytics
Model	:	lab 845
Serial No.	:	21021943
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	376	220608721	SDTH-002/1124	14-11-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.180 comparison with standard thermometer

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Cal Point (°C)	Standard Temperature (°C)	UUC Reading (°C)	Correction (°C)	Uncertainty (±°C)
25	25.00	25.0	0.00	0.25

COPY

[redacted]

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only

--End--

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0653
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Hot Air Oven
Manufacturer	:	Binder
Model	:	FD56
Serial No.	:	20210000003365
ID. No.	:	-
Resolution	:	1 °C
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 15) °C
Relative Humidity	:	(60 ± 20) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY
(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Hot Air Oven
Manufacturer	:	Binder
Model	:	FD56
Serial No.	:	20210000003365
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)

TRACEABILITY :


This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram.

COPY

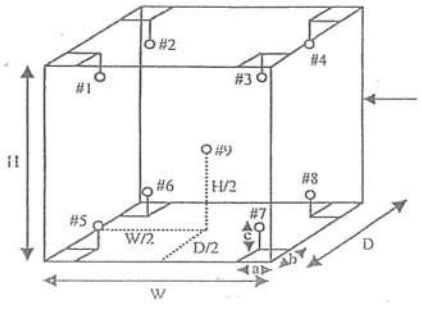

[redacted]

Dimension of the chamber	:	W x H x D	=	40 x 40 x 33	cm
Sensor Installation	:	a x b x c	=	5 x 5 x 5	cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Equipment	:	Hot Air Oven
Manufacture	:	Binder
Model	:	FD56
Serial No.	:	20210000003365
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the hot air oven and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	(± °C)
104	103.823	104.225	103.823	104.015	103.778	104.033	104.085	103.758	103.776	0.67

Hot Air Oven Performance Result

The performance of the hot air oven are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
104	104	104	0.11	0.49	0.63


COPY

[redacted]

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration o

Report Graph

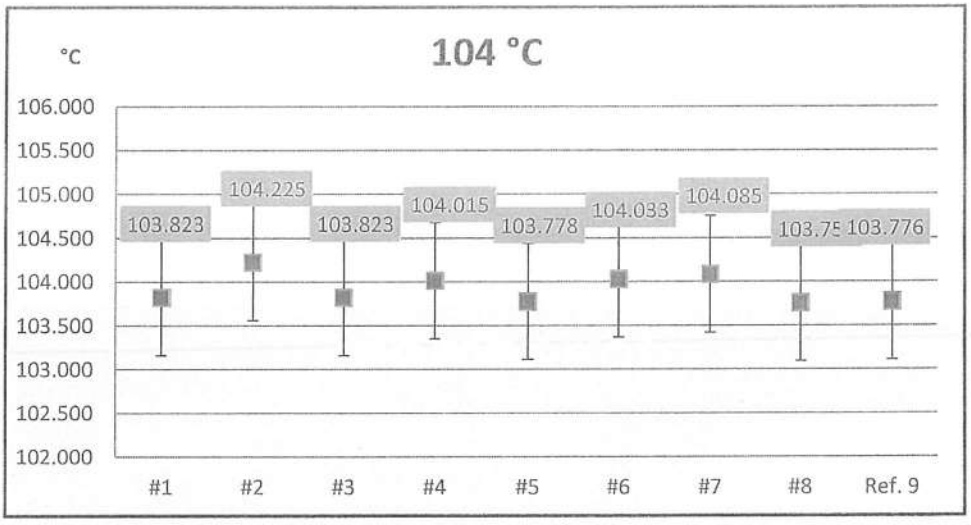

COPY

[redacted]

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration on

-- End --

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0654
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	COD Reactor
Manufacturer	:	Lovibond
Model	:	RD125
Serial No.	:	0423/00542
ID. No.	:	-
Resolution	:	-
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 15) °C
Relative Humidity	:	(60 ± 20) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	3-Mar-2025

COPY

[redacted]

APPROVED BY

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

( ) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	COD Reactor
Manufacturer	:	Lovibond
Model	:	RD125
Serial No.	:	0423/00542
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	02-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 1994 (re-approved 2011)

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram



COPY

[redacted]

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Equipment	:	COD Reactor
Manufacture	:	Lovibond
Model	:	RD125
Serial No.	:	0423/00542
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the COD Reactor and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#1	#2	#3	#4	#5	#6	#7	#8	#9	(± °C)
150	151.299	147.200	147.791	148.604	150.268	149.030	149.150	148.082	151.746	0.18

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#10	#11	#12	#13	#14	#15	#16	#17	#18	(± °C)
150	151.831	148.283	146.341	150.289	150.245	150.111	150.150	149.029	151.111	0.18

Cal Point	Measured Standard Temperature (°C) at Spread Locations						Uncertainty
(°C)	#19	#20	#21	#22	#23	#24	(± °C)
150	149.287	150.834	148.796	149.018	151.437	151.266	0.18

COPY

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only

-- End --

[redacted]

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : M25-0359
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM224-1S
Serial No.	:	0035106544
ID. No.	:	-
Capacity	:	220 g
Resolution	:	0.0001 g
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 10) °C
Relative Humidity	:	(50 ± 20) %
Barometric Pressure	:	(1010 ±10) hPa
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

Calibrated By : Mr. Bowornnan Langlea
(Mechanical Supervisor)

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM224-1S
Serial No.	:	0035106544
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Norminal Value	Serial No.	Cert. No.	Due Date	Traceability
Standard Weight Set	1 mg ~ 500 g	-	M2412021S	02-12-2025	TCS

CALIBRATION METHOD :

In-house method : CA.WI.11.015 based on UKAS LAB 14 : 2022

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :
TCS : Thai Calibration Services Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0189)

CALIBRATION RESULTS :

(/) Without Adjustment ( ) After Adjustment

DETERMINATION OF THE STANDARD DEVIATION OF WEIGHT MACHINE (N=10)

Nominal Value (g)	Standard Deviation (g)
200	0.00013

COPY

EFFECT OF OFF CENTER LOADING AT 100 g

Position					Maximum Difference (g)
1	2	3	4	5	
99.9999	99.9997	100.0001	100.0002	100.0001	0.0003

[redacted]

The uncertainties are for a confidence probability of approximately 95 % .

Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM224-1S
Serial No.	:	0035106544
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

EFFECT OF TARE AT 100 g

Nominal Value (g)	UUC* Reading (g)	Correction (g)
20	20.0002	-0.00020
40	40.0001	-0.00012
60	60.0001	-0.00007
80	80.0001	-0.00007
100	100.0001	-0.00001

ERROR OF INDICATION FROM NOMINAL VALUE

Nominal Value (g)	UUC* Reading (g)	Correction (g)	Uncertainty (±g)	Coverage Factor (k)
* Unload	0.0000	0.00000	0.00031	2.28
0.01	0.0100	0.00000	0.00031	2.28
0.05	0.0500	0.00000	0.00031	2.28
0.1	0.1001	-0.00009	0.00031	2.28
0.5	0.5001	-0.00010	0.00032	2.28
1	1.0001	-0.00011	0.00032	2.28
2	1.9997	0.00030	0.00032	2.28
5	4.9998	0.00021	0.00032	2.28
10	10.0000	0.00001	0.00032	2.28
20	20.0001	-0.00010	0.00031	2.25
40	40.0000	-0.00002	0.00032	2.23
60	60.0001	-0.00007	0.00032	2.20
80	80.0000	0.00003	0.00033	2.18
100	99.9999	0.00019	0.00033	2.18
120	120.0000	0.00008	0.00034	2.14
140	139.9999	0.00017	0.00036	2.11
160	159.9999	0.00022	0.00037	2.10
180	180.0000	0.00011	0.00039	2.07
200	200.0001	0.00001	0.00039	2.07

COPY

[redacted]

UUC : Unit Under Calibration

The table as per (*) marked are not NSC-ONSC accreditation scope.

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : M25-0360
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM2101-1S
Serial No.	:	0033508410
ID. No.	:	-
Capacity	:	2100 g
Resolution	:	0.1 g
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 10) °C
Relative Humidity	:	(50 ± 20) %
Barometric Pressure	:	(1010 ±10) hPa
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

( ) MR. PI
( ) MR. BUNPOT SUWANNARAT / Technical Manager

Calibrated By : Mr. Bowornnan Langlea
(Mechanical Supervisor)

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM2101-1S
Serial No.	:	0033508410
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Norminal Value	Serial No.	Cert. No.	Due Date	Traceability
Standard Weight Set	1 mg ~ 500 g	-	M2412021S	02-12-2025	TCS

CALIBRATION METHOD :

In-house method : CA.WI.11.015 based on UKAS LAB 14 : 2022

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :
TCS : Thai Calibration Services Co.,Ltd. , (NSC-TISI-TIS 17025 CALIBRATION 0189)

CALIBRATION RESULTS :

(/) Without Adjustment ( ) After Adjustment


COPY

DETERMINATION OF THE STANDARD DEVIATION OF WEIGHT MACHINE (N=10)

Nominal Value (g)	Standard Deviation (g)
500	0.12

EFFECT OF OFF CENTER LOADING AT 200 g

Position					Maximum Difference (g)
1	2	3	4	5	
199.6	200.4	197.4	195.9	202.0	3.7

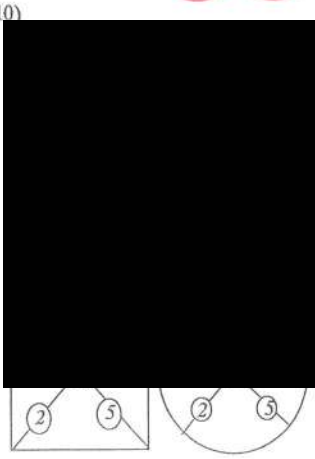

☐ ☑

The uncertainties are for a confidence probability of approximately 95 % .

Equipment	:	Electronic Balance
Manufacturer	:	Sartorius
Model	:	PRACTUM2101-1S
Serial No.	:	0033508410
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

EFFECT OF TARE AT 200 g

Nominal Value (g)	UUC* Reading (g)	Correction (g)
40	40.3	-0.30
80	81.1	-1.10
120	120.9	-0.90
160	159.9	0.10
200	200.1	-0.10

ERROR OF INDICATION FROM NOMINAL VALUE

Nominal Value (g)	UUC* Reading (g)	Correction (g)	Uncertainty (± g)	Coverage Factor (k)
* Unload	0.0	0.00	0.28	2.25
1	1.0	0.00	0.28	2.25
2	2.0	0.00	0.28	2.25
5	5.0	0.00	0.28	2.25
10	10.0	0.00	0.28	2.25
50	49.8	0.20	0.28	2.25
100	99.8	0.20	0.28	2.25
150	149.8	0.20	0.28	2.25
200	199.6	0.40	0.28	2.25
250	249.5	0.50	0.28	2.25
300	299.5	0.50	0.28	2.25
350	349.4	0.60	0.28	2.25
400	398.7	1.30	0.28	2.25
450	448.5	1.50	0.28	2.25
500	499.0	1.00	0.28	2.25

COPY

[redacted]

UUC : Unit Under Calibration

The table as per (*) marked are not NSC-ONSC accreditation scope.

The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0655
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Refrigerator
Manufacturer	:	SANDEN INTERCOOL
Model	:	SEA-0405
Serial No.	:	SEA0405-191200194
ID. No.	:	-
Resolution	:	1 °C
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 15) °C
Relative Humidity	:	(60 ± 20) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Refrigerator
Manufacturer	:	SANDEN INTERCOOL
Model	:	SEA-0405
Serial No.	:	SEA0405-191200194
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)

TRACEABILITY :


This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram

COPY

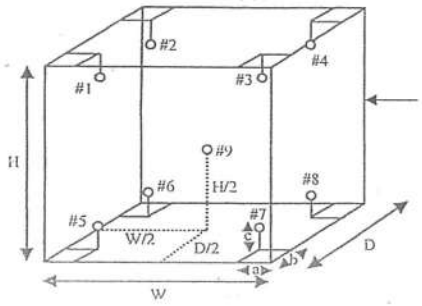

[redacted]

Dimension of the chamber	:	W x H x D	=	53 x 130 x 43	cm
Sensor Installation	:	a x b x c	=	5 x 5 x 5	cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Equipment	:	Refrigerator
Manufacture	:	SANDEN INTERCOOL
Model	:	SEA-0405
Serial No.	:	SEA0405-191200194
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the refrigerator and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	(± °C)
4	4.970	4.632	4.119	3.822	4.508	4.076	4.555	4.308	4.126	1.4

Refrigerator Performance Result

The performance of the refrigerator are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
4	4	4	0.98	1.6	2.9


COPY

[redacted]

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Report Graph

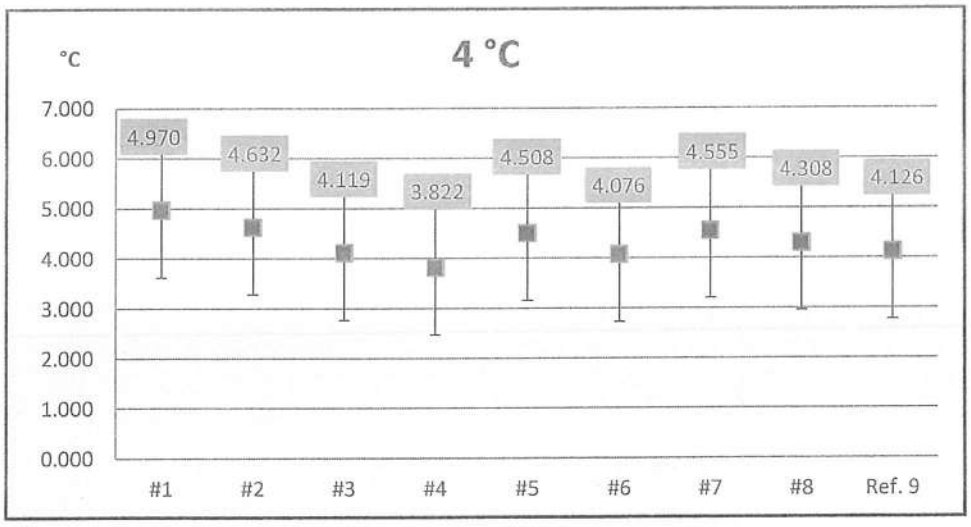

COPY

[redacted]

The above results are valid exclusively for calibration sample as mentioned in the repor

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0656
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Incubator
Manufacturer	:	ACCUPLUS
Model	:	I250
Serial No.	:	0408-0415-0034
ID. No.	:	-
Resolution	:	0.1 °C
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 15) °C
Relative Humidity	:	(60 ± 20) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

(/) M
( ) M

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Incubator
Manufacturer	:	ACCUPLUS
Model	:	I250
Serial No.	:	0408-0415-0034
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003/0824	01-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.160 based on ASTM E145 : 94 (re-approved 2021)


TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :

PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

Sensor Installation Diagram

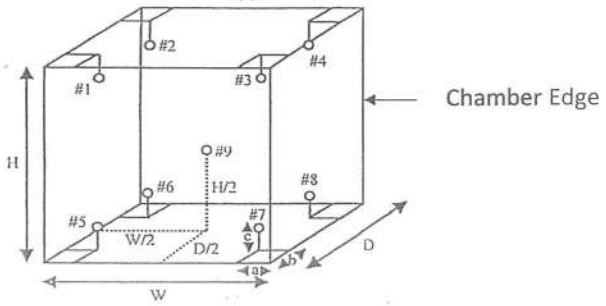

COPY

[redacted]

Dimension of the chamber	:	W x H x D	=	78 x 100 x 45	cm
Sensor Installation	:	a x b x c	=	5 x 5 x 5	cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Equipment	:	Incubator
Manufacture	:	ACCUPLUS
Model	:	I250
Serial No.	:	0408-0415-0034
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the incubator and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations									Uncertainty
(°C)	#1	#2	#3	#4	#5	#6	#7	#8	Ref. 9	(± °C)
20	20.204	20.344	20.218	20.310	19.964	20.077	20.086	19.786	20.102	0.36

Incubator Performance Result

The performance of the incubator are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Chamber Stability (± °C)	Chamber Uniformity (± °C)	Overall Variation (± °C)
20	20	20	0.16	0.47	0.79


COPY

[redacted]

UUC : Unit Under Calibration

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the repo
This result of calibration was found accurate as shown on date and place of calibration

Report Graph

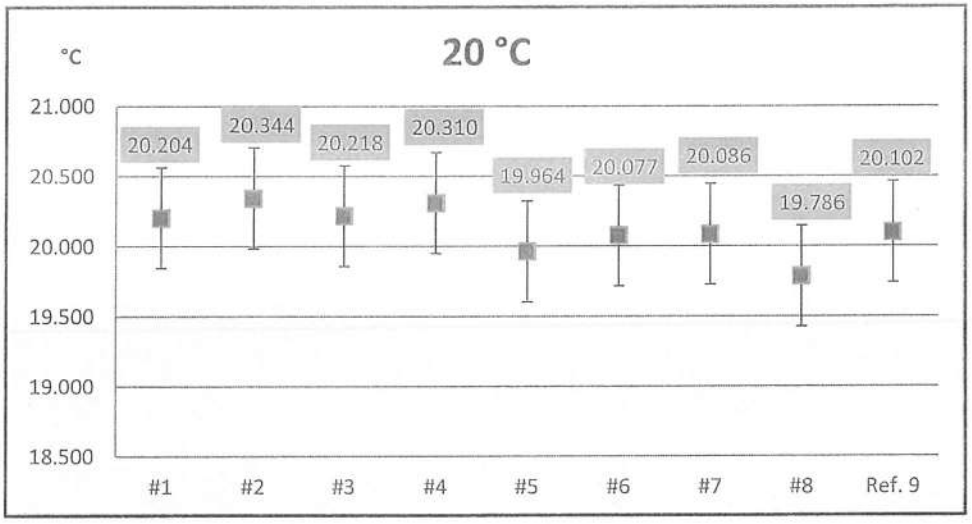

COPY

[redacted]

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

-- End --

PREMIER SYSTEM ENGINEERING CO., LTD.
123 Moo 8 Kanjanavanit Rd., Banpru, Hatyai, Songkhla 90250
E-mail : pse-cal@sritranggroup.com ,Fax. : (074)222912 Tel. : 084-2148162, 084-2148165, 074-222900-9

NSC-TISI-TIS 17025
CALIBRATION 0024

CALIBRATION CERTIFICATE

CERTIFICATE No. : T25-0657
CSR No. : 250252

Customer	:	Southern Thai Consulting Co., Ltd. 59/45 Moo5 Srisoontorn, Talang, Phuket 83110
Equipment	:	Water Bath
Manufacturer	:	Memmert
Model	:	WNB 22
Serial No.	:	L522.1030
ID. No.	:	-
Resolution	:	0.1 °C
Instrument Condition	:	Good Condition
Location of Calibration	:	Customer Laboratory
Ambient Temperature	:	(30 ± 10) °C
Relative Humidity	:	(50 ± 20) %
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025
Date of Issued	:	4-Mar-2025

COPY

[redacted]

APPROVED BY :

Calibrated By : Mr. Attapol Juntasurat
(Calibration Engineer)

APPROVED SIGNATORY
(/) MR. PIYAPONG RATTANAKAN / Calibration Manager
( ) MR. BUNPOT SUWANNARAT / Technical Manager

This certificate may not be reproduced other than in full except with the prior written approval of PREMIER SYSTEM ENGINEERING CO., LTD.
The uncertainties are for a confidence probability of approximately 95 % .

@PSE-CAL

Equipment	:	Water Bath
Manufacturer	:	Memmert
Model	:	WNB 22
Serial No.	:	L522.1030
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Calibration	:	1-Mar-2025

REFERENCE STANDARD INSTRUMENT :

Instrument Type	Model	Serial No.	Cert. No.	Due Date	Traceability
Digital Thermometer with Sensor	34970 A	MY 44042662	DAT003W/0824	02-08-2025	PSE

CALIBRATION METHOD :

In-house method : CA.WI.11.161 based on ASTM E715 : 80 (re-approved 2022)

TRACEABILITY :

This Calibration Certificate is traceable to national standards which realize the unit of measurment according to the International System of Unit (SI) through :


PSE : Premier System Engineering Co., Ltd. ,(NSC-TISI-TIS 17025 CALIBRATION 0024)

CALIBRATION RESULTS :

(/) Without Adjustment ( ) After Adjustment

COPY

Sensor Installation Diagram

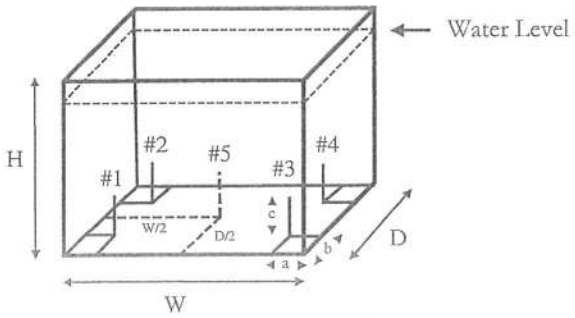

[redacted]

Dimension of the chamber	:	W x H x D	=	35 x 29 x 22	cm
Sensor Installation	:	a x b x c	=	5 x 5 x 5	cm

The uncertainties are for a confidence probability of approximately 95 % .
The above results are valid exclusively for calibration sample as mentioned in the report.
This result of calibration was found accurate as shown on date and place of calibration only.

Equipment	:	Water Bath
Manufacture	:	Memmert
Model	:	WNB 22
Serial No.	:	L522.1030
ID. No.	:	-
Date of Received	:	1-Mar-2025
Date of Received	:	1-Mar-2025

CALIBRATION RESULTS : (Cont.)

(/) Without Adjustment ( ) After Adjustment

Temperature Measurement Accuracy Test

The measurement results of the water bath and associates are reported in the manner as shown below

Cal Point	Measured Standard Temperature (°C) at Spread Locations					Uncertainty
(°C)	#1	#2	#3	#4	#5	(± °C)
85	84.58	84.80	84.57	84.60	84.77	0.35
95	94.85	95.05	94.85	95.08	95.15	0.44

Water Bath Performance Result

The performance of the water bath are reported as shown below

Cal Point (°C)	UUC Setting (°C)	UUC Reading (°C)	Water Bath Stability (± °C)	Water Bath Uniformity (± °C)	Overall Variation (± °C)
85	85.0	85.0	0.11	0.26	0.40
95	95.0	95.0	0.25	0.37	0.69

COPY

[redacted]

UUC : Unit Under Calibration


The uncertainty is not combine uniformity of the water bath


The uncertainties are for a confidence probability of approximately 95 % .

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration only.

Report Graph

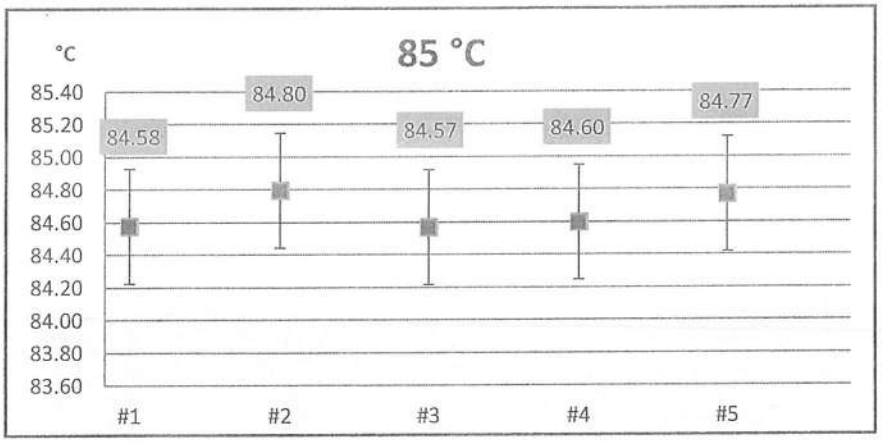

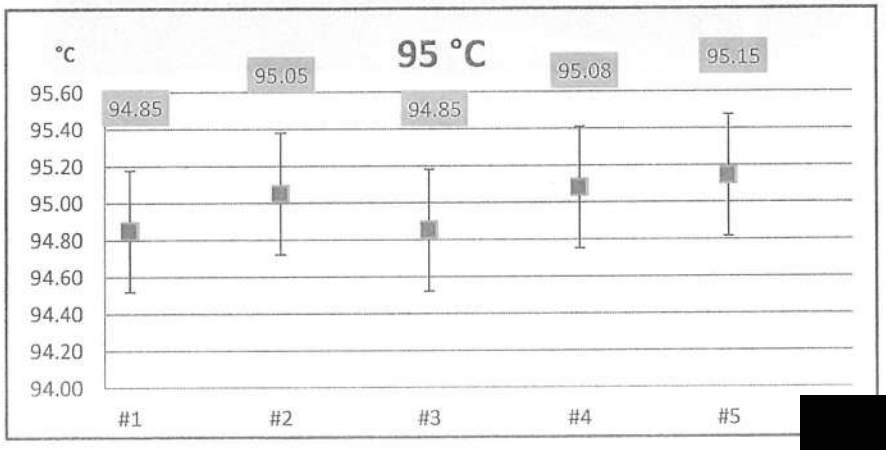

COPY

[redacted]

The above results are valid exclusively for calibration sample as mentioned in the report.

This result of calibration was found accurate as shown on date and place of calibration onl

-- End --

Bara Scientific Co., Ltd.
968 U Chu Liang Building Floor7 Rama4 Road
Silom Bangrak Bangkok Thailand 10500
Tel : 02-6324300 Fax : 02-6375496-7
www.barascientific.com

Bara Scientific
Solution of Success

ilac-MRA

THAILAND
NSC-TISI-TIS 17025
CALIBRATION 0209

Certificate of Calibration

Certificate No.	BSCC-UV-081/25
Equipment	UV/Vis Spectrophotometer
Model	UV-1800
Manufacturer	SHIMADZU
Serial No.	A11635305233 CD
ID No.	UV-03
Date of receipt	5 March 2025
Date of calibration	5 March 2025
Date of issue	7 March 2025
Customer name	Southern Thai Consulting Co.,Ltd.
Address	59/45 Moo 5, Srisoontorn, Talang, Phuket 83110
Temperature	(24.2-26.8) °C (On site)
Humidity	(54.6-64.0) %RH (On site)
Equipment condition	Good Operation
Calibration Location	Laboratory
Calibration Procedure	In-house method WI-UV-702-01 based on ASTM E275-01
Traceability	Wavelength Accuracy is traceable to certificate No. 118114 and 118119 Photometric Accuracy is traceable to certificate No. 118970 and 119006 Stray Light is traceable to certificate No. 118111 The above certificate are traceble to SI unit through Starna Scientific Ltd. (UKAS accredited calibration laboratory NO. 0659)
Calibrated by	Mr.Sarunkorn Pukaothong

COPY

[redacted]

Approved by

Mr.Pannaphong Phanmekakul
Technical Manager

alibrated item(s) as mention in this report / certificate.
e resuits are prohibited and also shall not be reproduced
except in full, without written approval of the Bara Scientific Co., Ltd.

Bara Scientific
Solution of Success

Bara Scientific Co., Ltd.
968 U Chu Liang Building Floor7 Rama4 Road
Silom Bangrak Bangkok Thailand 10500
Tel : 02-6324300 Fax : 02-6375496-7
www.barascientific.com

ilac-MRA

THAILAND
NSC-TISI-TIS 17025
CALIBRATION 0209

Certificate of Calibration

Certificate No. **BSCC-UV-081/25** Number of Page(s) 2 of 3

Calibration Results:

1.Wavelength Accuracy

Certified Wavelength (nm)	UUC (nm)	Error (nm)	Uncertainty (±nm)
360.89	360.81	-0.08	0.18
418.53	418.50	-0.03	0.18
513.39	513.39	0.00	0.18
572.99	573.12	0.13	0.18
879.41	879.40	-0.01	0.18

2.Photometric Accuracy (UV)

Wavelength (nm)	Certified Absorbance (A)	UUC (A)	Error (A)	Uncertainty (±A)
235	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
257	0.0000	0.0001	0.0001	0.0075
	0.8616	0.8587	-0.0029	0.0075
313	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
350	0.0000	0.0001	0.0001	0.0075
	0.6393	0.6382	-0.0011	0.0075

COPY

*CNR = Customer not request

[redacted]

The above results are valid exclus / certificate.
Advertising the report / Certificate and be reproduced
except in full, with

Bara Scientific Co., Ltd.
968 U Chu Liang Building Floor7 Rama4 Road
Silom Bangrak Bangkok Thailand 10500
Tel : 02-6324300 Fax : 02-6375496-7
www.barascientific.com

Bara Scientific
Solution of Success

ilac-MRA

THAILAND
NSC-TISI-TIS 17025
CALIBRATION 0209

Certificate of Calibration

Certificate No. **BSCC-UV-081/25** Number of Page(s) 3 of 3

Calibration Results:

3.Photometric Accuracy (Visible)

Wavelength (nm)	Certified Absorbance (A)	UUC (A)	Error (A)	Uncertainty (±A)
420.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
440.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
465.0	0.0000	0.0000	0.0000	0.0042
	0.5188	0.5186	-0.0002	0.0042
	0.6627	0.6627	0.0000	0.0042
	0.9424	0.9425	0.0001	0.0042
546.1	0.0000	0.0000	0.0000	0.0042
	0.5199	0.5199	0.0000	0.0042
	0.6989	0.6988	-0.0001	0.0042
	0.9972	0.9974	0.0002	0.0042
590.0	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
	CNR	CNR	CNR	CNR
635.0	0.0000	0.0000	0.0000	0.0042
	0.5611	0.5614	0.0003	0.0042
	0.7637	0.7636	-0.0001	0.0042
	1.0942	1.0944	0.0002	0.0042

COPY

*CNR = Customer not request

[redacted]

4.Stray Light*

Standard cut-off wavelength (nm)	Unit Under Calibration	
	Wavelength (nm)	Transmission (%T
201.15±0.11nm	200.90	0.9820

The Stray light transmission reference is less than 1.0%T and Stray light absc
***Stray Light not NSC-ONSC Accredited.**

The measurement uncertainty is base on a standard uncertainty multiplied by a coverage factor k=2

End of Certificate

The above results are valid exclusively for the calibrated item(s) as mention in this report / certificate.
Advertising the report / Certificate and publicity of the resuits are prohibited and also shall not be reproduced except in full, without written approval of the Bara Scientific Co., Ltd.

Harikul Science Co.,Ltd.
694 Soi Ratchadanivet 24, Pracharatbamphen,
Samsaennok, Huaikhwang, Bangkok 10310
Tel: 0-2274-2456 Fax: 0-2274-2443
Email: info@harikul.com www.harikul.com

CERT.No.: HS-W037F

Certificate of Calibration

Calibration Date : 18 Jun 25

Submitted by : SOUTHERN THAI CONSULTING CO.,LTD.
59/45 Moo 5 T.Srisoontorn, A.Talang Phuket 83110

Avg Room Temp 25 °C
Avg Water Temp 25 °C
Air Pressure : 760.00 mmHg
Salinity : 0 ppt

Model : YSI Pro20i
S/N : 23D101243
Probe : -
S/N : -
ID NO. : -
Air Temp ref : S/N. F8065C26
Barometric ref : S/N. F8065C26
Water Temp ref : -
ID NO. HS001
Technician : Kittipong M.

Calibration Details

Calibration Point	100% air sat. (@25 °C, DO = 8.26 mg/l)	(status)		(status)
Measurement 1 (mg/l)	8.26	(PASS)	-	-
Measurement 2 (mg/l)	8.26	(PASS)	-	-
Measurement 3 (mg/l)	8.25	(PASS)	-	-
Measurement 4 (mg/l)	8.25	(PASS)	-	-
Measurement 5 (mg/l)	8.24	(PASS)	-	-
Measurement 6 (mg/l)	8.24	(PASS)	-	-
Measurement 7 (mg/l)	8.24	(PASS)	-	-
Measurement 8 (mg/l)	8.25	(PASS)	-	-
Measurement 9 (mg/l)	8.27	(PASS)	-	
Measurement 10 (mg/l)	8.29	(PASS)	-	-
Mean Measurement	8.25	mg/l	-	-
Inaccuracy	0.01	mg/l	-	-
Overall Status	(PASS)			

Manufacturer Specification

Accuracy = +/- 0.2 mg/l

1) This certificate is issued based on the result that are found as shown on date and place of test only.
2) The calibration procedure followed in accordance with Harikul Science Co., Ltd.
3) This result shall not be used for advertis

COPY

[redacted]

Technician Signature
(Kittipong Maekwong)


Supreecha Su.
Laboratory Manager
(Supreecha Sumaritam)

ภาคผนวกที่ 5

แผนฉุกเฉินกรณีเกิดเพลิงไหม้ สึนามิ และแผ่นดินไหว


La Green Hotel & Residence

แผนอพยพกรณีเกิดเหตุไฟไหม้

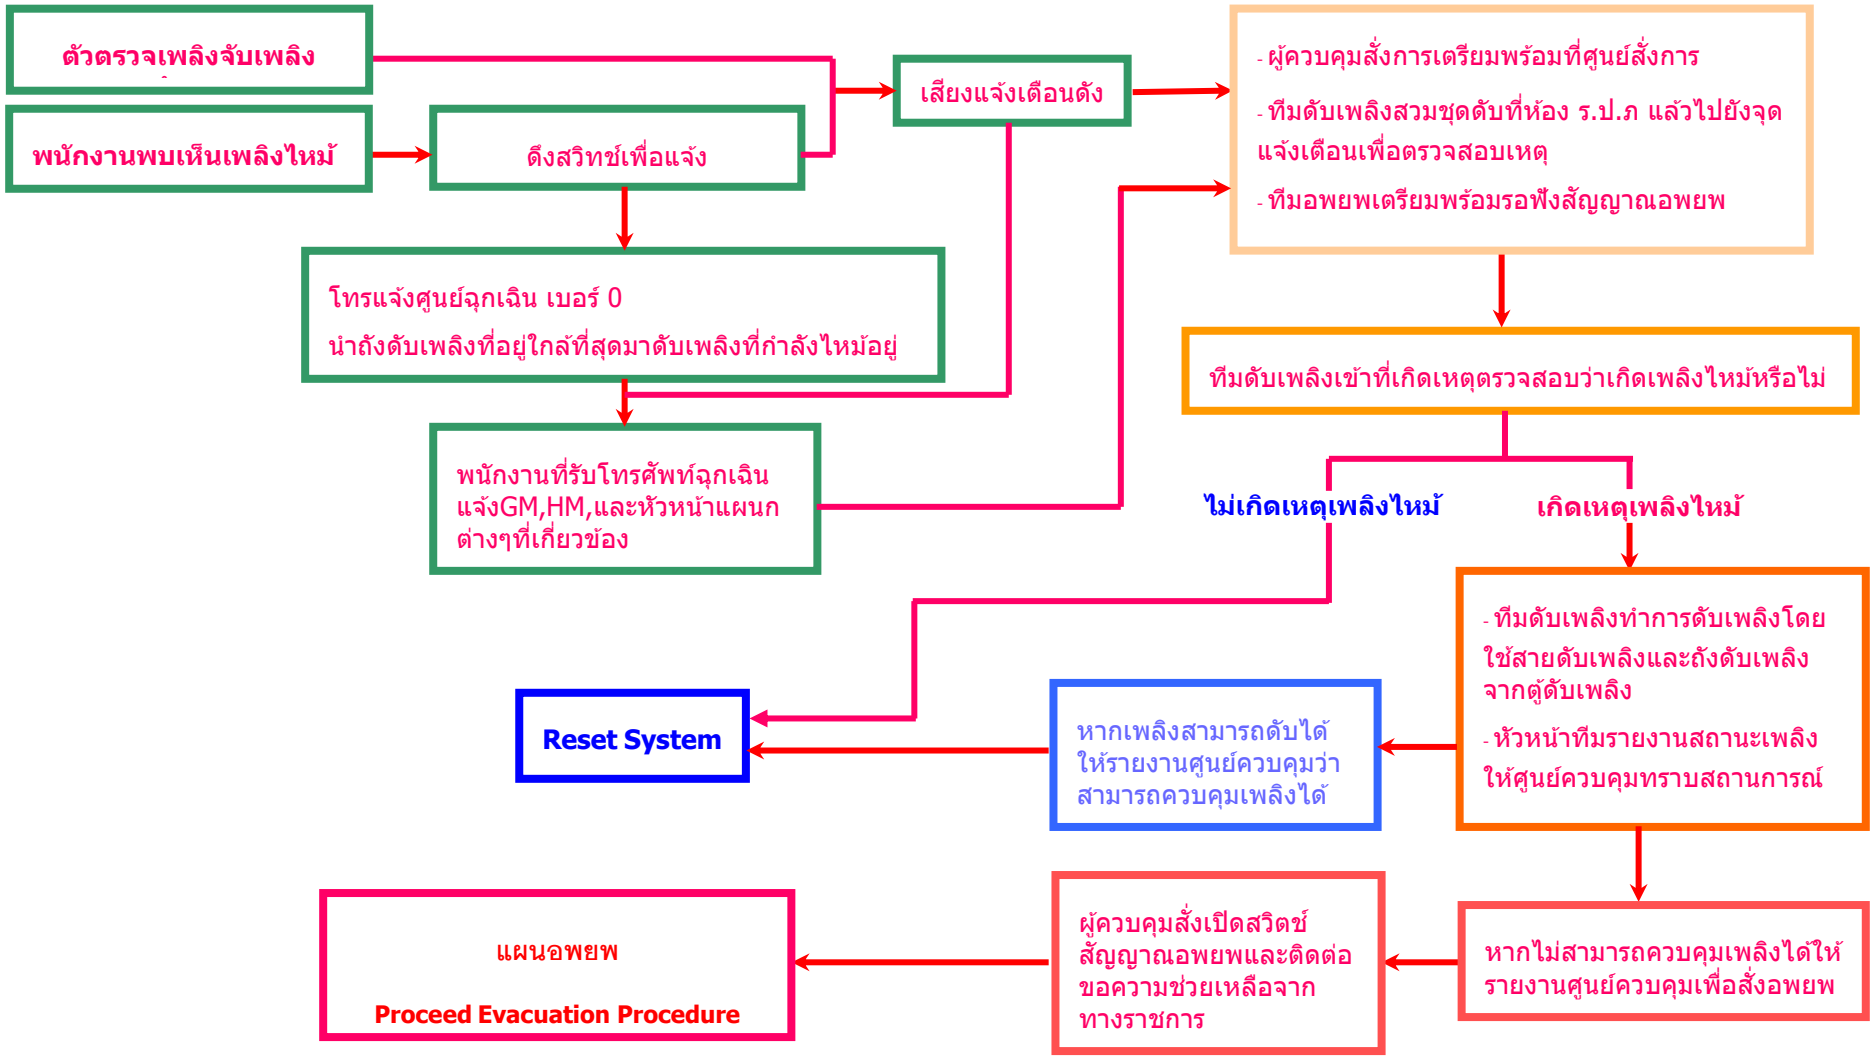

La Green
Hotel & Residence

แผนอพยพกรณีเกิดเหตุไฟไหม้

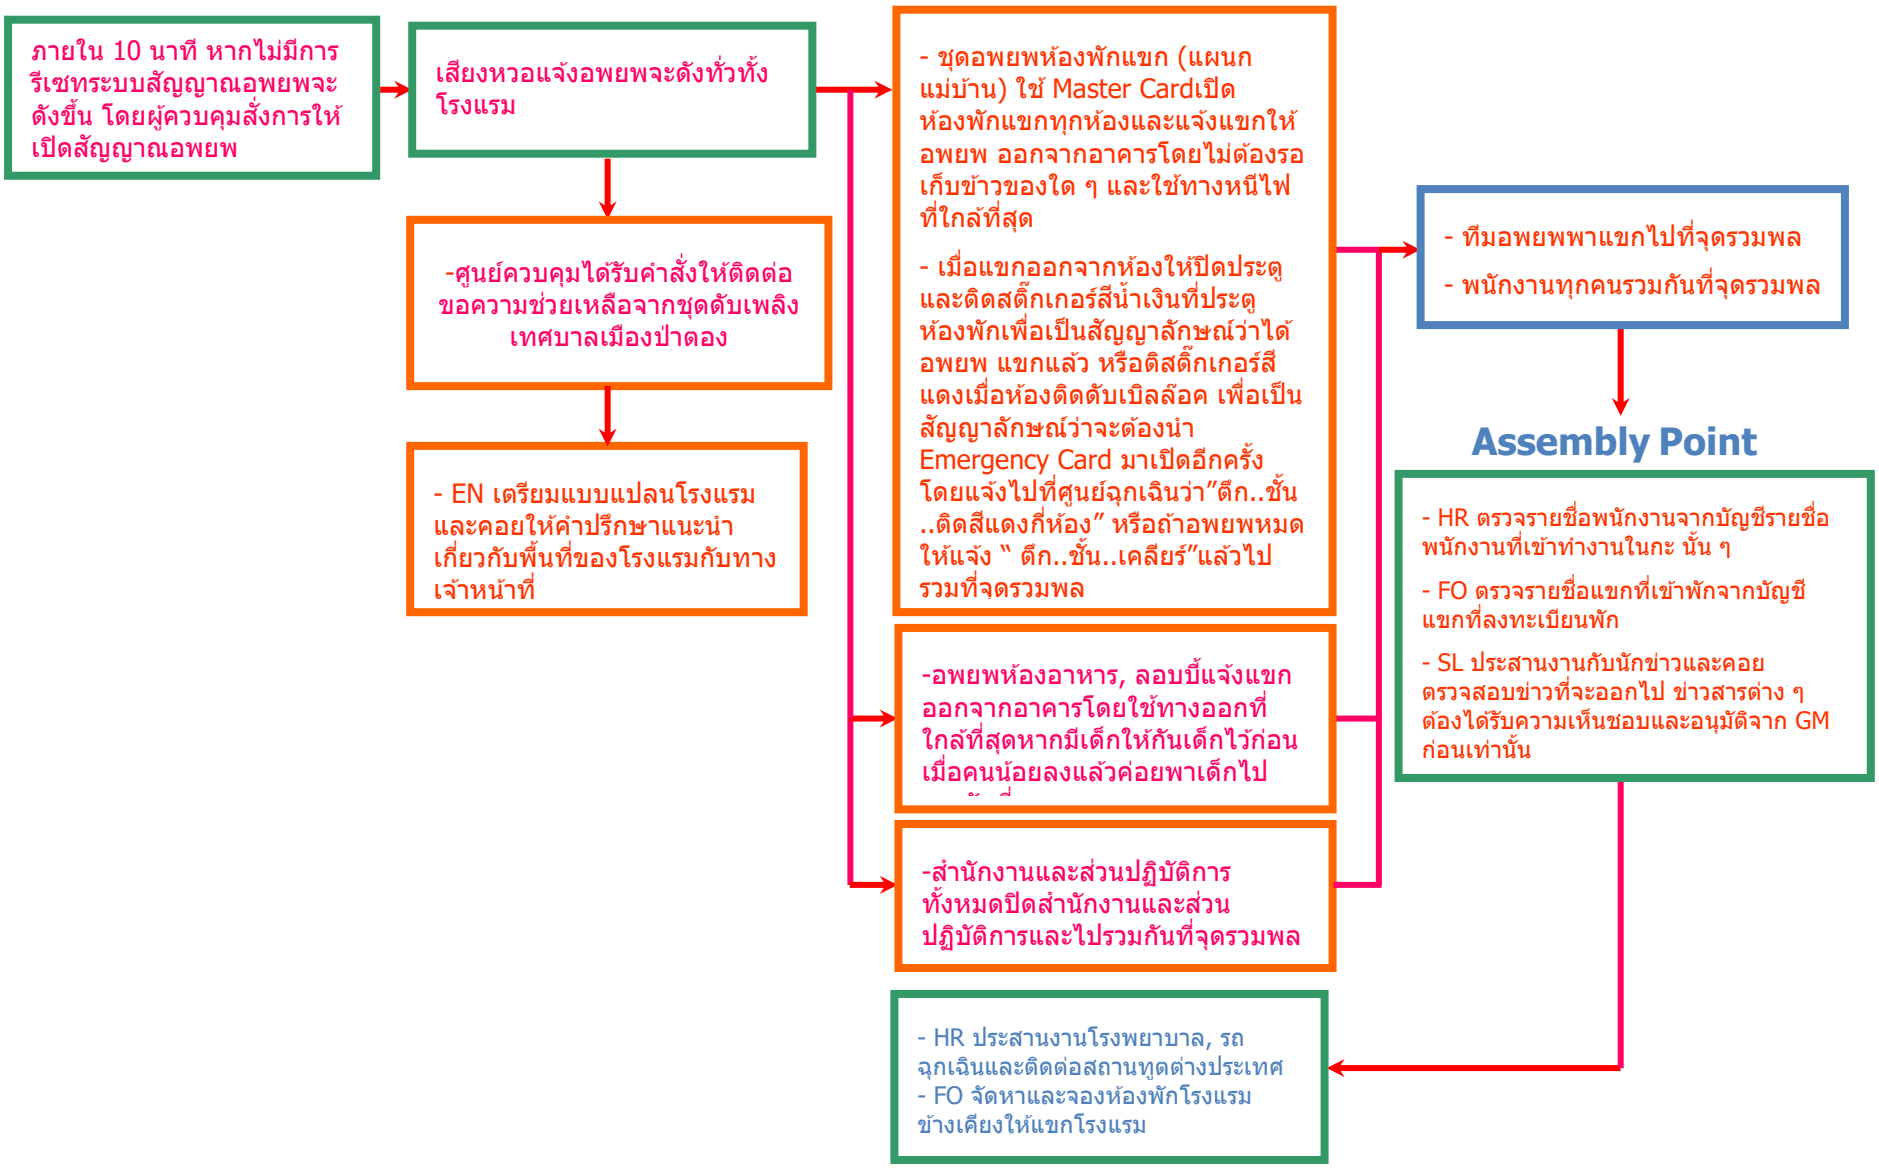

แผนอพยพกรณีเกิดเหตุฉุกเฉินต่าง ๆ



ภาคผนวกที่ 6

Checklist อุปกรณ์ดับเพลิง ประจำเดือนมกราคม–ธันวาคม 2568

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month January 2025

Adisorn H. 31/1/2025
Approved by : Loss Prevention Manager

Kotin S. 31/01/25
Approved by : Loss Prevention Supervisor

Worawoot P. 31/01/25
Inspection by : Loss Prevention Officer

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. January 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer....Worawoot P.....

Date...31/1/2025.....

Loss Prevention Supervisor.....Yothin S.....

Date.....31/01/25.....

Loss Prevention Manager...Adisorn M.

Date.....31/1/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month January 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer... Worawoot P.

Date... 31/01/2025

Loss Prevention Supervisor... Yotin S.

Date... 31/01/25

Loss Prevention Manager... Adisorn M.

Date... 31/1/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month: January 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not installed
	Halotron	NA	NA	Not installed

Loss Prevention Officer: Worawoot P.
Date: 31/01/2025

Loss Prevention Supervisor: Kotin S.
Date: 31/01/25

Loss Prevention Manager: Adisorn M.
Date: 31/1/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month January 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness In side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer... Worawut P. ..... Loss Prevention Supervisor... Yotin S. .....

Date... 31/01/2025 ..... Date... 31/01/25 .....

Loss Prevention Manager... Adisorn M. .....

Date... 31/1/2025 .....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. January 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer. Worawat P.

Date. 31/01/2025

Loss Prevention Supervisor. Botin S.

Date. 31/01/25

Loss Prevention Manager. Adisorn M.

Date. 31/1/2024

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month: January 2025

DESCRIPTION		Fire Extinguisher ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดสเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant ที่รับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ตัวดับเพลิง FHC เปิดออก
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer: Worawoot P.

Date: 31/1/2025

Loss Prevention Supervisor: Yotin S.

Date: 31/01/25

Loss Prevention Manager: Adisorn M.

Date: 31/1/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. January 2025

DESCRIPTION		Fire Extinguisher ถังดับเพลิง	Axe ขวาน	Hose Reel สายดึงแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัววัดน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..Worawat P.....

Date..31/1/2025.....

Loss Prevention Supervisor....Bodin S.....

Date....31/01/25.....

Loss Prevention Manager.....Adisorn M.....

Date.....31/1/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. January 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant In front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer. Worawoot P.

Date. 31/01/2025

Loss Prevention Supervisor. Yotin S.

Date. 31/01/25

Loss Prevention Manager. Aowsorn M.

Date. 31/1/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month February 2025

Approved by : Loss Prevention Manager

Yotin S. 28/02/25

Approved by : Loss Prevention Supervisor

Worawoot P. 28/02/2025

Inspection by : Loss Prevention Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. February 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเซ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor..Sutin S.....

Date..28/02/25.....

Loss Prevention Manager.....

Date..3.3.25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. February 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ส่งซ่อมเพลิง FHC ไม่ครบ
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer.... Worawat P. .....

Date..... 28/02/25 .....

Loss Prevention Manager.....

Date..... 3-3-25 .....

Loss Prevention Supervisor.... Kotin S. .....

Date..... 28/02/25 .....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..February 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer....Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor....Sotiln S.....

Date....28/2/25.....

Loss Prevention Manager.....

Date....3.3.25.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer..... Worawoot P.

Date...28/02/25.....

Loss Prevention Supervisor..... Yotin S.

Date.....28/2/25.....

Loss Prevention Manager.....

Date.....7.3.25.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Jothin S.

Date 28/02/25 Date 28/2/25

Loss Prevention Manager

Date 3.3.25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer... Worawoot P. ... Loss Prevention Supervisor... Yotin S. ...

Date... 28/02/25 ... Date... 28/2/25 ...

Loss Prevention Manager...

Date... 3.3.25 ...

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..February 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer..Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor..Potin S.....

Date..28/2/25.....

Loss Prevention Manager.....

Date..3.3.25.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month February 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer Worawoot P.

Date 28/02/25

Loss Prevention Supervisor Yotin S.

Date 28/2/25

Loss Prevention Manager

Date 3.3.25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: February 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	✓		
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	NA		Wooden Sign
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

Worawoot P.
Loss Prevention Officer
Date: 28/02/25

Yotin S.
Loss Prevention Supervisor
Date: 28/2/25

Loss Prevention Manager
Date: 3/3/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: February 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สถานะหลอดไฟ Work	Lighting /สถานะหลอดไฟ Not Work	Remark หมายเหตุ
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	✓	✓		
2		In front of the elevator floor B	✓	✓	✓		
3		Exit from Building B to Building C.	✓	✓	✓		
4		Fire escape exit In front of the water pump room	✓	✓	NA		Wooden Sign
5		Fire escape exit In front of the generator room	✓	✓	NA		Wooden Sign
6	FL.1	In front of guest room No.B101	✓	✓	✓		
7		In front of guest room No.B108	✓	✓	✓		
8		In front of guest room No.B116/B123	✓	✓	✓		
9	FL.2	In front of guest room No.B201	✓	✓	✓		
10		In front of guest room No.B208	✓	✓	✓		
11		In front of guest room No.B216/B223	✓	✓	✓		
12	FL.3	In front of guest room No.B301	✓	✓	✓		
13		In front of guest room No.B308	✓	✓	✓		
14		In front of guest room No.B316/B323	✓	✓	✓		
15	FL.4	In front of guest room No.B401	✓	✓	✓		
16		In front of guest room No.B408	✓	✓	✓		
17		In front of guest room No.B416/B423	✓	✓	✓		
18	FL.5	In front of guest room No.B501	✓	✓	✓		
19		In front of guest room No.B508	✓	✓	✓		
20		In front of guest room No.B516/B523	✓	✓	✓		
21	FL.6	In front of guest room No.B601	✓	✓	✓		
22		In front of guest room No.B608	✓	✓	✓		
23		In front of guest room No.B66/B123	✓	✓	✓		
24	FL.7	In front of guest room No.B701	✓	✓	✓		
25		In front of guest room No.B708	✓	✓	✓		
26		In front of guest room No.B716/B723	✓	✓	✓		
		Totally	26	26	24		

Worawoot P.
Loss Prevention Officer
Date: 28/02/25

Yotin S.
Loss Prevention Supervisor
Date: 28/2/25

Loss Prevention Manager
Date: 3-3-25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: February 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพแสงไฟ		Remark หมายเหตุ
					Work	No! Work	
		Building C					
1	FL.1	In front of the entrance to Building C	✓	✓	✓		
2		In front of guest room No.C118	✓	✓	✓		
3		In front of the exit door to Building C	✓	✓	✓		
4	FL.2	INearby the elevator, 2nd floor	✓	✓	✓		
5		In front of guest room No.C202	✓	✓	✓		
6		In front of guest room No.C207	✓	✓	✓		
7	FL.3	INearby the elevator, 3rd floor	✓	✓	✓		
8		In front of guest room No.C306	✓	✓	✓		
9		In front of guest room No.C307	✓	✓	✓		
10	FL.4	INearby the elevator, 4th floor	✓	✓	✓		
11		In front of guest room No.C402	✓	✓	✓		
12		In front of guest room No.C407	✓	✓	✓		
13	FL.5	INearby the elevator, 5th floor	✓	✓	✓		
14		In front of guest room No.C407	✓	✓	✓		
15		In front of guest room No.C506	✓	✓	✓		
16	FL.6	INearby the elevator, 6th floor	✓	✓	✓		
17		In front of guest room No.C602	✓	✓	✓		
18		In front of guest room No.C607	✓	✓	✓		
19	FL.7	INearby the elevator, 7th floor	✓	✓	✓		
20		In front of guest room No.C702	✓	✓	✓		
21		In front of guest room No.C707	✓	✓	✓		
		Totally	21	21	21		

Worawoot P.
Loss Prevention Officer
Date: 28/02/25

Yothin S.
Loss Prevention Supervisor
Date: 28/2/25

Loss Prevention Manager
Date: 5.3.25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: February 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building D					
1	FL.B	Entrance to the parking lot under Building D.	✓	✓	✓		
2	FL.1	INearby the elevator, 1st floor	✓	✓	✓		
3		In front of the entrance to the fitness	✓	✓	✓		
4		Back door to snook kitchen	✓	✓	✓		
5	FL.2	In front of the Spa	✓	✓	✓		
6		Spa Exit Door	✓	✓	✓		
7		In front of the sauna room	✓	✓	✓		
8		In front of Fire exit door	✓	✓	✓		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
10		In front of the restroom	✓	✓	✓		
11		In front of exit door	✓	✓	✓		
12		In front of entrance door	✓	✓	✓		
		Building F					
13	FL.1	Kids Club Entrance door	✓	✓	✓		
14		Kids Club exit door	✓	✓	✓		
		Totally					

Warawoot P.
Loss Prevention Officer
Date: 28/02/25

Yutin S.
Loss Prevention Supervisor
Date: 28/2/25

Loss Prevention Manager
Date: 3.3.25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. February 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเซ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor..Sutin S.....

Date..28/02/25.....

Loss Prevention Manager.....

Date..3.3.25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. February 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ส่งซ่อมเพลิง FHC ไม่ครบ
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer.... Worawat P. .....

Date..... 28/02/25 .....

Loss Prevention Manager.....

Date..... 3-3-25 .....

Loss Prevention Supervisor.... Kotin S. .....

Date..... 28/02/25 .....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..February 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer....Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor....Sotiln S.....

Date....28/2/25.....

Loss Prevention Manager.....

Date....3.3.25.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer..... Worawoot P.

Date...28/02/25.....

Loss Prevention Supervisor..... Yotin S.

Date.....28/2/25.....

Loss Prevention Manager.....

Date.....7.3.25.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Jothin S.

Date 28/02/25 Date 28/2/25

Loss Prevention Manager

Date 3.3.25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month February 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer... Worawoot P. ... Loss Prevention Supervisor... Yotin S. ...

Date... 28/02/25 ... Date... 28/2/25 ...

Loss Prevention Manager...

Date... 3.3.25 ...

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..February 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer..Worawoot P.....

Date..28/02/25.....

Loss Prevention Supervisor..Potin S.....

Date..28/2/25.....

Loss Prevention Manager.....

Date..3.3.25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month March 2025

1/4/2025

Approved by : Loss Prevention Manager

Jetin S. 30/3/25

Approved by : Loss Prevention Supervisor

Jirasak S. 30/03/25

Inspection by : Loss Prevention Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. March 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ถังดับเพลิง FHC ขึ้นสนิม
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer Jirasak S.

Date 30/03/25

Loss Prevention Supervisor Yothin S.

Date 30/3/25

Loss Prevention Manager

Date 1/4/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month March 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer Jirasak S.

Date 20/03/25

Loss Prevention Supervisor Watin S.

Date 30/3/25

Loss Prevention Manager .....

Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. March 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Kotin S.
Date 30/3/25

Loss Prevention Manager
Date 1 1 Δ /2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. March 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer Jirasak S.

Date 30/03/25

Loss Prevention Supervisor Yotin S.

Date 30/3/25

Loss Prevention Manager .....

Date 1/4/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. March 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer Jirasak S.

Date 30/03/25

Loss Prevention Supervisor Yotin S.

Date 30/3/25

Loss Prevention Manager .....

Date 1/4/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. March 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ถังดับเพลิง FHC ขึ้นสนิม
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer Jirasak S.

Date 30/03/25

Loss Prevention Supervisor Yothin S.

Date 30/3/25

Loss Prevention Manager

Date 1/4/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month March 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer Jirasak S.

Date 20/03/25

Loss Prevention Supervisor Watin S.

Date 30/3/25

Loss Prevention Manager .....

Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. March 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Kotin S.
Date 30/3/25

Loss Prevention Manager
Date 1 1 Δ /2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month March 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer Jirasak S.
Date 30/03/25

Loss Prevention Supervisor Yotin S.
Date 30/3/25

Loss Prevention Manager
Date 1/4/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. March 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer Jirasak S.

Date 30/03/25

Loss Prevention Supervisor Yotin S.

Date 30/3/25

Loss Prevention Manager .....

Date 1/4/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: March 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สถานะหลอดไฟ Work	Lighting /สถานะหลอดไฟ Not Work	Remark หมายเหตุ
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	✓		
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	NA		Wooden Sign
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

Jirasak S.
Loss Prevention Officer
Date: 30/03/25

Loss Prevention Manager
Date: 1/4/25

Yoth S.
Loss Prevention Supervisor
Date: 30/3/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: March 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	✓	✓		
2		In front of the elevator floor B	✓	✓	✓		
3		Exit from Building B to Building C.	✓	✓	✓		
4		Fire escape exit In front of the water pump room	✓	✓	NA		Wooden Sign
5		Fire escape exit In front of the generator room	✓	✓	NA		Wooden Sign
6	FL.1	In front of guest room No.B101	✓	✓	✓		
7		In front of guest room No.B108	✓	✓	✓		
8		In front of guest room No.B116/B123	✓	✓	✓		
9	FL.2	In front of guest room No.B201	✓	✓	✓		
10		In front of guest room No.B208	✓	✓	✓		
11		In front of guest room No.B216/B223	✓	✓	✓		
12	FL.3	In front of guest room No.B301	✓	✓	✓		
13		In front of guest room No.B308	✓	✓	✓		
14		In front of guest room No.B316/B323	✓	✓	✓		
15	FL.4	In front of guest room No.B401	✓	✓	✓		
16		In front of guest room No.B408	✓	✓	✓		
17		In front of guest room No.B416/B423	✓	✓	✓		
18	FL.5	In front of guest room No.B501	✓	✓	✓		
19		In front of guest room No.B508	✓	✓	✓		
20		In front of guest room No.B516/B523	✓	✓	✓		
21	FL.6	In front of guest room No.B601	✓	✓	✓		
22		In front of guest room No.B608	✓	✓	✓		
23		In front of guest room No.B66/B123	✓	✓	✓		
24	FL.7	In front of guest room No.B701	✓	✓	✓		
25		In front of guest room No.B708	✓	✓	✓		
26		In front of guest room No.B716/B723	✓	✓	✓		
		Totally	26	26	24		

Jirasak S.
Loss Prevention Officer
Date: 30/03/25

Yotin S.
Loss Prevention Supervisor
Date: 30/3/25

Loss Prevention Manager
Date: 1/4/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: March 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building C					
1	FL.1	In front of the entrance to Building C	✓	✓	✓		
2		In front of guest room No.C118	✓	✓	✓		
3		In front of the exit door to Building C	✓	✓	✓		
4	FL.2	INearby the elevator, 2nd floor	✓	✓	✓		
5		In front of guest room No.C202	✓	✓	✓		
6		In front of guest room No.C207	✓	✓	✓		
7	FL.3	INearby the elevator, 3rd floor	✓	✓	✓		
8		In front of guest room No.C306	✓	✓	✓		
9		In front of guest room No.C307	✓	✓	✓		
10	FL.4	INearby the elevator, 4th floor	✓	✓	✓		
11		In front of guest room No.C402	✓	✓	✓		
12		In front of guest room No.C407	✓	✓	✓		
13	FL.5	INearby the elevator, 5th floor	✓	✓	✓		
14		In front of guest room No.C407	✓	✓	✓		
15		In front of guest room No.C506	✓	✓	✓		
16	FL.6	INearby the elevator, 6th floor	✓	✓	✓		
17		In front of guest room No.C602	✓	✓	✓		
18		In front of guest room No.C607	✓	✓	✓		
19	FL.7	INearby the elevator, 7th floor	✓	✓	✓		
20		In front of guest room No.C702	✓	✓	✓		
21		In front of guest room No.C707	✓	✓	✓		
		Totally	21	21	21		

Jirasak S.
Loss Prevention Officer
Date: 30/03/25

Yotin S.
Loss Prevention Supervisor
Date: 30/3/25

Loss Prevention Manager
Date: 1/4/2025

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: March 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building D					
1	FL.B	Entrance to the parking lot under Building D.	✓	✓	✓		
2	FL.1	INearby the elevator, 1st floor	✓	✓	✓		
3		In front of the entrance to the fitness	✓	✓	✓		
4		Back door to snook kitchen	✓	✓	✓		
5	FL.2	In front of the Spa	✓	✓	✓		
6		Spa Exit Door	✓	✓	✓		
7		In front of the sauna room	✓	✓	✓		
8		In front of Fire exit door	✓	✓	✓		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
10		In front of the restroom	✓	✓	✓		
11		In front of exit door	✓	✓	✓		
12		In front of entrance door	✓	✓	✓		
		Building F					
13	FL.1	Kids Club Entrance door	✓	✓	✓		
14		Kids Club exit door	✓	✓	✓		
		Totally					

Jirasak S.
Loss Prevention Officer
Date: 30/03/25

Yotin S.
Loss Prevention Supervisor
Date: 30/3/25

Loss Prevention Manager
Date: 1/4/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month April 2025

30/4/2025

Approved by : Loss Prevention Manager

Jotin S.

Approved by : Loss Prevention Supervisor

Nerawoot Ruangmalai

Inspection by : Loss Prevention Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. April 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ตู้ดับเพลิง FHC เปิดทิ้ง
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawat Puangmala.....

Date.....26/04/2025.....

Loss Prevention Supervisor..... Yotin S. .....

Date.....30/4/25.....

Loss Prevention Manager.....

Date.....30/4/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. APRIL 2025

DESCRIPTION		Fire Extinguisher ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข้า	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..... Worawat Rungmalai.....

Date..... 26/04/2025.....

Loss Prevention Supervisor..... Sothy S.....

Date..... 30/4/25.....

Loss Prevention Manager.....

Date..... 30/4/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. April 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer. Worawoot P.

Date. 26/04/2025

Loss Prevention Supervisor. Kotin S.

Date. 30/4/25

Loss Prevention Manager.

Date. 30/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month April 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer..Werawoot P.....

Date..26/04/2025.....

Loss Prevention Supervisor.....Kotin S.....

Date.....30/4/25.....

Loss Prevention Manager.....

Date.....30/4/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month... April 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer... Worawoot P. Loss Prevention Supervisor... Yotin S.

Date... 26/04/2025 Date... 30/4/25

Loss Prevention Manager.....

Date... 30/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..April 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer..Worawoot P.....

Date...20/04/2025.....

Loss Prevention Supervisor..Yotin S.....

Date...30/4/25.....

Loss Prevention Manager.....

Date...30/4/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. April 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer. Worawat P.

Date. 26/04/2025

Loss Prevention Supervisor. Yothin S.

Date. 30/4/25

Loss Prevention Manager.

Date. 30/4/2025

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month April 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer..Worawat.....L.....
Date 26/04/2025

Loss Prevention Supervisor.....Jatin S.....
Date.....30/4/25.....

Loss Prevention Manager.....
Date.....30/4/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. April 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ตู้ดับเพลิง FHC เปิดทิ้ง
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawat Puangmala.....

Date.....26/04/2025.....

Loss Prevention Supervisor..... Yotin S. .....

Date.....30/4/25.....

Loss Prevention Manager.....

Date.....30/4/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. APRIL 2025

DESCRIPTION		Fire Extinguisher ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข้า	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..... Worawat Rungmalai.....

Date..... 26/04/2025.....

Loss Prevention Supervisor..... Sothy S.....

Date..... 30/4/25.....

Loss Prevention Manager.....

Date..... 30/4/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. April 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Loss Prevention Officer. Worawoot P.

Date. 26/04/2025

Loss Prevention Supervisor. Kotin S.

Date. 30/4/25

Loss Prevention Manager.

Date. 30/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month April 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Loss Prevention Officer..Werawoot P.....

Date..26/04/2025.....

Loss Prevention Supervisor.....Kotin S.....

Date.....30/4/25.....

Loss Prevention Manager.....

Date.....30/4/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month... April 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer... Worawoot P. Loss Prevention Supervisor... Yotin S.

Date... 26/04/2025 Date... 30/4/25

Loss Prevention Manager.....

Date... 30/4/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..April 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Loss Prevention Officer..Worawoot P.....

Date...20/04/2025.....

Loss Prevention Supervisor..Yotin S.....

Date...30/4/25.....

Loss Prevention Manager.....

Date...30/4/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. April 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer. Worawat P.

Date. 26/04/2025

Loss Prevention Supervisor. Yothin S.

Date. 30/4/25

Loss Prevention Manager.

Date. 30/4/2025

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: April 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow แคบกว่าปกติ	Lighting ไฟฉุกเฉิน Work	Lighting ไฟฉุกเฉิน Not Work	Remark ข้อสังเกตุ
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	✓		
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	NA		Wooden Sign
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

Pittawat A. (For)
Loss Prevention Officer
Date: 30/4/25

Yotin S.
Loss Prevention Supervisor
Date: 30/4/25

Yotin S. (For)
Loss Prevention Manager
Date: 30/4/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: April 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /การทำงานของไฟ Work	Not Work	Remark หมายเหตุ
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	✓	✓		
2		In front of the elevator floor B	✓	✓	✓		
3		Exit from Building B to Building C.	✓	✓	✓		
4		Fire escape exit in front of the water pump room	✓	✓	NA		Wooden Sign
5		Fire escape exit in front of the generator room	✓	✓	NA		Wooden Sign
6	FL.1	In front of guest room No.B101	✓	✓	✓		
7		In front of guest room No.B108	✓	✓	✓		
8		In front of guest room No.B116/B123	✓	✓	✓		
9	FL.2	In front of guest room No.B201	✓	✓	✓		
10		In front of guest room No.B208	✓	✓	✓		
11		In front of guest room No.B216/B223	✓	✓	✓		
12	FL.3	In front of guest room No.B301	✓	✓	✓		
13		In front of guest room No.B308	✓	✓	✓		
14		In front of guest room No.B316/B323	✓	✓	✓		
15	FL.4	In front of guest room No.B401	✓	✓	✓		
16		In front of guest room No.B408	✓	✓	✓		
17		In front of guest room No.B416/B423	✓	✓	✓		
18	FL.5	In front of guest room No.B501	✓	✓	✓		
19		In front of guest room No.B508	✓	✓	✓		
20		In front of guest room No.B516/B523	✓	✓	✓		
21	FL.6	In front of guest room No.B601	✓	✓	✓		
22		In front of guest room No.B608	✓	✓	✓		
23		In front of guest room No.B66/B123	✓	✓	✓		
24	FL.7	In front of guest room No.B701	✓	✓	✓		
25		In front of guest room No.B708	✓	✓	✓		
26		In front of guest room No.B716/B723	✓	✓	✓		
		Totally	26	26	24		

Pittawat. A. (For)
Loss Prevention Officer
Date: 30/4/25

Yutin S.
Loss Prevention Supervisor
Date: 30/4/25

Yutin S. (For)
Loss Prevention Manager
Date: 30/4/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: April 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ทางแคบ	Lighting /สถานะหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building C					
1	FL.1	In front of the entrance to Building C	✓	✓	✓		
2		In front of guest room No.C118	✓	✓	✓		
3		In front of the exit door to Building C	✓	✓	✓		
4	FL.2	INearby the elevator, 2nd floor	✓	✓	✓		
5		In front of guest room No.C202	✓	✓	✓		
6		In front of guest room No.C207	✓	✓	✓		
7	FL.3	INearby the elevator, 3rd floor	✓	✓	✓		
8		In front of guest room No.C306	✓	✓	✓		
9		In front of guest room No.C307	✓	✓	✓		
10	FL.4	INearby the elevator, 4th floor	✓	✓	✓		
11		In front of guest room No.C402	✓	✓	✓		
12		In front of guest room No.C407	✓	✓	✓		
13	FL.5	INearby the elevator, 5th floor	✓	✓	✓		
14		In front of guest room No.C407	✓	✓	✓		
15		In front of guest room No.C506	✓	✓	✓		
16	FL.6	INearby the elevator, 6th floor	✓	✓	✓		
17		In front of guest room No.C602	✓	✓	✓		
18		In front of guest room No.C607	✓	✓	✓		
19	FL.7	INearby the elevator, 7th floor	✓	✓	✓		
20		In front of guest room No.C702	✓	✓	✓		
21		In front of guest room No.C707	✓	✓	✓		
		Totally	21	21	21		

Pittawat A. (For)
Loss Prevention Officer
Date: 30/4/25

Yotin S.
Loss Prevention Supervisor
Date: 30/4/25

Yotin S. (For)
Loss Prevention Manager
Date: 30/4/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: April 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ทางแคบ	Lighting / การส่องสว่าง Work	Not Work	Remark หมายเหตุ
		Building D					
1	FL.B	Entrance to the parking lot under Building D.	✓	✓	✓		
2	FL.1	INearby the elevator, 1st floor	✓	✓	✓		
3		In front of the entrance to the fitness	✓	✓	✓		
4		Back door to snook kitchen	✓	✓	✓		
5	FL.2	In front of the Spa	✓	✓	✓		
6		Spa Exit Door	✓	✓	✓		
7		In front of the sauna room	✓	✓	✓		
8		In front of Fire exit door	✓	✓	✓		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
10		In front of the restroom	✓	✓	✓		
11		In front of exit door	✓	✓	✓		
12		In front of entrance door	✓	✓	✓		
		Building F					
13	FL.1	Kids Club Entrance door	✓	✓	✓		
14		Kids Club exit door	✓	✓	✓		
		Totally	14	14	14		

Pittanat A. (For)
Loss Prevention Officer
Date: 30/4/25

Yotin S.
Loss Prevention Supervisor
Date: 30/4/25

Yotin S. (For)
Loss Prevention Manager
Date: 30/4/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month May 2025

31/5/2025
Approved by : Loss Prevention Manager

Yotin S. 31/05/25
Approved by : Loss Prevention Supervisor

Worawat P. 31/05/25
Inspection by : Loss Prevention Officer

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. May 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ที่ดับเพลิง หมดอายุ
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawoot P.

Date....31/05/25.....

Loss Prevention Supervisor..... Yothin S.

Date....31/05/25.....

Loss Prevention Manager.....3/6/25.....

Date....3/6/25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month May 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..... Worawoot P.

Date..... 31/05/25

Loss Prevention Supervisor..... Kotim S.

Date..... 31/05/25

Loss Prevention Manager.....

Date..... 3/6/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	ok	ok	
Jaak Din Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Generator Room	Halotron	ok	ok	
MDB Rooom	Halotron	ok	ok	
Storage Gas	Halotron	ok	ok	
Back Of The Canteen Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Bakery Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Laundry Room	Halotron	ok	ok	
	Halotron	ok	ok	
Front Of The Prayer Room	Halotron	ok	ok	
	Halotron	ok	ok	
Nearby Guest Room A216	Halotron	ok	ok	
Nearby Guest Room A316	Halotron	ok	ok	
Nearby Guest Room A416	Halotron	ok	ok	
Nearby Guest Room A516	Halotron	ok	ok	
Nearby Guest Room A616	Halotron	ok	ok	
Nearby Guest Room A716	Halotron	ok	ok	

Loss Prevention Officer Woranuot P.

Date 31/05/25

Loss Prevention Supervisor Yuttin S.

Date 31/05/25

Loss Prevention Manager

Date 31/6/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	ok	ok	
	Halotron 2	ok	ok	
Front of Pump Room	Halotron 1	ok	ok	
	Halotron 2	ok	ok	
Nearby Guest Room B101	Halotron	ok	ok	
Nearby Guest Room B116	Halotron	ok	ok	
Nearby Guest Room B201	Halotron	ok	ok	
Nearby Guest Room B216	Halotron	ok	ok	
Nearby Guest Room B301	Halotron	ok	ok	
Nearby Guest Room B316	Halotron	ok	ok	
Nearby Guest Room B401	Halotron	ok	ok	
Nearby Guest Room B416	Halotron	ok	ok	
Nearby Guest Room B501	Halotron	ok	ok	
Nearby Guest Room B516	Halotron	ok	ok	
Nearby Guest Room B601	Halotron	ok	ok	
Nearby Guest Room B616	Halotron	ok	ok	
Nearby Guest Room B701	Halotron	ok	ok	
Nearby Guest Room B716	Halotron	ok	ok	

Loss Prevention Officer Worawoot P.

Date 31/05/25

Loss Prevention Supervisor Yotin S.

Date 31/05/25

Loss Prevention Manager

Date 31/5/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoit P. Loss Prevention Supervisor Yotin S.

Date 31/05/25 Date 31/05/25

Loss Prevention Manager

Date 31/5/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Yotin S.

Date 31/05/25 Date 31/05/25

Loss Prevention Manager

Date 3/6/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..May 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer.....Worawoot P.....

Date.....31/05/25.....

Loss Prevention Supervisor.....Yothin S.....

Date.....31/05/25.....

Loss Prevention Manager.....

Date.....31/6/25.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month May 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer Worawat P.

Date 31/05/25

Loss Prevention Supervisor Yotin S.

Date 31/05/25

Loss Prevention Manager

Date 31/5/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. May 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ที่ดับเพลิง หมดอายุ
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawoot P.

Date....31/05/25.....

Loss Prevention Supervisor..... Yothin S.

Date....31/05/25.....

Loss Prevention Manager.....3/6/25.....

Date....3/6/25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month May 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer..... Worawoot P.

Date..... 31/05/25

Loss Prevention Supervisor..... Kotim S.

Date..... 31/05/25

Loss Prevention Manager.....

Date..... 3/6/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	ok	ok	
Jaak Din Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Generator Room	Halotron	ok	ok	
MDB Rooom	Halotron	ok	ok	
Storage Gas	Halotron	ok	ok	
Back Of The Canteen Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Bakery Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Laundry Room	Halotron	ok	ok	
	Halotron	ok	ok	
Front Of The Prayer Room	Halotron	ok	ok	
	Halotron	ok	ok	
Nearby Guest Room A216	Halotron	ok	ok	
Nearby Guest Room A316	Halotron	ok	ok	
Nearby Guest Room A416	Halotron	ok	ok	
Nearby Guest Room A516	Halotron	ok	ok	
Nearby Guest Room A616	Halotron	ok	ok	
Nearby Guest Room A716	Halotron	ok	ok	

Loss Prevention Officer Woranuot P.

Date 31/05/25

Loss Prevention Supervisor Yuttin S.

Date 31/05/25

Loss Prevention Manager

Date 31/6/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	ok	ok	
	Halotron 2	ok	ok	
Front of Pump Room	Halotron 1	ok	ok	
	Halotron 2	ok	ok	
Nearby Guest Room B101	Halotron	ok	ok	
Nearby Guest Room B116	Halotron	ok	ok	
Nearby Guest Room B201	Halotron	ok	ok	
Nearby Guest Room B216	Halotron	ok	ok	
Nearby Guest Room B301	Halotron	ok	ok	
Nearby Guest Room B316	Halotron	ok	ok	
Nearby Guest Room B401	Halotron	ok	ok	
Nearby Guest Room B416	Halotron	ok	ok	
Nearby Guest Room B501	Halotron	ok	ok	
Nearby Guest Room B516	Halotron	ok	ok	
Nearby Guest Room B601	Halotron	ok	ok	
Nearby Guest Room B616	Halotron	ok	ok	
Nearby Guest Room B701	Halotron	ok	ok	
Nearby Guest Room B716	Halotron	ok	ok	

Loss Prevention Officer Worawoot P.

Date 31/05/25

Loss Prevention Supervisor Yotin S.

Date 31/05/25

Loss Prevention Manager

Date 31/5/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoit P. Loss Prevention Supervisor Yotin S.

Date 31/05/25 Date 31/05/25

Loss Prevention Manager

Date 31/5/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month May 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Yotin S.

Date 31/05/25 Date 31/05/25

Loss Prevention Manager

Date 3/6/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..May 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer.....Worawoot P.....

Date.....31/05/25.....

Loss Prevention Supervisor.....Yothin S.....

Date.....31/05/25.....

Loss Prevention Manager.....

Date.....31/6/25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month June 2025

25/6/2025
Approved by : Loss Prevention Manager

Yothin S. 30/06/2025
Approved by : Loss Prevention Supervisor

Worawoot Puangmalai 25/06/2025
Inspection by : Loss Prevention Officer

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. June 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ถังดับเพลิงขาดหาย
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawoot P. .....

Date..... 25/05/2025 .....

Loss Prevention Supervisor..... Yotin S. .....

Date..... 30/06/2025 .....

Loss Prevention Manager.....

Date..... 25/6/2025 .....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month... June 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer... Worawoot P. .....

Date... 25/06/2025 .....

Loss Prevention Manager.....

Date... 25/6/2025 .....

Loss Prevention Supervisor... Kotin S. .....

Date... 30/06/2025 .....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month... June 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	OK	OK	
Jaak Din Restaurant	CO2	Ok	Ok	
	Wet Chemical	Ok	Ok	
	Halotron	Ok	Ok	
Generator Room	Halotron	Ok	Ok	
MDB Rooom	Halotron	Ok	Ok	
Storage Gas	Halotron	Ok	Ok	
Back Of The Canteen Room	CO2	Ok	Ok	
	Wet Chemical	OK	OK	
	Halotron	Ok	OK	
Front Of The Bakery Room	CO2	Ok	Ok	
	Wet Chemical	OK	OK	
	Halotron	OK	Ok	
Front Of The Laundry Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Front Of The Prayer Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Nearby Guest Room A216	Halotron	Ok	Ok	
Nearby Guest Room A316	Halotron	Ok	Ok	
Nearby Guest Room A416	Halotron	Ok	Ok	
Nearby Guest Room A516	Halotron	Ok	Ok	
Nearby Guest Room A616	Halotron	Ok	Ok	
Nearby Guest Room A716	Halotron	Ok	Ok	

Loss Prevention Officer... Worawut P.
Date... 25/05/2025

Loss Prevention Supervisor... Yotin S.
Date... 30/06/2025

Loss Prevention Manager.....
Date... 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rcoom	Halotron 1	Ok	Ok	
	Halo 2	Ok	Ok	
Front of Pump Room	Halotr 1	Ok	OK	
	Halotr 2	Ok	Ok	
Nearby Guest Room B101	Halotron	Ok	Ok	
Nearby Guest Room B116	Halotron	Ok	Ok	
Nearby Guest Room B201	Halotron	Ok	Ok	
Nearby Guest Room B216	Halotron	Ok	Ok	
Nearby Guest Room B301	Halotron	OK	Ok	
Nearby Guest Room B316	Halotron	OK	Ok	
Nearby Guest Room B401	Halotron	OK	Ok	
Nearby Guest Room B416	Halotron	Ok	Ok	
Nearby Guest Room B501	Halotron	Ok	Ok	
Nearby Guest Room B516	Halotron	OK	Ok	
Nearby Guest Room B601	Halotron	OK	Ok	
Nearby Guest Room B616	Halotron	Ok	Ok	
Nearby Guest Room B701	Halotron	Ok	Ok	
Nearby Guest Room B716	Halotron	Ok	Ok	

Loss Prevention Officer... Worawoot P.

Date... 25/06/25

Loss Prevention Supervisor... Yotin S.

Date... 30/06/2025

Loss Prevention Manager...

Date... 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Yotin S.

Date 25/06/2025 Date 30/06/2025

Loss Prevention Manager .....

Date 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO_2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Worawat P. Loss Prevention Supervisor Yotin S.

Date 25/06/2025 Date 30/06/2025

Loss Prevention Manager .....

Date 25/6/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..June 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	/	/			
2	Factory Hydrant infront of loading dock	/	/			

Loss Prevention Officer..Worawut P.....

Date..25/06/2025.....

Loss Prevention Supervisor..Jatin S.....

Date..30/06/2025.....

Loss Prevention Manager.....

Date..25/6/2025.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. June 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer. Wornwoot P.

Date. 25/06/2025

Loss Prevention Supervisor. Yotin S.

Date. 30/06/2025

Loss Prevention Manager.

Date. 25/6/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. June 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ถังดับเพลิงขาดหาย
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer..... Worawoot P. .....

Date..... 25/05/2025 .....

Loss Prevention Supervisor..... Yotin S. .....

Date..... 30/06/2025 .....

Loss Prevention Manager.....

Date..... 25/6/2025 .....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month... June 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer... Worawoot P. .....

Date... 25/06/2025 .....

Loss Prevention Manager.....

Date... 25/6/2025 .....

Loss Prevention Supervisor... Kotin S. .....

Date... 30/06/2025 .....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month... June 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	OK	OK	
Jaak Din Restaurant	CO2	Ok	Ok	
	Wet Chemical	Ok	Ok	
	Halotron	Ok	Ok	
Generator Room	Halotron	Ok	Ok	
MDB Rooom	Halotron	Ok	Ok	
Storage Gas	Halotron	Ok	Ok	
Back Of The Canteen Room	CO2	Ok	Ok	
	Wet Chemical	OK	OK	
	Halotron	Ok	OK	
Front Of The Bakery Room	CO2	Ok	Ok	
	Wet Chemical	OK	OK	
	Halotron	OK	Ok	
Front Of The Laundry Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Front Of The Prayer Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Nearby Guest Room A216	Halotron	Ok	Ok	
Nearby Guest Room A316	Halotron	Ok	Ok	
Nearby Guest Room A416	Halotron	Ok	Ok	
Nearby Guest Room A516	Halotron	Ok	Ok	
Nearby Guest Room A616	Halotron	Ok	Ok	
Nearby Guest Room A716	Halotron	Ok	Ok	

Loss Prevention Officer... Worawut P.
Date... 25/05/2025

Loss Prevention Supervisor... Yotin S.
Date... 30/06/2025

Loss Prevention Manager.....
Date... 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rcoom	Halotron 1	Ok	Ok	
	Halo 2	Ok	Ok	
Front of Pump Room	Halotr 1	Ok	OK	
	Halotr 2	Ok	Ok	
Nearby Guest Room B101	Halotron	Ok	Ok	
Nearby Guest Room B116	Halotron	Ok	Ok	
Nearby Guest Room B201	Halotron	Ok	Ok	
Nearby Guest Room B216	Halotron	Ok	Ok	
Nearby Guest Room B301	Halotron	OK	Ok	
Nearby Guest Room B316	Halotron	OK	Ok	
Nearby Guest Room B401	Halotron	OK	Ok	
Nearby Guest Room B416	Halotron	Ok	Ok	
Nearby Guest Room B501	Halotron	Ok	Ok	
Nearby Guest Room B516	Halotron	OK	Ok	
Nearby Guest Room B601	Halotron	OK	Ok	
Nearby Guest Room B616	Halotron	Ok	Ok	
Nearby Guest Room B701	Halotron	Ok	Ok	
Nearby Guest Room B716	Halotron	Ok	Ok	

Loss Prevention Officer... Worawoot P.

Date... 25/06/25

Loss Prevention Supervisor... Yotin S.

Date... 30/06/2025

Loss Prevention Manager...

Date... 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawoot P. Loss Prevention Supervisor Yotin S.

Date 25/06/2025 Date 30/06/2025

Loss Prevention Manager .....

Date 25/6/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month June 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO_2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Worawat P. Loss Prevention Supervisor Yotin S.

Date 25/06/2025 Date 30/06/2025

Loss Prevention Manager .....

Date 25/6/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..June 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	/	/			
2	Factory Hydrant infront of loading dock	/	/			

Loss Prevention Officer..Worawut P.....

Date..25/06/2025.....

Loss Prevention Supervisor..Jatin S.....

Date..30/06/2025.....

Loss Prevention Manager.....

Date..25/6/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month July 2025

29/7/25

Approved by : Loss Prevention Manager

Yotin S.

Approved by : Loss Prevention Supervisor

Worawoot Puangmalai

Inspection by : Loss Prevention Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month July 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดผ่านม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ต้องดับเพลิงเบื้องต้น
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer Woramwoot P.

Date 29/07/2025

Loss Prevention Supervisor Jotin S.

Date 28/07/25

Loss Prevention Manager .....

Date 29/7/29

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month July 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	ไม่มีสายฉีดแบบม้วน
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer Worawat P.

Date 28/07/2025

Loss Prevention Supervisor Jatin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	ok	ok	
Jaak Din Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Generator Room	Halotron	ok	ok	
MDB Rooom	Halotron	ok	ok	
Storage Gas	Halotron	ok	ok	
Back Of The Canteen Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Bakery Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Laundry Room	Halotron	ok	ok	
	Halotron	ok	ok	
Front Of The Prayer Room	Halotron	ok	ok	
	Halotron	ok	ok	
Nearby Guest Room A216	Halotron	ok	ok	
Nearby Guest Room A316	Halotron	ok	ok	
Nearby Guest Room A416	Halotron	ok	ok	
Nearby Guest Room A516	Halotron	ok	ok	
Nearby Guest Room A616	Halotron	ok	ok	
Nearby Guest Room A716	Halotron	ok	ok	

Loss Prevention Officer Worawoot P.

Date 28/07/2025

Loss Prevention Supervisor Yotin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Front of Pump Room	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Nearby Guest Room B101	Halotron	Ok	Ok	
Nearby Guest Room B116	Halotron	Ok	Ok	
Nearby Guest Room B201	Halotron	Ok	Ok	
Nearby Guest Room B216	Halotron	Ok	Ok	
Nearby Guest Room B301	Halotron	Ok	Ok	
Nearby Guest Room B316	Halotron	Ok	Ok	
Nearby Guest Room B401	Halotron	Ok	Ok	
Nearby Guest Room B416	Halotron	Ok	Ok	
Nearby Guest Room B501	Halotron	Ok	Ok	
Nearby Guest Room B516	Halotron	Ok	Ok	
Nearby Guest Room B601	Halotron	Ok	Ok	
Nearby Guest Room B616	Halotron	Ok	Ok	
Nearby Guest Room B701	Halotron	Ok	Ok	
Nearby Guest Room B716	Halotron	Ok	Ok	

Loss Prevention Officer Worawoot P.

Date 28/07/2025

Loss Prevention Supervisor Yotin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawut P. Loss Prevention Supervisor Yotin S.

Date 28/07/2025 Date 28/07/25

Loss Prevention Manager MS

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Woranuch P. Loss Prevention Supervisor Jutin S.

Date 28/07/2025 Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.....

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer..Worawoot P.....

Date....28/07/2025.....

Loss Prevention Supervisor....Jatin S.....

Date....28/07/25.....

Loss Prevention Manager.....

Date....29/7/25.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month July 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Loss Prevention Officer Woramoot P.

Date 28/07/2025

Loss Prevention Supervisor Jatin S.

Date 28/07/25

Loss Prevention Manager .....

Date 29/7/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month July 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดผ่านม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ต้องดับเพลิงเบื้องต้น
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Loss Prevention Officer Woramwoot P.

Date 29/07/2025

Loss Prevention Supervisor Jotin S.

Date 28/07/25

Loss Prevention Manager .....

Date 29/7/29

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month July 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	ไม่มีสายฉีดแบบม้วน
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Loss Prevention Officer Worawat P.

Date 28/07/2025

Loss Prevention Supervisor Jatin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	ok	ok	
Jaak Din Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Generator Room	Halotron	ok	ok	
MDB Rooom	Halotron	ok	ok	
Storage Gas	Halotron	ok	ok	
Back Of The Canteen Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Bakery Room	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Front Of The Laundry Room	Halotron	ok	ok	
	Halotron	ok	ok	
Front Of The Prayer Room	Halotron	ok	ok	
	Halotron	ok	ok	
Nearby Guest Room A216	Halotron	ok	ok	
Nearby Guest Room A316	Halotron	ok	ok	
Nearby Guest Room A416	Halotron	ok	ok	
Nearby Guest Room A516	Halotron	ok	ok	
Nearby Guest Room A616	Halotron	ok	ok	
Nearby Guest Room A716	Halotron	ok	ok	

Loss Prevention Officer Worawoot P.

Date 28/07/2025

Loss Prevention Supervisor Yotin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Front of Pump Room	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Nearby Guest Room B101	Halotron	Ok	Ok	
Nearby Guest Room B116	Halotron	Ok	Ok	
Nearby Guest Room B201	Halotron	Ok	Ok	
Nearby Guest Room B216	Halotron	Ok	Ok	
Nearby Guest Room B301	Halotron	Ok	Ok	
Nearby Guest Room B316	Halotron	Ok	Ok	
Nearby Guest Room B401	Halotron	Ok	Ok	
Nearby Guest Room B416	Halotron	Ok	Ok	
Nearby Guest Room B501	Halotron	Ok	Ok	
Nearby Guest Room B516	Halotron	Ok	Ok	
Nearby Guest Room B601	Halotron	Ok	Ok	
Nearby Guest Room B616	Halotron	Ok	Ok	
Nearby Guest Room B701	Halotron	Ok	Ok	
Nearby Guest Room B716	Halotron	Ok	Ok	

Loss Prevention Officer Worawoot P.

Date 28/07/2025

Loss Prevention Supervisor Yotin S.

Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	ok	ok	
Front of the elevator 1 FL	Halotron	ok	ok	
Nearby Guest Room C201	Halotron	ok	ok	
Front Of Pantry 2 FL.	Halotron	ok	ok	
Nearby Guest Room C306	Halotron	ok	ok	
Front Of Pantry 3 FL.	Halotron	ok	ok	
Nearby Guest Room C402	Halotron	ok	ok	
Front Of Pantry 4 FL.	Halotron	ok	ok	
Nearby Guest Room C506	Halotron	ok	ok	
Front Of Pantry 5 FL.	Halotron	ok	ok	
Nearby Guest Room C602	Halotron	ok	ok	
Front Of Pantry 6 FL.	Halotron	ok	ok	
Nearby Guest Room B702	Halotron	ok	ok	
Front Of Pantry 7 FL.	Halotron	ok	ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Loss Prevention Officer Worawut P. Loss Prevention Supervisor Yotin S.

Date 28/07/2025 Date 28/07/25

Loss Prevention Manager MS

Date 29/7/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month July 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Loss Prevention Officer Woranuch P. Loss Prevention Supervisor Jutin S.

Date 28/07/2025 Date 28/07/25

Loss Prevention Manager

Date 29/7/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.....

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Loss Prevention Officer..Worawoot P.....

Date....28/07/2025.....

Loss Prevention Supervisor....Jatin S.....

Date....28/07/25.....

Loss Prevention Manager.....

Date....29/7/25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month August 2025

Approved by : Loss Prevention Manager

Approved by : Safety Officer

Yotin S.

Inspection by : Loss Prevention Sup./Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..August 2025.....

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ตู้ดับเพลิงเปียกฝน
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Safety Officer.....

Date.....2/9/2025.....

Loss Prevention Sup./Offcer.....Yotin S.....

Date.....31/08/25.....

Loss Prevention Manager.....

Date.....1/9/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. August 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	ไม่มีสายฉีดแบบม้วน
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Safety Officer.....

Date..... 2/9/2025

Loss Prevention Sup./Officer..... Yotin S.

Date..... 31/08/25

Loss Prevention Manager.....

Date..... 1/9/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month August 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	Ok	Ok	
Jaak Din Restaurant	CO2	Ok	Ok	
	Wet Chemical	Ok	Ok	
	Halotron	Ok	Ok	
Generator Room	Halotron	Ok	Ok	
MDB Rooom	Halotron	Ok	Ok	
Storage Gas	Halotron	Ok	Ok	
Back Of The Canteen Room	CO2	Ok	Ok	
	Wet Chemical	Ok	Ok	
	Halotron	Ok	Ok	
Front Of The Bakery Room	CO2	Ok	Ok	
	Wet Chemical	Ok	Ok	
	Halotron	Ok	Ok	
Front Of The Laundry Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Front Of The Prayer Room	Halotron	Ok	Ok	
	Halotron	Ok	Ok	
Nearby Guest Room A216	Halotron	Ok	Ok	
Nearby Guest Room A316	Halotron	Ok	Ok	
Nearby Guest Room A416	Halotron	Ok	Ok	
Nearby Guest Room A516	Halotron	Ok	Ok	
Nearby Guest Room A616	Halotron	Ok	Ok	
Nearby Guest Room A716	Halotron	Ok	Ok	

Safety Officer.....

Date.....2/9/2025

Loss Prevention Sup./Officer.....Yotin S.

Date.....31/08/25

Loss Prevention Manager.....

Date.....1/9/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month August 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Front of Pump Room	Halotron 1	Ok	Ok	
	Halotron 2	Ok	Ok	
Nearby Guest Room B101	Halotron	Ok	Ok	
Nearby Guest Room B116	Halotron	Ok	Ok	
Nearby Guest Room B201	Halotron	Ok	Ok	
Nearby Guest Room B216	Halotron	Ok	Ok	
Nearby Guest Room B301	Halotron	Ok	Ok	
Nearby Guest Room B316	Halotron	Ok	Ok	
Nearby Guest Room B401	Halotron	Ok	Ok	
Nearby Guest Room B416	Halotron	Ok	Ok	
Nearby Guest Room B501	Halotron	Ok	Ok	
Nearby Guest Room B516	Halotron	Ok	Ok	
Nearby Guest Room B601	Halotron	Ok	Ok	
Nearby Guest Room B616	Halotron	Ok	Ok	
Nearby Guest Room B701	Halotron	Ok	Ok	
Nearby Guest Room B716	Halotron	Ok	Ok	

Safety Officer.....

Date.....2/9/2025

Loss Prevention Sup./Officer.....Yotin S.

Date.....31/08/25

Loss Prevention Manager.....

Date.....1/9/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. August 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	Ok	Ok	
Front of the elevator 1 FL	Halotron	Ok	Ok	
Nearby Guest Room C201	Halotron	Ok	Ok	
Front Of Pantry 2 FL.	Halotron	Ok	Ok	
Nearby Guest Room C306	Halotron	Ok	Ok	
Front Of Pantry 3 FL.	Halotron	Ok	Ok	
Nearby Guest Room C402	Halotron	Ok	Ok	
Front Of Pantry 4 FL.	Halotron	Ok	Ok	
Nearby Guest Room C506	Halotron	Ok	Ok	
Front Of Pantry 5 FL.	Halotron	Ok	Ok	
Nearby Guest Room C602	Halotron	Ok	Ok	
Front Of Pantry 6 FL.	Halotron	Ok	Ok	
Nearby Guest Room B702	Halotron	Ok	Ok	
Front Of Pantry 7 FL.	Halotron	Ok	Ok	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Safety Officer.....

Date..... 2/9/2025

Loss Prevention Sup./Officer..... Yotin S.

Date..... 31/08/25

Loss Prevention Manager.....

Date..... 2/9/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month August 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	ok	ok	
Front of the men's restroom	Halotron	ok	ok	
Snook Restaurant	CO2	ok	ok	
	Wet Chemical	ok	ok	
	Halotron	ok	ok	
Storage Gas of Snook	Halotron	ok	ok	
Front Of Sauna room 2 FL.	Halotron	ok	ok	
	Halotron	ok	ok	
In side Pump Room	Halotron	ok	ok	
OG 3 FL.	Halotron	ok	ok	
OG Outdoor 3 FL.	Halotron	ok	ok	
Front of Pump Room	Halotron	ok	ok	
	Halotron	ok	ok	
Parking lot, Building D	Halotron	ok	ok	
	Halotron	ok	ok	

Safety Officer.....

Date 2/9/2025

Loss Prevention Sup./Officer Yotin S.

Date 31/08/25

Loss Prevention Manager.....

Date 1/9/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month August 2025

No.	Description	Factory Hydrant		Public Hydrant		Remarks
		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Safety Officer.....

Date 2/9/2025

Loss Prevention Sup./Officer.....

Date 31/08/25

Loss Prevention Manager.....

Date 1/9/2025

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. August 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Safety Officer.....

Date..... 2/9/2025

Loss Prevention Sup./Officer..... Yotin S.

Date..... 31/08/25

Loss Prevention Manager.....

Date..... 1/9/2025

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: August 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow จุดตรงทางแคบ	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	NA		Wooden Sign
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	✓		
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

Safety Officer
Date: 2/9/2025

Loss Prevention Manager
Date: 2/9/2025

Loss Prevention Sup./Officer
Date: 31/08/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: August 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ทางเดินแคบ	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	✓	✓		
2		In front of the elevator floor B	✓	✓	✓		
3		Exit from Building B to Building C.	✓	✓	NA		
4		Fire escape exit In front of the water pump room	✓	✓	✓		
5		Fire escape exit In front of the generator room	✓	✓	NA		
6	FL.1	In front of guest room No.B101	✓	✓	✓		
7		In front of guest room No.B108	✓	✓	✓		
8		In front of guest room No.B116/B123	✓	✓	✓		
9	FL.2	In front of guest room No.B201	✓	✓	✓		
10		In front of guest room No.B208	✓	✓	✓		
11		In front of guest room No.B216/B223	✓	✓	✓		
12	FL.3	In front of guest room No.B301	✓	✓	✓		
13		In front of guest room No.B308	✓	✓	✓		
14		In front of guest room No.B316/B323	✓	✓	✓		
15	FL.4	In front of guest room No.B401	✓	✓	✓		
16		In front of guest room No.B408	✓	✓	✓		
17		In front of guest room No.B416/B423	✓	✓	✓		
18	FL.5	In front of guest room No.B501	✓	✓	X		
19		In front of guest room No.B508	✓	✓	✓		
20		In front of guest room No.B516/B523	✓	✓	✓		
21	FL.6	In front of guest room No.B601	✓	✓	✓		
22		In front of guest room No.B608	✓	✓	✓		
23		In front of guest room No.B66/B123	✓	✓	✓		
24	FL.7	In front of guest room No.B701	✓	✓	✓		
25		In front of guest room No.B708	✓	✓	✓		
26		In front of guest room No.B716/B723	✓	✓	✓		
		Totally	26	26	23		

Safety Officer
Date: 2/9/2025

Loss Prevention Manager
Date: 1/9/2025

Loss Prevention Sup./Officer
Date: 31/08/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: August 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
		Building C					
1	FL.1	In front of the entrance to Building C	✓	✓	✓		
2		In front of guest room No.C118	✓	✓	✓		
3		In front of the exit door to Building C	✓	✓	✓		
4	FL.2	INearby the elevator, 2nd floor	✓	✓	✓		
5		In front of guest room No.C202	✓	✓	✓		
6		In front of guest room No.C207	✓	✓	✓		
7	FL.3	INearby the elevator, 3rd floor	✓	✓	✓		
8		In front of guest room No.C306	✓	✓	✓		
9		In front of guest room No.C307	✓	✓	✓		
10	FL.4	INearby the elevator, 4th floor	✓	✓	✓		
11		In front of guest room No.C402	✓	✓	✓		
12		In front of guest room No.C407	✓	✓	✓		
13	FL.5	INearby the elevator, 5th floor	✓	✓	✓		
14		In front of guest room No.C407	✓	✓	✓		
15		In front of guest room No.C506	✓	✓	✓		
16	FL.6	INearby the elevator, 6th floor	✓	✓	✓		
17		In front of guest room No.C602	✓	✓	✓		
18		In front of guest room No.C607	✓	✓	✓		
19	FL.7	INearby the elevator, 7th floor	✓	✓	✓		
20		In front of guest room No.C702	✓	✓	✓		
21		In front of guest room No.C707	✓	✓	✓		
		Totally	21	21	21		

Safety Officer
Date: 21/8/2025

Loss Prevention Manager
Date: 1/9/2025

Loss Prevention Sup./Officer
Date: 31/08/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: August 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
Building D							
1	FL.B	Entrance to the parking lot under Building D.	✓	✓	✓		
2	FL.1	INearby the elevator, 1st floor	✓	✓	✓		
3		In front of the entrance to the fitness	✓	✓	✓		
4		Back door to snook kitchen	✓	✓	✓		
5	FL.2	In front of the Spa	✓	✓	✓		
6		Spa Exit Door	✓	✓	✓		
7		In front of the sauna room	✓	✓	✓		
8		In front of Fire exit door	✓	✓	✓		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
10		In front of the restroom	✓	✓	✓		
11		In front of exit door	✓	✓	✓		
12		In front of entrance door	✓	✓	✓		
Building F							
13	FL.1	Kids Club Entrance door	✓	✓	✓		
14		Kids club exit door	✓	✓	✓		
Totally			14	14	14		

Safety Officer
Date: 2/9/2025

Loss Prevention Manager
Date: 1/9/2025

Loss Prevention Sup./Officer
Date: 31/08/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month September 2025

10/10/2025

Approved by : Loss Prevention Manager

Approved by : Safety Officer

Yotin S.

Inspection by : Loss Prevention Sup./~~Officer~~

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month September 2025

DESCRIPTION		Fire Extinguish ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อเสะข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	คัดต้นเพลิง ไม่ได้ตาก
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Safety Officer.....

Date 10/10/2025

Loss Prevention Manager.....

Date 10/10/2025

Loss Prevention Sup./~~Officer~~ Yotin S.

Date 30/09/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month September 2025

DESCRIPTION		Fire Extinguish ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	✓	NA	NA	ไม่มีสายฉีดแบบม้วน
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C29	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	✓	✓	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	NA	

Safety Officer.....

Date 10/10/2025

Loss Prevention Sup./~~Officer~~ Jotin S.

Date 30/09/25

Loss Prevention Manager.....

Date 10/10/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. September 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Safety Officer.....

Date.....10/10/2025

Loss Prevention Sup./~~Officer~~.....Yotin S.

Date.....30/09/25

Loss Prevention Manager.....

Date.....10/10/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month. September 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Safety Officer.....

Date..... 10/10/2025

Loss Prevention Sup./~~Officer~~..... Yatin S.

Date.....

Loss Prevention Manager.....

Date..... 10/10/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month September 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Safety Officer.....

Date 10/10/2025

Loss Prevention Sup./~~Officer~~ Yotin S.

Date 30/09/25

Loss Prevention Manager.....

Date 10/10/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month September 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Safety Officer.....

Date 10/10/2025

Loss Prevention Sup./~~Officer~~ Yotin S.

Date 30/09/25

Loss Prevention Manager.....

Date 10/10/2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..September 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Safety Officer.....

Date..10/10/2025.....

Loss Prevention Sup./Officer..Yotin S.....

Date..30/09/2025.....

Loss Prevention Manager.....

Date..10/10/2025.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. September 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Safety Officer.....

Date. 10/10/2025

Loss Prevention Sup./~~Officer~~. Jestin S.

Date. 30/09/25

Loss Prevention Manager.....

Date. 10/10/2025

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: September 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพแสงออกไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	NA		Wooden Sign
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	✓		
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

.....
Safety Officer
Date: 10/10/2025

.....
Loss Prevention Manager
Date: 10/10/2025

Yatin S.
.....
Loss Prevention Sup./~~Officer~~
Date: 30/09/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: September 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ทุกตรงทางออก	Lighting /สภาพแสงสว่าง		Remark หมายเหตุ
					Work	Not Work	
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	✓	✓		
2		In front of the elevator floor B	✓	✓	✓		
3		Exit from Building B to Building C.	✓	✓	NA		Wooden Sign
4		Fire escape exit In front of the water pump room	✓	✓	✓		
5		Fire escape exit In front of the generator room	✓	✓	NA		Wooden Sign
6	FL.1	In front of guest room No.B101	✓	✓	✓		
7		In front of guest room No.B108	✓	✓	✓		
8		In front of guest room No.B116/B123	✓	✓	✓		
9	FL.2	In front of guest room No.B201	✓	✓	✓		
10		In front of guest room No.B208	✓	✓	✓		
11		In front of guest room No.B216/B223	✓	✓	✓		
12	FL.3	In front of guest room No.B301	✓	✓	✓		
13		In front of guest room No.B308	✓	✓	✓		
14		In front of guest room No.B316/B323	✓	✓	✓		
15	FL.4	In front of guest room No.B401	✓	✓	✓		
16		In front of guest room No.B408	✓	✓	✓		
17		In front of guest room No.B416/B423	✓	✓	✓		
18	FL.5	In front of guest room No.B501	✓	✓	✓		
19		In front of guest room No.B508	✓	✓	✓		
20		In front of guest room No.B516/B523	✓	✓	✓		
21	FL.6	In front of guest room No.B601	✓	✓	✓		
22		In front of guest room No.B608	✓	✓	✓		
23		In front of guest room No.B66/B123	✓	✓	✓		
24	FL.7	In front of guest room No.B701	✓	✓	✓		
25		In front of guest room No.B708	✓	✓	✓		
26		In front of guest room No.B716/B723	✓	✓	✓		
		Totally	26	26	24		

Safety Officer
Date: 10/10/2025

Loss Prevention Manager
Date: 10/10/2025

Loss Prevention Sup./~~Officer~~
Date: 30/09/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: September 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow จุดหรี่ทาง	Lighting /สภาพแสงไฟ Work	Not Work	Remark หมายเหตุ
		Building C					
1	FL.1	In front of the entrance to Building C	✓	✓	✓		
2		In front of guest room No.C118	✓	✓	✓		
3		In front of the exit door to Building C	✓	✓	✓		
4	FL.2	INearby the elevator, 2nd floor	✓	✓	✓		
5		In front of guest room No.C202	✓	✓	✓		
6		In front of guest room No.C207	✓	✓	✓		
7	FL.3	INearby the elevator, 3rd floor	✓	✓	✓		
8		In front of guest room No.C306	✓	✓	✓		
9		In front of guest room No.C307	✓	✓	✓		
10	FL.4	INearby the elevator, 4th floor	✓	✓	✓		
11		In front of guest room No.C402	✓	✓	✓		
12		In front of guest room No.C407	✓	✓	✓		
13	FL.5	INearby the elevator, 5th floor	✓	✓	✓		
14		In front of guest room No.C407	✓	✓	✓		
15		In front of guest room No.C506	✓	✓	✓		
16	FL.6	INearby the elevator, 6th floor	✓	✓	✓		
17		In front of guest room No.C602	✓	✓	✓		
18		In front of guest room No.C607	✓	✓	✓		
19	FL.7	INearby the elevator, 7th floor	✓	✓	✓		
20		In front of guest room No.C702	✓	✓	✓		
21		In front of guest room No.C707	✓	✓	✓		
		Totally	21	21	21		

Safety Officer
Date: 10/10/2025

Loss Prevention Manager
Date: 10/10/2025

Yotin S.
Loss Prevention Sup./~~Officer~~
Date: 30/09/25

LaGreen
Retch Residence

Fire Exit Signage Checklist Report

Month: September 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สถานะแสงไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building D					
1	FL.B	Entrance to the parking lot under Building D.	✓	✓	✓		
2	FL.1	INearby the elevator, 1st floor	✓	✓	✓		
3		In front of the entrance to the fitness	✓	✓	✓		
4		Back door to snook kitchen	✓	✓	✓		
5	FL.2	In front of the Spa	✓	✓	✓		
6		Spa Exit Door	✓	✓	✓		
7		In front of the sauna room	✓	✓	✓		
8		In front of Fire exit door	✓	✓	✓		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
10		In front of the restroom	✓	✓	✓		
11		In front of exit door	✓	✓	✓		
12		In front of entrance door	✓	✓	✓		
		Building F					
13	FL.1	Kids Club Entrance door	✓	✓	✓		
14		Kids Club exit door	✓	✓	✓		
		Totally					

Safety Officer
Date: 30/10/2025

Loss Prevention Manager
Date: 30/10/2025

Yotin S.
Loss Prevention Sup./~~Officer~~
Date: 30/09/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month October 2025

Approved by : Loss Prevention Manager

Approved by : Safety Officer

Worawoot Ruangmalai
Inspection by : Loss Prevention Sup./Officer

Loss Prevention Department 2025

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. October 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A02	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A03	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A04	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A05	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A06	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A07	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-A08	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B10	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B11	Front Of Elevator FL.2	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B12	Front Of Elevator FL.3	NA	✓	✓	NA	NA	✓	✓	NA	✓	ถังดับเพลิงเข็น
FHC-B13	Front Of Elevator FL.4	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B14	Front Of Elevator FL.5	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B15	Front Of Elevator FL.6	✓	✓	✓	NA	NA	✓	✓	NA	✓	
FHC-B16	Front Of Elevator FL.7	✓	✓	✓	NA	NA	✓	✓	NA	✓	

Safety Officer.....

Date.....31/10/25

Loss Prevention Sup./Offcer...Worawoot.....

Date.....29/10/25

Loss Prevention Manager.....

Date.....30/10/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. October 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	✓	✓	✓	NA	NA	✓	/	NA	NA	
FHC-C18	Front Of Pantry FL.1	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C19	Front Of Elevator FL.2	✓	✓	NA	NA	NA	✓	/	NA	NA	ไม่มีสายฉีดแบบม้วน
FHC-C20	Front Of Pantry FL.2	✓	✓	✓	NA	NA	✓	/	NA	NA	
FHC-C21	Front Of Elevator FL.3	✓	✓	✓	NA	NA	✓	/	NA	NA	
FHC-C22	Front Of Pantry FL.3	✓	✓	✓	NA	NA	✓	/	NA	NA	
FHC-C23	Front Of Elevator FL.4	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C24	Front Of Pantry FL.4	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C25	Front Of Elevator FL.5	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C26	Front Of Pantry FL.5	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C27	Front Of Elevator FL.6	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C28	Front Of Pantry FL.6	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C29	Front Of Elevator FL.7	/	✓	✓	NA	NA	/	/	NA	NA	
FHC-C30	Front Of Pantry FL.7	✓	✓	✓	NA	NA	/	/	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C32	Front Of Elevator FL.2	✓	✓	✓	NA	NA	/	/	NA	NA	
FHC-C33	Front Of Elevator FL.3	✓	✓	✓	NA	NA	/	/	NA	NA	

Safety Officer.....

Date.. 31/10/25

Loss Prevention Sup./Officer... Werawoot

Date.. 29/10/25

Loss Prevention Manager.....

Date.. 29/10/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month October 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	✓	✓	
Jaak Din Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Generator Room	Halotron	✓	✓	
MDB Rooom	Halotron	✓	✓	
Storage Gas	Halotron	✓	✓	
Back Of The Canteen Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Bakery Room	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Front Of The Laundry Room	Halotron	✓	✓	
	Halotron	✓	✓	
Front Of The Prayer Room	Halotron	✓	✓	
	Halotron	✓	✓	
Nearby Guest Room A216	Halotron	✓	✓	
Nearby Guest Room A316	Halotron	✓	✓	
Nearby Guest Room A416	Halotron	✓	✓	
Nearby Guest Room A516	Halotron	✓	✓	
Nearby Guest Room A616	Halotron	✓	✓	
Nearby Guest Room A716	Halotron	✓	✓	

Safety Officer.....

Date 31/10/68

Loss Prevention Sup./Officer Worawoot

Date 29/10/25

Loss Prevention Manager.....

Date 30/10/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month October 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Front of Pump Room	Halotron 1	✓	✓	
	Halotron 2	✓	✓	
Nearby Guest Room B101	Halotron	✓	✓	
Nearby Guest Room B116	Halotron	✓	✓	
Nearby Guest Room B201	Halotron	✓	✓	
Nearby Guest Room B216	Halotron	✓	✓	
Nearby Guest Room B301	Halotron	✓	✓	
Nearby Guest Room B316	Halotron	✓	✓	
Nearby Guest Room B401	Halotron	✓	✓	
Nearby Guest Room B416	Halotron	✓	✓	
Nearby Guest Room B501	Halotron	✓	✓	
Nearby Guest Room B516	Halotron	✓	✓	
Nearby Guest Room B601	Halotron	✓	✓	
Nearby Guest Room B616	Halotron	✓	✓	
Nearby Guest Room B701	Halotron	✓	✓	
Nearby Guest Room B716	Halotron	✓	✓	

Safety Officer.....

Date 31/10/25

Loss Prevention Sup./Officer.....

Date 29/10/25

Loss Prevention Manager.....

Date 30/10/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..October 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	✓	✓	
Front of the elevator 1 FL	Halotron	✓	✓	
Nearby Guest Room C201	Halotron	✓	✓	
Front Of Pantry 2 FL.	Halotron	✓	✓	
Nearby Guest Room C306	Halotron	✓	✓	
Front Of Pantry 3 FL.	Halotron	✓	✓	
Nearby Guest Room C402	Halotron	✓	✓	
Front Of Pantry 4 FL.	Halotron	✓	✓	
Nearby Guest Room C506	Halotron	✓	✓	
Front Of Pantry 5 FL.	Halotron	✓	✓	
Nearby Guest Room C602	Halotron	✓	✓	
Front Of Pantry 6 FL.	Halotron	✓	✓	
Nearby Guest Room B702	Halotron	✓	✓	
Front Of Pantry 7 FL.	Halotron	✓	✓	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Safety Officer.....

Date..31/10/25

Loss Prevention Sup./Officer..Weravuot.....

Date..29/10/25

Loss Prevention Manager.....

Date..30/10/25

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..October 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	✓	✓	
Front of the men's restroom	Halotron	✓	✓	
Snook Restaurant	CO2	✓	✓	
	Wet Chemical	✓	✓	
	Halotron	✓	✓	
Storage Gas of Snook	Halotron	✓	✓	
Front Of Sauna room 2 FL.	Halotron	✓	✓	
	Halotron	✓	✓	
In side Pump Room	Halotron	✓	✓	
OG 3 FL.	Halotron	✓	✓	
OG Outdoor 3 FL.	Halotron	✓	✓	
Front of Pump Room	Halotron	✓	✓	
	Halotron	✓	✓	
Parking lot, Building D	Halotron	✓	✓	
	Halotron	✓	✓	

Safety Officer.....

Date.....31/10/25.....

Loss Prevention Sup./Officer...Wararwoot.....

Date.....29/10/25.....

Loss Prevention Manager.....

Date.....30/10/25.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month..October 2025.....

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	✓	✓			
2	Factory Hydrant infront of loading dock	✓	✓			

Safety Officer.....

Date.....31/10/25.....

Loss Prevention Sup./Officer..Worawoot.....

Date.....29/10/25.....

Loss Prevention Manager.....

Date.....30/10/25.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. October 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Jaak Din Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	
Sanook Restaurant	Fire Blanket 1	✓	✓	
	Fire Blanket 2	✓	✓	

Safety Officer.....

Date.....31/10/68.....

Loss Prevention Sup./Officer..Woravoot.....

Date.....29/10/25.....

Loss Prevention Manager.....

Date.....30/10/25.....

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: October 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
		Building A					
1	FL.B	In front of GM office	✓	✓	✓		
2		BOH Corridor	✓	✓	✓		
3		In front of HK office	✓	✓	✓		
4		In front of Bekery room	✓	✓	✓		
5		Stairs leading up to the gas store	✓	✓	✓		
6	FL.1	Pizza Pasta Area	✓	✓	✓		
7		Jaak Din Restaurant	✓	✓	✓		
8		Jaak Din Restaurant Cashier	✓	✓	✓		
9		Fire escape exit on the main kitchen side	✓	✓	✓		
10		Fire escape exit to building B.	✓	✓	NA		Hooden Sign
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	✓	✓	✓		
12		In front of the guest room No.A203	✓	✓	✓		
13		In front of the guest room No.A210	✓	✓	✓		
14		In front of the fire escape door near the guest room No.A217	✓	✓	✓		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	✓	✓	✓		
16		In front of the guest room No.A303	✓	✓	✓		
17		In front of the guest room No.A310	✓	✓	✓		
18		In front of the fire escape door near the guest room No.A317	✓	✓	✓		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	✓	✓	✓		
20		In front of the guest room No.A403	✓	✓	✓		
21		In front of the guest room No.A410	✓	✓	✓		
22		In front of the fire escape door near the guest room No.A417	✓	✓	✓		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	✓	✓	✓		
24		In front of the guest room No.A503	✓	✓	✓		
25		In front of the guest room No.A510	✓	✓	✓		
26		In front of the fire escape door near the guest room No.A517	✓	✓	✓		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	✓	✓	✓		
28		In front of the guest room No.A603	✓	✓	✓		
29		In front of the guest room No.A610	✓	✓	✓		
30		In front of the fire escape door near the guest room No.A617	✓	✓	✓		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	✓	✓	✓		
32		In front of the guest room No.A703	✓	✓	✓		
33		In front of the guest room No.A710	✓	✓	✓		
34		In front of the fire escape door near the guest room No.A717	✓	✓	✓		
		Totally	34	34	33		

Safety Officer
Date: 31/10/25

Loss Prevention Manager
Date: 30/10/25

Worawoot
Loss Prevention Sup./Officer
Date: 29/10/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: October 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุดตรงทางเดิน	Lighting /สภาพการออกไฟ Work	Lighting /สภาพการออกไฟ Not Work	Remark หมายเหตุ
		Building B					
1	FL.B	Entrance to the parking lot under Building B.	✓	/	/		
2		In front of the elevator floor B	✓	/	/		
3		Exit from Building B to Building C.	✓	/	NA		Wooden Sign
4		Fire escape exit In front of the water pump room	✓	/	/		
5		Fire escape exit In front of the generator room	✓	/	NA		Wooden Sign
6	FL.1	In front of guest room No.B101	✓	/	/		
7		In front of guest room No.B108	✓	/	/		
8		In front of guest room No.B116/B123	✓	/	/		
9	FL.2	In front of guest room No.B201	✓	/	/		
10		In front of guest room No.B208	✓	/	/		
11		In front of guest room No.B216/B223	✓	/	/		
12	FL.3	In front of guest room No.B301	✓	/	/		
13		In front of guest room No.B308	✓	/	/		
14		In front of guest room No.B316/B323	✓	/	/		
15	FL.4	In front of guest room No.B401	✓	/	/		
16		In front of guest room No.B408	✓	/	/		
17		In front of guest room No.B416/B423	✓	/	/		
18	FL.5	In front of guest room No.B501	✓	/	/		
19		In front of guest room No.B508	✓	/	/		
20		In front of guest room No.B516/B523	✓	/	/		
21	FL.6	In front of guest room No.B601	✓	/	/		
22		In front of guest room No.B608	✓	/	/		
23		In front of guest room No.B66/B123	✓	/	/		
24	FL.7	In front of guest room No.B701	✓	/	/		
25		In front of guest room No.B708	/	/	/		
26		In front of guest room No.B716/B723	✓	/	/		
		Totally	26	26	24		

.....
Safety Officer
Date: 31/10/25

.....
Loss Prevention Manager
Date: 30/10/25

Woravoot
.....
Loss Prevention Sup./Officer
Date: 29/10/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: October 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรชี้ทาง	Lighting /สภาพหลอดไฟ		Remark หมายเหตุ
					Work	Not Work	
		Building C					
1	FL.1	In front of the entrance to Building C	/	/	/		
2		In front of guest room No.C118	/	/	/		
3		In front of the exit door to Building C	/	/	/		
4	FL.2	INearby the elevator, 2nd floor	/	/	/		
5		In front of guest room No.C202	/	/	/		
6		In front of guest room No.C207	/	/	/		
7	FL.3	INearby the elevator, 3rd floor	/	/	/		
8		In front of guest room No.C306	/	/	/		
9		In front of guest room No.C307	/	/	/		
10	FL.4	INearby the elevator, 4th floor	/	/	/		
11		In front of guest room No.C402	/	/	/		
12		In front of guest room No.C407	/	/	/		
13	FL.5	INearby the elevator, 5th floor	/	/	/		
14		In front of guest room No.C407	/	/	/		
15		In front of guest room No.C506	/	/	/		
16	FL.6	INearby the elevator, 6th floor	/	/	/		
17		In front of guest room No.C602	/	/	/		
18		In front of guest room No.C607	/	/	/		
19	FL.7	INearby the elevator, 7th floor	/	/	/		
20		In front of guest room No.C702	/	/	/		
21		In front of guest room No.C707	/	/	/		
		Totally	21	21	21		

Safety Officer
Date: 31/10/68

Loss Prevention Manager
Date: 30/10/25

Worawoot
Loss Prevention Sup./Officer
Date: 29/10/25

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: October 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุบัติเหตุ	Lighting /สภาพแสงสว่าง Work	Lighting /สภาพแสงสว่าง Not Work	Remark หมายเหตุ
Building D							
1	FL.B	Entrance to the parking lot under Building D.	/	/	/		
2	FL.1	INearby the elevator, 1st floor	/	/	/		
3		In front of the entrance to the fitness	/	/	/		
4		Back door to snook kitchen	/	/	/		
5	FL.2	In front of the Spa	/	/	/		
6		Spa Exit Door	/	/	/		
7		In front of the sauna room	/	/	/		
8		In front of Fire exit door	/	/	/		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	/	/	/		
10		In front of the restroom	/	/	/		
11		In front of exit door	/	/	/		
12		In front of entrance door	/	/	/		
Building F							
13	FL.1	Kids Club Entrance door	/	/	/		
14		Kids Club exit door	/	/			
Totally			14	14	14		

Safety Officer
Date: 31/10/25

Loss Prevention Manager
Date: 30/10/25

Waraporn
Loss Prevention Sup./Officer
Date: 29/10/25

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month November 2025

Approved by : Loss Prevention Manager

Approved by : Safety Officer

Witthayawat Daloonphet
Inspection by : Loss Prevention Sup./Officer

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. November 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	/	/	/	NA	NA	/	/	NA	/	
FHC-A02	Front Of Elevator FL.1	/	/	/	NA	NA	/	/	NA	/	
FHC-A03	Front Of Elevator FL.2	/	/	/	NA	NA	/	/	NA	/	
FHC-A04	Front Of Elevator FL.3	/	/	/	NA	NA	/	/	NA	/	
FHC-A05	Front Of Elevator FL.4	/	/	/	NA	NA	/	/	NA	/	
FHC-A06	Front Of Elevator FL.5	/	/	/	NA	NA	/	/	NA	/	
FHC-A07	Front Of Elevator FL.6	/	/	/	NA	NA	/	/	NA	/	
FHC-A08	Front Of Elevator FL.7	/	/	/	NA	NA	/	/	NA	/	
Fire Hose Cabinet building B											
FHC-B09	Front Of Elevator FL.B	/	/	/	NA	NA	/	/	NA	NA	
FHC-B10	Front Of Elevator FL.1	/	/	/	NA	NA	/	/	NA	/	
FHC-B11	Front Of Elevator FL.2	/	/	/	NA	NA	/	/	NA	/	
FHC-B12	Front Of Elevator FL.3	NA	/	/	NA	NA	/	/	NA	/	ถังดับเพลิงเปิดออก
FHC-B13	Front Of Elevator FL.4	/	/	/	NA	NA	/	/	NA	/	
FHC-B14	Front Of Elevator FL.5	/	/	/	NA	NA	/	/	NA	/	
FHC-B15	Front Of Elevator FL.6	/	/	/	NA	NA	/	/	NA	/	
FHC-B16	Front Of Elevator FL.7	/	/	/	NA	NA	/	/	NA	/	

Safety Officer.....

Date.....25/11/25.....

Loss Prevention Manager.....

Date.....25/11/2025.....

Loss Prevention Sup./Offcer...witthayawat.....

Date.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month.. November 2025

DESCRIPTION		Fire Extinguishe ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเจ็ท	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวจ่ายน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building C											
FHC-C17	Front Of Elevator FL.1	/	/	/	NA	NA	/	/	NA	NA	
FHC-C18	Front Of Pantry FL.1	/	/	/	NA	NA	/	/	NA	NA	
FHC-C19	Front Of Elevator FL.2	/	/	NA	NA	NA	/	/	NA	NA	ไม่มี Hose Reel
FHC-C20	Front Of Pantry FL.2	/	/	/	NA	NA	/	/	NA	NA	
FHC-C21	Front Of Elevator FL.3	/	/	/	NA	NA	/	/	NA	NA	
FHC-C22	Front Of Pantry FL.3	/	/	/	NA	NA	/	/	NA	NA	
FHC-C23	Front Of Elevator FL.4	/	/	/	NA	NA	/	/	NA	NA	
FHC-C24	Front Of Pantry FL.4	/	/	/	NA	NA	/	/	NA	NA	
FHC-C25	Front Of Elevator FL.5	/	/	/	NA	NA	/	/	NA	NA	
FHC-C26	Front Of Pantry FL.5	/	/	/	NA	NA	/	/	NA	NA	
FHC-C27	Front Of Elevator FL.6	/	/	/	NA	NA	/	/	NA	NA	
FHC-C28	Front Of Pantry FL.6	/	/	/	NA	NA	/	/	NA	NA	
FHC-C29	Front Of Elevator FL.7	/	/	/	NA	NA	/	/	NA	NA	
FHC-C30	Front Of Pantry FL.7	/	/	/	NA	NA	/	/	NA	NA	
Fire Hose Cabinet building D											
FHC-C31	Front Of Elevator FL.1	/	/	/	NA	NA	/	/	NA	NA	
FHC-C32	Front Of Elevator FL.2	/	/	/	NA	NA	/	/	NA	NA	
FHC-C33	Front Of Elevator FL.3	/	/	/	NA	NA	/	/	NA	NA	

Safety Officer.....

Date..... 25/11/25

Loss Prevention Manager.....

Date..... 25/11/25

Loss Prevention Sup./Officer.... Witthayawat

Date.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month November 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	/	/	
Jaak Din Restaurant	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Generator Room	Halotron	/	/	
MDB Rooom	Halotron	/	/	
Storage Gas	Halotron	/	/	
Back Of The Canteen Room	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Front Of The Bakery Room	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Front Of The Laundry Room	Halotron	/	/	
	Halotron	/	/	
Front Of The Prayer Room	Halotron	/	/	
	Halotron	/	/	
Nearby Guest Room A216	Halotron	/	/	
Nearby Guest Room A316	Halotron	/	/	
Nearby Guest Room A416	Halotron	/	/	
Nearby Guest Room A516	Halotron	/	/	
Nearby Guest Room A616	Halotron	/	/	
Nearby Guest Room A716	Halotron	/	/	

Safety Officer.....

Date 25/11/25

Loss Prevention Sup./Officer Witthayawat

Date.....

Loss Prevention Manager.....

Date 25/11/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month November 2025

Building B				
Place	Type	Condition	Pressure	Remarks
Front of MDB Rooom	Halotron 1	/	/	
	Halotron 2	/	/	
Front of Pump Room	Halotron 1	/	/	
	Halotron 2	/	/	
Nearby Guest Room B101	Halotron	/	/	
Nearby Guest Room B116	Halotron	/	/	
Nearby Guest Room B201	Halotron	/	/	
Nearby Guest Room B216	Halotron	/	/	
Nearby Guest Room B301	Halotron	/	/	
Nearby Guest Room B316	Halotron	/	/	
Nearby Guest Room B401	Halotron	/	/	
Nearby Guest Room B416	Halotron	/	/	
Nearby Guest Room B501	Halotron	/	/	
Nearby Guest Room B516	Halotron	/	/	
Nearby Guest Room B601	Halotron	/	/	
Nearby Guest Room B616	Halotron	/	/	
Nearby Guest Room B701	Halotron	/	/	
Nearby Guest Room B716	Halotron	/	/	

Safety Officer.....

Date 25/11/25

Loss Prevention Sup./Officer Witthayawat

Date.....

Loss Prevention Manager.....

Date 25/11/2025

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month November 2025

Building C				
Place	Type	Condition	Pressure	Remarks
Nearby Guest Room C102	Halotron	/	/	
Front of the elevator 1 FL	Halotron	/	/	
Nearby Guest Room C201	Halotron	/	/	
Front Of Pantry 2 FL.	Halotron	/	/	
Nearby Guest Room C306	Halotron	/	/	
Front Of Pantry 3 FL.	Halotron	/	/	
Nearby Guest Room C402	Halotron	/	/	
Front Of Pantry 4 FL.	Halotron	/	/	
Nearby Guest Room C506	Halotron	/	/	
Front Of Pantry 5 FL.	Halotron	/	/	
Nearby Guest Room C602	Halotron	/	/	
Front Of Pantry 6 FL.	Halotron	/	/	
Nearby Guest Room B702	Halotron	/	/	
Front Of Pantry 7 FL.	Halotron	/	/	
Building F				
Kids Club	Halotron	NA	NA	Not Installed
	Halotron	NA	NA	Not Installed

Safety Officer.....

Date.....25/11/25.....

Loss Prevention Sup./Officer.....Witthayanat.....

Date.....

Loss Prevention Manager.....

Date.....25/11/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month: November 2025

Building D				
Place	Type	Condition	Pressure	Remarks
Fitness in side staff room	Halotron	/	/	
Front of the men's restroom	Halotron	/	/	
Snook Restaurant	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Storage Gas of Snook	Halotron	/	/	
Front Of Sauna room 2 FL.	Halotron	/	/	
	Halotron	/	/	
In side Pump Room	Halotron	/	/	
OG 3 FL.	Halotron	/	/	
OG Outdoor 3 FL.	Halotron	/	/	
Front of Pump Room	Halotron	/	/	
	Halotron	/	/	
Parking lot, Building D	Halotron	/	/	
	Halotron	/	/	

Safety Officer.....

Date.....25/11/25.....

Loss Prevention Sup./Officer.....Witthayawat.....

Date.....

Loss Prevention Manager.....

Date.....25/11/2025.....

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST

Month. November 2025

	Description	Factory Hydrant		Public Hydrant		Remarks
No.		ข้อต่อ	ฝาครอบ	ข้อต่อ	ฝาครอบ	
1	Factory Hydrant in front of the moterbike parking	/	/			
2	Factory Hydrant infront of loading dock	/	/			

Safety Officer..... Loss Prevention Sup./Officer.....Witthayawat.....

Date.....25/11/25..... Date.....

Loss Prevention Manager.....

Date.....25/11/2025.....

LaGreen
Hotel & Residence

Fire Blanket Inspection

Month. November 2025

Place	Type	Condition	Pressure	Remarks
Canteen	Fire Blanket 1	/	/	
	Fire Blanket 2	/	/	
Jaak Din Restaurant	Fire Blanket 1	/	/	
	Fire Blanket 2	/	/	
Sanook Restaurant	Fire Blanket 1	/	/	
	Fire Blanket 2	/	/	

Safety Officer.....

Date.....25/11/25.....

Loss Prevention Sup./Officer.....Witthayawat.....

Date.....

Loss Prevention Manager.....

Date.....25/11/2025.....

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: November 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow ลูกศรสี่ทาง	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
Building A							
1	FL.B	In front of GM office	/	/	/		
2		BOH Corridor	/	/	/		
3		In front of HK office	/	/	/		
4		In front of Bekery room	/	/	/		
5		Stairs leading up to the gas store	/	/	/		
6	FL.1	Pizza Pasta Area	/	/	/		
7		Jaak Din Restaurant	/	/	/		
8		Jaak Din Restaurant Cashier	/	/	/		
9		Fire escape exit on the main kitchen side	/	/	/		
10		Fire escape exit to building B.	/	/	NA		Wooden Sign
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	/	/	/		
12		In front of the guest room No.A203	/	/	/		
13		In front of the guest room No.A210	/	/	/		
14		In front of the fire escape door near the guest room No.A217	/	/	/		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	/	/	/		
16		In front of the guest room No.A303	/	/	/		
17		In front of the guest room No.A310	/	/	/		
18		In front of the fire escape door near the guest room No.A317	/	/	/		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	/	/	/		
20		In front of the guest room No.A403	/	/	/		
21		In front of the guest room No.A410	/	/	/		
22		In front of the fire escape door near the guest room No.A417	/	/	/		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	/	/	/		
24		In front of the guest room No.A503	/	/	/		
25		In front of the guest room No.A510	/	/	/		
26		In front of the fire escape door near the guest room No.A517	/	/	/		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	/	/	/		
28		In front of the guest room No.A603	/	/	/		
29		In front of the guest room No.A610	/	/	/		
30		In front of the fire escape door near the guest room No.A617	/	/	/		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	/	/	/		
32		In front of the guest room No.A703	/	/	/		
33		In front of the guest room No.A710	/	/	/		
34		In front of the fire escape door near the guest room No.A717	/	/	/		
Totally			34	34	33		

Safety Officer
Date: 25/11/25

Loss Prevention Manager
Date: 25/11/2025

Witthayawat
Loss Prevention Sup./Officer
Date:

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: November 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุกกระชั้นทาง	Lighting /สภาพแสงสว่าง Work	Lighting /สภาพแสงสว่าง Not Work	Remark หมายเหตุ
Building B							
1	FL.B	Entrance to the parking lot under Building B.	/	/	/		
2		In front of the elevator floor B	/	/	/		
3		Exit from Building B to Building C.	/	/	NA		wooden sign
4		Fire escape exit In front of the water pump room	/	/	/		
5		Fire escape exit In front of the generator room	/	/	NA		wooden sign
6	FL.1	In front of guest room No.B101	/	/	/		
7		In front of guest room No.B108	/	/	/		
8		In front of guest room No.B116/B123	/	/	/		
9	FL.2	In front of guest room No.B201	/	/	/		
10		In front of guest room No.B208	/	/	/		
11		In front of guest room No.B216/B223	/	/	/		
12	FL.3	In front of guest room No.B301	/	/	/		
13		In front of guest room No.B308	/	/	/		
14		In front of guest room No.B316/B323	/	/	/		
15	FL.4	In front of guest room No.B401	/	/	/		
16		In front of guest room No.B408	/	/	/		
17		In front of guest room No.B416/B423	/	/	/		
18	FL.5	In front of guest room No.B501	/	/	/		
19		In front of guest room No.B508	/	/	/		
20		In front of guest room No.B516/B523	/	/	/		
21	FL.6	In front of guest room No.B601	/	/	/		
22		In front of guest room No.B608	/	/	/		
23		In front of guest room No.B66/B123	/	/	/		
24	FL.7	In front of guest room No.B701	/	/	/		
25		In front of guest room No.B708	/	/	/		
26		In front of guest room No.B716/B723	/	/	/		
Totally			26	26	24		

Safety Officer
Date: 25/11/25

Loss Prevention Manager
Date: 25/11/2025

wittayawat
Loss Prevention Sup./Officer
Date:

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: November 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุกตรีทาง	Lighting /สภาพหลอดไฟ Work	Lighting /สภาพหลอดไฟ Not Work	Remark หมายเหตุ
		Building C					
1	FL.1	In front of the entrance to Building C	/	/	/		
2		In front of guest room No.C118	/	/	/		
3		In front of the exit door to Building C	/	/	/		
4	FL.2	INearby the elevator, 2nd floor	/	/	/		
5		In front of guest room No.C202	/	/	/		
6		In front of guest room No.C207	/	/	/		
7	FL.3	INearby the elevator, 3rd floor	/	/	/		
8		In front of guest room No.C306	/	/	/		
9		In front of guest room No.C307	/	/	/		
10	FL.4	INearby the elevator, 4th floor	/	/	/		
11		In front of guest room No.C402	/	/	/		
12		In front of guest room No.C407	/	/	/		
13	FL.5	INearby the elevator, 5th floor	/	/	/		
14		In front of guest room No.C407	/	/	/		
15		In front of guest room No.C506	/	/	/		
16	FL.6	INearby the elevator, 6th floor	/	/	/		
17		In front of guest room No.C602	/	/	/		
18		In front of guest room No.C607	/	/	/		
19	FL.7	INearby the elevator, 7th floor	/	/	/		
20		In front of guest room No.C702	/	/	/		
21		In front of guest room No.C707	/	/	/		
Totally			21	21	21		

Safety Officer
Date: 25/11/25

Loss Prevention Manager
Date: 25/11/2025

Witthayawat
Loss Prevention Sup./Officer
Date:

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: November 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุกกรณ์ทาง	Lighting /สภาพแสงสว่าง		Remark หมายเหตุ
					Work	Not Work	
		Building D					
1	FL.B	Entrance to the parking lot under Building D.	/	/	/		
2	FL.1	INearby the elevator, 1st floor	/	/	/		
3		In front of the entrance to the fitness	/	/	/		
4		Back door to snook kitchen	/	/	/		
5	FL.2	In front of the Spa	/	/	/		
6		Spa Exit Door	/	/	/		
7		In front of the sauna room	/	/	/		
8		In front of Fire exit door	/	/	/		
9	FL.3	In front of the fire escape door near the elevator on FL.3rd	/	/	/		
10		In front of the restroom	/	/	/		
11		In front of exit door	/	/	/		
12		In front of entrance door	/	/	/		
		Building F					
13	FL.1	Kids Club Entrance door	/	/	/		
14		Kids Club exit door	/	/	/		
		Totally					

Safety Officer
Date: 25/11/25

Loss Prevention Manager
Date: 25/11/2025

Witthayawat
Loss Prevention Sup./Officer
Date:

LaGreen
Hotel & Residence

PREVENTIVE MAINTENANCE CHECK LIST (FHC)

Month December 2025

Approved by : Loss Prevention Manager

Approved by : Safety Officer

Worawoot Puangmalai (LP Officer)

Inspection by : Loss Prevention Sup./Officer

LaGreen
Hotel & Residence

ENTIVE MAINTENANCE CHECK LIST

Month..December..2025.....

DESCRIPTION		Fire Extinguisher ถังดับเพลิง	Axe ขวาน	Hose Reel สายฉีดแบบม้วน	Fire Hoses สายดับเพลิง	Jet Nozzle หัวฉีดเข็ม	Hydrant Cover ฝาครอบท่อและข้อ	Factory Hydrant หัวรับน้ำดับเพลิง	Public Hydrant หัวรับน้ำดับเพลิง	Chalk ชอล์ก	Remark
Fire Hose Cabinet building A											
FHC-A01	Front Of Elevator FL.B	/	/	/	NA	NA	/	/	NA	/	
FHC-A02	Front Of Elevator FL.1	/	/	/	NA	NA	/	/	NA	/	
FHC-A03	Front Of Elevator FL.2	/	/	/	NA	NA	/	/	NA	/	
FHC-A04	Front Of Elevator FL.3	/	/	/	NA	NA	/	/	NA	/	
FHC-A05	Front Of Elevator FL.4	/	/	/	NA	NA	/	/	NA	/	
FHC-A06	Front Of Elevator FL.5	/	/	/	NA	NA	/	/	NA	/	
FHC-A07	Front Of Elevator FL.6	/	/	/	NA	NA	/	/	NA	/	
FHC-A08	Front Of Elevator FL.7	/	/	/	NA	NA	/	/	NA	/	

Safety Officer.....

Date.....5/1/69.....

Loss Prevention Manager.....

Date.....6/1/26.....

Loss Prevention Sup./Offcer.....Worawoot.....

Date.....31/12/2025.....

LaGreen
Hotel & Residence

Fire Extinguishers Inspection

Month..December 2025

Building A				
Place	Type	Condition	Pressure	Remarks
Front Office	Halotron	/	/	
Jaak Din Restaurant	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Generator Room	Halotron	/	/	
MDB Rooom	Halotron	/	/	
Storage Gas	Halotron	/	/	
Back Of The Canteen Room	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Front Of The Bakery Room	CO2	/	/	
	Wet Chemical	/	/	
	Halotron	/	/	
Front Of The Laundry Room	Halotron	/	/	
	Halotron	/	/	
Front Of The Prayer Room	Halotron	/	/	
	Halotron	/	/	
Nearby Guest Room A216	Halotron	/	/	
Nearby Guest Room A316	Halotron	/	/	
Nearby Guest Room A416	Halotron	/	/	
Nearby Guest Room A516	Halotron	/	/	
Nearby Guest Room A616	Halotron	/	/	
Nearby Guest Room A716	Halotron	/	/	

Safety Officer.....

Date.....5/1/26

Loss Prevention Sup./Officer..Kreemwoot.....

Date..31/12/2025.....

Loss Prevention Manager.....

Date.....5/1/26

LaGreen
Hotel & Residence

Fire Exit Signage Checklist Report

Month: December 2025

No. ลำดับ	Floor ชั้น	Location สถานที่	Fire Exit ป้ายทางออก	Narrow อุบัติเหตุ	Lighting /สภาพแสงสว่าง Work	Lighting /สภาพแสงสว่าง Not Work	Remark หมายเหตุ
		Building A					
1	FL.B	In front of GM office	/	/	/		
2		BOH Corridor	/	/	/		
3		In front of HK office	/	/	/		
4		In front of Bekery room	/	/	/		
5		Stairs leading up to the gas store	/	/	/		
6	FL.1	Pizza Pasta Area	/	/	/		
7		Jaak Din Restaurant	/	/	/		
8		Jaak Din Restaurant Cashier	/	/	/		
9		Fire escape exit on the main kitchen side	/	/	/		
10		Fire escape exit to building B.	/	/	NA		Wooden Sign
11	FL.2	In front of the fire escape door near the elevator on FL.2nd	/	/	/		
12		In front of the guest room No.A203	/	/	/		
13		In front of the guest room No.A210	/	/	/		
14		In front of the fire escape door near the guest room No.A217	/	/	/		
15	FL.3	In front of the fire escape door near the elevator on FL.3rd	/	/	/		
16		In front of the guest room No.A303	/	/	/		
17		In front of the guest room No.A310	/	/	/		
18		In front of the fire escape door near the guest room No.A317	/	/	/		
19	FL.4	In front of the fire escape door near the elevator on FL.4th	/	/	/		
20		In front of the guest room No.A403	/	/	/		
21		In front of the guest room No.A410	/	/	/		
22		In front of the fire escape door near the guest room No.A417	/	/	/		
23	FL.5	In front of the fire escape door near the elevator on FL.5th	/	/	/		
24		In front of the guest room No.A503	/	/	/		
25		In front of the guest room No.A510	/	/	/		
26		In front of the fire escape door near the guest room No.A517	/	/	/		
27	FL.6	In front of the fire escape door near the elevator on FL.6th	/	/	/		
28		In front of the guest room No.A603	/	/	/		
29		In front of the guest room No.A610	/	/	/		
30		In front of the fire escape door near the guest room No.A617	/	/	/		
31	FL.7	In front of the fire escape door near the elevator on FL.7th	/	/	/		
32		In front of the guest room No.A703	/	/	/		
33		In front of the guest room No.A710	/	/	/		
34		In front of the fire escape door near the guest room No.A717	/	/	/		
		Totally	34	34	33		

Safety Officer
Date: 31/12/25

Loss Prevention Manager
Date: 5/1/26

Worawat
Loss Prevention Sup./Officer
Date: 31/12/2025

ภาคผนวกที่ 7

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ (แบบ ทส. 1) และรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย (แบบ ทส. 2) ประจำเดือนมกราคม–ธันวาคม 2568

LaGreen
Hotel & Residence

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย (ทส.1 และ ทส.2)

เรียน นายก อบต. ตำบลเชิงทะเล

ทางบริษัท เดอะ ซิวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน มกราคม 2568 (แบบ ทส.1 และ ทส.2)จึงเรียนมาเพื่อรับทราบ

ขอแสดงความนับถือ

9 - 02 - 25

.....

Chief Engineer

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 147 หมู่ที่ 1 ซอย –

ถนน – แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]


จังหวัด [illegible] โทรศัพท์ ..... โทรสาร .....

มี [illegible] เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท [illegible]

ใบอนุญาตเลขที่ (ถ้ามี) [illegible] ออกให้โดย [illegible] หมดอายุ .....

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

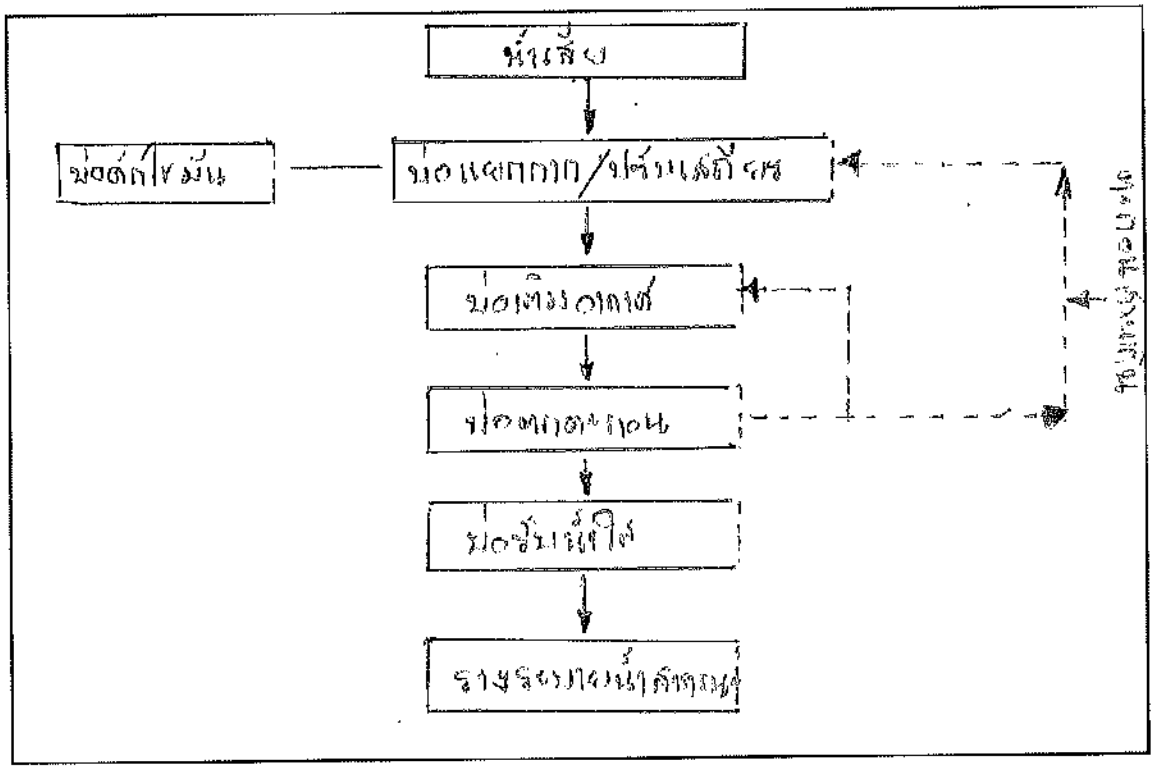

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือ ผู้บันท
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่น ๆ (ระบุ) (ปกติ/ผิดปกติ)			
31.01.68	80.25	140	112	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
02.02.68	80.25	296	236.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
03.02.68	80.25	216	172.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
04.02.68	80.25	209	167.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
05.02.68	80.25	280	224	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
06.02.68	80.25	221	176.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
07.02.68	80.25	224	179.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
08.02.68	80.25	260	208	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
09.02.68	80.25	284	227.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
10.02.68	80.25	281	224.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
11.02.68	80.25	174	139.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
12.02.68	80.25	285	228	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
13.02.68	80.25	221	176.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
14.02.68	80.25	253	202.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
15.02.68	80.25	242	193.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
16.02.68	80.25	209	167.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือ ผู้บันท
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่น ๆ (ระบุ) (ปกติ/ผิดปกติ)			
1.01.68	50.63	237	189.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
13.01.68	50.65	271	216.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
9.01.68	50.25	241	192.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
20.01.68	50.25	348	278.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
21.01.68	50.25	390	312	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
22.01.68	50.25	241	192.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
23.01.68	50.25	276	220.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
24.01.68	50.25	260	208	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
25.01.68	50.25	274	219.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
26.01.68	50.25	206	164.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
27.01.68	50.25	254	203.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
28.01.68	50.25	305	244	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
29.01.68	50.25	206	164.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
30.01.68	50.25	280	224	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
31.01.68	80.25	188	150.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(..... 5- 2- 25 .....)

..... ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 147 หมู่ที่ 6 ซอย .....
ถนน ..... แขวง/ตำบล ..... เขต/อำเภอ.....
จังหวัด ..... โทรศัพท์ ..... โทรสาร .....
มี ..... เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
ประกอบกิจการประเภท .....
ใบอนุญาตเลขที่ (ถ้ามี) ..... ออกให้โดย ..... หมดอายุ .....

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(.....)

..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration activated sludge process A/S
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 23.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ) .....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☐ เครื่องสูบน้ำ ☐ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☑ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ระบายน้ำสาธารณะ

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด .....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 3987.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 7852

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 6251.60

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย ..... ระบายปกติ

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- อื่นๆ ..... ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข .....

.....

คำเตือน **๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖**

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย (ทส.1 และ ทส.2)

เรียน นายก อบต. ตำบลเชิงทะเล

ทางบริษัท เดอะ ซิวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน มกราคม 2568 (แบบ ทส.1 และ ทส.2)จึงเรียนมาเพื่อรับทราบ

ผู้รับมอบ

.....

LaGreen
Hotel & Residence

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ทส.1 และ ทส.2)

เรียน นายก อบต. ตำบลเชิงทะเล

ทางบริษัท เดอะ ชิวิว เทสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน กุมภาพันธ์ 2568 (แบบ ทส.1 และ ทส.2)จึงเรียนมาเพื่อรับทราบ

ขอแสดงความนับถือ

.....

Chief Engineer

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -

ถนน - แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]


จังหวัด [illegible] โทรศัพท์ [illegible] โทรสาร .....

มี [illegible] เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท [illegible]

ใบอนุญาตเลขที่ (ถ้ามี) [illegible] ออกให้โดย [illegible] หมดอายุ .....

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

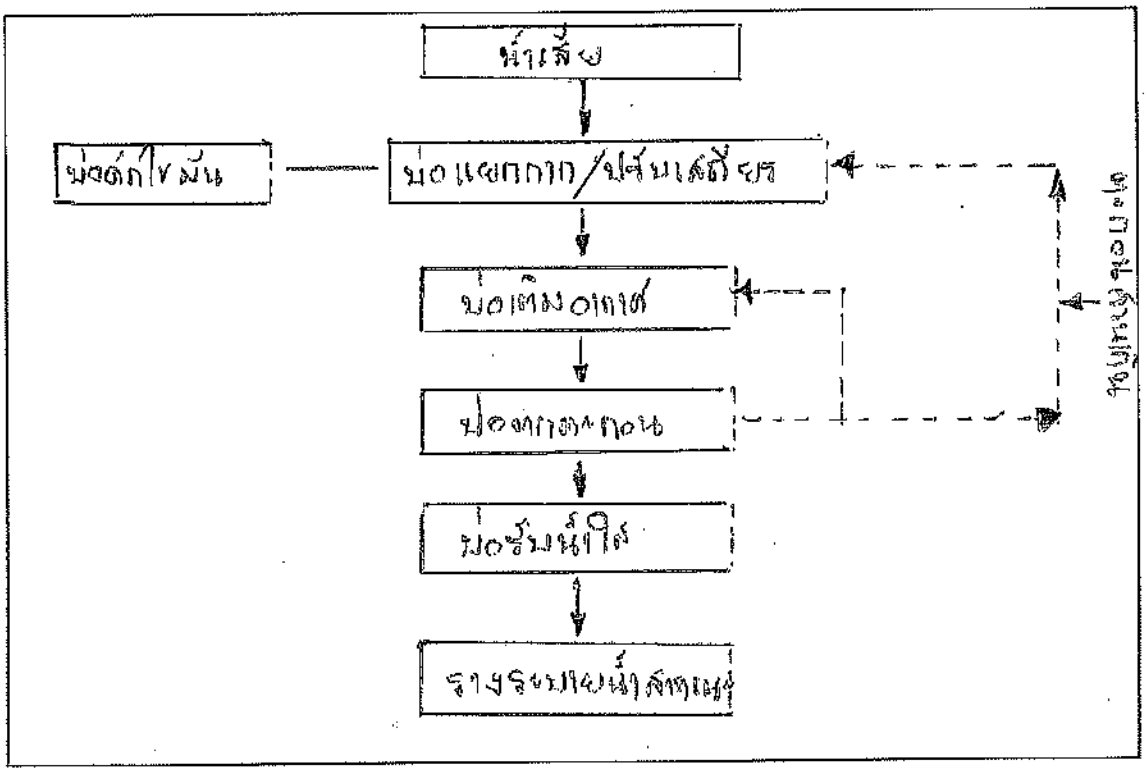

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือ ผู้บันท
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่น ๆ (ระบุ) (ปกติ/ผิดปกติ)			
1	ก.พ68	80.25	271	216.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
2	ก.พ68	80.25	321	256.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
3	ก.พ68	80.25	244	195.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
4	ก.พ68	80.25	223	178.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
5	ก.พ68	80.25	211	168.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
6	ก.พ68	80.25	242	193.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
7	ก.พ68	80.25	202	161.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
8	ก.พ68	80.25	309	247.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
9	ก.พ68	80.25	240	192	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
10	ก.พ68	80.25	251	200.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
11	ก.พ68	80.25	196	156.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
12	ก.พ68	80.25	195	156	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
13	ก.พ68	80.25	204	163.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
14	ก.พ68	80.25	215	172	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
15	ก.พ68	80.25	254	203.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
16	ก.พ68	80.2	301	240.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือ ผู้บันท
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่น ๆ (ระบุ) (ปกติ/ผิดปกติ)			
17	ก.พ 68	80.23	240	192	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
18	ก.พ 68	80.23	189	151.2	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
19	ก.พ 68	80.23	145	116	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
20	ก.พ 68	80.23	176	140.8	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
21	ก.พ 68	80.23	219	175.2	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
22	ก.พ 68	80.23	258	206.4	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
23	ก.พ 68	80.23	235	188	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
24	ก.พ 68	80.23	113	90.4	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
25	ก.พ 68	80.23	217	173.6	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
26	ก.พ 68	80.23	236	188.8	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
27	ก.พ 68	80.23	179	143.2	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
28	ก.พ 68	80.23	314	251.2	ระบาย	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

.....เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(.....)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย –
ถนน – แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]
จังหวัด [illegible] โทรศัพท์ ..... โทรสาร .....
มี [illegible] เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
ประกอบกิจการประเภท [illegible]
ใบอนุญาตเลขที่ (ถ้ามี) [illegible] ออกให้โดย [illegible] หมดอายุ [illegible]

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน [illegible] พ.ศ. 2568 ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

[illegible] เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
([illegible])
[illegible] ผู้ควบคุมระบบบำบัดน้ำเสีย
([illegible])
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Activated sludge process A/S
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 33.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ) .....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☑ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) [illegible]

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด .....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2467.84

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 6406

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 5120

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย ..... ระบายทิ้ง

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) ..... —

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- อื่นๆ ..... ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข .....

.....

คำเตือน **๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖**

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส1และท.ส2)

เรียน นายก อบต.ตำบลเชิงทะเล

ทางบริษัท เดอะซิวิว เดสทิเนชั่น จำกัด เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน มีนาคม 2568 (แบบ ทส.1 และ ทส.2) จึงเรียนมาเพื่อรับทราบ

ขอแสดงความนับถือ

.....

Chief Engineer

สัมมนาการบำบัดน้ำเสียชุมชนด้วยระบบบึงประดิษฐ์

| ลำดับที่ | ชื่อผู้บันทึก | ชื่อโครงการ/ชื่อสถานที่ | ปริมาณน้ำเสียที่ผ่านระบบบึงประดิษฐ์ (ลบ.ม.) | การวัดค่าพารามิเตอร์ต่างๆ ของน้ำเสียก่อนเข้าระบบบึงประดิษฐ์ | | |

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือ ผู้บันท์
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่น ๆ (ระบุ) (ปกติ/ผิดปกติ)			
17	03/68	80.25	905	140	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
18	03/68	80.25	169	133.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
19	03/68	80.25	154	124.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
20	03/68	80.25	158	124.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
21	03/68	80.18	176	140.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
22	03/68	80.94	157	125.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
23	03/68	80.95	180	144	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
24	03/68	80.93	211	168.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
25	03/68	80.95	158	126.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
26	03/68	80.95	177	141.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
27	03/68	80.95	148	118.4	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
28	03/68	80.95	174	139.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
29	03/68	80.23	169	119.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
30	03/68	80.25	198	155.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
31	03/68	80.25	190	153.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Nuwpun Sacat)

..... ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

แบบ ทส. ๒

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 1/27 หมู่ที่ 6 ซอย .....

ถนน ..... แขวง/ตำบล ..... เขต/อำเภอ .....

จังหวัด ..... โทรศัพท์ ..... โทรสาร .....

มี ..... เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

ประกอบกิจการประเภท .....

ใบอนุญาตเลขที่ (ถ้ามี) ..... ออกให้โดย ..... หมดอายุ .....

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริมและรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(.....)

..... ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย .....

ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย ..... ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน

☐ แบบไม่ต่อเนื่อง (ระบุ) .....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☐ เครื่องเติมอากาศ

☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี

☑ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) .....

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด .....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 1483.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 5540

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 1443

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย ระบบดี ๆ ดีมาก

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- อื่นๆ ..... ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข .....

.....

คำเตือน **๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖**

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

วันที่ 07.04.2568

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส1และท.ส2)

เรียน นายก อบต.ตำบลเชิงทะเล

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน มีนาคม 2568 (แบบ ทส.1 และ ทส.2) จึงเรียนมาเพื่อรับทราบ

ผู้รับมอบเอกสาร

.....

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -

ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ อัมพวา


จังหวัด สมุทรสาคร โทรศัพท์ ..... โทรสาร ..... มี

นาย วสิทธิ์ชัย โพโดนอก เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ

กิจการประเภท ธุรกิจโรงแรม ใบอนุญาตเลขที่ (ถ้ามี)

96/2556 ออกให้โดย เทศบาลแม่กลอง หมดอายุ 31 ธันวาคม 2559

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

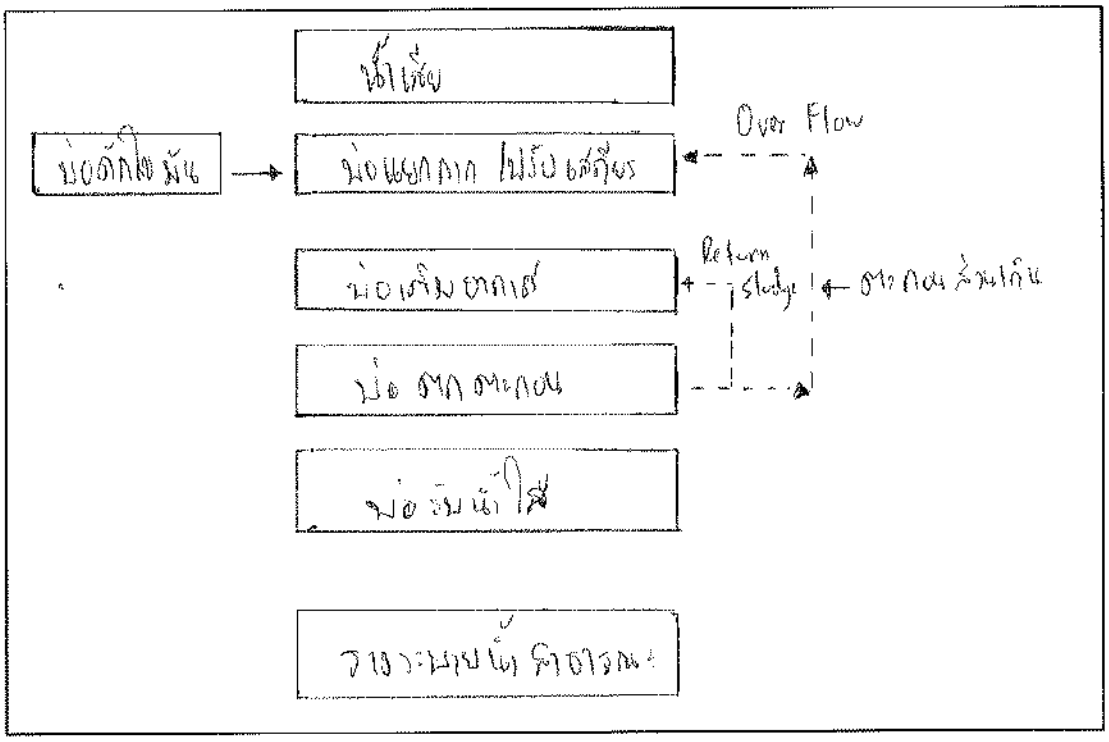

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1/4/68	80.25	152	121.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
2/4/68	80.25	165	132.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
3/4/68	80.25	124	99.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
4/4/68	80.25	167	133.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
5/4/68	80.25	188	150.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
6/4/68	80.25	188	150.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
7/4/68	80.25	172	137.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
8/4/68	80.25	162	129.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
9/4/68	80.25	85	68.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
10/4/68	80.25	119	95.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
11/4/68	80.25	138	110.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
12/4/68	80.25	130	104.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
13/4/68	80.25	100	80.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
14/4/68	80.25	113	90.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
15/4/68	80.25	95	76.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
16/4/68	80.25	135	108.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/4/68	80.15	141	112.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
18/4/68	80.15	96	76.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
19/4/68	80.15	122	97.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
20/4/68	80.15	177	141.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
21/4/68	80.15	146	116.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
22/4/68	80.15	110	80.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
23/4/68	80.15	130	104.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
24/4/68	80.15	130	104.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
25/4/68	80.15	145	116.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
26/4/68	80.15	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
27/4/68	80.15	142	113.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
28/4/68	80.15	141	112.8	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
29/4/68	80.15	159	127.2	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
30/4/68	80.15	162	129.6	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Nuwpan Saeut)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

แบบ ทส. ๒

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

---

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -

ถนน - แขวง/ตำบล เชียงเครือ เขต/อำเภอ ปง

จังหวัด พะเยา โทรศัพท์ ..... โทรสาร ..... มี

นาย อภิสิทธิ์ ใหญ่เมือง เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ

กิจการประเภท ธุรกิจโรงแรม ใบอนุญาตเลขที่

(ถ้ามี) 96/2556 ออกให้โดย กรุงเทพมหานคร หมดอายุ 28 กันยายน 2559

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ

เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม

และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Nuwpan Jaeed)

..... ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process

ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.13 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน

☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ

☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี

☑ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ร่องน้ำสาธารณะ

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2407.50 หน่วย

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 416 ม³

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 333.4 ม³

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรื่อง ขอนำส่งเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส1และท.ส2)

เรียน นายก อบต.ตำบลเชิงทะเล

ทางบริษัท เดอะชิวิว เดสทิเนชั่น จำกัด เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่ภระทรวงกำหนดเกี่ยวกับการทำงานของระบบน้ำเสีย ประจำเดือน : ม.ค. 2568 (แบบ ทส.1 และ ทส.2) จึงเรียนมาเพื่อรับทราบ

ขอแสดงความนับถือ

.....

Chief Engineer

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 14๗ หมู่ที่ 6 ซอย -

ถนน - แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]


จังหวัด [illegible] โทรศัพท์ ..... โทรสาร ..... มี

นาย [illegible] [illegible] เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ

กิจการประเภท [illegible] ใบอนุญาตเลขที่ (ถ้ามี)

46 [illegible] ออกให้โดย [illegible] หมดอายุ [illegible]

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

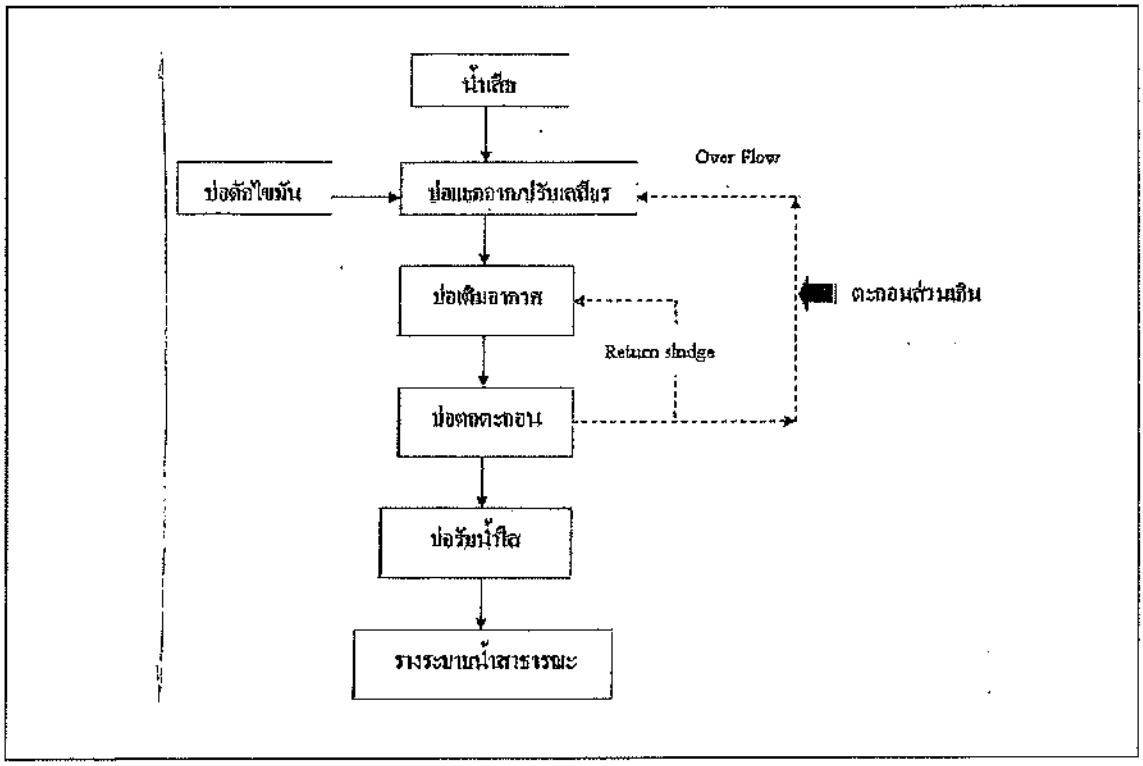

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(.....)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ ๑๒๑ หมู่ที่ ๖ ซอย .....
ถนน ..... แขวง/ตำบล ..... เขต/อำเภอ .....
จังหวัด ..... โทรศัพท์ ..... โทรสาร ..... มี
..... เป็นเจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ..... ใบอนุญาตเลขที่
(ถ้ามี) ..... ออกให้โดย ..... หมดอายุ .....

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(.....)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย ..... ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย ..... ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☐ แบบต่อเนื่อง ..... ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ) .....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☐ เครื่องสูบน้ำ ☐ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) .....

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด .....

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณ การใช้ ไฟฟ้าของ ระบบ บำบัดน้ำ เสีย (หน่วย)	ปริมาณ น้ำใช้ ในทุกกิจกรรม ของ แหล่งกำเนิด มลพิษ (ลบ.ม.)	ปริมาณน้ำ เสียที่เข้า ระบบ บำบัดน้ำเสีย (ลบ.ม.)	การระบาย น้ำทิ้งจากระบบ บำบัดน้ำเสีย (ระบาย/ ไม่ระบาย)	ปริมาณ สารเคมีหรือ สารสกัด ชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือ กิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณ ตะกอน ส่วนเกิน ที่เกิดขึ้นจาก ระบบบำบัด น้ำเสียที่นำไป กำจัด (ลบ.ม.)	ปัญหา อุปสรรค และ แนวทาง แก้ไข	
						ระบบบำบัด น้ำเสีย (ปกติ/ผิดปกติ)	เครื่อง สูบน้ำ (ปกติ/ ผิดปกติ)	เครื่องเติม อากาศ (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมน้ำเสีย (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมสารเคมี (ปกติ/ ผิดปกติ)	เครื่องสูบ ตะกอน (ปกติ/ ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ ผิดปกติ)			
1/5/61	80.25	151	164.50	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
2/5/61	80.25	145	149.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
3/5/61	80.25	203	161.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
4/5/61	80.25	151	104.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
5/5/61	80.25	116	88.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
6/5/61	80.25	117	95.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
7/5/61	80.25	131	104.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
8/5/61	81.25	106	85.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
9/5/61	80.25	82	65.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
10/5/61	82.25	78	62.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
11/5/61	80.25	107	85.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
12/5/61	80.25	191	152.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
13/5/61	80.25	131	104.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
14/5/61	80.25	37	29.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
15/5/61	80.25	31	24.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
16/5/61	80.25	54	43.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/5/67	๑๐.๑๕	๕๑	๖๖.๔๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
18/5/67	๑๐.๑๔	๑๙	๗๖.๐๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
19/5/68	๑๐.๑๕	๒๑	๑๖.๑๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
20/5/68	๑๐.๑๔	๑๑๑	๘๘-๑๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
21/5/68	๑๐.๒๓	๕๕	๖๘.๐๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
22/5/68	๑๐.๑๕	๕๗	๔๕.๖๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
23/5/68	๑๐.๑๕	๑๐๖	๘๒.๔๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
24/5/68	๑๐.๑๕	๑๐๔	๘๑.๒๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
25/5/68	๑๐.๑๕	๑๑๖	๙๒.๔๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
26/5/68	๑๐.๑๕	๑๐๕	๘๔.๐๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
29/5/68	๑๐.๑๕	๑๑	๑๖.๑๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
30/5/68	๑๐.๑๕	๑๑๕	๘๒.๐๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
31/5/68	๑๐.๑๕	๑๕๒	๑๒๑.๖๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
1/6/68	๑๐.๑๔	๑๐๑	๘๐.๑๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	
3/6/68	๑๐.๑๕	๑๓๑	๑๐๔.๑๐	ระบาย	–	ปกติ	ปกติ	ปกติ	–	–	ปกติ	–	–	–	

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 9487.75 kwh

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 3177.๐๐

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2537.60

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ).....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน **๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖**

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน มิถุนายน 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....


Chief Engineer.

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย
ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ ถลาง
จังหวัด ภูเก็ต โทรศัพท์ โทรสาร มี
นาย วสันต์ ไพโรเอก เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท จัดกิจกรรม ใบอนุญาตเลขที่ (ถ้ามี)
96/2566 ออกให้โดย กทม มหาดไทย หมดอายุ 28 กันยายน 2571

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

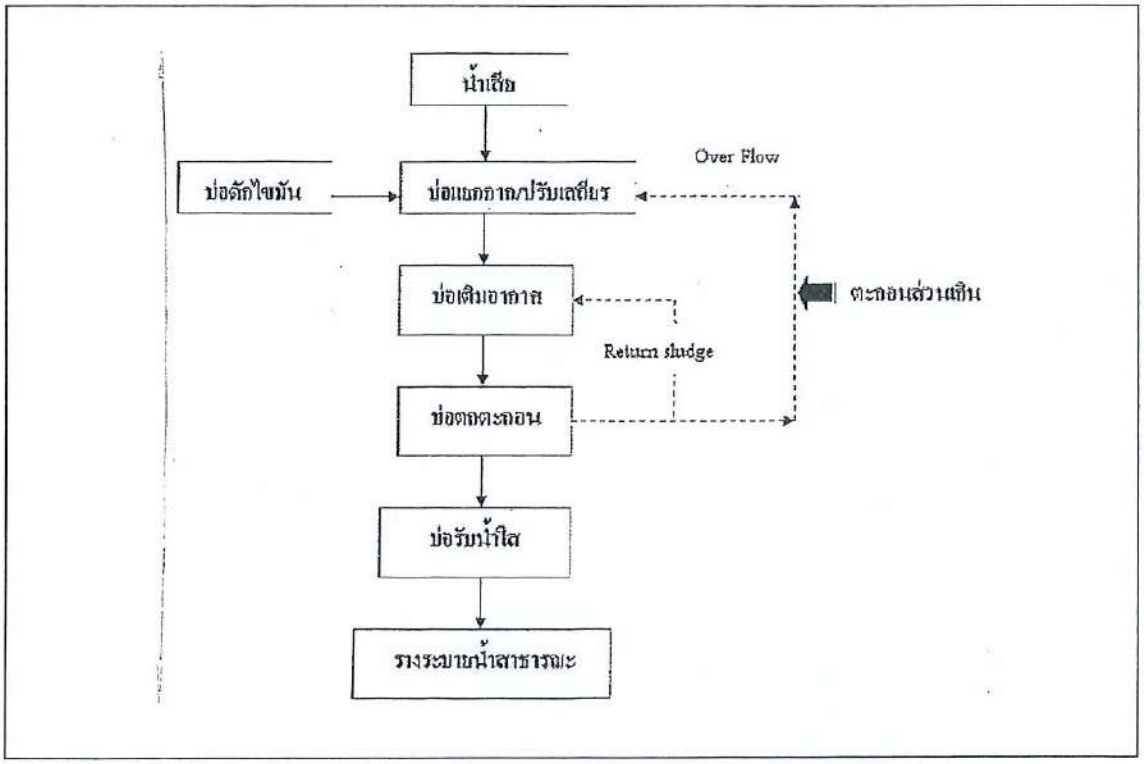

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณ การใช้ ไฟฟ้าของ ระบบ บำบัดน้ำ เสีย (หน่วย)	ปริมาณ น้ำใช้ ในทุกกิจกรรม ของ แหล่งกำเนิด มลพิษ (ลบ.ม.)	ปริมาณน้ำ เสียที่เข้า ระบบ บำบัดน้ำเสีย (ลบ.ม.)	การระบาย น้ำทิ้งจากระบบ บำบัดน้ำเสีย (ระบาย/ ไม่ระบาย)	ปริมาณ สารเคมีหรือ สารสกัด ชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือ กิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณ ตะกอน ส่วนเกิน ที่เกิดขึ้นจาก ระบบบำบัด น้ำเสียที่นำไป กำจัด (ลบ.ม.)	ปัญหา อุปสรรค และ แนวทาง แก้ไข	
						ระบบบำบัด น้ำเสีย (ปกติ/ผิดปกติ)	เครื่อง สูบน้ำ (ปกติ/ ผิดปกติ)	เครื่องเติม อากาศ (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมน้ำเสีย (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมสารเคมี (ปกติ/ ผิดปกติ)	เครื่องสูบ ตะกอน (ปกติ/ ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ ผิดปกติ)			
1/6/68	80.25	141	112.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
2/6/68	80.25	68	54.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
3/6/68	80.25	113	90.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
4/6/68	80.25	52	41.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
5/6/68	80.25	162	209.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
6/6/68	80.25	88	70.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
7/6/68	80.25	53	42.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
8/6/68	80.25	56	44.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
9/6/68	80.25	112	89.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
10/6/68	80.25	87	69.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
11/6/68	80.25	96	76.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
12/6/68	80.25	67	53.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
13/6/68	80.25	66	52.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
14/6/68	80.25	102	81.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
15/6/68	80.25	61	48.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
16/6/68	80.25	108	86.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/6/68	80.25	184	147.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
18/6/68	80.25	33	26.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
19/6/68	80.25	115	92.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
20/6/68	80.25	138	110.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
21/6/68	80.26	72	57.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
22/6/68	80.25	85	68.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
23/6/68	80.25	113	90.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
24/6/68	80.25	26	20.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
25/6/68	80.25	109	87.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
26/6/68	80.25	195	156.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
27/6/68	80.25	37	29.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
28/6/68	80.25	107	85.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
29/6/68	80.25	253	202.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
30/6/68	80.25	175	140	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupon Sapout)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล โป่งตะแบก เขต/อำเภอ คลอง
จังหวัด สุโขทัย โทรศัพท์ ..... โทรสาร ..... มี
นาย วัลลิสลาม โพโดเดช เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ธุรกิจ โรงแรม ใบอนุญาตเลขที่
(ถ้ามี) 96/2566 ออกให้โดย กระทรวงมหาดไทย หมดอายุ 28 กันยายน 2571

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Narupon Saeoui)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process.
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.83 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ..... ระบายน้ำสาธารณะ

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2,407.50

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 3074

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2459.90

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

วันที่

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน มิถุนายน 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ผู้รับมอบเอกสาร

.....

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน กรกฎาคม 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....


Chief Engineer.

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย
ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล ธาตุ . เขต/อำเภอ สกล
จังหวัด สกลนคร โทรศัพท์ ..... โทรสาร ..... มี
นาย วสันต์ ศิริผล ในนาม เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท อุตสาหกรรม ใบอนุญาตเลขที่ (ถ้ามี)
๑๖/๒๕๖๖ ออกให้โดย กระทรวงมหาดไทย หมดอายุ ๒๘ กันยายน ๒๕๗๑

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

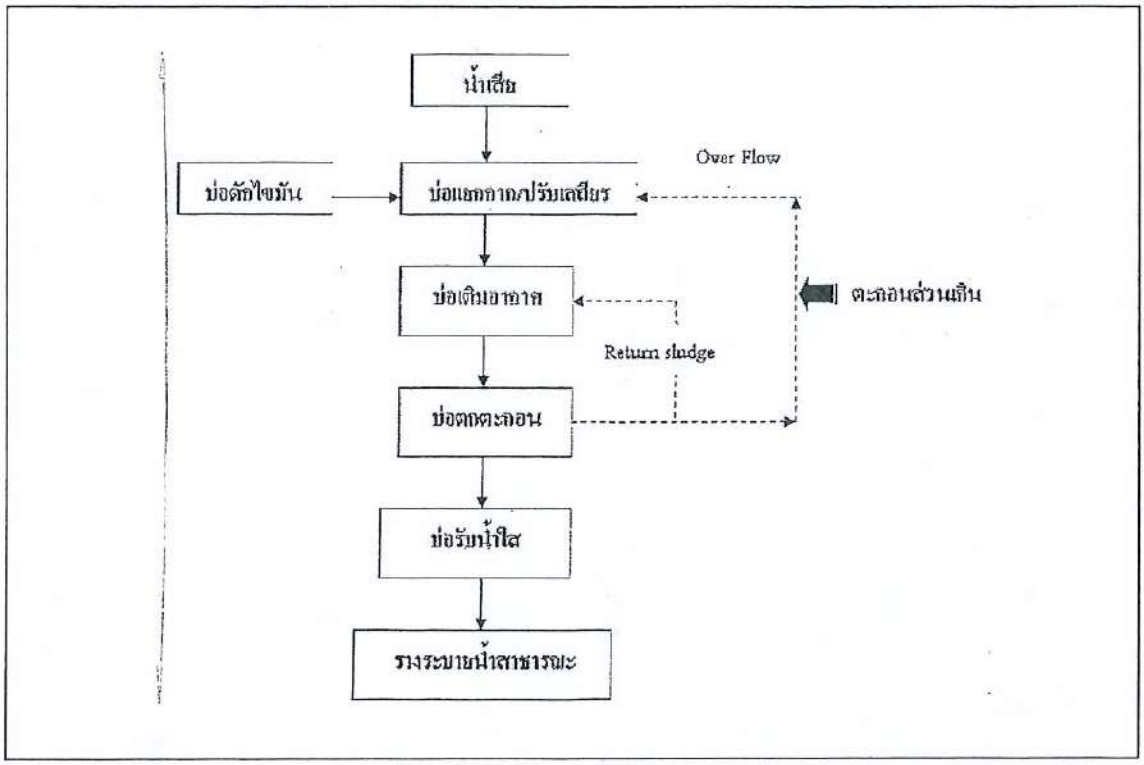

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1/7/68	80.25	97	77.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
2/7/68	80.25	196	156.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
3/7/68	80.25	193	154.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
4/7/68	80.25	159	127.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
5/7/68	80.25	145	116.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
6/7/68	80.25	113	90.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
7/7/68	80.25	184	147.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
8/7/68	80.25	166	132.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
9/7/68	80.25	133	106.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
10/7/68	80.25	185	148.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
11/7/68	80.25	84	67.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
12/7/68	80.25	112	89.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
13/7/68	80.25	159	127.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
14/7/68	80.25	229	183.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
15/7/68	80.25	180	144.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน
16/7/68	80.25	77	61.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ณัฐพน

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/7/68	80.25	125	100	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
18/7/68	80.25	90	72	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
19/7/68	80.25	136	108	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
20/7/68	80.25	125	100	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
21/7/68	80.25	97	77.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
22/7/68	80.25	239	191.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
23/7/68	80.25	252	201.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
24/7/68	80.25	163	130.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
25/7/68	80.25	106	84	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
26/7/68	80.25	130	104	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
27/7/68	80.25	45	36.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
28/7/68	80.25	123	98.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
29/7/68	80.25	102	81.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
30/7/68	80.25	83	66.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
31/7/68	80.25	129	103.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupon Saeod)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

แบบ ทส. ๒

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 144 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]
จังหวัด [illegible] โทรศัพท์ ..... โทรสาร ..... มี
นาย [illegible] เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท [illegible] ใบอนุญาตเลขที่
(ถ้ามี) [illegible] ออกให้โดย [illegible] หมดอายุ [illegible]

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Narupon Saeoud)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.69 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) [illegible]

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2487.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 4357.00

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 3485.60

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

วันที่

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน กรกฎาคม 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ผู้รับมอบเอกสาร

.....

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน สิงหาคม 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....

Chief Engineer.

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

วันที่

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน สิงหาคม 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ผู้รับมอบเอกสาร


.....

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 144 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ ปากช่อง
จังหวัด นครราชสีมา โทรศัพท์ ..... โทรสาร ..... มี
นาย วรวิทย์ โชติพงศ์ เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท อุตสาหกรรม ใบอนุญาตเลขที่ (ถ้ามี)
9 ต.ค. 2566 ออกให้โดย กรมโยธาธิการ หมดอายุ 28 กันยายน 2571

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

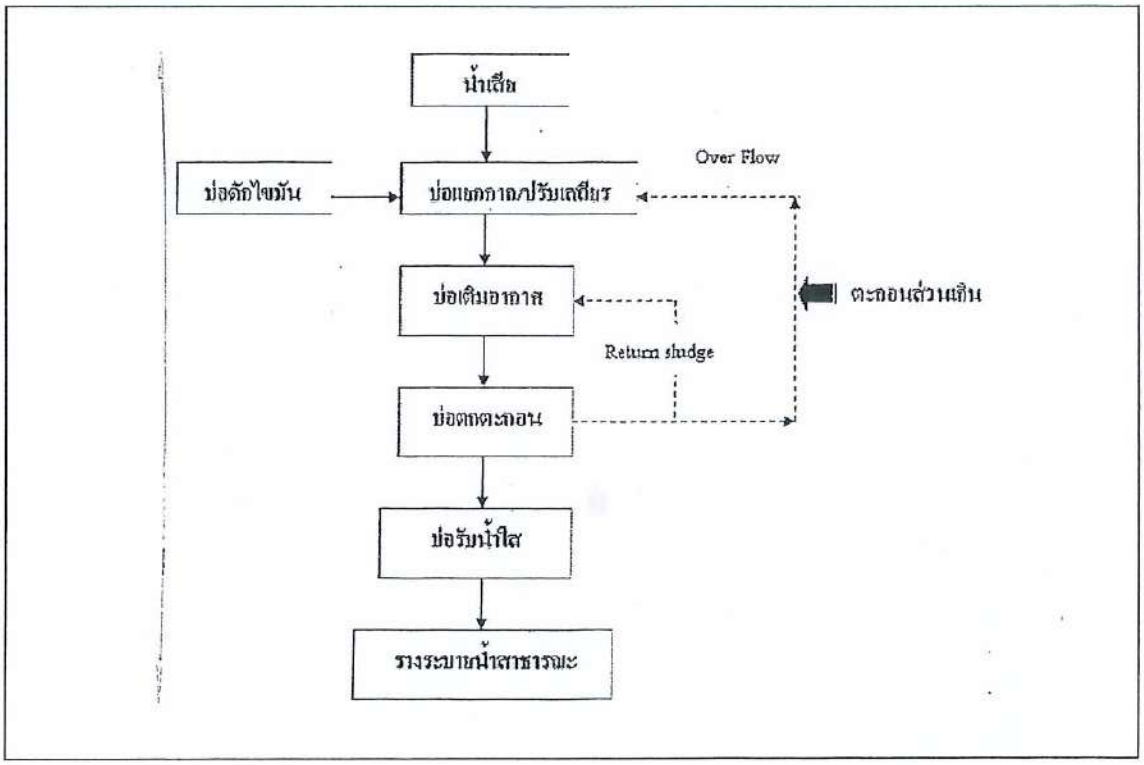

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1/8/68	80.25	121	96.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
2/8/68	80.25	131	104.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
3/8/68	80.25	23	18.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
4/8/68	80.25	84	67.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
5/8/68	80.25	70	56.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
6/8/68	80.25	157	125.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
7/8/68	80.25	66	52.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
8/8/68	80.25	72	57.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
9/8/68	80.25	102	81.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
10/8/68	80.25	78	62.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
11/8/68	80.25	144	115.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
12/8/68	80.25	98	98.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
13/8/68	80.25	198	158.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
14/8/68	80.25	201	160.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
15/8/68	80.25	70	56.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
16/8/68	80.25	76	60.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/8/68	80.45	86	68.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
18/8/68	80.25	123	98.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
19/8/68	80.25	53	42.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
20/8/68	80.25	122	97.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
21/8/68	80.25	224	179.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
22/8/68	80.25	191	152.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
23/8/68	80.25	56	44.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
24/8/68	80.25	402	321.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
25/8/68	80.25	81	68.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
26/8/68	80.25	39	31.90	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
27/8/68	80.25	56	44.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
28/8/68	80.25	63	50.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
29/8/68	80.45	60	48.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
30/8/68	80.25	155	124.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
31/8/68	80.25	228	182.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupun Saeoui)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชียงเครือ เขต/อำเภอ กาญ
จังหวัด สุโขทัย โทรศัพท์ โทรสาร มี
นาย วัลลภ ชินโพธิ์ เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ธุรกิจโรงแรม ใบอนุญาตเลขที่
(ถ้ามี) 96/2516 ออกให้โดย กระทรวงมหาดไทย หมดอายุ ปีกำหนด ตลอด

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน พ.ศ. ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Narupon Saeoui)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activ
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ..... ราชบายเขื่อนรัชการที่ ๒

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2,487.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 3,527.00

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2857.60

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน กันยายน 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....


Chief Engineer.

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย
ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ กลง
จังหวัด ภูเก็ต โทรศัพท์ ..... โทรสาร ..... มี
นาย ยาลี สมพ โพโดเดช เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ธุรกิจโรงแรม ใบอนุญาตเลขที่ (ถ้ามี)
96/2566 ออกให้โดย กรุงเทพมหานคร หมดอายุ 28 กันยายน 2571

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

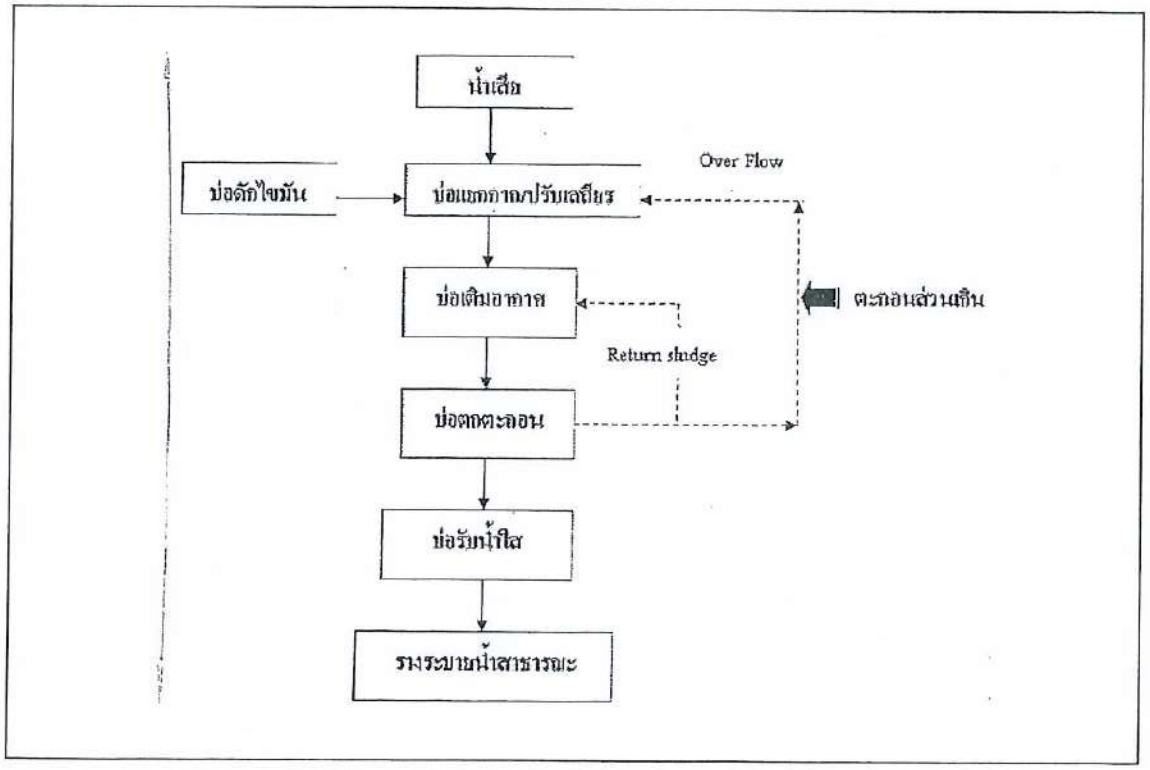

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1/9/68	80.25	112	89.60	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
2/9/68	80.25	72	57.60	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
3/9/68	80.25	45	36.00	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
4/9/68	80.25	117	93.60	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
5/9/68	80.25	42	33.60	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
6/9/68	80.25	106	84.80	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
7/9/68	80.25	173	138.40	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
8/9/68	80.25	125	100	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
9/9/68	80.25	117	93.60	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
10/9/68	80.25	48	38.40	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
11/9/68	80.25	73	58.40	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
12/9/68	80.25	59	47.20	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
13/9/68	80.25	74	59.20	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
14/9/68	80.25	179	143.20	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
15/9/68	80.25	123	98.40	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
16/9/68	80.25	118	94.00	5:00	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ															ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/9/61	80.25	100	80.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
18/9/61	80.25	96	88.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
19/9/61	80.25	80	64.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
20/9/61	80.25	0	0	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
21/9/61	80.25	130	104.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
22/9/61	80.25	154	123.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
23/9/61	80.25	11	8.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
24/9/61	80.25	66	52.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
25/9/61	80.25	107	85.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
26/9/61	80.25	19	15.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
27/9/61	80.25	70	56.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
28/9/61	80.25	262	209.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
29/9/61	80.25	119	95.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ
30/9/61	80.25	289	231.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ลายมือ

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupon Saeoui)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

แบบ ทส. ๒

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 104 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชียงเจ เขต/อำเภอ กาบ
จังหวัด ยโสธร โทรศัพท์ ..... โทรสาร ..... มี
นาย. ชาล่ ธงชาย โพโกเมด เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ธรกิจ โรงแรม ใบอนุญาตเลขที่
(ถ้ามี) 96/2566 ออกให้โดย กรุงเทพ มหานคร หมดอายุ 28 กันยายน 2567

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Narupon Saeoui.)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ..... ราง ระบายน้ำสาธารณะ

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2407.50

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 3,023

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2418.40

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ..... ☐ ปกติ ☐ ผิดปกติ (ระบุ).....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

ใบรับมอบเอกสาร

วันที่

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน กันยายน 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ผู้รับมอบเอกสาร


.....

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล หัวทะเล เขต/อำเภอ สูงเนิน
จังหวัด นครราชสีมา โทรศัพท์ ..... โทรสาร ..... มี
นาย วรากร โพโดเอด เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท รร กิจโรงแรม ใบอนุญาตเลขที่ (ถ้ามี)
96/2566 ออกให้โดย กรมการปกครอง หมดอายุ 28 กันยายน 2571

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

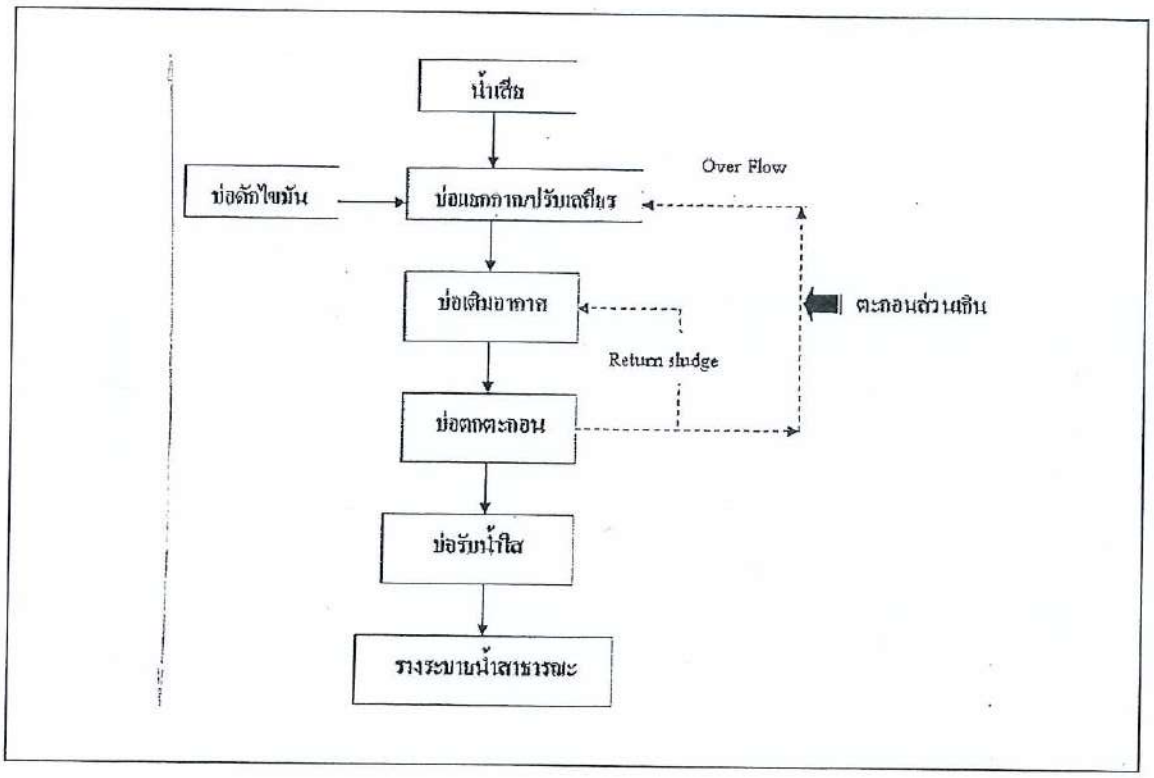

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1/10/68	80.25	119	95.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
2/10/68	80.25	93	18.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
3/10/68	80.25	66	52.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
4/10/68	80.25	115	92.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
5/10/68	80.25	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
6/10/68	80.25	66	52.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
7/10/68	80.25	140	112.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
8/10/68	80.25	105	84.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
9/10/68	80.25	82	65.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
10/10/68	80.25	113	90.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
11/10/68	80.25	52	41.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
12/10/68	80.25	173	138.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
13/10/68	80.25	103	82.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
14/10/68	80.25	135	108.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
15/10/68	80.25	135	108.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก
16/10/68	80.25	139	111.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	ผู้บันทึก

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	ลายมือชื่อผู้บันทึก
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/10/68	80.25	90	72.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
18/10/68	80.25	79	63.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
19/10/68	80.25	100	80.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
20/10/68	80.25	107	85.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
21/10/68	80.25	181	144.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
22/10/68	80.25	212	169.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
23/10/68	80.25	159	127.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
24/10/68	80.25	161	128.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
25/10/68	80.25	30	24.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
26/10/68	80.25	65	52.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
27/10/68	80.25	140	112.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
28/10/68	80.25	129	103.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
29/10/68	80.25	144	115.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
30/10/68	80.25	135	108.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	
31/10/68	80.25	236	188.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Varupon Saeout)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]
จังหวัด [illegible] โทรศัพท์ ..... โทรสาร ..... มี
[illegible] เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท [illegible] ใบอนุญาตเลขที่
(ถ้ามี) 96/2566 ออกให้โดย [illegible] หมดอายุ [illegible]

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Wasupon Saeoui)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
( )
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
( )
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ) .....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) [illegible]

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด .....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2487.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 3,670

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 2936

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน พฤศจิกายน 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....


Chief Engineer.

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ สอง
จังหวัด แพร่ โทรศัพท์ ..... โทรสาร ..... มี
นาย วสันต์ ชาญ ไพโรจน์ เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท อุตสาหกรรม ..... ใบอนุญาตเลขที่ (ถ้ามี)
96/2566 ออกให้โดย นายกเทศมนตรี หมดอายุ 28 กันยายน 2571

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

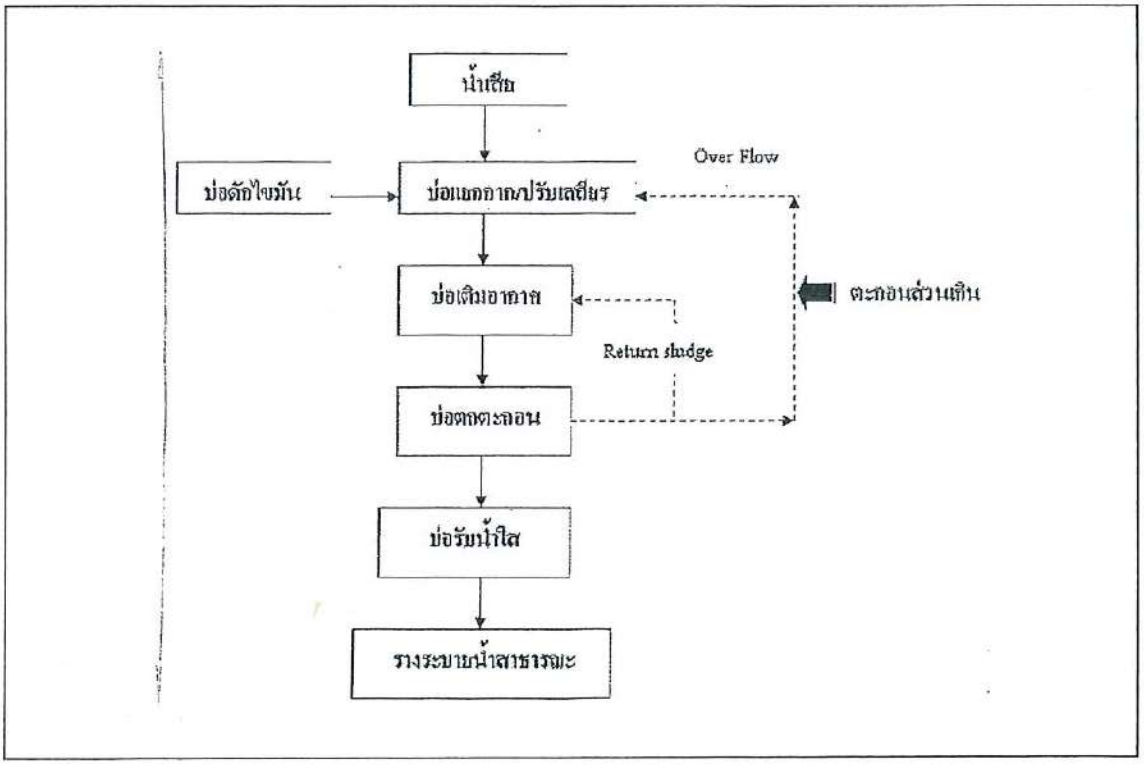

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณ การใช้ ไฟฟ้าของ ระบบ บำบัดน้ำ เสีย (หน่วย)	ปริมาณ น้ำใช้ ในทุกกิจกรรม ของ แหล่งกำเนิด มลพิษ (ลบ.ม.)	ปริมาณน้ำ เสียที่เข้า ระบบ บำบัดน้ำเสีย (ลบ.ม.)	การระบาย น้ำทิ้งจากระบบ บำบัดน้ำเสีย (ระบาย/ ไม่ระบาย)	ปริมาณ สารเคมีหรือ สารสกัด ชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือ กิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณ ตะกอน ส่วนเกิน ที่เกิดขึ้นจาก ระบบบำบัด น้ำเสียที่นำไป กำจัด (ลบ.ม.)	ปัญหา อุปสรรค และ แนวทาง แก้ไข	
						ระบบบำบัด น้ำเสีย (ปกติ/ผิดปกติ)	เครื่อง สูบน้ำ (ปกติ/ ผิดปกติ)	เครื่องเติม อากาศ (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมน้ำเสีย (ปกติ/ ผิดปกติ)	เครื่องกวน/ ผสมสารเคมี (ปกติ/ ผิดปกติ)	เครื่องสูบ ตะกอน (ปกติ/ ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ ผิดปกติ)			
1/11/68	80.25	65	52.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
2/11/68	80.25	211	168.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
3/11/68	80.25	167	133.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
4/11/68	80.25	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
5/11/68	80.25	250	200.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
6/11/68	80.25	164	131.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
7/11/68	80.25	177	141.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
8/11/68	80.25	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
9/11/68	80.25	108	86.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
10/11/68	80.25	83	66.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
11/11/68	80.25	151	120.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
12/11/68	80.25	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
13/11/68	80.25	134	107.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
14/11/68	80.25	185	148.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
15/11/68	80.25	102	81.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
16/11/68	80.25	155	124.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17/11/68	80.25	115	96.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
18/11/68	80.25	128	102.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
19/11/68	80.25	124	99.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
20/11/68	80.25	161	128.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
21/11/68	80.25	122	97.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
22/11/68	80.25	158	126.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
23/11/68	80.25	143	114.48	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
24/11/68	80.25	139	111.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
25/11/68	80.25	125	120.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
26/11/68	80.25	81	64.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
27/11/68	80.25	180	144.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
28/11/68	80.25	119	95.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
29/11/68	80.25	160	128.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
30/11/68	80.25	142	113.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupon Sareut)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 144 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล [illegible] เขต/อำเภอ [illegible]
จังหวัด [illegible] โทรศัพท์ ..... โทรสาร ..... มี
[illegible] เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท [illegible] ใบอนุญาตเลขที่
(ถ้ามี) 96/2516 ออกให้โดย [illegible] หมดอายุ 28 กันยายน 2571

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Manpon Saeoui)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.63 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) [illegible]

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2,407.5

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 4213

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 3410.40

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ..... ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน ๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

LaGreen
Hotel & Residence

เรียน นายกองค์การบริหารส่วนตำบลเชิงทะเล

เรื่อง ขอนำเอกสารแบบบันทึกรายงานรายละเอียดของสถิติข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย

(ท.ส.1 และ ท.ส.2)

ทางบริษัท เดอะซีวิว เดสทิเนชั่น จำกัด ขอนำส่งรายงานดังกล่าว ตามที่กระทรวงกำหนดเกี่ยวกับ – การทำงานของระบบน้ำเสีย ประจำเดือน ธันวาคม 2568 (แบบ ท.ส.1 และ ท.ส.2)

จึงเรียนมาเพื่อทราบ

ขอแสดงความนับถือ

.....


Chief Engineer.

แบบ ทส. ๑

แบบบันทึกรายละเอียดของสถิติและข้อมูลซึ่งแสดงผลการทำงานของระบบบำบัดน้ำเสีย
ของแหล่งกำเนิดมลพิษ

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล เชิงทะเล เขต/อำเภอ กยาง
จังหวัด ภูเก็ต โทรศัพท์ - โทรสาร - มี
นาย วรเดช สวน โดย โต เอก เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท ธุรกิจโรงแรม ใบอนุญาตเลขที่ (ถ้ามี)
๑๖ / ๒๕๖ ออกให้โดย กระทรง มหาดไทย หมดอายุ

ซึ่งมีแผนผังแสดงการทำงานของระบบบำบัดน้ำเสีย ดังนี้

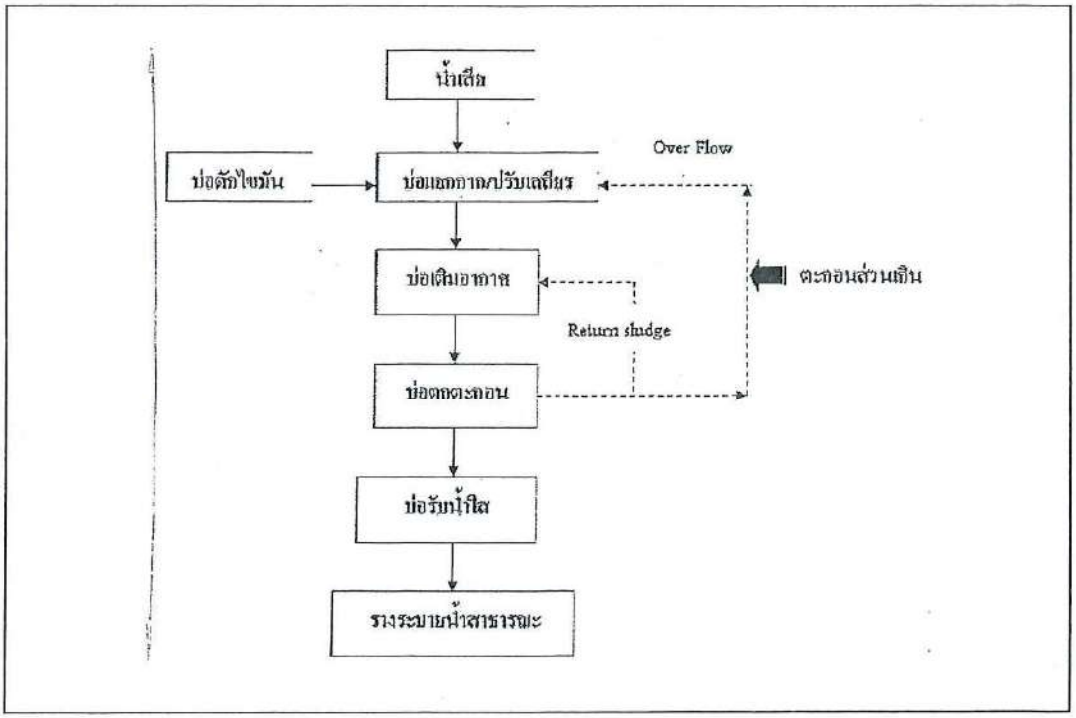

ได้จัดเก็บสถิติและข้อมูลแสดงผลการทำงานของระบบบำบัดน้ำเสียปรากฏตามตาราง ดังนี้

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
1-12-68	80.25	136	108.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
2-12-68	80.25	129	103.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
3-12-68	80.25	142	113.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
4-12-68	80.25	127	101.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
5-12-68	80.25	175	140.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
6-12-68	80.25	135	108.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
7-12-68	80.25	85	68.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
8-12-68	80.25	138	110.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
9-12-68	80.25	186	148.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
10-12-68	80.25	121	96.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
11-12-68	80.25	84	67.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
12-12-68	80.25	194	155.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
13-12-68	80.25	190	152.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
14-12-68	80.25	181	144.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
15-12-68	80.25	112	89.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน
16-12-68	80.25	99	79.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	นฤพน

วัน เดือน ปี	สถิติและข้อมูลที่เก็บจากแหล่งกำเนิดมลพิษ														ลายมือชื่อ ผู้บันทึก
	ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย)	ปริมาณน้ำใช้ในทุกกิจกรรมของแหล่งกำเนิดมลพิษ (ลบ.ม.)	ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.)	การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย (ระบาย/ไม่ระบาย)	ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ชื่อ/ปริมาณ) (ลิตรหรือกิโลกรัม)	การทำงานของระบบบำบัดน้ำเสีย							ปริมาณตะกอนส่วนเกินที่เกิดขึ้นจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.)	ปัญหาอุปสรรคและแนวทางแก้ไข	
						ระบบบำบัดน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องสูบน้ำ (ปกติ/ผิดปกติ)	เครื่องเติมอากาศ (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมน้ำเสีย (ปกติ/ผิดปกติ)	เครื่องกวน/ผสมสารเคมี (ปกติ/ผิดปกติ)	เครื่องสูบตะกอน (ปกติ/ผิดปกติ)	อื่นๆ (ระบุ) (ปกติ/ผิดปกติ)			
17-12-61	80.25	165	134.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
18-12-61	80.25	257	205.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
19-12-61	80.25	133	106.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
20-12-61	80.25	160	128.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
21-12-61	80.25	143	154.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
22-12-61	80.25	158	126.40	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
23-12-61	80.25	180	144.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
24-12-61	80.25	217	173.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
25-12-61	80.25	251	200.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
26-12-61	80.25	220	176.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
27-12-61	80.25	334	267.20	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
28-12-61	80.25	311	248.80	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
29-12-61	80.25	117	93.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
30-12-61	80.25	117	93.60	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน
31-12-61	80.25	355	284.00	ระบาย	-	ปกติ	ปกติ	ปกติ	-	-	ปกติ	-	-	-	แกมน

หมายเหตุ ๑. ให้กรอกสถิติและข้อมูลเฉพาะในกรณีที่มีสถิติและข้อมูลนั้น ๆ ในแต่ละวัน

๒. ในกรณีระบบบำบัดน้ำเสียที่มีการติดตั้งเครื่องตรวจวัดคุณภาพน้ำทิ้งแบบอัตโนมัติ ให้แนบผลการตรวจวัดคุณภาพน้ำทิ้งทุกวันแยกตามพารามิเตอร์ที่ตรวจวัด และทำการสรุปผลเป็นสถิติและข้อมูลรายเดือน

ขอรับรองว่าการบันทึกสถิติและข้อมูลตามตารางข้างต้นถูกต้องทุกประการ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ

(Narupon Saeng)

.....ผู้ควบคุมระบบบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย.....

..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย

(.....)

ใบอนุญาตเลขที่ ..... หมดอายุ .....

ออกให้โดย .....

แบบ ทส. ๒

รายงานสรุปผลการทำงานของระบบบำบัดน้ำเสีย

๑. ข้อมูลทั่วไป

แหล่งกำเนิดมลพิษ ตั้งอยู่เลขที่ 149 หมู่ที่ 6 ซอย -
ถนน - แขวง/ตำบล ชิงกาง เขต/อำเภอ สวน
จังหวัด สมุทร โทรศัพท์ ..... โทรสาร ..... มี
นาย วุฒิชัย ภาคโพธิ์แดง เป็นเจ้าของหรือผู้ครอบครองหล่งกำเนิดมลพิษ ประกอบ
กิจการประเภท รีสอร์ทโรงแรม ใบอนุญาตเลขที่
(ถ้ามี) 46/2566 ออกให้โดย กรุงเทพมหานคร หมดอายุ 28 กันยายน 2571

ในการนี้ขอรายงานสรุปผลการทำงานของระบบบำบัดน้ำเสียของแหล่งกำเนิดมลพิษสำหรับ
เดือน ..... พ.ศ. ..... ตามที่ได้กำหนดในมาตรา ๘๐ แห่งพระราชบัญญัติส่งเสริม
และรักษาคุณภาพสิ่งแวดล้อมแห่งชาติ พ.ศ. ๒๕๓๕ ในฐานะ

..... เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ
(Narupon Saeo-I)
..... ผู้ควบคุมระบบบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....
..... ผู้รับจ้างให้บริการบำบัดน้ำเสีย
(.....)
ใบอนุญาตเลขที่ ..... หมดอายุ .....
ออกให้โดย .....

๒. ข้อมูลเกี่ยวกับระบบบำบัดน้ำเสีย และแหล่งรองรับน้ำทิ้ง

(๑) ประเภท/ชนิดของระบบบำบัดน้ำเสีย Aeration Activated Sludge Process
ความสามารถในการรองรับน้ำเสียของระบบบำบัดน้ำเสีย 73.13 ลบ.ม./วัน

(๒) การทำงานของระบบบำบัดน้ำเสีย ☑ แบบต่อเนื่อง 24 ชั่วโมง/วัน
☐ แบบไม่ต่อเนื่อง (ระบุ).....

(๓) อุปกรณ์และเครื่องมือที่ใช้ในระบบบำบัดน้ำเสีย ☑ เครื่องสูบน้ำ ☑ เครื่องเติมอากาศ
☐ เครื่องกวน/ผสมน้ำเสีย ☐ เครื่องกวน/ผสมสารเคมี
☐ เครื่องสูบตะกอน ☐ อื่น ๆ (ระบุ) .....

(๔) แหล่งรองรับน้ำทิ้ง (ระบุ) ..... ท่อระบายน้ำสาธารณะ

(๕) วิธีจัดการตะกอนที่เกิดขึ้นจากระบบบำบัดน้ำเสียและวิธีการกำจัด.....

๓. สรุปผลการทำงานของระบบบำบัดน้ำเสียเป็นรายเดือน

(๑) ปริมาณการใช้ไฟฟ้าของระบบบำบัดน้ำเสีย (หน่วย) 2,487.75

(๒) ปริมาณน้ำใช้ทุกกิจกรรมในแหล่งกำเนิดมลพิษ (ลบ.ม.) 540

(๓) ปริมาณน้ำเสียที่เข้าระบบบำบัดน้ำเสีย (ลบ.ม.) 432

(๔) การระบายน้ำทิ้งจากระบบบำบัดน้ำเสีย .....

(๕) ปริมาณสารเคมีหรือสารสกัดชีวภาพที่ใช้ (ลิตรหรือกิโลกรัม) .....

(๖) การทำงานของระบบบำบัดน้ำเสียและอุปกรณ์

- ระบบบำบัดน้ำเสีย ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- เครื่องสูบน้ำ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องเติมอากาศ ☑ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมน้ำเสีย ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องกวน/ผสมสารเคมี ☐ ปกติ ☐ ผิดปกติ (ระบุ) .....
- เครื่องสูบตะกอน ☑ ปกติ ☐ ผิดปกติ (ระบุ).....
- อื่นๆ.....☐ ปกติ ☐ ผิดปกติ (ระบุ) .....

(๗) ปริมาณตะกอนส่วนเกินจากระบบบำบัดน้ำเสียที่นำไปกำจัด (ลบ.ม.) .....

(๘) ปัญหา อุปสรรค และแนวทางแก้ไข.....

.....

คำเตือน **๑. เจ้าของหรือผู้ครอบครองแหล่งกำเนิดมลพิษ ผู้ควบคุมระบบบำบัดน้ำเสีย หรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดไม่จัดเก็บสถิติ ข้อมูล หรือไม่ทำบันทึกหรือรายงานตามมาตรา ๘๐ ต้องระวางโทษจำคุกไม่เกินหนึ่งเดือน หรือปรับไม่เกินหนึ่งหมื่นบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๖**

๒. ผู้ควบคุมระบบบำบัดน้ำเสียหรือผู้รับจ้างให้บริการบำบัดน้ำเสียผู้ใดทำบันทึกหรือรายงานโดยแสดงข้อความอันเป็นเท็จ ต้องระวางโทษจำคุกไม่เกินหนึ่งปี หรือปรับไม่เกินหนึ่งแสนบาท หรือทั้งจำทั้งปรับตามมาตรา ๑๐๗

ภาคผนวกที่ 8

ใบเสร็จค่าขยะ

ประจำเดือนมกราคม–ธันวาคม 2568

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 28/12/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนาย : มลฝอย ประจำเดือน			
	ม.ค. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 08[illegible]

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴就 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 25/3/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนขยะมูลฝอย ประจำเดือน			
	ก.พ. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีอี เดสติเนชั่น จำกัด

วันที่ 日期 DATE 30/4/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนขยะมูลฝอย ประจำเดือน			
	มี.ค. 68	-	25,000	-
(2)	ค่าขนขยะวัสดุก่อสร้าง 2 เที่ยว	-	7,000	-
บาท BAHT 銖	สามหมื่นสองพันบาทถ้วน	รวมเงิน TOTAL 共銀	32,000	-

ผู้รับเงิน 收貨人 COLLECTOR

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บ่าชัท เดอะวิว เดสท์เนชั่น จำกัด วันที่ 日期 DATE 30/5/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนาย:มูลฝอย ประจำเดือน			
	เม.ย. 68	-	25,000	-

เล่มที่/Book No./本號. _____

เลขที่/ Bill No./單號. _____

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

บิลเงินสด
CASH SALE/現兌單

นามผู้ซื้อ Customer: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ Date: 26/6/68

ที่อยู่ Address: 147 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

ทะเบียนการค้า Commercial License 商標編號:

จำนวน Quantity 數量	รายการ / Description / 貨名	หน่วยละ Unit Price 備註	จำนวนเงิน Amount 銀額	
(1)	ค่าขนะมูลฝอย ประจำเดือน			
	พ.ค. 68	-	25,000	-

อุธิวัฒน์ จงจิตร

22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต

โทร. 093-623-7195

เล่มที่ BOOK NO.	เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兌單 CASH SALE

นาม 賣就 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 31/7/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	มี.ค. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีวิว เดสติเนชั่น จำกัด

วันที่ 日期 DATE 29/8/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าหมอนวดมูลฝอย ประจำเดือน			
	ก.ค. 68	-	25,000	-
(2)	ค่าหมอนวดเคลื่อนไหวนอกเหนือสัญญา	-	5,000	-
บาท BAHT 銖	สามหมื่นบาทถ้วน	รวมเงิน TOTAL 共銀	30,000	-

ผู้รับเงิน 收貨人 COLLECTOR จิตมา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 28/12/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนาย : มลฝอย ประจำเดือน			
	ม.ค. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 08[illegible]

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴就 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 25/3/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนขยะมูลฝอย ประจำเดือน			
	ก.พ. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีอี เดสติเนชั่น จำกัด

วันที่ 日期 DATE 30/4/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนขยะมูลฝอย ประจำเดือน			
	มี.ค. 68	-	25,000	-
(2)	ค่าขนขยะวัสดุก่อสร้าง 2 เที่ยว	-	7,000	-
บาท BAHT 銖	สามหมื่นสองพันบาทถ้วน	รวมเงิน TOTAL 共銀	32,000	-

ผู้รับเงิน 收貨人 COLLECTOR

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บ่าชัท เดอะวิว เดสท์เนชั่น จำกัด วันที่ 日期 DATE 30/5/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าขนาย:มูลฝอย ประจำเดือน			
	เม.ย. 68	-	25,000	-

เล่มที่/Book No./本號. _____

เลขที่/ Bill No./單號. _____

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

บิลเงินสด
CASH SALE/現兌單

นามผู้ซื้อ Customer: บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ Date: 26/6/68

ที่อยู่ Address: 147 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

ทะเบียนการค้า Commercial License 商標編號:

จำนวน Quantity 數量	รายการ / Description / 貨名	หน่วยละ Unit Price 備註	จำนวนเงิน Amount 銀額	
(1)	ค่าขนะมูลฝอย ประจำเดือน			
	พ.ค. 68	-	25,000	-

อุธิวัฒน์ จงจิตร

22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต

โทร. 093-623-7195

เล่มที่ BOOK NO.	เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兌單 CASH SALE

นาม 賣就 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 31/7/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 數量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	มี.ค. 68	-	25,000	-

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兌單 CASH SALE

นาม 貴姓 CUSTOMER บริษัท เดอะซีวิว เดสติเนชั่น จำกัด

วันที่ 日期 DATE 29/8/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 貨名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 銀額	
(1)	ค่าหมอนวดมูลฝอย ประจำเดือน			
	ก.ค. 68	-	25,000	-
(2)	ค่าหมอนวดเคลื่อนไหวนอกเหนือสัญญา	-	5,000	-
บาท BAHT 銖	สามหมื่นบาทถ้วน	รวมเงิน TOTAL 共銀	30,000	-

ผู้รับเงิน 收貨人 COLLECTOR จิตมา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 089-899-7185

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兑單 CASH SALE

นาม 實號 CUSTOMER บริษัท เอ.ซี.วี. เดสติเนชั่น จำกัด

วันที่ 日期 DATE 25/9/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน ส.ค. 68	-	25,000	-
2	ค่าขนขยะเศษร่วงขยะ (นอกเหนือสัญญา)		6,000	-
บาท BAHT 銖	สามหมื่นหนึ่งพันบาทถ้วน	รวมเงิน TOTAL 共银	31,000	-

ผู้รับเงิน 收银人 COLLECTOR

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 實號 CUSTOMER บริษัท เดอะซีท เดสทิเนชั่น จำกัด วันที่ 日期 DATE 30/10/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO. _____ เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO. _____

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	ก.ย 68	-	25,000	-
2	ค่าขนขยะเศษอาหาร (ขยะเหนียวสัญญา)		6,500	-
			5	
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共银	31,500	-

ผู้รับเงิน 收银人 COLLECTOR จิตา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-693-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兑單 CASH SALE

นาม 實號 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด วันที่ 日期 DATE 21/11/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO. _____ เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO. _____

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	ต.ค. 68	-	25,000	-
2	ค่าขนขยะเคลียร์ขยะ (นอกเหนือสัญญา)		6,500	-
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共銀	31,500	-

ผู้รับเงิน 收银人 COLLECTOR จักรา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兑單 CASH SALE

นาม 實號 NAME บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 30/12/68

ที่อยู่ 住址 ADDRESS 149 ม.1 ต.เชิงทะเล อ.กลาง จ. ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货号	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนาย: มูลฝอย ประจำเดือน			
	พ.ย. 68	-	25,000	-
1	ค่าขนาย: เคลียร์ราย: (นอกเหนือสัญญา)		6,500	-
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共银	31,500	-

ผู้รับเงิน 收银人 COLLECTOR อำภา

วันที่ 日期 DATE

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 089-899-7185

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด

CASH SALE 現兑單 CASH SALE

นาม 實號 CUSTOMER บริษัท เอ.ซี.วี. เดสติเนชั่น จำกัด

วันที่ 日期 DATE 25/9/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน ส.ค. 68	-	25,000	-
2	ค่าขนขยะเศษร่วงขยะ (นอกเหนือสัญญา)		6,000	-
บาท BAHT 銖	สามหมื่นหนึ่งพันบาทถ้วน	รวมเงิน TOTAL 共银	31,000	-

ผู้รับเงิน 收银人 COLLECTOR

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร 093-623-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兌單 CASH SALE

นาม 實號 CUSTOMER บริษัท เดอะซีท เดสทิเนชั่น จำกัด วันที่ 日期 DATE 30/10/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO. _____ เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO. _____

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	ก.ย 68	-	25,000	-
2	ค่าขนขยะเศษอาหาร (ขยะเหนียวสัญญา)		6,500	-
			5	
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共银	31,500	-

ผู้รับเงิน 收银人 COLLECTOR จิตา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-693-7195

เล่มที่ BOOK NO. | เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兑單 CASH SALE

นาม 實號 CUSTOMER บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด วันที่ 日期 DATE 21/11/68

ที่อยู่ 住址 ADDRESS 149 ม.6 ต.เชิงทะเล อ.กลาง จ.ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO. _____ เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO. _____

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货名	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนขยะมูลฝอย ประจำเดือน			
	ต.ค. 68	-	25,000	-
2	ค่าขนขยะเคลียร์ขยะ (นอกเหนือสัญญา)		6,500	-
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共銀	31,500	-

ผู้รับเงิน 收银人 COLLECTOR จักรา

อธิวัฒน์ จงจิตร
22/46 ม.2 ต.ป่าคลอก อ.กลาง จ.ภูเก็ต
โทร. 093-623-7195

เล่มที่ BOOK NO.

เลขที่ BILL NO.

บิลเงินสด
CASH SALE 現兑單 CASH SALE

นาม 實號 NAME บริษัท เดอะซีวิว เดสทิเนชั่น จำกัด

วันที่ 日期 DATE 30/12/68

ที่อยู่ 住址 ADDRESS 149 ม.1 ต.เชิงทะเล อ.กลาง จ. ภูเก็ต

เลขประจำตัวประชาชน IDENTIFICATION NO.

เลขประจำตัวผู้เสียภาษีอากร TAX IDENTIFICATION NO.

จำนวน QUANTITY 数量	รายการ DESCRIPTION 货号	หน่วยละ UNIT PRICE 備註	จำนวนเงิน AMOUNT 银额	
1	ค่าขนาย: มูลฝอย ประจำเดือน			
	พ.ย. 68	-	25,000	-
1	ค่าขนาย: เคลียร์ราย: (นอกเหนือสัญญา)		6,500	-
บาท BAHT 銖	สามหมื่นหนึ่งพันห้าร้อยบาทถ้วน	รวมเงิน TOTAL 共银	31,500	-

ผู้รับเงิน 收银人 COLLECTOR อำภา

วันที่ 日期 DATE

ภาคผนวกที่ 9

ใบเสร็จค่าตักไขมัน

ประจำเดือนมกราคม–ธันวาคม 2568

นางปิยวีร์ บุญศรี

35/257 ม.2 ต.เกาะแก้ว อ.เมืองภูเก็ต จ.ภูเก็ต 83000

เล่มที่ 12 เลขประจำตัวผู้เสียภาษีอากร 3 8012 00984 55 0 เลขที่ 580

สำนักงานใหญ่ TEL : 090-4567893

ใบเสร็จรับเงิน/ใบกำกับภาษี

RECEIPT/TAX INVOICE

วันที่/DATE 27/08/25

ชื่อลูกค้า/CUSTOMER NAME บริษัท เออะ ซีซิอ เดสติเนชั่น จำกัด

ที่อยู่/ADDRESS 149 หมู่ที่ 6 ต.เชิงทะเล อ.ถลาง จ.ภูเก็ต 83110

เลขประจำตัวผู้เสียภาษี/TAX ID. 0835564009188 ☑ สำนักงานใหญ่ ☐ สาขา.....

จำนวน	รายละเอียดสินค้าหรือบริการ	ราคาหน่วยละ	จำนวนเงิน	
1	ชาคาด่าสูบสีอปฏิกูล (ดำเนินการแล้วเสร็จวันที่ 13/07/25)	4,500	4,500	-

สี่พันห้าร้อยสิบห้าบาทถ้วน.

จำนวนเงิน (ตัวอักษร)

รวมราคาทั้งสิ้น	4,500	-
จำนวนภาษีมูลค่าเพิ่ม 7 %	315	-
จำนวนเงินรวมทั้งสิ้น	4,815	-

ชำระเป็น ☐ เงินสด

☑ โอนเงิน วันที่ 27/08/25

☐ เช็ค ธนาคาร.....สาขา.....เลขที่.....ลงวันที่.....

ผู้รับเงิน ปิยวีร์ บุญศรี วันที่ 27/08/25.

นางปิยวีร์ บุญศรี

35/257 ม.2 ต.เกาะแก้ว อ.เมืองภูเก็ต จ.ภูเก็ต 83000

เล่มที่ 12 เลขประจำตัวผู้เสียภาษีอากร 3 8012 00984 55 0 เลขที่ 582

สำนักงานใหญ่ TEL : 090-4567893

ใบเสร็จรับเงิน/ใบกำกับภาษี

RECEIPT/TAX INVOICE

วันที่/DATE 08/09/25

ชื่อลูกค้า/CUSTOMER NAME บริษัท เดอะ ซีวิว เดสทิเนชั่น ภูเก็ต.

ที่อยู่/ADDRESS 149 หมู่ที่ 6 ต.เชิงทะเล อ.ถลาง จ.ภูเก็ต 83110

เลขประจำตัวผู้เสียภาษี/TAX ID 0835564009188. ☑ สำนักงานใหญ่ ☐ สาขา.....

จำนวน	รายละเอียดสินค้าหรือบริการ	ราคาหน่วยละ	จำนวนเงิน	
1	ราคาค่าสูบสิ่งปฏิกูล (ดำเนินการแล้วเสร็จวันที่ 06/09/25)	4,500	4,500	-.
2	ราคาค่าสูบสิ่งปฏิกูล (ดำเนินการแล้วเสร็จวันที่ 07/09/25)	4,500	9,000	-.

หนึ่งหมื่นสามพันสี่ร้อยสี่สิบห้าบาทถ้วน.

จำนวนเงิน (ตัวอักษร)

รวมราคาทั้งสิ้น	13,500	-.
จำนวนภาษีมูลค่าเพิ่ม 7 %	945	-.
จำนวนเงินรวมทั้งสิ้น	14,445	-.

ชำระเป็น ☐ เงินสด

☐ โอนเงิน วันที่.....

☐ เช็ค ธนาคาร.....สาขา.....เลขที่.....ลงวันที่.....

ผู้รับเงิน ปิยวีร์ บุญศรี. วันที่ 08/09/25.

ภาคผนวกที่ 10

ภาพคนสวนดูแลพื้นที่สีเขียว

ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.







ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**

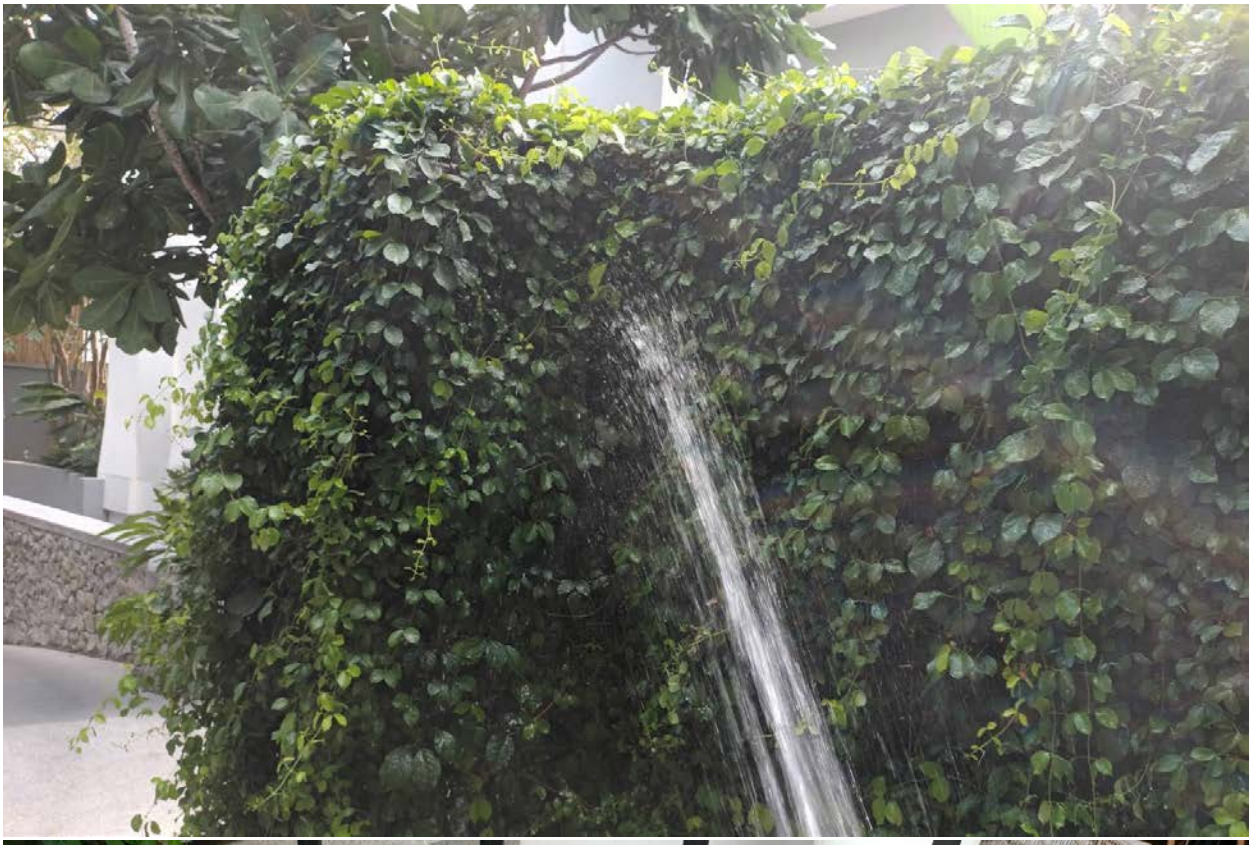

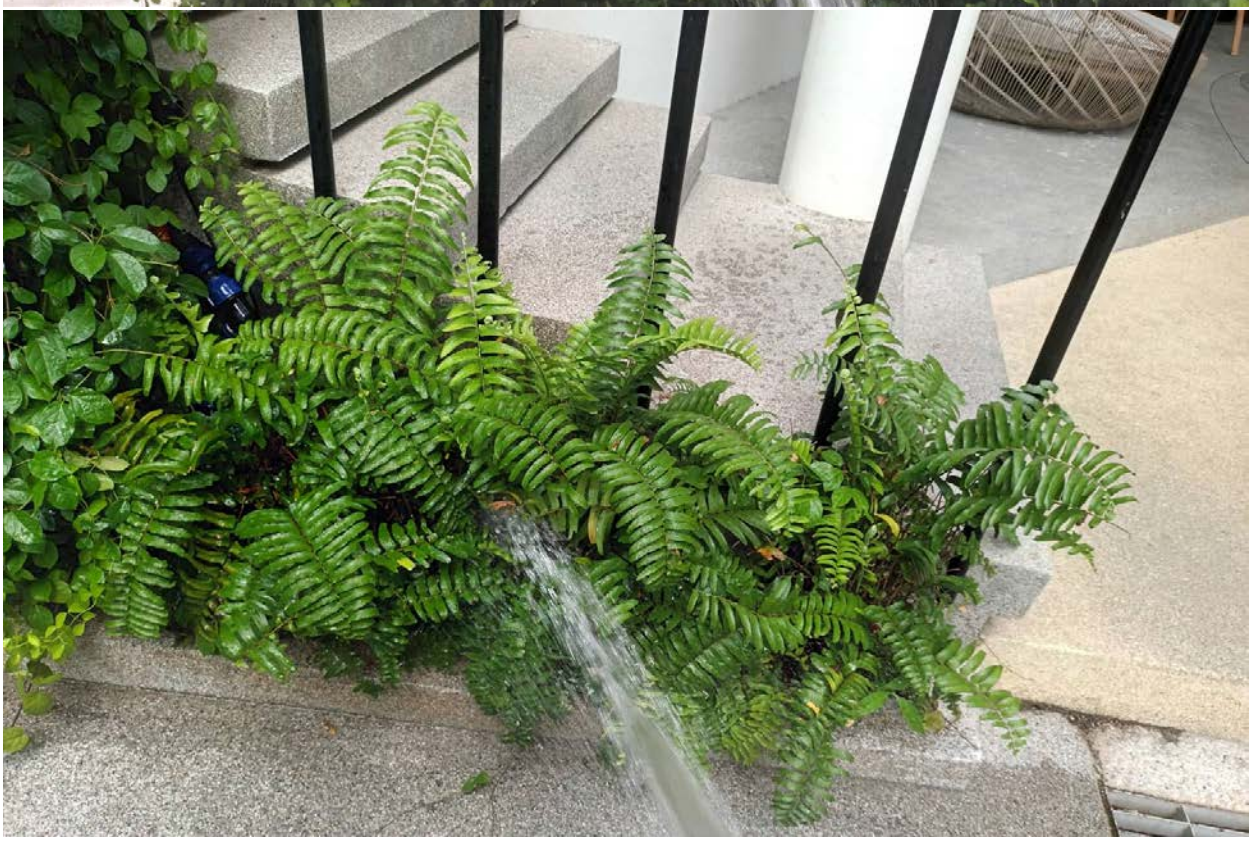

ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**







ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**

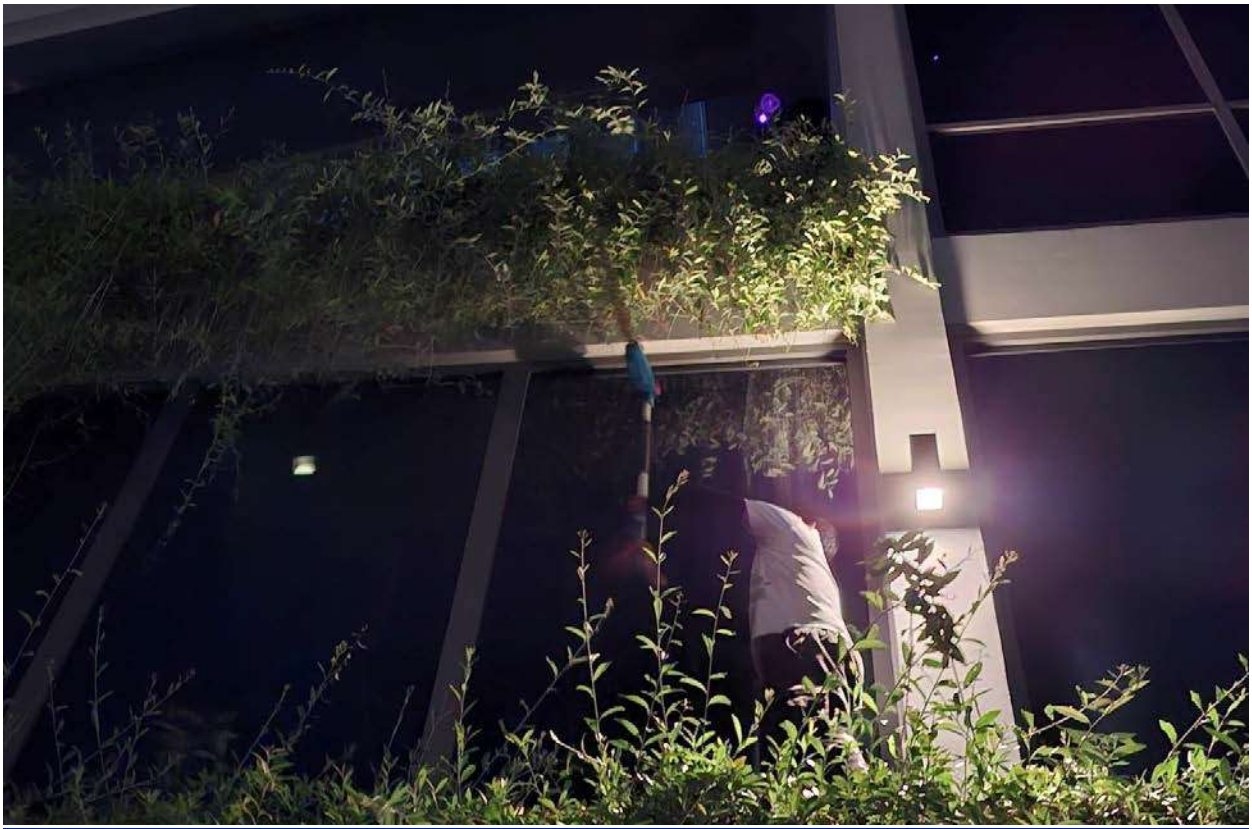

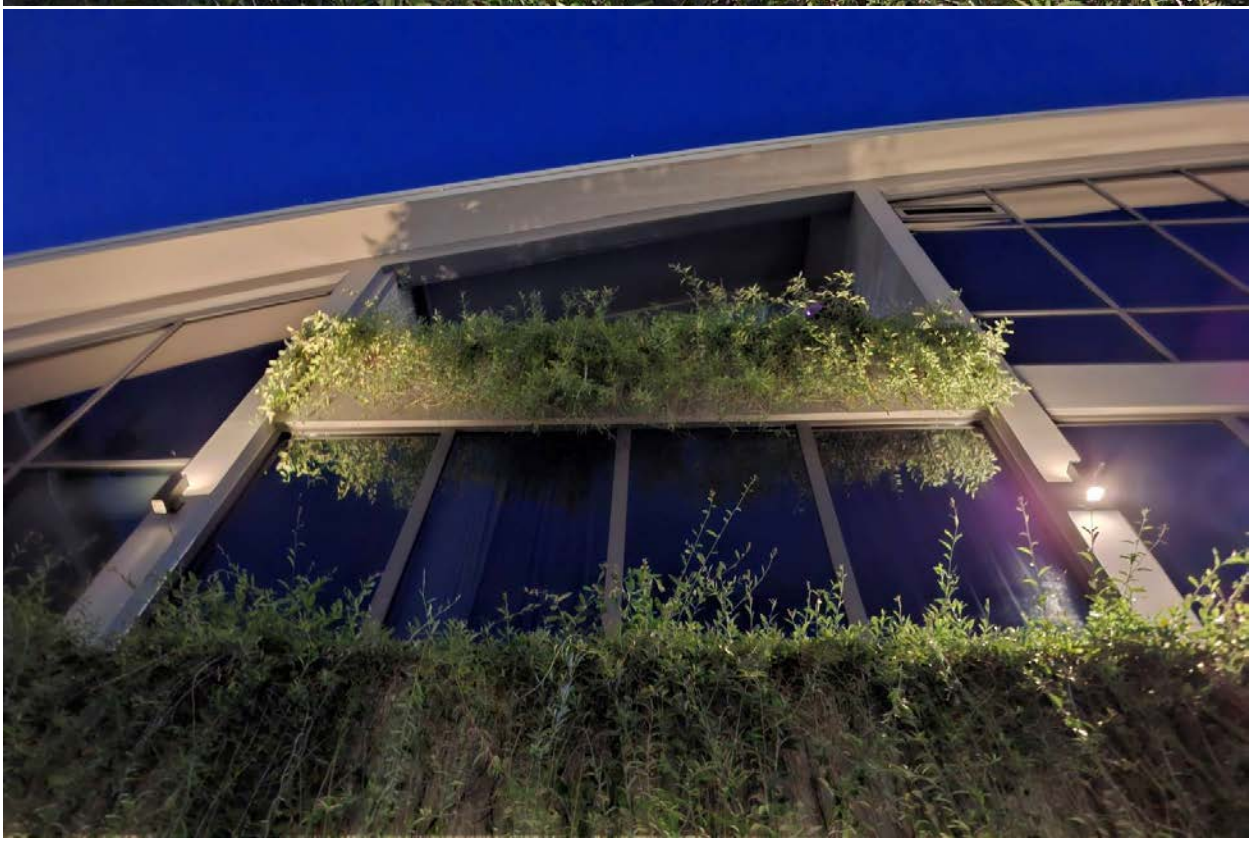


ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**



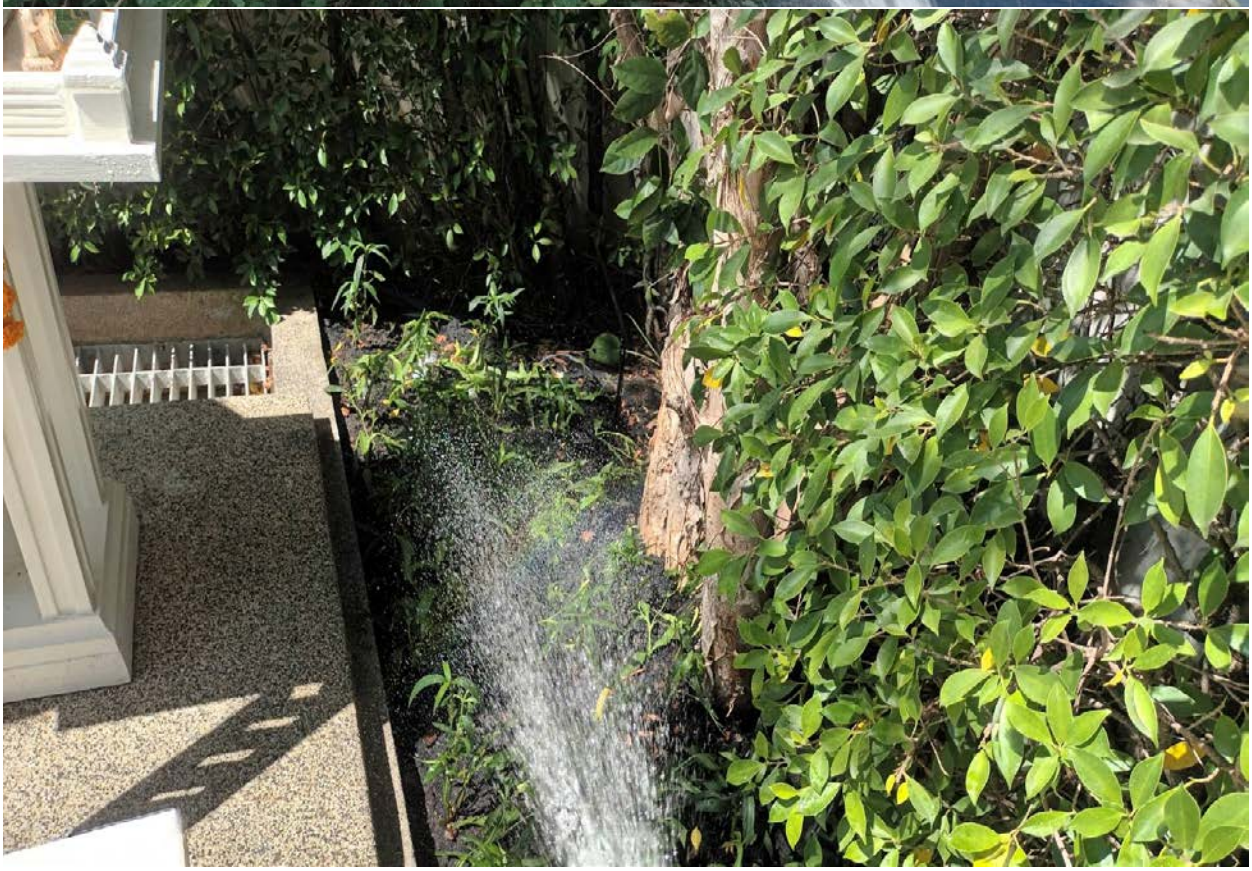


ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**

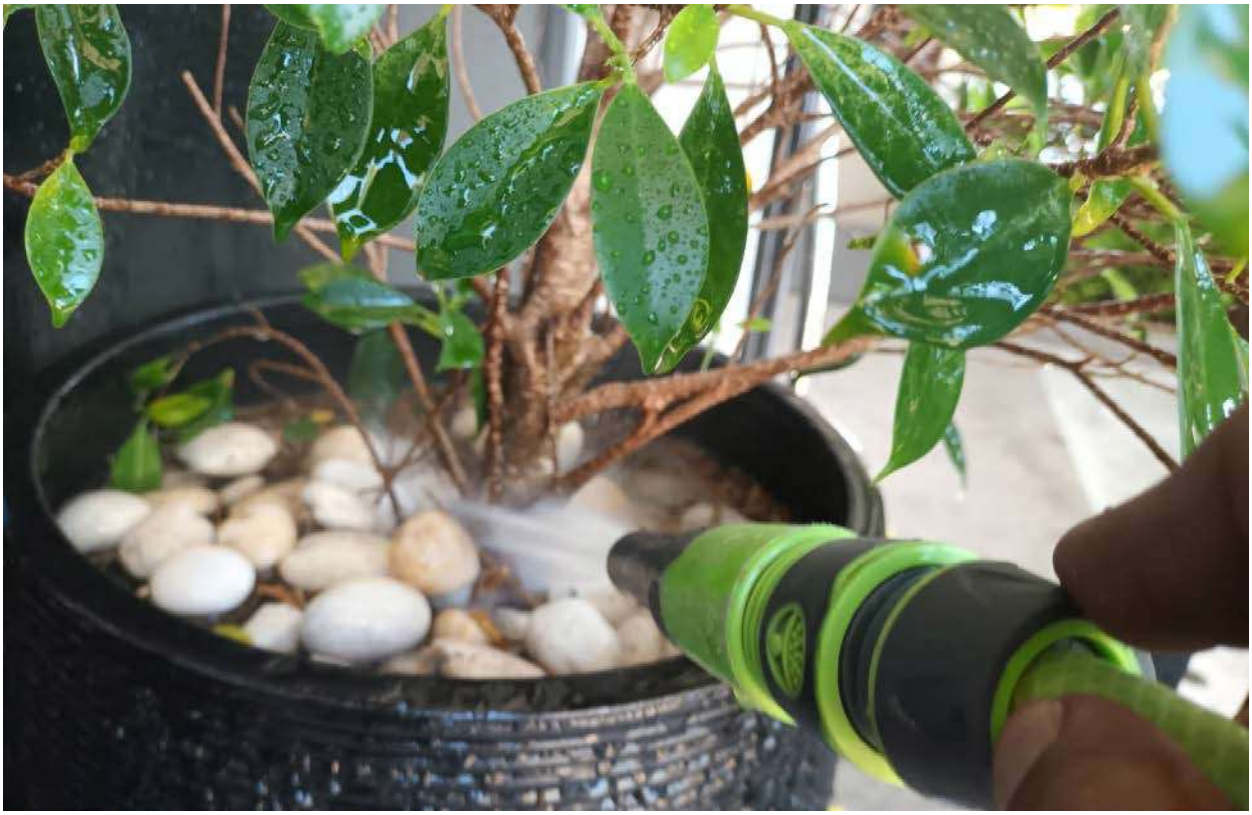



ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.





ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.





ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.





ภาพคนสวนดูแลพื้นที่สีเขียว – **Hotel.**





ภาพคนสวนดูแลพื้นที่สีเขียว – Hotel.






ภาคผนวกที่ 11

ภาพทำความสะอาดห้องพักขยะรวม



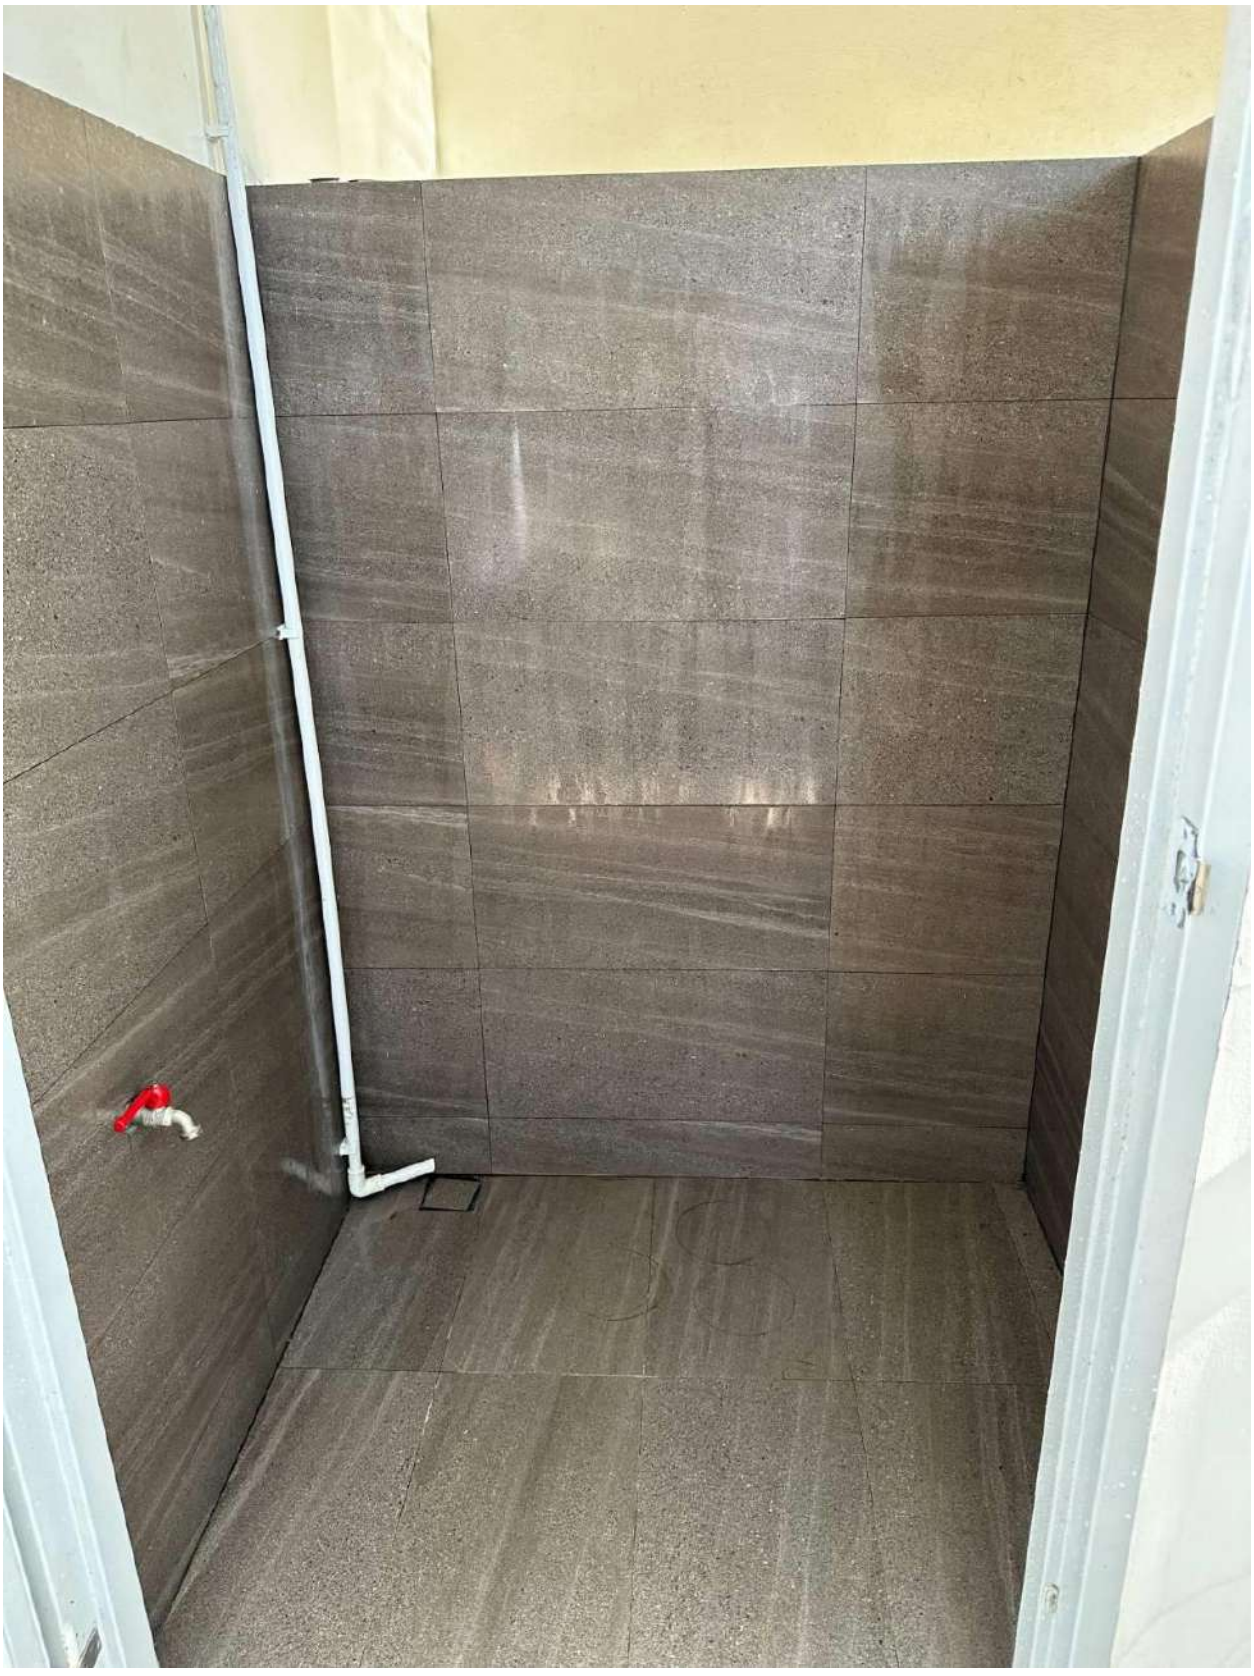



ภาคผนวกที่ 12

Air Condition Maintenance Recording

Lagreen Hotel & Resident

Engineering Department

AC Preventive Maintenance Plan (PM) 2025

Summary Room PM Building A 102 Rooms

2nd floor					
Code	**Room**	**Type**	**Model**	**BTU**	**PM**
AC-A2-F053	Room A201		AVE-19HJFDL	19100 Btu/h	Clean AC A201
AC-A2-F054	Room A202		AVE-19HJFDL	19101 Btu/h	PM Air A202
AC-A2-F055	Room A203				
AC-A2-F056	Room A204		AVE-19HJFDL	19100 Btu/h	Clean AC A204
AC-A2-F057	Room A205		AVE-19HJFDL	19100 Btu/h	Clean AC A205
AC-A2-F058	Room A206		AVE-19HJFDL	19100 Btu/h	Clean AC A206
AC-A2-F059	Room A207		AVE-19HJFDL	19100 Btu/h	Clean AC A207
AC-A2-F060	Room A208		AVE-19HJFDL	19100 Btu/h	Clean AC A208
AC-A2-F061	Room A209 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A209
AC-A2-F062	Room A209 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A209
AC-A2-F063	Room A210		AVE-19HJFDL	19100 Btu/h	Clean AC A210
AC-A2-F064	Room A211 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A211
AC-A2-F065	Room A211 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A211
AC-A2-F066	Room A212				
AC-A2-F067	Room A213		AVE-19HJFDL	19100 Btu/h	Clean AC A213
AC-A2-F068	Room A214 Living		AVE-19HJFDL	19100 Btu/h	A214 PM Air Living
AC-A2-F069	Room A214 Bedroom		AVE-19HJFDL	19100 Btu/h	A214 PM Air Bedro
AC-A2-F070	Room A215 Living		AVE-19HJFDL	19101 Btu/h	Clean AC A215
AC-A2-F071	Room A215 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A215
AC-A2-F072	Room A216 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A216
AC-A2-F073	Room A216 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A216
AC-A2-F074	Room A217 Living				
AC-A2-F075	Room A217 Bedroom				
17					15

PS Use		0
Room PM Plan		17
Total Already Done	91	
March 25 Done	14	A201,A210,A213,A303,A305,A31
April 25 Done	16	A204,A206,A208,A302,A406,A50
May Done	11	A306,A308,A404,A410,A508,A51
June Done	11	A608,A414,A710,A614,A712,A61
July Done	6	A606,A701,A601,A708,A416,A71
August Done	4	A207,A209,A205,A407
October	3	A307,A706,A215,A304

				3rd floor	
Period Of Work	**Code**	**Room**	**Type**	**Model**	**BTU**
22/03/25	AC-A3-F076	Room A301		AVE-19HJFDL	19100 Btu/h
7/8/2026	AC-A3-F077	Room A302		AVE-19HJFDL	19100 Btu/h
	AC-A3-F078	Room A303		AVE-19HJFDL	19100 Btu/h
24/04/25	AC-A3-F079	Room A304		AVE-19HJFDL	19101 Btu/h
13/08/25	AC-A3-F080	Room A305		AVE-19HJFDL	19100 Btu/h
27/04/25	AC-A3-F081	Room A306		AVE-19HJFDL	19100 Btu/h
8/10/2025	AC-A3-F082	Room A307		AVE-20HJFDL	19101 Btu/h
27/04/25	AC-A3-F083	Room A308		AVE-19HJFDL	19100 Btu/h
8/10/2025	AC-A3-F084	Room A309 Living		AVE-19HJFDL	19100 Btu/h
8/10/2025	AC-A3-F085	Room A309 Bedroom		AVE-09HJFDL	9600 Btu/h
16/03/25	AC-A3-F086	Room A310		AVE-19HJFDL	19100 Btu/h
28/07/25	AC-A3-F087	Room A311 Living		AVE-19HJFDL	19100 Btu/h
28/07/25	AC-A3-F088	Room A311 Bedroom		AVE-09HJFDL	9600 Btu/h
	AC-A3-F089	Room A312		AVE-19HJFDL	19100 Btu/h
25/03/25	AC-A3-F090	Room A313			
23/07/25	AC-A3-F091	Room A314 Living			
23/07/25	AC-A3-F092	Room A314 Bedroom			
14/10/25	AC-A3-F093	Room A315 Living		AVE-19HJFDL	19100 Btu/h
14/10/26	AC-A3-F094	Room A315 Bedroom		AVE-09HJFDL	9600 Btu/h
26/6/2025	AC-A3-F095	Room A316 Living			
26/6/2025	AC-A3-F096	Room A316 Bedroom			
	AC-A3-F097	Room A317 Living		AVE-19HJFDL	19100 Btu/h
	AC-A3-F098	Room A317 Bedroom		AVE-09HJFDL	9600 Btu/h
		17			

0,A315,A405,A409,A505,A509,A609,A709,A716
3,A504,A507,A511,A602,A604,A607,A616,A703,A704,A715
6,A611,A506,A402
2,A713,A311,A312,A413,A417 A216
1,A211

					4th floor
PM	**Period Of Work**	**Code**	**Room**	**Type**	**Model**
Clean AC A301	22/10/2025	AC-A4-F099	Room A401		AVE-19HJFDL
Clean AC A302	4/2/2025	AC-A4-F100	Room A402		AVE-19HJFDL
Clean AC A303	29/03/25	AC-A4-F101	Room A403		AVE-19HJFDL
Clean AC A304	28/10/25	AC-A4-F102	Room A404		AVE-19HJFDL
Clean AC A305	26/03/25	AC-A4-F103	Room A405		AVE-19HJFDL
Clean AC A306	14/05/25	AC-A4-F104	Room A406		AVE-19HJFDL
Clean AC A307	10/7/2025	AC-A4-F105	Room A407		AVE-19HJFDL
Clean AC A308	5/9/2025	AC-A4-F106	Room A408		AVE-19HJFDL
Clean AC A309	26/05/25	AC-A4-F107	Room A409 Living		AVE-19HJFDL
Clean AC A309	**26/05/25**	AC-A4-F108	Room A409 Bedroom		AVE-09HJFDL
Clean AC A310	18/03/25	AC-A4-F109	Room A410		AVE-19HJFDL
Clean AC A311	18/06/25	AC-A4-F110	Room A411 Living		
Clean AC A311	18/06/25	AC-A4-F111	Room A411 Bedroom		
Clean AC A312	21/06/25	AC-A4-F112	Room A412		
		AC-A4-F113	Room A413		AVE-19HJFDL
		AC-A4-F114	Room A414 Living		AVE-19HJFDL
		AC-A4-F115	Room A414 Bedroom		AVE-09HJFDL
Clean AC A315	23/02/25	AC-A4-F116	Room A415 Living		AVE-19HJFDL
Clean AC A315	25/02/25	AC-A4-F117	Room A415 Bedroom		AVE-09HJFDL
		AC-A4-F118	Room A416 Living		AVE-19HJFDL
		AC-A4-F119	Room A416 Bedroom		AVE-09HJFDL
A317 Living	12/2/2025	AC-A4-F120	Room A417 Living		AVE-19HJFDL
A317 Bedroom	12/2/2025	AC-A4-F121	Room A417 Bedroom		AVE-09HJFDL
18			17		

0	0
17	17

BTU	PM	Period Of Work	Code	Room	Type
19100 Btu/h	PM Air A401	19/07/25	AC-A5-F122	Room A501	
19100 Btu/h	Clean AC A402	16/05/25	AC-A5-F123	Room A502	
19100 Btu/h	PM Air A403	19/07/25	AC-A5-F124	Room A503	
19100 Btu/h	Clean AC A404	5/11/2025	AC-A5-F125	Room A504	
19100 Btu/h	Clean AC A405	26/03/25	AC-A5-F126	Room A505	
19100 Btu/h	Clean AC A406	21/04/25	AC-A5-F127	Room A506	
19101 Btu/h	Clean AC A407	9/7/2025	AC-A5-F128	Room A507	
19100 Btu	Clean AC A408	29/05/25	AC-A5-F129	Room A508	
19100 Btu	Clean AC A409	18/03/25	AC-A5-F130	Room A509 Living	
9600 Btu/h	Clean AC A409	18/03/25	AC-A5-F131	Room A509 Bedroom	
19100 Btu/h	Clean AC A410	5/6/2025	AC-A5-F132	Room A510	
			AC-A5-F133	Room A511 Living	
			AC-A5-F134	Room A511 Bedroom	
			AC-A5-F135	Room A512	
19100 Btu/h	Clean AC A413	23/06/25	AC-A5-F136	Room A513	
19100 Btu/h	Clean AC A414	6/5/2025	AC-A5-F137	Room A514 Living	
9600 Btu/h	Clean AC A414	6/5/2025	AC-A5-F138	Room A514 Bedroom	
19100 Btu/h	Clean AC A415	9/9/2025	AC-A5-F139	Room A515 Living	
9400 Btu/h	Clean AC A415	9/9/2025	AC-A5-F140	Room A515 Bedroom	
19100 Btu/h	Clean AC A416	13/07/25	AC-A5-F141	Room A516 Living	
9600 Btu/h	Clean AC A416	13/07/25	AC-A5-F142	Room A516 Bedroom	
19100 Btu/h	Clean AC A417	23/06/25	AC-A5-F143	Room A517 Living	
9600 Btu/h	Clean AC A417	23/06/25	AC-A5-F144	Room A517 Bedroom	
	14			17	

5th floor					
Model	**BTU**	**PM**	**Period Of Work**	**Code**	**Room**
				AC-A6-F145	Room A601
AVE-09HJFDL	19100 Btu/h	Clean AC A502	8/3/2025	AC-A6-F146	Room A602
AVE-09HJFDL	19100 Btu/h	Clean AC A503	4/10/2025	AC-A6-F147	Room A603
AVE-09HJFDL	19100 Btu/h	Clean AC A504	14/4/2025	AC-A6-F148	Room A604
AVE-09HJFDL	19100 Btu/h	Clean AC A505	27/03/25	AC-A6-F149	Room A605
AVE-09HJFDL	19100 Btu/h	Clean AC A506	19/05/25	AC-A6-F150	Room A606
AVE-19HJFDL	19100 Btu/h	Clean AC A507	4/11/2025	AC-A6-F151	Room A607
AVE-09HJFDL	19100 Btu/h	Clean AC A508	5/12/2025	AC-A6-F152	Room A608
AVE-19HJFDL	19100 Btu/h	Clean AC A509	3/11/2025	AC-A6-F153	Room A609 Living
AVE-09HJFDL	9600 Btu/h	Clean AC A509	3/11/2025	AC-A6-F154	Room A609 Bedroom
				AC-A6-F155	Room A610
AVE-19HJFDL	19100 Btu/h	Clean AC A511	17/04/25	AC-A6-F156	Room A611 Living
AVE-09HJFDL	9600 Btu/h	Clean AC A511	17/04/25	AC-A6-F157	Room A611 Bedroom
AVE-09HJFDL	9601 Btu/h	PM Air A512	7/9/2025	AC-A6-F158	Room A612
				AC-A6-F159	Room A613
AVE-19HJFDL	19100 Btu/h	Clean AC A514	15/09/25	AC-A6-F160	Room A614 Living
AVE-09HJFDL	9600 Btu/h	Clean AC A514	15/09/25	AC-A6-F161	Room A614 Bedroom
AVE-19HJFDL	19100 Btu/h	Clean AC A515	30/09/25	AC-A6-F162	Room A615 Living
AVE-09HJFDL	9600 Btu/h	Clean AC A515	30/09/25	AC-A6-F163	Room A615 Bedroom
AVE-19HJFDL	19100 Btu/h	Clean AC A516	30/4/2025	AC-A6-F164	Room A616 Living
AVE-09HJFDL	9600 Btu/h	Clean AC A516	30/4/2025	AC-A6-F165	Room A616 Bedroom
AVE-09HJFDL	9601 Btu/h	PM Air A517 Living	7/8/2026	AC-A6-F166	Room A617 Living
AVE-09HJFDL	9602 Btu/h	PM Air A517 Bedro	7/8/2026	AC-A6-F167	Room A617 Bedroom
		14			17

6th floor					
Type	**Model**	**BTU**	**PM**	**Period Of Work**	**Code**
	AVE-19HJFDL	19099 Btu/h	Clean AC A601	7/6/2025	AC-A7-F168
	AVE-19HJFDL	19100 Btu/h	Clean AC A602	4/8/2025	AC-A7-F169
					AC-A7-F170
	AVE-19HJFDL	19100 Btu/h	Clean AC A604	31/03/25	AC-A7-F171
					AC-A7-F172
	AVE-19HJFDL	19100 Btu/h	Clean AC A606	7/1/2025	AC-A7-F173
	AVE-19HJFDL	19100 Btu/h	Clean AC A607	30/3/2025	AC-A7-F174
	AVE-19HJFDL	19100 Btu/h	Clean AC A608	6/3/2025	AC-A7-F175
	AVE-19HJFDL	19100 Btu/h	Clean AC A609	3/11/2025	AC-A7-F176
	AVE-09HJFDL	9600 Btu/h	Clean AC A609	3/11/2025	AC-A7-F177
	AVE-19HJFDL	19100 Btu/h	Clean AC A610	22/6/2025	AC-A7-F178
	AVE-19HJFDL	19100 Btu/h	Clean AC A611	5/3/2025	AC-A7-F179
	AVE-09HJFDL	9600 Btu/h	Clean AC A611	5/3/2025	AC-A7-F180
	AVE-19HJFDL	19100 Btu/h	Clean AC A612	16/6/2025	AC-A7-F181
	AVE-19HJFDL	19100 Btu/h	Clean AC A613	18/9/2025	AC-A7-F182
	AVE-19HJFDL	19100 Btu/h	Clean AC A614	6/7/2025	AC-A7-F183
	AVE-09HJFDL	9600 Btu/h	Clean AC A614	6/7/2025	AC-A7-F184
	AVE-19HJFDL	19100 Btu/h	Clean AC A615	22/9/2025	AC-A7-F185
	AVE-09HJFDL	9400 Btu/h	Clean AC A615	22/9/2025	AC-A7-F186
	AVE-19HJFDL	19100Btu/h	Clean AC A616	15/4/2025	AC-A7-F187
	AVE-09HJFDL	9600 Btu/h	Clean AC A616	15/4/2025	AC-A7-F188
	AVE-19HJFDL	19100Btu/h	Clean AC A617	20/09/25	AC-A7-F189
	AVE-09HJFDL	9600 Btu/h	Clean AC A617	20/09/26	AC-A7-F190
			15		

7th floor					
Room	**Type**	**Model**	**BTU**	**PM**	**Period Of Work**
Room A701		AVE-19HJFDL	19100 Btu/h	Clen AC A701	7/6/2025
Room A702		AVE-19HJFDL	19100 Btu/h	PM Air A702	8/2/2025
Room A703		AVE-19HJFDL	19100 Btu/h	Clean AC A703	4/4/2025
Room A704		AVE-19HJFDL	19100 Btu/h	Clean AC A704	4/4/2025
Room A705		AVE-19HJFDL	19101 Btu/h	Clean AC A705	22/25/25
Room A706		AVE-20HJFDL	19100 Btu/h	Clean AC A706	10/6/2025
Room A707		AVE-19HJFDL	19100 Btu/h	Clean AC A707	23/09/25
Room A708		AVE-19HJFDL	21499 Btu/h	Clean AC A708	7/6/2025
Room A709 Living		AVE-19HJFDL	21500 Btu/h	Clean AC A709	3/10/2025
Room A709 Bedroom		AVE-19HJFDL	21500 Btu/h	Clean AC A709	3/10/2025
Room A710		AVE-19HJFDL	21500 Btu/h	Clean AC A710	6/7/2025
Room A711 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A711	14/07/2025
Room A711 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A711	14/07/2025
Room A712		AVE-19HJFDL	19100 Btu/h	Clean AC A712	6/10/2025
Room A713		AVE-19HJFDL	19101 Btu/h	Clean AC A713	16/6/2025
Room A714 Living					
Room A714 Bedroom					
Room A715 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A715	23/04/25
Room A715 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A715	23/04/25
Room A716 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A716	29/03/25
Room A716 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A716	29/03/25
Room A717 Living		AVE-19HJFDL	19100 Btu/h	Clean AC A717	24/09/25
Room A717 Bedroom		AVE-09HJFDL	9600 Btu/h	Clean AC A717	24/09/25
17				15	

ภาคผนวกที่ 13

ภาพการขุดลอกท่อระบายน้ำ








after


before

ภาคผนวกที่ 14

การฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ ประจำปี 2568

เลขทะเบียนวุฒิบัตรที่ ๒๙/๒๕๖๘

องค์การบริหารส่วนตำบลเชิงทะเล

ได้รับใบอนุญาตจากกรมสวัสดิการและคุ้มครองแรงงาน ใบอนุญาตเลขที่ ๐๑๐๒-๐๒-๒๕๖๖-๐๐๔๖

โรงแรมลากรีน โฮเทล แอนด์ เรสซิเดนซ์

ที่อยู่ ๑๔๙ ตำบลเชิงทะเล อำเภอถลาง จังหวัดภูเก็ต

ได้ดำเนินการฝึกซ้อมดับเพลิงและฝึกซ้อมอพยพหนีไฟ
ตามกฎกระทรวงกำหนดมาตรฐานในการบริหาร จัดการ และดำเนินการด้านความปลอดภัย อาชีวอนามัย
และสภาพแวดล้อมในการทำงานเกี่ยวกับการป้องกันและระงับอัคคีภัย พ.ศ. ๒๕๕๕ ลงวันที่ ๗ ธันวาคม ๒๕๕๕

เมื่อวันที่ ๖ สิงหาคม ๒๕๖๘ มีผู้เข้ารับการฝึกซ้อม ๒๐๑ คน

ให้ไว้ ณ วันที่ ๖ สิงหาคม ๒๕๖๘



(นายมาโนช พันธ์ฉลาด)
นายกองค์การบริหารส่วนตำบลเชิงทะเล

